2026 POST 5 DAY 1 STATEMENT

Thank you for responding to our call for help. Last night on midnight shift we sent a foreman and 4 crew members to the 3 North Tailgate section to get the section setup to run production in the #3 Entry on dayshift. The foreman had called out and said they were battling some areas of bad top and water in the section but, had gotten the auxiliary section fan location moved and set up for production.

Shortly after that call we had a motor and some supply cars catch fire at the front end of the section. It seems to have burnt up the leaky feeder cable and we have since lost communications with the 3 North section. We have evacuated the rest of the mine but have been unable to contact the 3 North Section crew. The fire has been put out and we have begun efforts to explore and find our missing miners. We have made it to within 4 blocks of the face where we had just moved the Fresh Air-Base too. There is a power borehole there where a permanent pump switch has been established. There is power to the switch and the pump is currently running to keep water levels down.

Last week we mined into the new shaft that is located on the section and marked on your maps. The fan and shaft site has been setup and is ready for operation. The new shaft is a dual shaft with a Blowing fan installed on the intake side that is currently off. This shaft is equipped with ventilation doors on the intake and return sides on the surface that will open but, only when the blowing fan on that shaft is turned on. They will close immediately if that blowing fan is shut off. The fan is ready for service and can be turned on whenever you need with permission from the Super Intendent.

The rest of the mine is ventilated by a blowing fan that is located on the surface outby. Air normally intakes up number the #1 entry and returns down #3. We had some power issues when we tried turning the new blowing fan at the same time as the outby fan. The fans would run at about half speed when both ran simultaneously. We are looking into the issue.

All state and federal agencies are on site with back up teams ready to go. Please continue our exploration and rescue efforts and find our missing miners.

TEAM INSTRUCTIONS POST 5 DAY 1

Account for all missing miners and bring survivors to the Fresh Air-Base

Explore the entire mine if safe to do so

The Outby Fan can be turned off or on with permission from the Superintendent, but cannot be stalled or reversed.

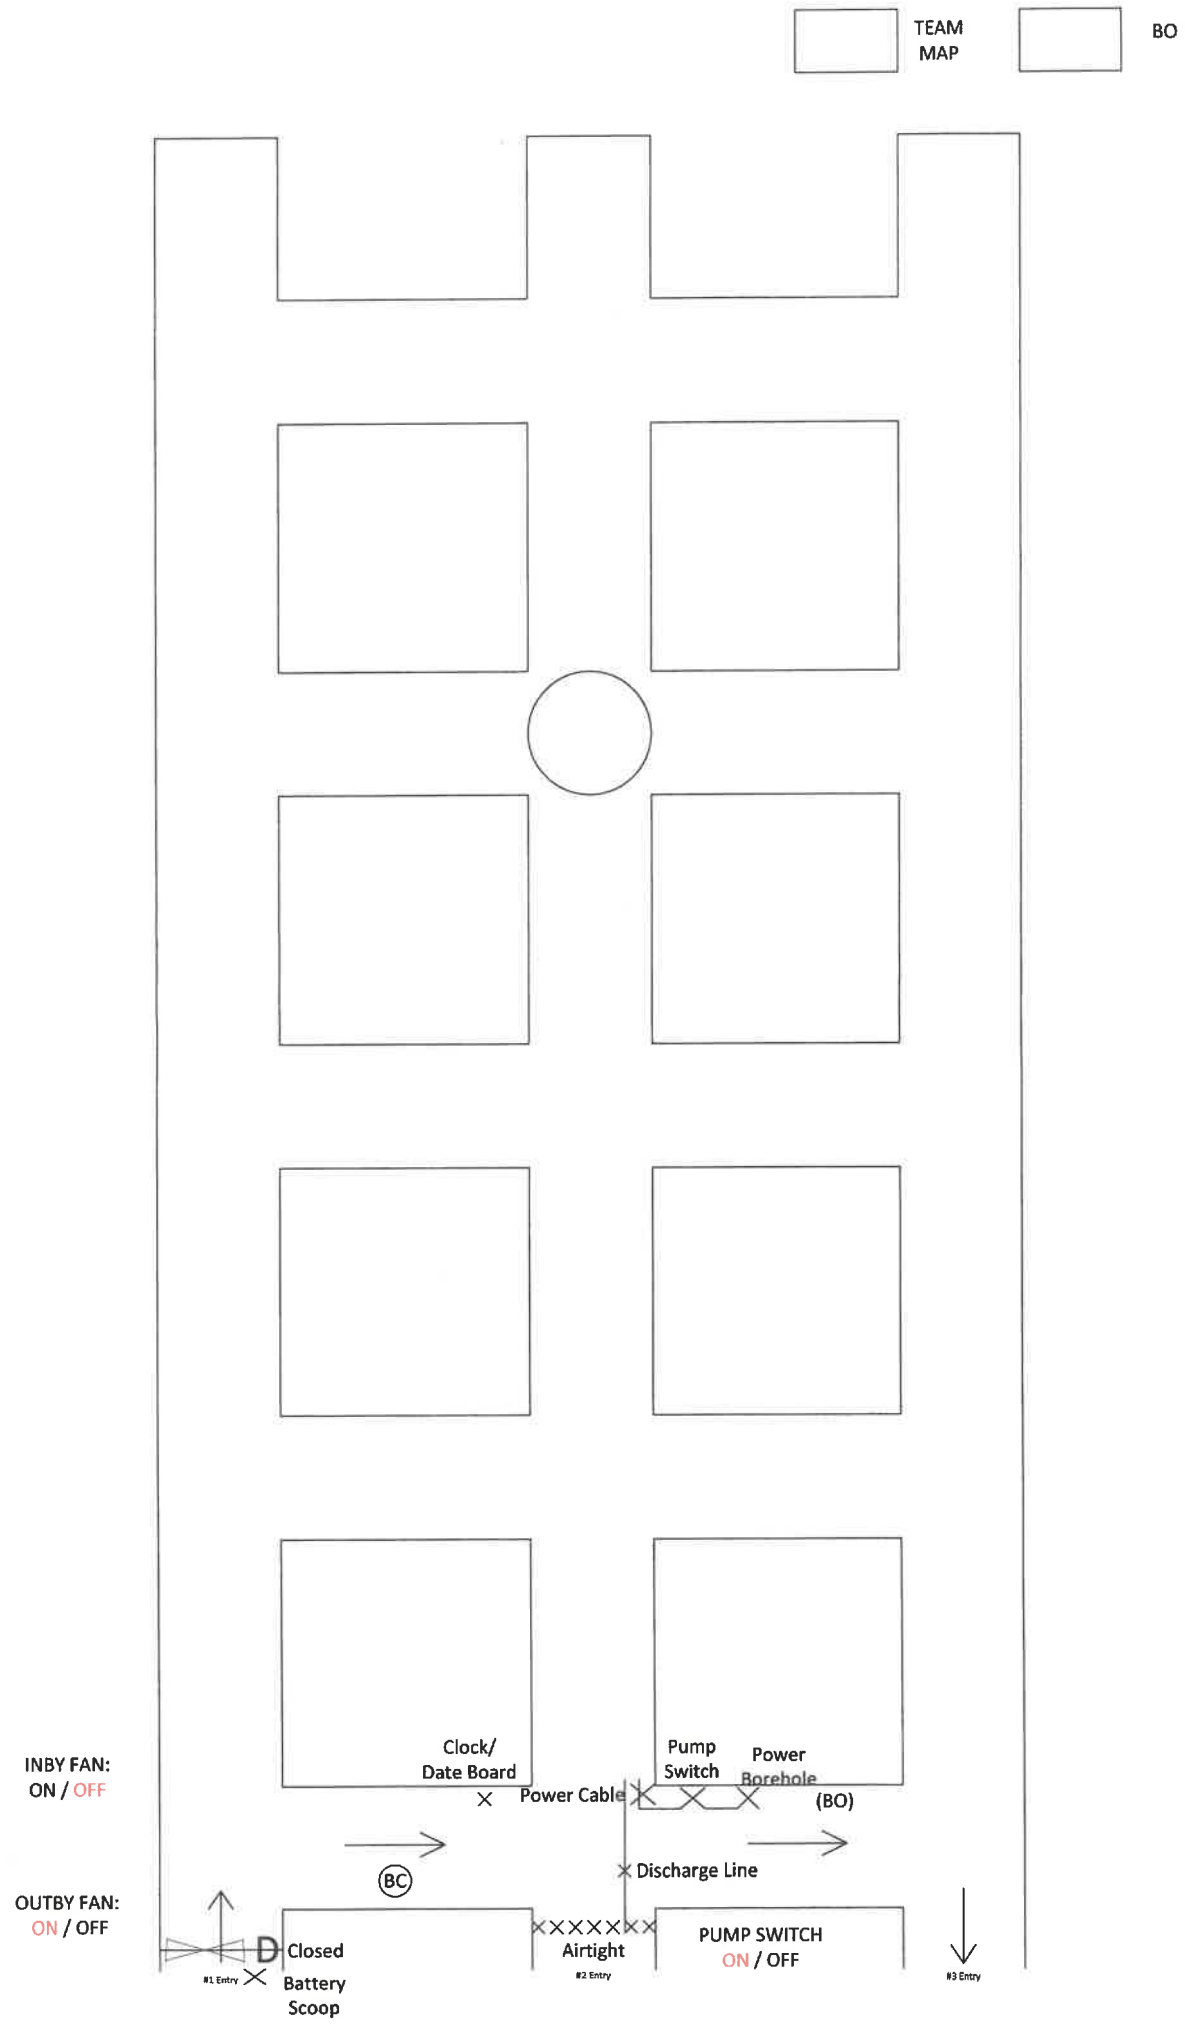
The Inby Fan can be turned on or off with permission from the Superintendent, but

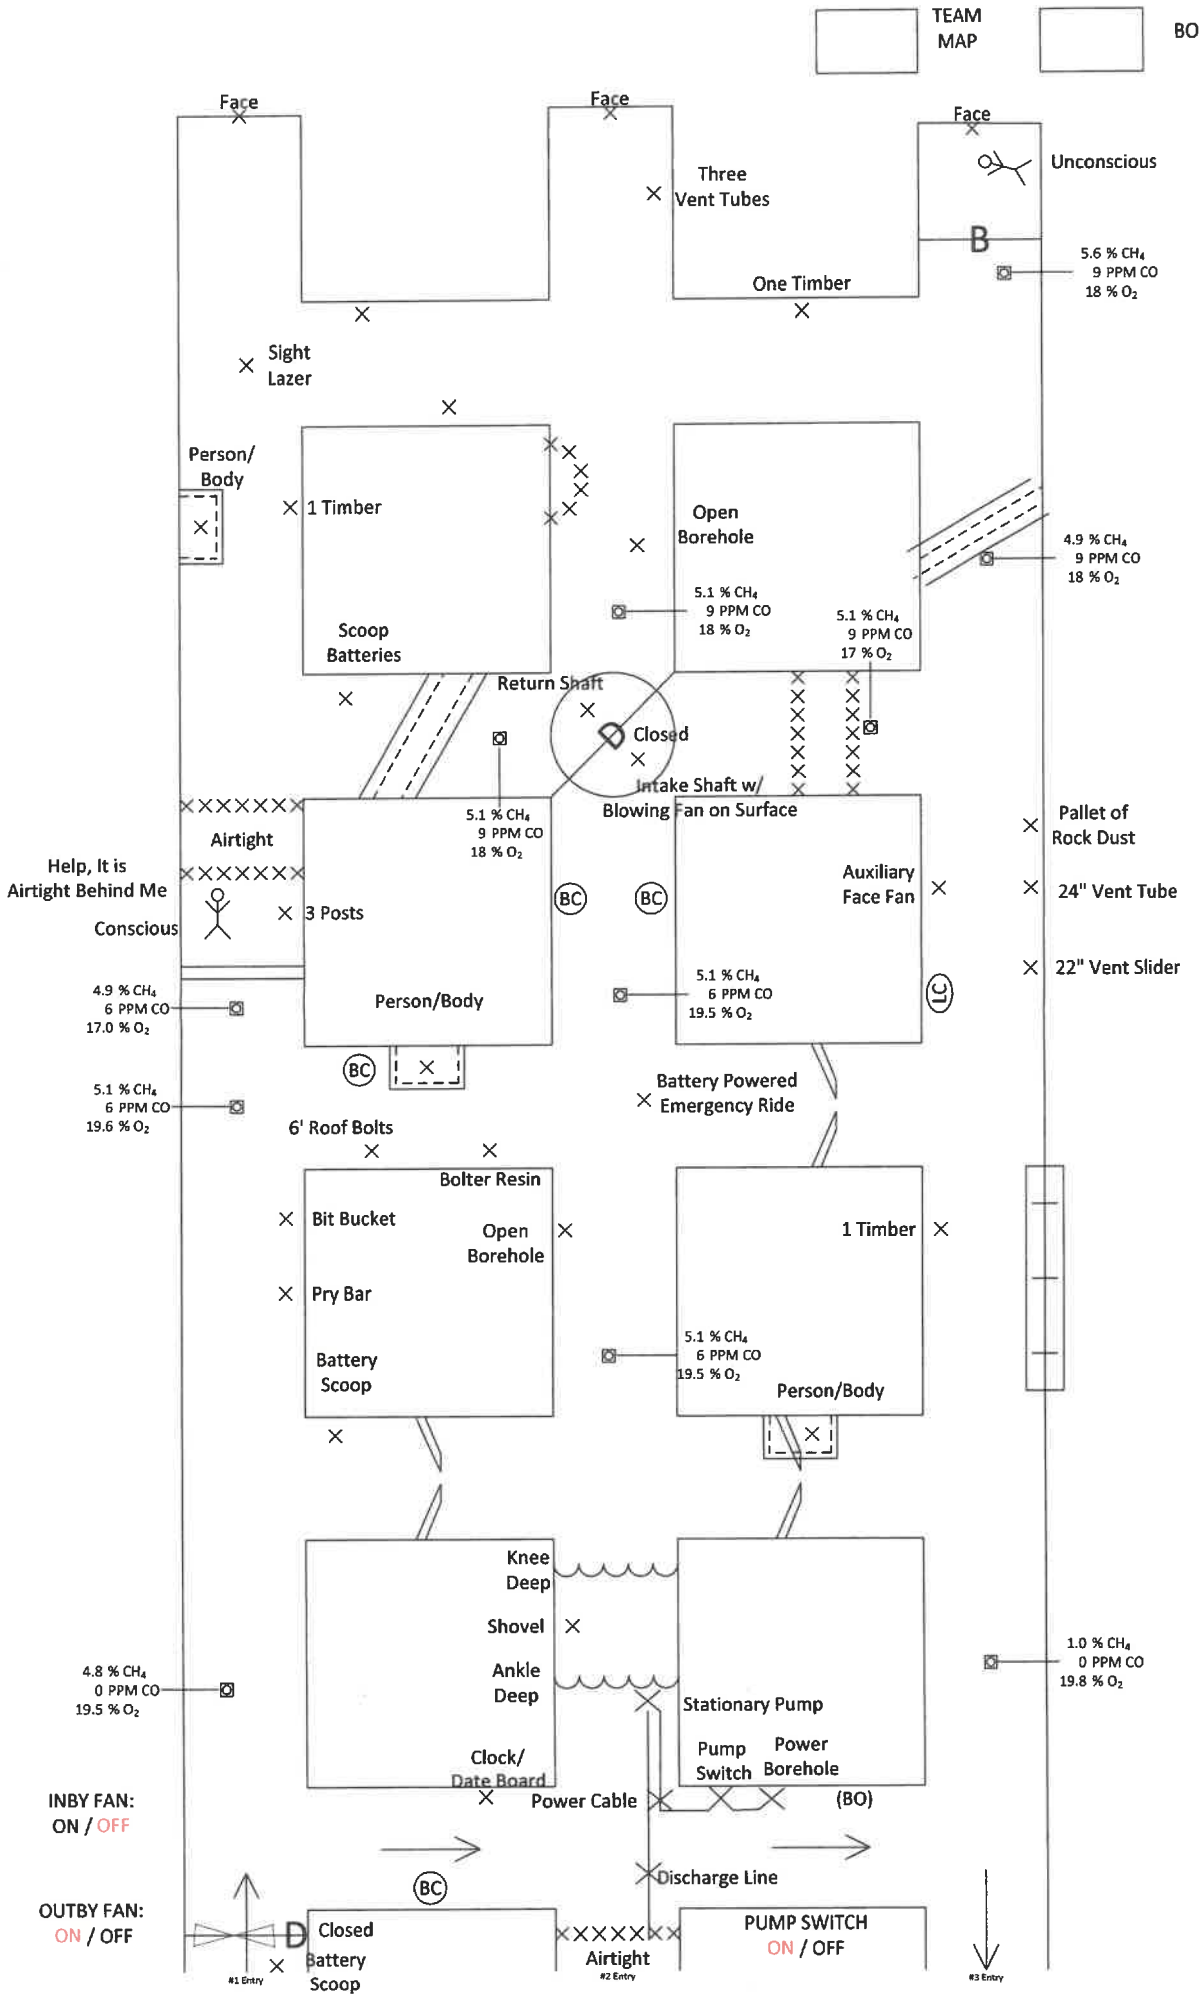
cannot be stalled or reversed.

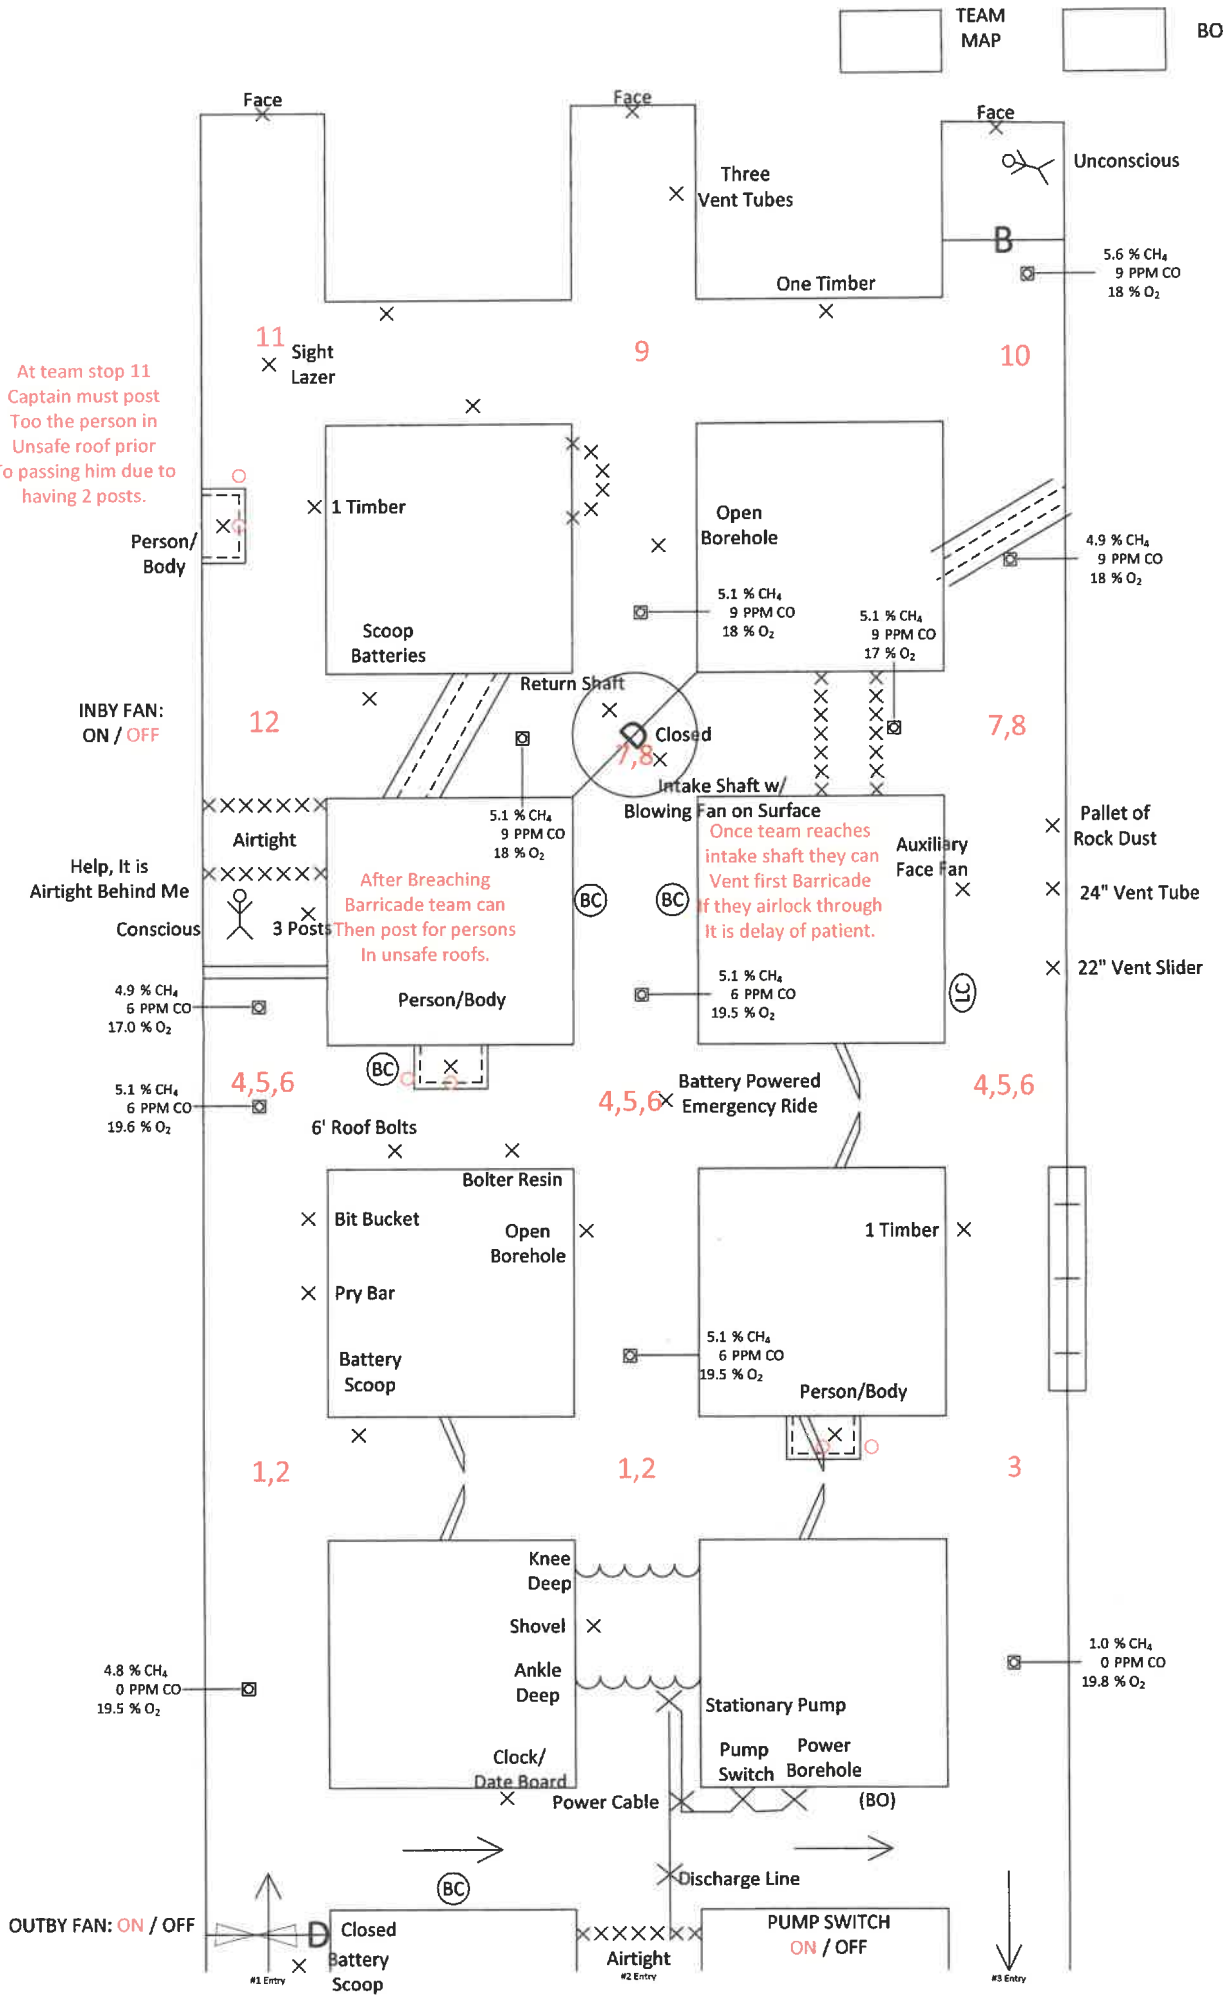
Power to the Pump can be removed by the pump switch located in the Fresh Air Base.

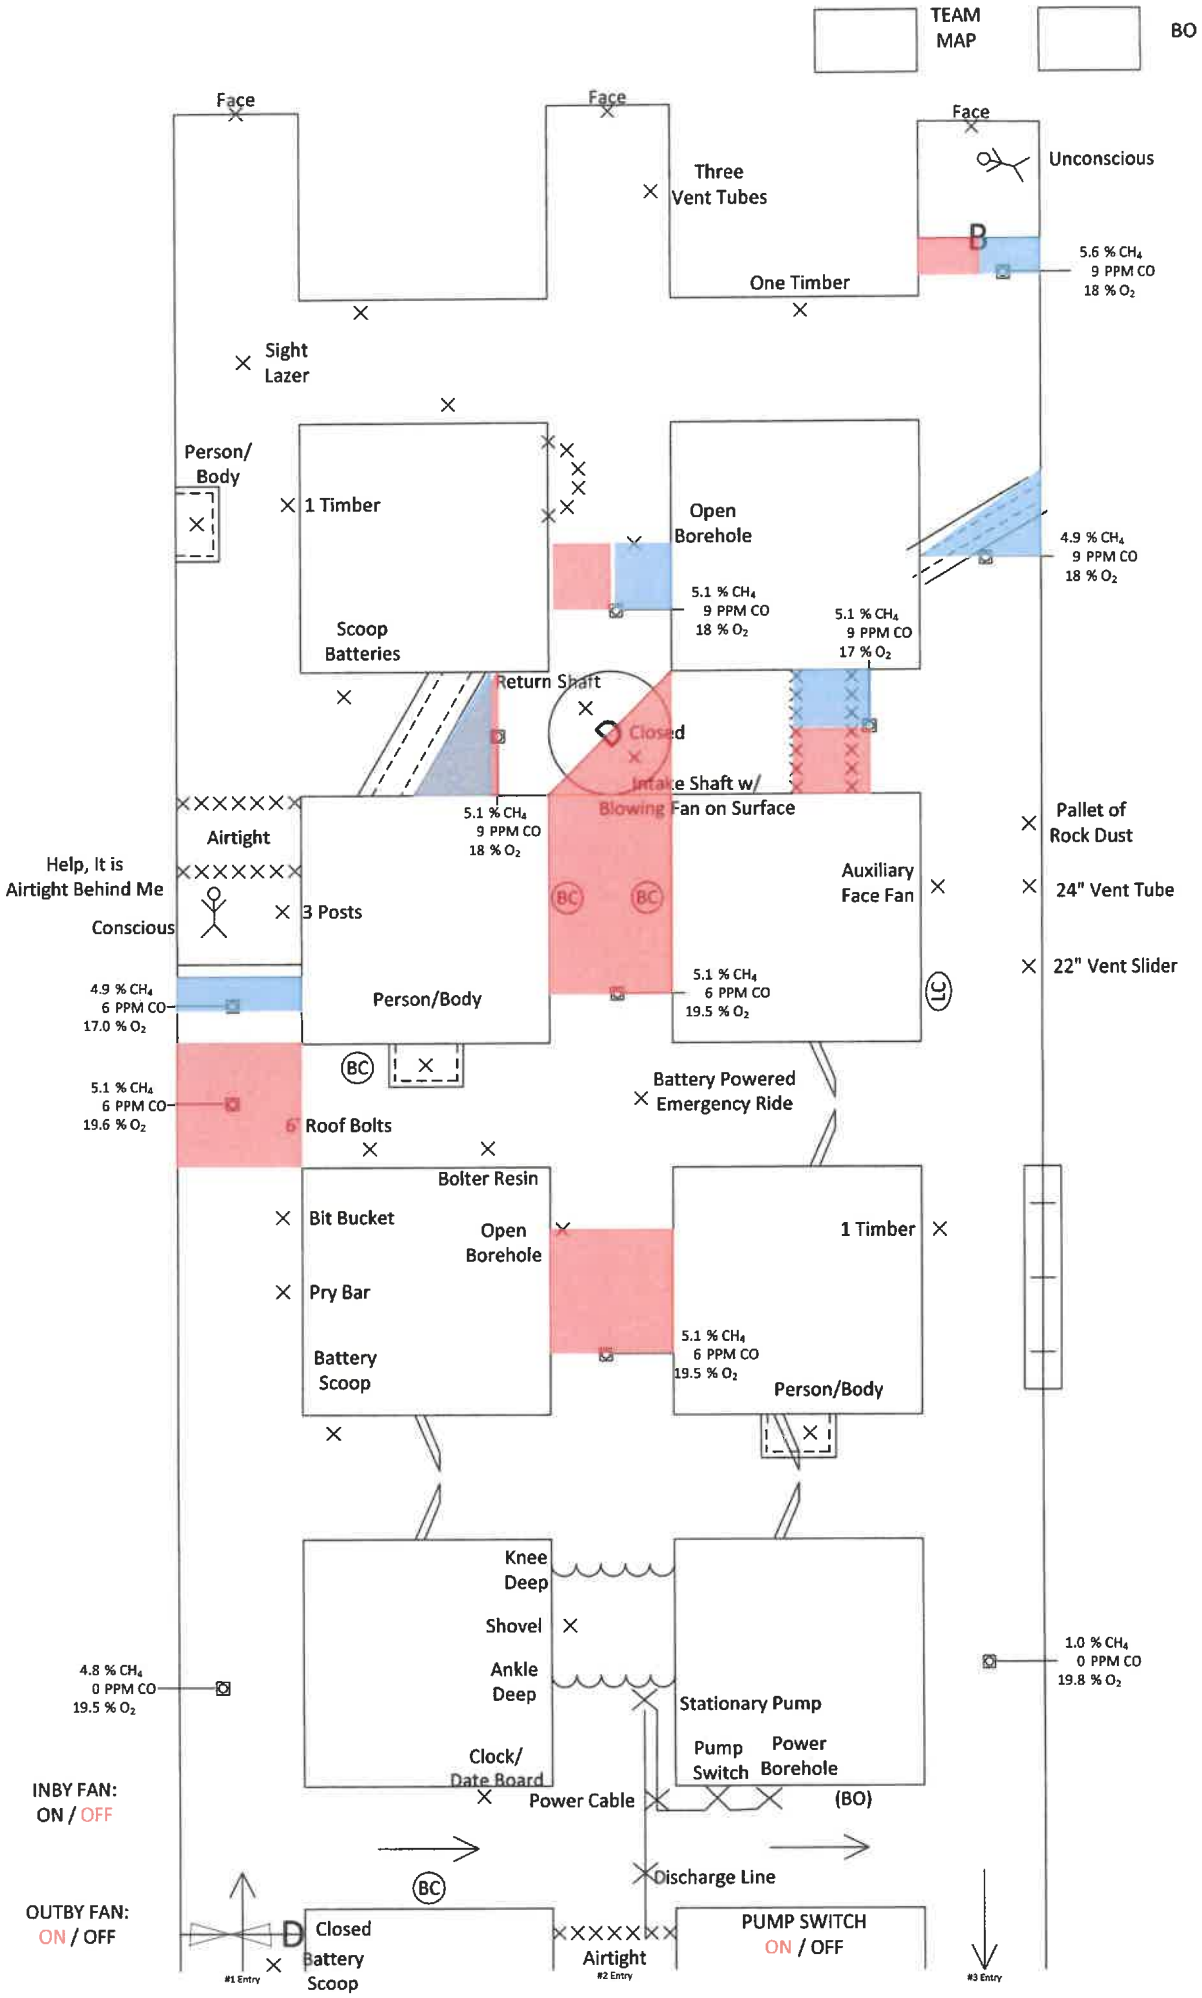
There is a 75 Minute time limit

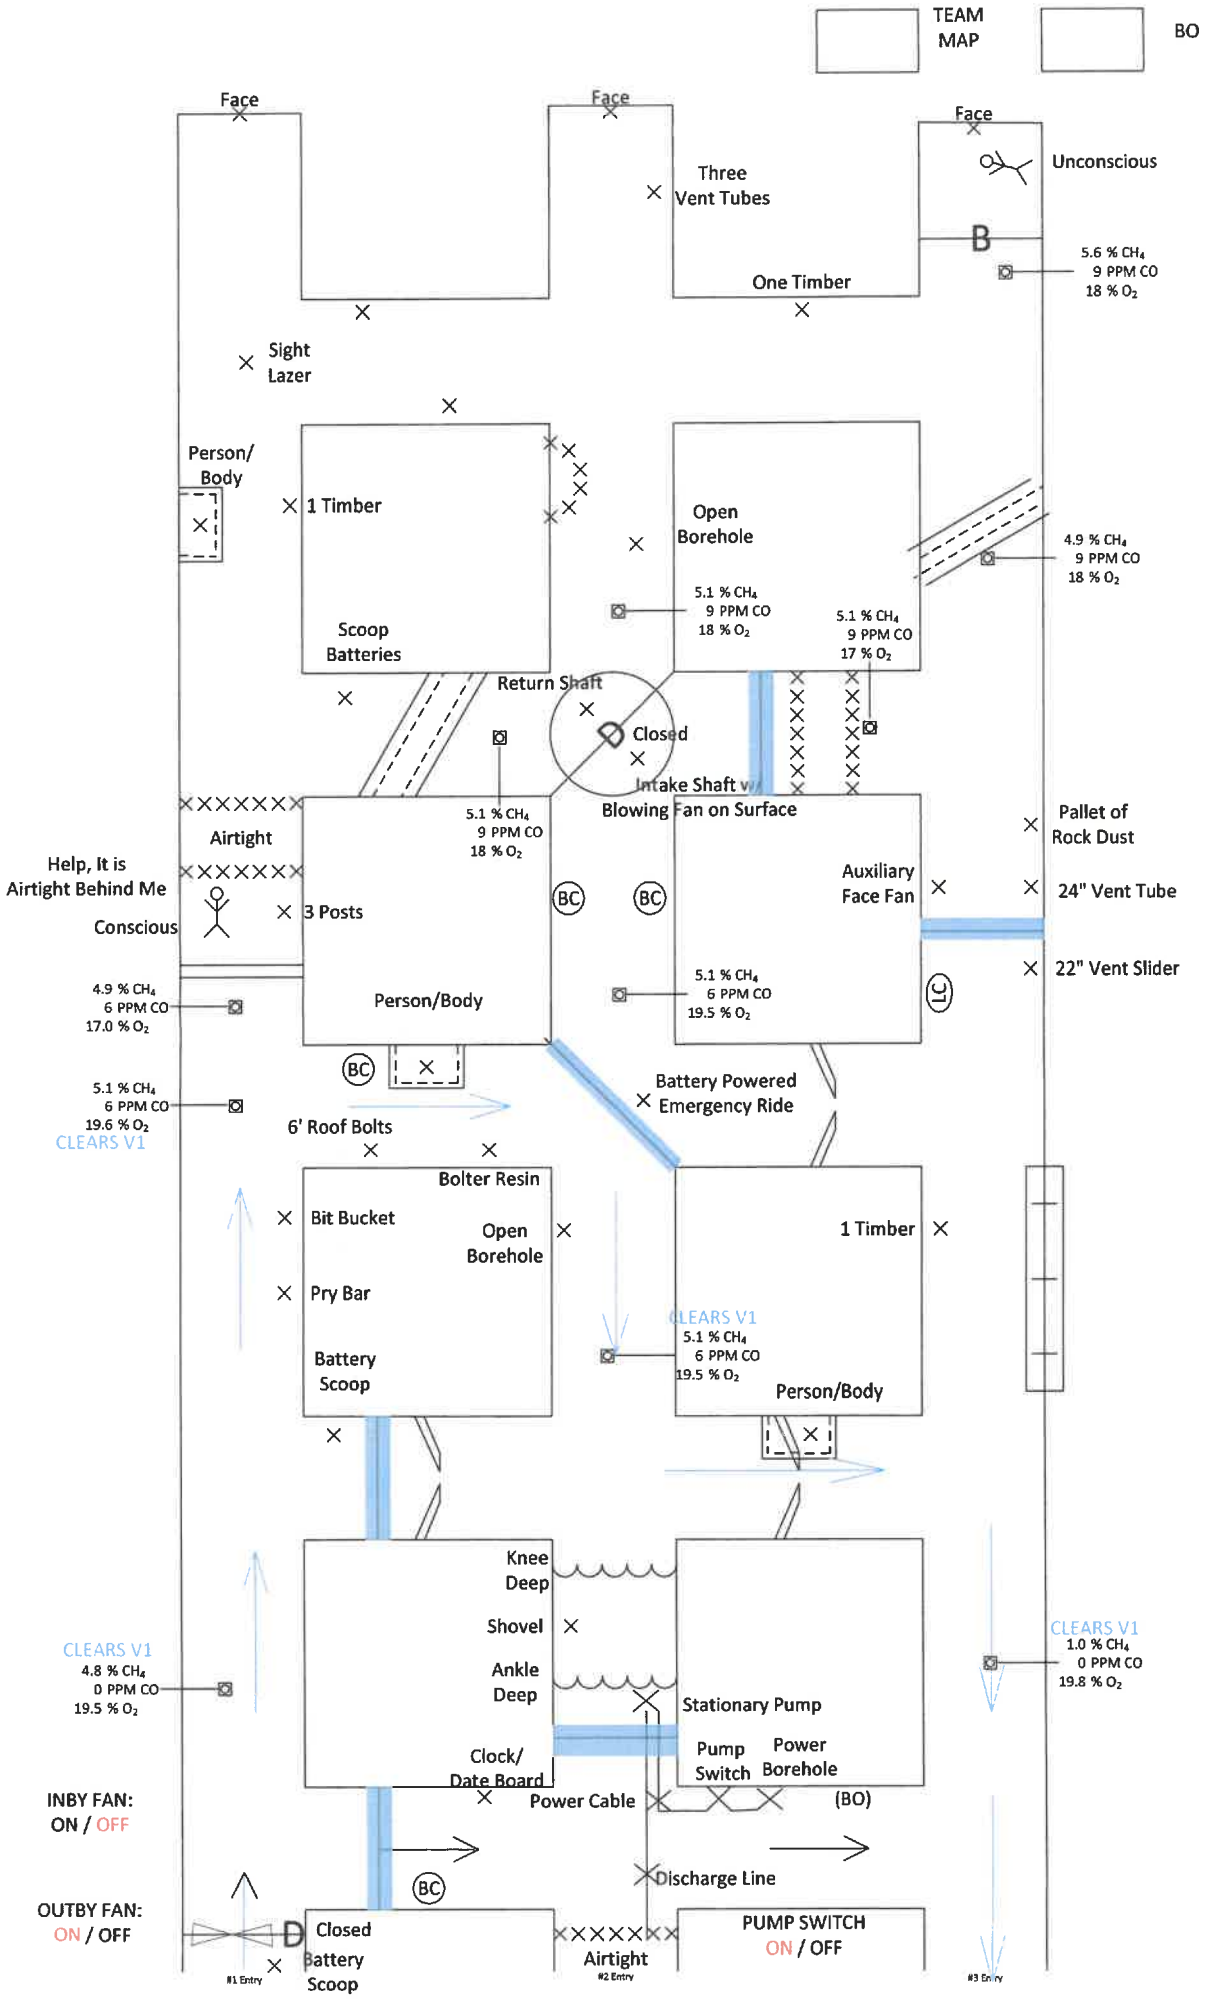
Good Luck

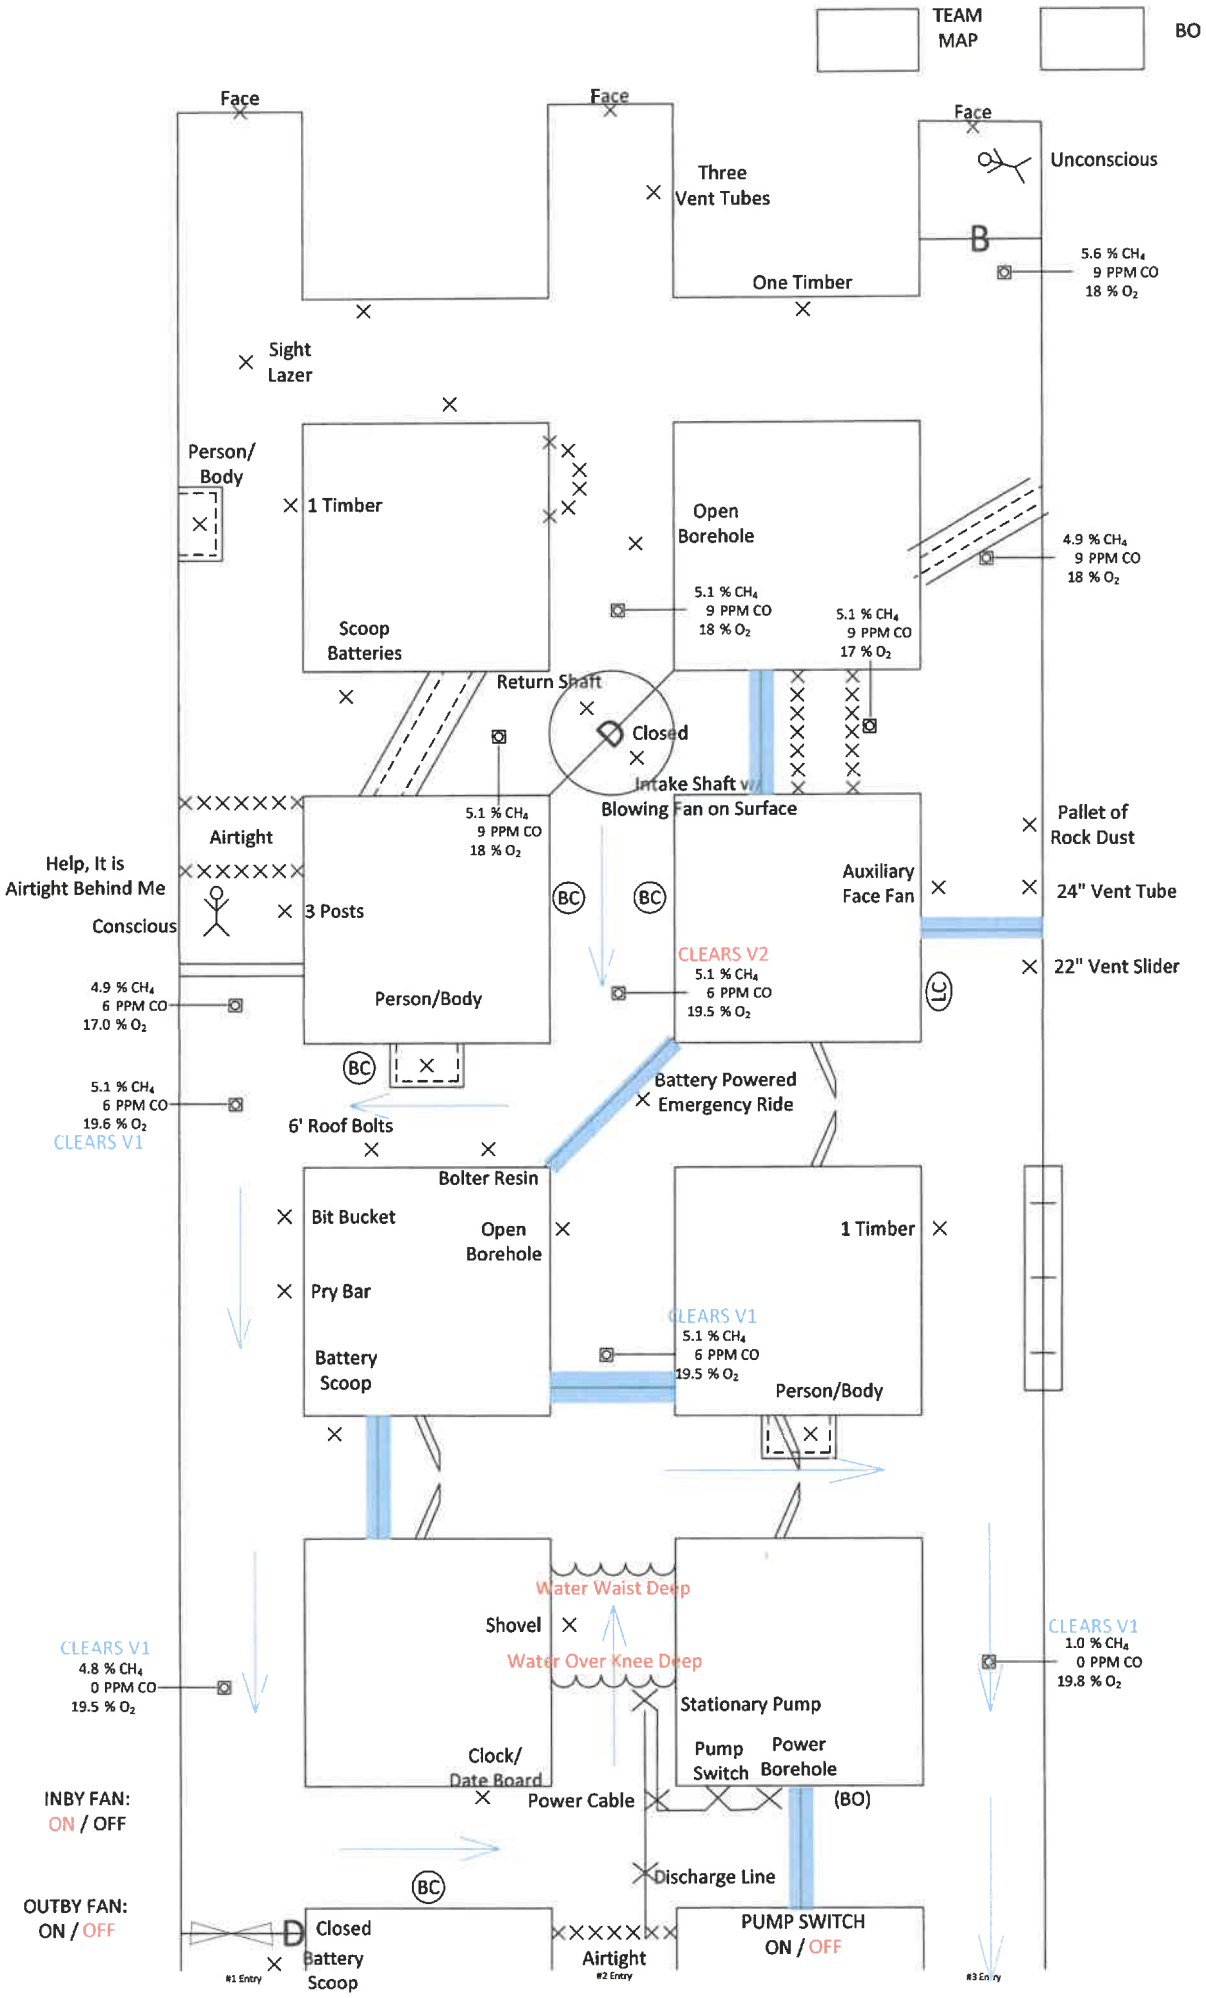

TEAM MAP
BO
INBY FAN:
ON / OFF
OUTBY FAN:
ON / OFF
Clock/
Date Board
Power Cable
Pump
Switch
Power
Borehole
(BO)
BC
Discharge Line
Closed
Battery
Scoop
#1 Entry
Airtight
#2 Entry
PUMP SWITCH
ON / OFF
#3 Entry

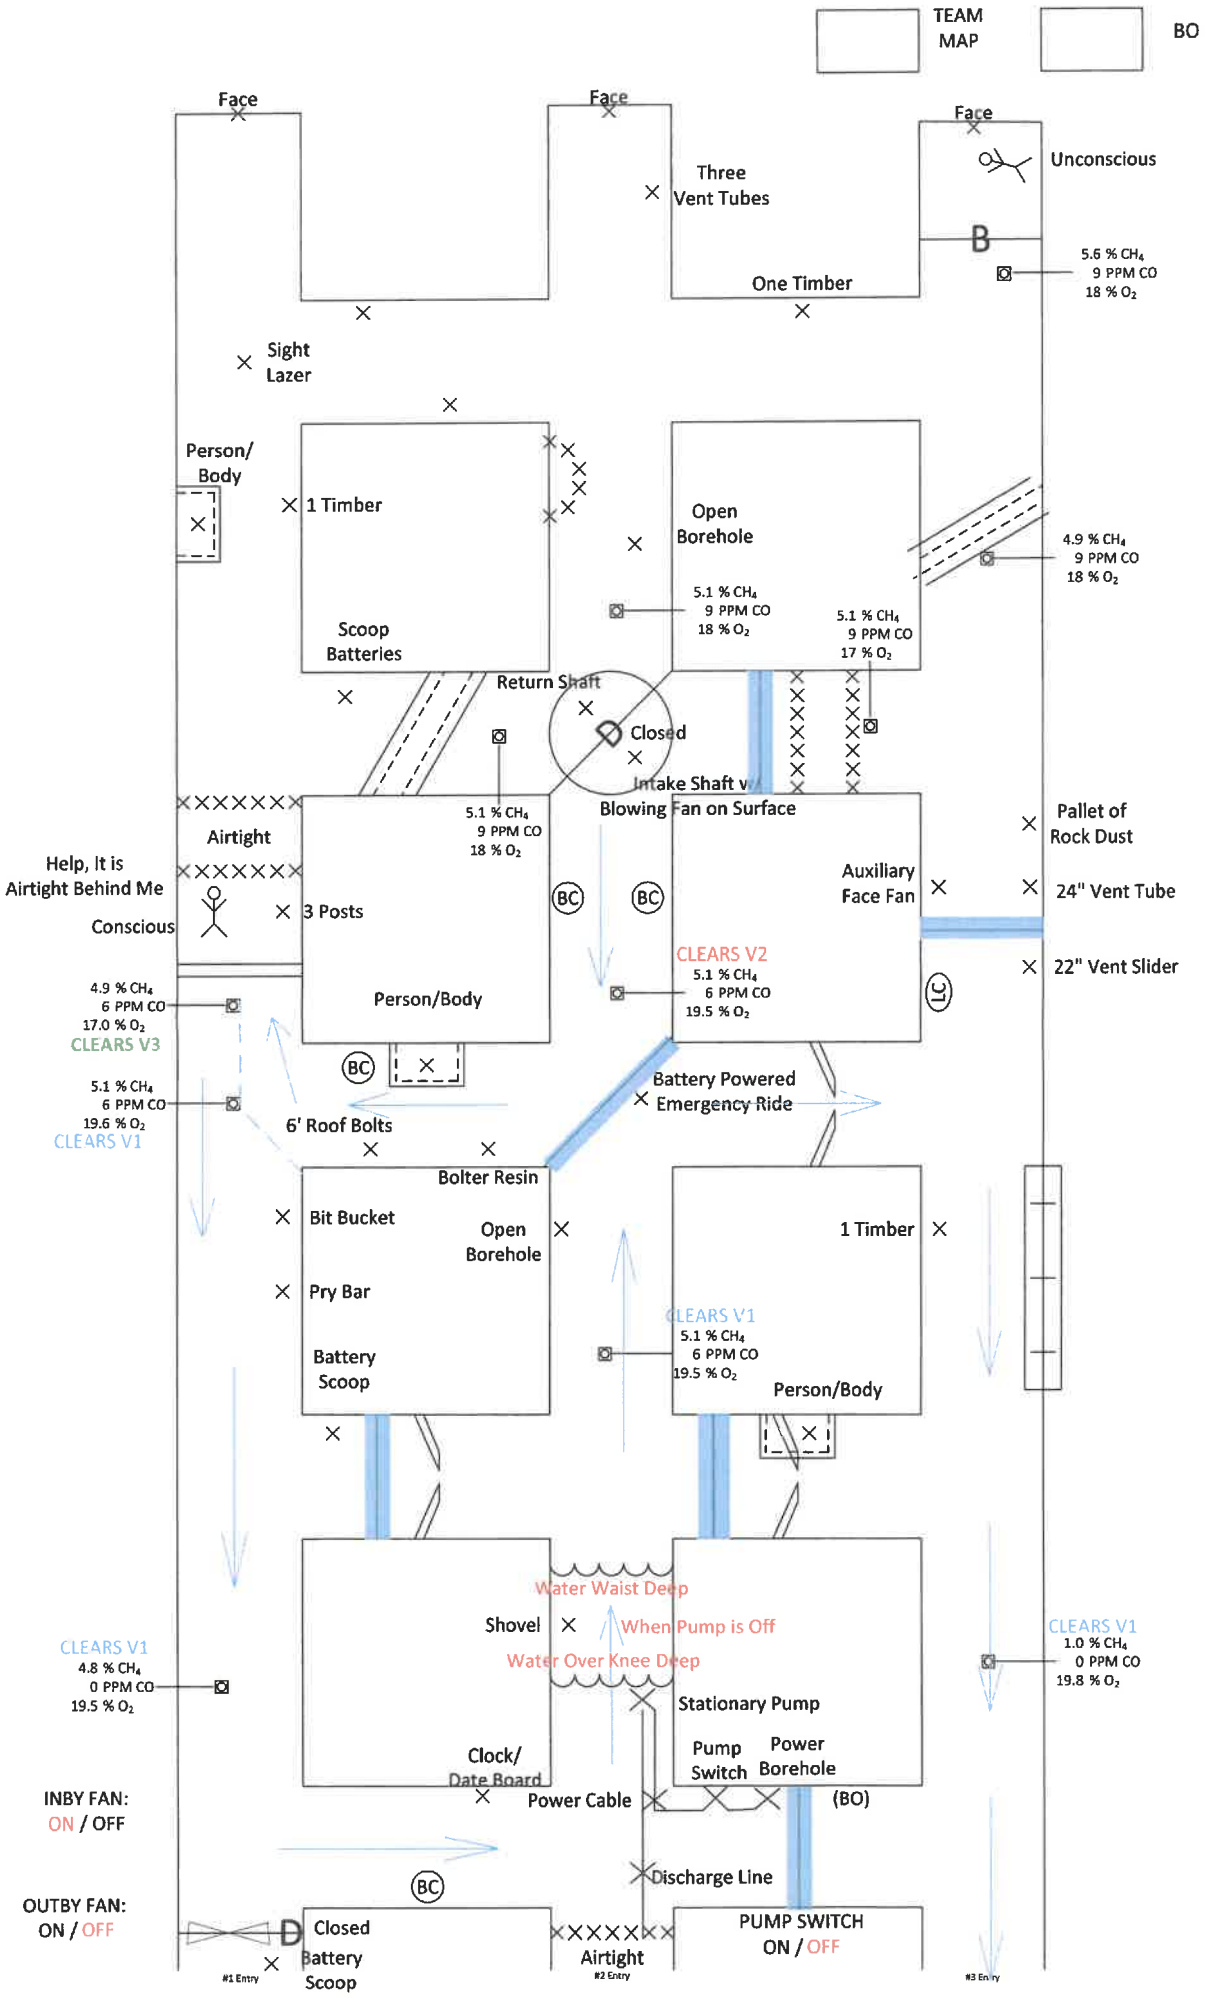

TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
One Timber
Sight Lazer
Person/ Body
1 Timber
Open Borehole
4.9 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
18 % O2
Scoop Batteries
5.1 % CH4
9 PPM CO
17 % O2
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Pallet of Rock Dust
Airtight
5.1 % CH4
9 PPM CO
18 % O2
Help, It is Airtight Behind Me
Conscious
3 Posts
BC
BC
Auxiliary Face Fan
24" Vent Tube
22" Vent Slider
4.9 % CH4
6 PPM CO
17.0 % O2
Person/Body
5.1 % CH4
6 PPM CO
19.5 % O2
LC
5.1 % CH4
6 PPM CO
19.6 % O2
BC
Battery Powered Emergency Ride
6' Roof Bolts
Bolter Resin
Bit Bucket
Open Borehole
1 Timber
Pry Bar
5.1 % CH4
6 PPM CO
19.5 % O2
Battery Scoop
Person/Body
Knee Deep
Shovel
Ankle Deep
1.0 % CH4
0 PPM CO
19.8 % O2
4.8 % CH4
0 PPM CO
19.5 % O2
Stationary Pump
Pump Switch
Power Borehole
Clock/ Date Board
Power Cable
(BO)
INBY FAN:
ON / OFF
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed
Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry

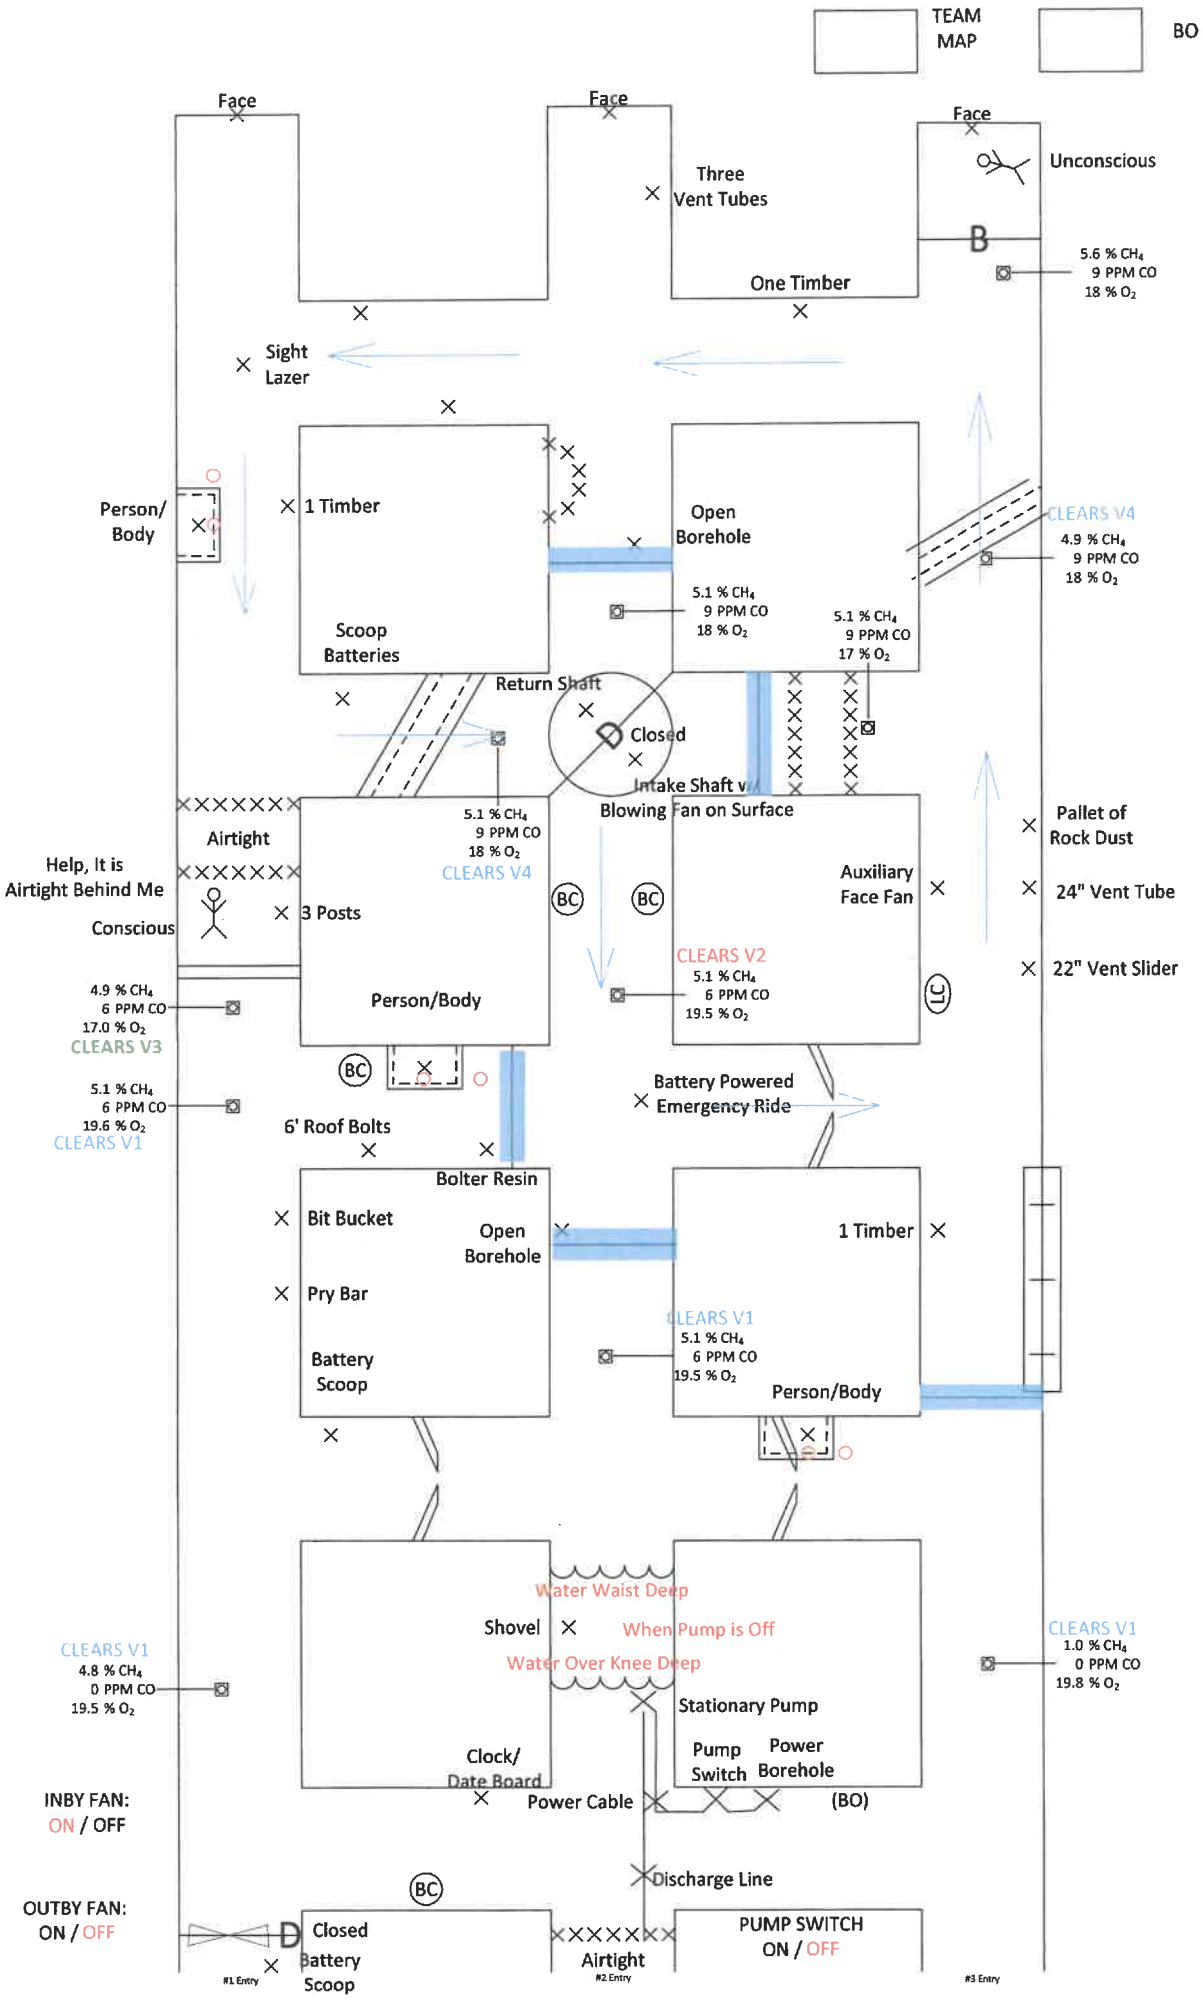

TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
One Timber
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
11
Sight Lazer
9
10
At team stop 11 Captain must post Too the person in Unsafe roof prior To passing him due to having 2 posts.
1 Timber
Open Borehole
Person/ Body
Scoop Batteries
5.1 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
17 % O2
4.9 % CH4
9 PPM CO
18 % O2
INBY FAN: ON / OFF
12
Return Shaft
Closed
7,8
7,8
Intake Shaft w/ Blowing Fan on Surface
Airtight
Help, It is Airtight Behind Me
Conscious
3 Posts
5.1 % CH4
9 PPM CO
18 % O2
After Breaching Barricade team can Then post for persons In unsafe roofs.
Person/Body
BC
BC
Once team reaches intake shaft they can Vent first Barricade If they airlock through It is delay of patient.
Auxiliary Face Fan
5.1 % CH4
6 PPM CO
19.5 % O2
LC
Pallet of Rock Dust
24" Vent Tube
22" Vent Slider
4.9 % CH4
6 PPM CO
17.0 % O2
5.1 % CH4
6 PPM CO
19.6 % O2
4,5,6
BC
4,5,6
Battery Powered Emergency Ride
4,5,6
6' Roof Bolts
Bolter Resin
Bit Bucket
Open Borehole
Pry Bar
Battery Scoop
1 Timber
5.1 % CH4
6 PPM CO
19.5 % O2
Person/Body
1,2
1,2
3
Knee Deep
Shovel
Ankle Deep
Clock/ Date Board
Stationary Pump
Pump Switch
Power Borehole
(BO)
Power Cable
4.8 % CH4
0 PPM CO
19.5 % O2
1.0 % CH4
0 PPM CO
19.8 % O2
BC
Discharge Line
OUTBY FAN: ON / OFF
D
Closed Battery Scoop
Airtight
PUMP SWITCH ON / OFF
#1 Entry
#2 Entry
#3 Entry

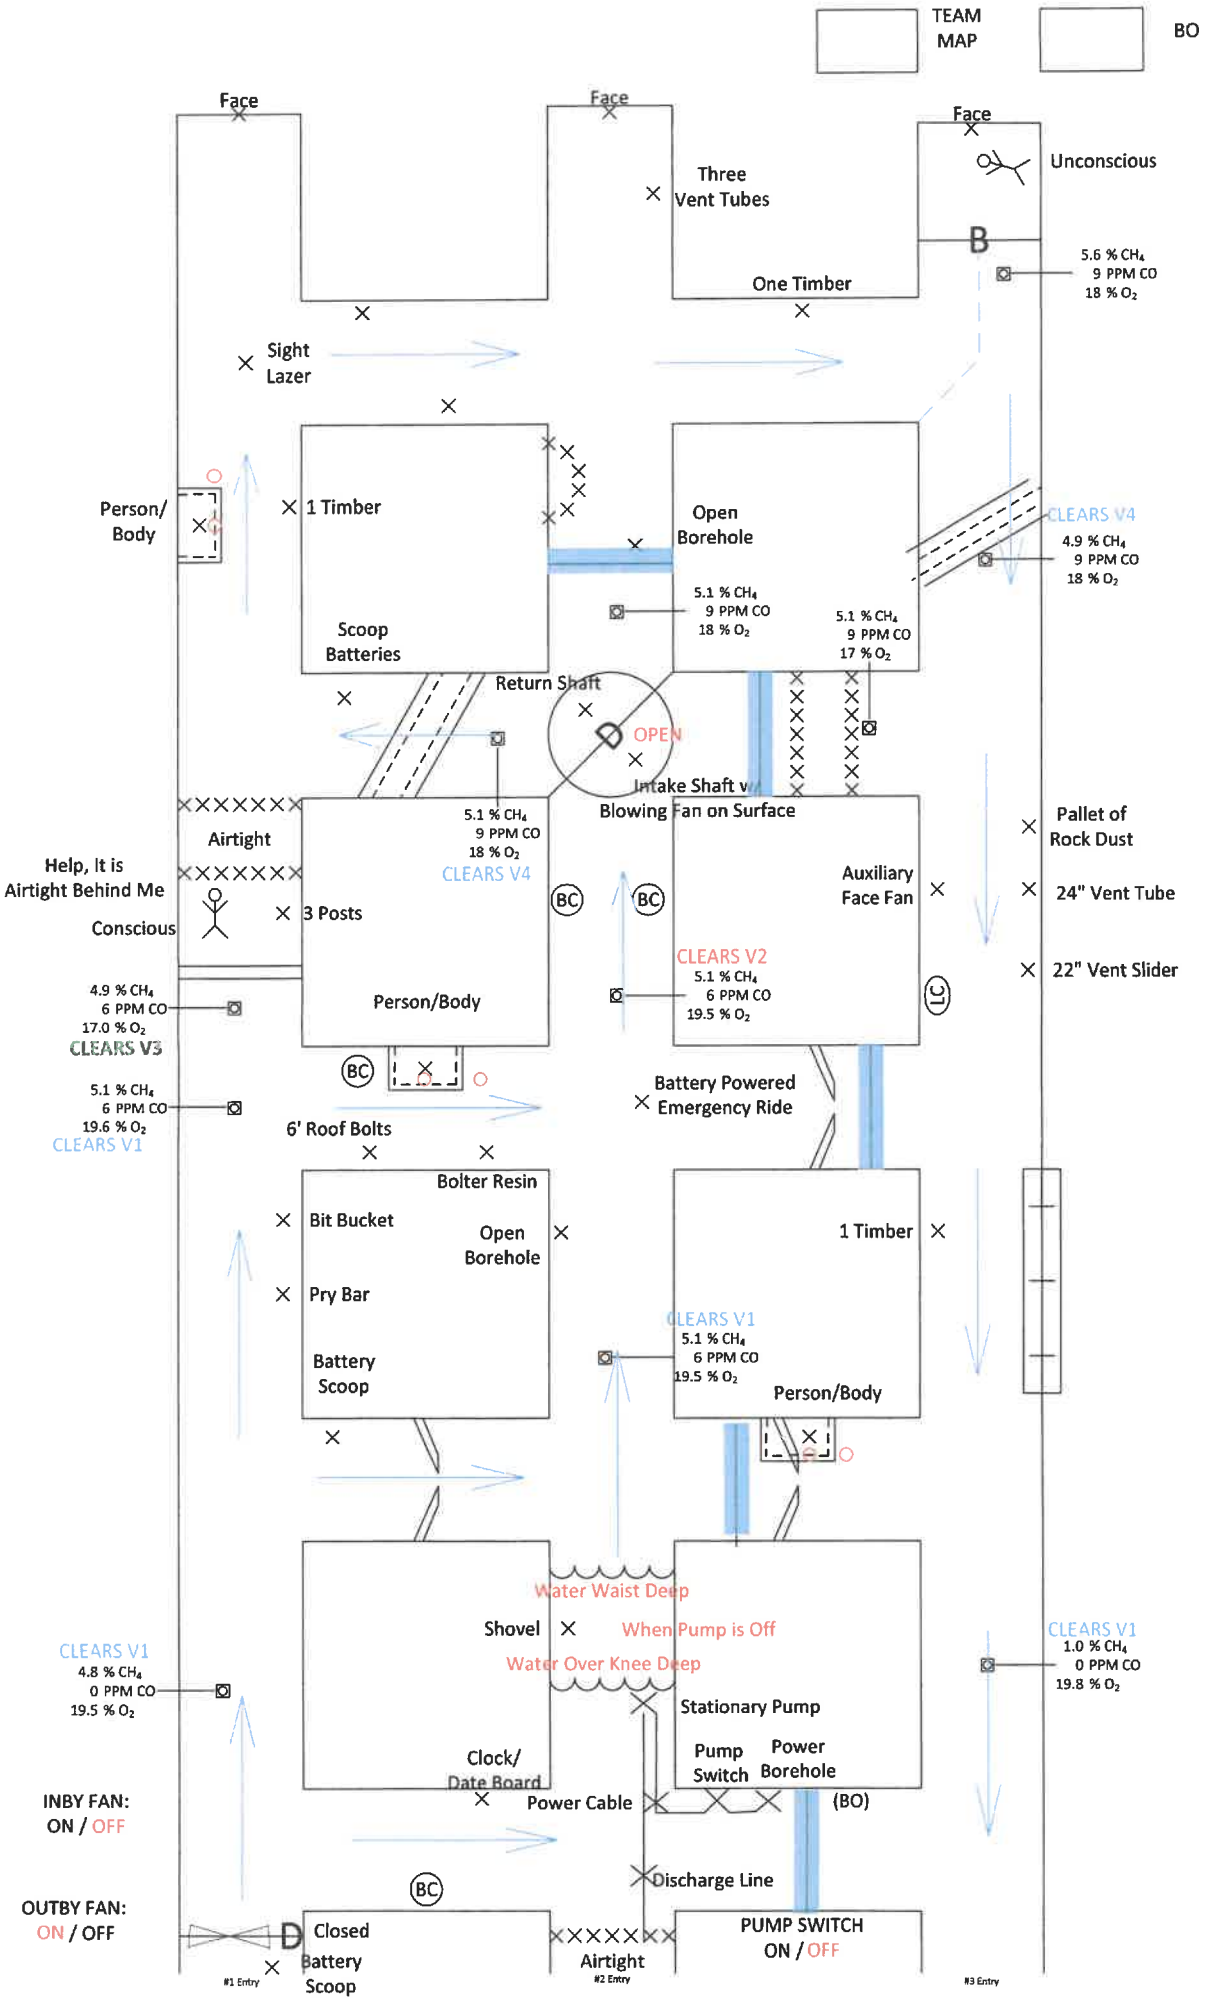

TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
One Timber
Sight Lazer
Person/ Body
1 Timber
Open Borehole
4.9 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
17 % O2
Scoop Batteries
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
Auxiliary Face Fan
24" Vent Tube
22" Vent Slider
4.9 % CH4
6 PPM CO
17.0 % O2
Person/Body
5.1 % CH4
6 PPM CO
19.5 % O2
LC
BC
BC
BC
5.1 % CH4
6 PPM CO
19.6 % O2
6' Roof Bolts
Battery Powered Emergency Ride
Bolter Resin
Bit Bucket
Open Borehole
1 Timber
Pry Bar
5.1 % CH4
6 PPM CO
19.5 % O2
Battery Scoop
Person/Body
Knee Deep
Shovel
Ankle Deep
Clock/ Date Board
4.8 % CH4
0 PPM CO
19.5 % O2
1.0 % CH4
0 PPM CO
19.8 % O2
Stationary Pump
Pump Switch
Power Borehole
INBY FAN:
ON / OFF
Power Cable
(BO)
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry


TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
One Timber
Sight Lazer
Person/ Body
1 Timber
Scoop Batteries
Open Borehole
5.1 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
17 % O2
4.9 % CH4
9 PPM CO
18 % O2
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
BC
BC
Auxiliary Face Fan
24" Vent Tube
22" Vent Slider
LC
4.9 % CH4
6 PPM CO
17.0 % O2
Person/Body
5.1 % CH4
6 PPM CO
19.5 % O2
BC
5.1 % CH4
6 PPM CO
19.6 % O2
CLEARS V1
Battery Powered Emergency Ride
6' Roof Bolts
Bolter Resin
Bit Bucket
Open Borehole
Pry Bar
Battery Scoop
1 Timber
CLEARS V1
5.1 % CH4
6 PPM CO
19.5 % O2
Person/Body
Knee Deep
Shovel
Ankle Deep
Clock/ Date Board
Stationary Pump
Pump Switch
Power Borehole
(BO)
Power Cable
CLEARS V1
4.8 % CH4
0 PPM CO
19.5 % O2
CLEARS V1
1.0 % CH4
0 PPM CO
19.8 % O2
INBY FAN:
ON / OFF
OUTBY FAN:
ON / OFF
BC
Discharge Line
D
Closed Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry


TEAM MAP
BO
Face
Face
Face
Unconscious
Three Vent Tubes
One Timber
B
5.6 % CH4
9 PPM CO
18 % O2
Sight
Lazer
Person/ Body
1 Timber
Scoop Batteries
Open Borehole
5.1 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
17 % O2
4.9 % CH4
9 PPM CO
18 % O2
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
Person/Body
BC
BC
Auxiliary Face Fan
24" Vent Tube
CLEARS V2
5.1 % CH4
6 PPM CO
19.5 % O2
22" Vent Slider
LC
4.9 % CH4
6 PPM CO
17.0 % O2
5.1 % CH4
6 PPM CO
19.6 % O2
CLEARS V1
BC
6' Roof Bolts
Battery Powered Emergency Ride
Bolter Resin
Bit Bucket
Open Borehole
Pry Bar
Battery Scoop
1 Timber
CLEARS V1
5.1 % CH4
6 PPM CO
19.5 % O2
Person/Body
Water Waist Deep
Shovel
Water Over Knee Deep
CLEARS V1
4.8 % CH4
0 PPM CO
19.5 % O2
Stationary Pump
Pump Switch
Power Borehole
Clock/ Date Board
Power Cable
(BO)
CLEARS V1
1.0 % CH4
0 PPM CO
19.8 % O2
INBY FAN:
ON / OFF
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry


TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
One Timber
Sight Lazer
Person/ Body
1 Timber
Open Borehole
4.9 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
17 % O2
Scoop Batteries
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
BC
BC
Auxiliary Face Fan
24" Vent Tube
CLEARS V2
5.1 % CH4
6 PPM CO
19.5 % O2
22" Vent Slider
LC
4.9 % CH4
6 PPM CO
17.0 % O2
CLEARS V3
Person/Body
BC
5.1 % CH4
6 PPM CO
19.6 % O2
CLEARS V1
6' Roof Bolts
Battery Powered Emergency Ride
Bolter Resin
Bit Bucket
Open Borehole
1 Timber
Pry Bar
CLEARS V1
5.1 % CH4
6 PPM CO
19.5 % O2
Battery Scoop
Person/Body
Water Waist Deep
Shovel
When Pump is Off
Water Over Knee Deep
CLEARS V1
4.8 % CH4
0 PPM CO
19.5 % O2
Stationary Pump
CLEARS V1
1.0 % CH4
0 PPM CO
19.8 % O2
Clock/ Date Board
Pump Switch
Power Borehole
INBY FAN:
ON / OFF
Power Cable
(BO)
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed
Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry


TEAM MAP
BO
Face
Face
Face
Three Vent Tubes
Unconscious
B
5.6 % CH4
9 PPM CO
18 % O2
One Timber
Sight Lazer
Person/ Body
1 Timber
Open Borehole
CLEARS V4
4.9 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
18 % O2
Scoop Batteries
5.1 % CH4
9 PPM CO
17 % O2
Return Shaft
Closed
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
CLEARS V4
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
BC
BC
Auxiliary Face Fan
24" Vent Tube
CLEARS V2
5.1 % CH4
6 PPM CO
19.5 % O2
LC
22" Vent Slider
4.9 % CH4
6 PPM CO
17.0 % O2
CLEARS V3
Person/Body
BC
Battery Powered Emergency Ride
5.1 % CH4
6 PPM CO
19.6 % O2
CLEARS V1
6' Roof Bolts
Bolter Resin
Bit Bucket
Open Borehole
1 Timber
Pry Bar
CLEARS V1
5.1 % CH4
6 PPM CO
19.5 % O2
Battery Scoop
Person/Body
Water Waist Deep
Shovel
When Pump is Off
Water Over Knee Deep
CLEARS V1
4.8 % CH4
0 PPM CO
19.5 % O2
Stationary Pump
CLEARS V1
1.0 % CH4
0 PPM CO
19.8 % O2
Clock/ Date Board
Pump Switch
Power Borehole
INBY FAN:
ON / OFF
Power Cable
(BO)
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed
Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry


TEAM MAP
BO
Face
Face
Face
Unconscious
Three Vent Tubes
One Timber
B
5.6 % CH4
9 PPM CO
18 % O2
Sight Lazer
Person/ Body
1 Timber
Open Borehole
CLEARS V4
4.9 % CH4
9 PPM CO
18 % O2
5.1 % CH4
9 PPM CO
18 % O2
Scoop Batteries
5.1 % CH4
9 PPM CO
17 % O2
Return Shaft
OPEN
Intake Shaft w/ Blowing Fan on Surface
Airtight
5.1 % CH4
9 PPM CO
18 % O2
CLEARS V4
Pallet of Rock Dust
Help, It is Airtight Behind Me
Conscious
3 Posts
BC
BC
Auxiliary Face Fan
24" Vent Tube
CLEARS V2
5.1 % CH4
6 PPM CO
19.5 % O2
LC
22" Vent Slider
4.9 % CH4
6 PPM CO
17.0 % O2
CLEARS V3
Person/Body
BC
Battery Powered Emergency Ride
5.1 % CH4
6 PPM CO
19.6 % O2
CLEARS V1
6' Roof Bolts
Bolter Resin
Bit Bucket
Open Borehole
1 Timber
Pry Bar
CLEARS V1
5.1 % CH4
6 PPM CO
19.5 % O2
Battery Scoop
Person/Body
Water Waist Deep
Shovel
When Pump is Off
Water Over Knee Deep
CLEARS V1
4.8 % CH4
0 PPM CO
19.5 % O2
Stationary Pump
CLEARS V1
1.0 % CH4
0 PPM CO
19.8 % O2
Clock/ Date Board
Pump Switch
Power Borehole
INBY FAN:
ON / OFF
Power Cable
(BO)
Discharge Line
BC
OUTBY FAN:
ON / OFF
D
Closed Battery Scoop
Airtight
PUMP SWITCH
ON / OFF
#1 Entry
#2 Entry
#3 Entry