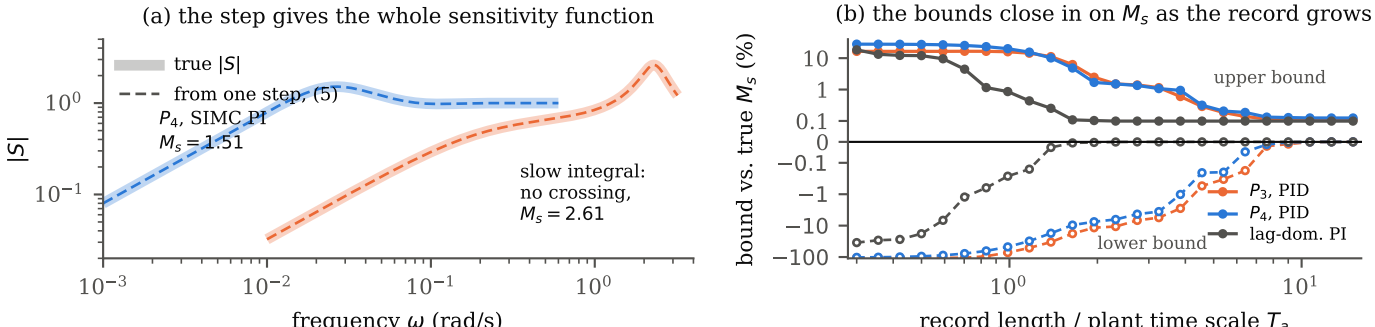
(a) the step gives the whole sensitivity function
true |S|
from one step, (5)
P4, SIMC PI
Ms = 1.51
slow integral:
no crossing,
Ms = 2.61
|S|
frequency ω (rad/s)
(b) the bounds close in on Ms as the record grows
upper bound
lower bound
P3, PID
P4, PID
lag-dom. PI
bound vs. true Ms (%)
record length / plant time scale Ta