

“identification only”

Aviano Campus

Facility Condition Assessment Report



CAMPUS SUMMARY

Year Built ¹	2002-2005
GSF ²	296,106
Date of Assessment	21-Jan-2020

¹ Indicates range of dates of construction present on campus

² Only permanent and semi permanent facilities are included

SCHOOL SUMMARY

School	Assessor Condition		Annual Condition Report (June 2019)		2009 Congressional	Starting Grade	Ending Grade	Students
	Q-Rating	FCI	Q-Rating	FCI	Q-Rating			
Aviano Elementary School	Q 1	99	Q 1	99	Q 1	Sure Start	Fifth	695
Aviano Middle/High School	Q 1	99	Q 1	99	Q 1	Sixth	Twelfth	431

BUILDING SUMMARY

Building/School	Year Built	GSF	Aviano ES (%Occupied)	Aviano MS/HS (%Occupied)	Type
Aviano ES Bldg 114	2005	20,049	100%	0%	PERM
Aviano MS/HS Bldg 151	2002	275,854	44%	86%	PERM
Aviano ES Bldg 153	2002	203	100%	0%	PERM

I. INTRODUCTION

The Aviano Campus is part of Aviano Hospital-School Annex, Aviano Air Base, Italy. This report provides a summary of findings for the physical condition assessment of buildings at this campus. The physical condition assessment includes a general description of typical building systems found and includes conditions present at the time of the site visit.

II. SCHOOL PHYSICAL DESCRIPTION

The summary below provides a physical description of the campus. When multiple systems or materials are present, the predominant system or material observed during the facility condition assessment is shown.

a. STRUCTURAL/EXTERIOR ENCLOSURE: The building exterior is an exterior insulation and finish system (E.I.F.S). Roof coverings are clay tile. Exterior doors are pre-finished aluminum with glazing. Window systems are pre-finished aluminum with double-glazing.

b. INTERIORS: Floor finishes used include ceramic tile and carpet. Walls are painted hard surfaces. Ceilings are acoustical lay-in tiles.

c. MECHANICAL: Campus facilities have heating, which is provided by boilers. All campus facilities have air conditioning, which is provided by chilled water. The campus has two elevators.

d. ELECTRICAL: No electrical upgrades have been completed, and most wiring appears to be original. Lighting is typically lay-in fixtures with fluorescent lamps. Ground-fault circuit interrupter (GFCI) receptacles appear to be present, but are not properly labeled. The campus has an intercom system. There is a security system, and security cameras are present.

e. PLUMBING: Plumbing fixtures and piping are original. Domestic hot water is provided by indirect water heaters.

f. SITE: The campus has no dedicated parking for privately owned vehicles. In addition, Aviano Elementary School has four playgrounds.

g. LIFE SAFETY: A fire safety inspection report, dated 5 August 2019, was provided for inclusion in this report. The inspection was conducted by the 34th Civil Engineer Squadron Fire Department. Multiple deficiencies were noted, and the inspection report is included in Appendix I.

"identification only"

III. OBSERVATIONS

The following observations were made: Exterior door security was observed or reported to be a problem at exterior stairways where locks are difficult to operate. Additionally, many dual leaf exterior door coordinators are not functioning properly, preventing closure if the leaves are closed in the wrong order. Exterior window awning style hold-open mechanisms are failing, causing the windows to fall while in the open position. The low slope modified bitumen and single-ply roofing systems are approaching the end of their statistical lives and are deteriorated due to age. The low slope modified bitumen roofs have deteriorated requiring areas at the Elementary School's Gym to be replaced several years ago. The areas over the Music and Storage rooms were being replaced during the assessment. The interior finishes are aging as intended; however, the carpet was observed to be in moderately deteriorated condition due to age. Additionally, the paint finishes in Building 151 appear moderately deteriorated and multicolored.

It appears that outside air is being introduced into the HVAC system. The air handlers, chillers, and exhaust fans located on the roof of Building 151 appear to be weathered and discolored. Additionally, the chiller coils appeared to be damaged due to weather elements, possibly hail. A roof-top package unit above the Gym, Room E99 is severely deteriorated. Also, there were sections of hydronic piping located on the roof that were severely deteriorated and beginning to fail. The air handlers, exhaust fans, boilers, and pumps inside the buildings were generally observed to be in good condition.

The Facility Utilization Survey (FUS) drawings to include the site plan have been updated to reflect the following: newly added X-Building X151B and X-Building X151C. Room-use changes were observed throughout the campus. Building 151 was identified as a shared facility between Aviano Elementary School, Aviano Middle/High School, and the DoDEA Europe South DSO. Additionally, the Maintenance contractor, SKE, occupies space in the building. Aviano Elementary School and Aviano Middle/High School utilize approximately 99% of Building 151 (274,442 SF); the DoDEA Europe South DSO utilizes approximately <1% of Building 151 (529 SF), and SKE utilizes approximately <1% of Building 151, specifically Rooms E99F and E99G (883 SF) for a GSF total of 275,854 SF. Finally, the assessment team observed some damage to the site work surrounding the campus; the pavers in a few areas around Building 151 are beginning to sink, this is a potential tripping hazard.

Building 114 remained a Q-1.

Building 151 remained a Q-1.

Building 153 remained a Q-1.

“identification only”

IV. QUALITY / CONDITION RATINGS

Table 1 shows building-specific information to include Real Property Unique Identifier (RPUID), type of construction, year built, gross area, Facility Condition Index (FCI), and Q-Rating. Table 2 shows buildings that are classified as temporary (TEMP) or relocatable (RELO) and therefore, by definition, are not included in Quality/Condition calculations.

TABLE 1: QUALITY / CONDITION RATINGS								
Photo	Building	RPUID	Type	Year Built	GSF	Assessed		Plant Replacement Value ³
						FCI	Q-Rating	
	114	391800	PERM	2005	20,049	100	Q 1	
	51	389310	PERM	2002	275,854	99	Q 1	
	153	389310	PERM	2002	203	100	Q 1	

³ The Plant Replacement Value is calculated according to the DoD Facility Pricing Guide

TABLE 2: TEMPORARY / RELOCATABLE BUILDINGS					
Photo	Building	Type	Year Built	GSF	Current Use
	X114A	RELO	2005	66	Storage Shed
	X114B	RELO	2005	29	Storage Shed
	X114C	RELO	2017	66	Storage Shed
	X114D	RELO	2017	66	Storage Shed

“identification only”

TABLE 2: TEMPORARY / RELOCATABLE BUILDINGS

Photo	Building	Type	Year Built	GSF	Current Use
	X151A	RELO	2017	66	Storage Shed
	X151B	RELO	2018	33	Storage Shed
	X151C	RELO	2020	96	Storage Shed

"Identification Only"

Appendix A


“identification only”

Site Plan

"Identification Only"

[illegible]

"identification only"

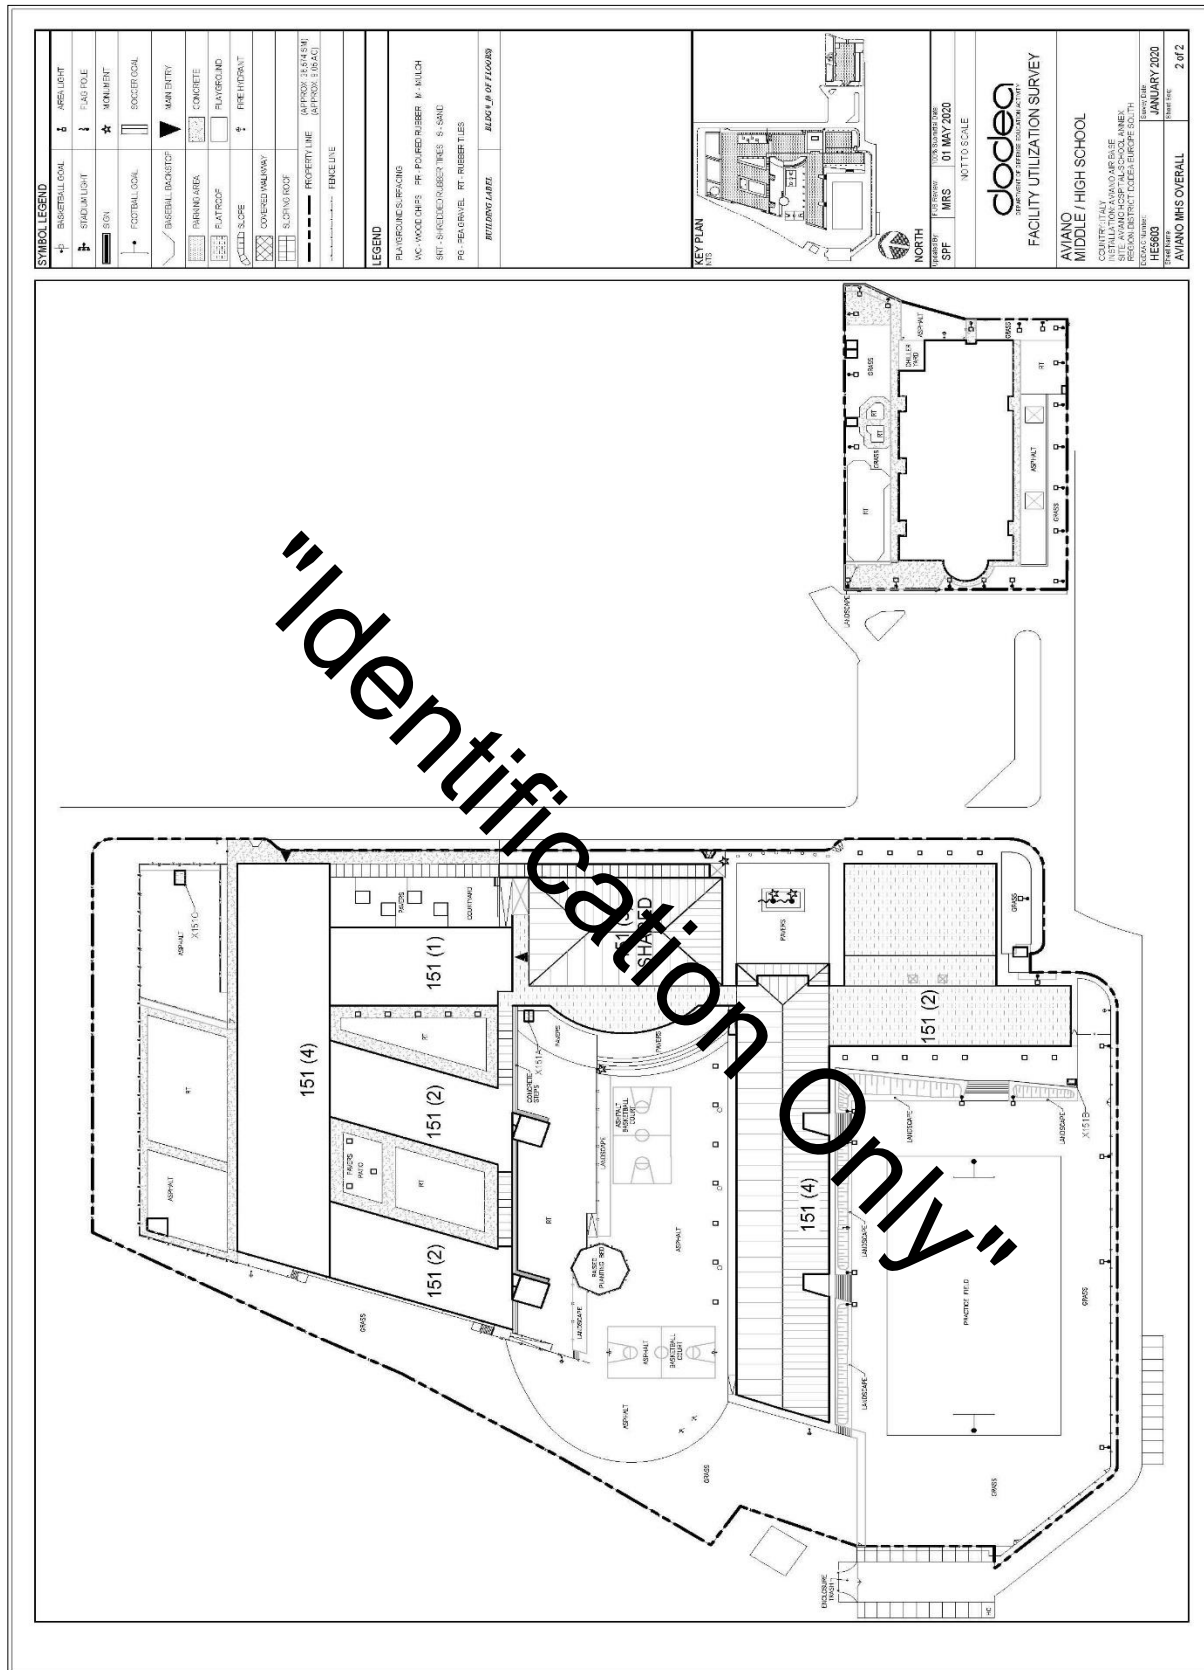

Appendix B

“identification only”

Overview of Sustainment Management System (SMS) and
BUILDER™ Engineered Management System (EMS)

“Identification Only”

Overview of Sustainment Management System (SMS) and BUILDER™ Engineered Management System (EMS)

Sustainment Management System (SMS)

The Sustainment Management System (SMS) is a suite of web-based software applications developed by the United States Army Corps of Engineers - Engineer Research Development Center - Construction Engineering Research Laboratory (USACE-ERDC-CERL) to help facility engineers, technicians, and managers decide when, where, and how to best maintain the built environment. The SMS modules include BUILDER™ and ROOFER™ for assessing building conditions, PAVER™ for pavements, and RAILER™ for railroad infrastructure.

Because real property assets are so vast and diverse, a "knowledge-based" philosophy drives the SMS process. The process starts with the automated download of real property data, and then more detailed system inventory is modeled and/or collected which identifies components and their key life cycle attributes such as the age and material.

From this inventory, Condition Index (CI) measures for each component are predicted based on its expected stage in the life cycle. Objective and repeatable inspections can then be performed on various components to verify their condition with respect to the expected life cycle deterioration. The level of detail and frequency of these inspections are not fixed like other processes; they are dependent on knowledge of component criticality, the expected and measured condition and rate of deterioration, and remaining maintenance and service life. This "knowledge-based" inspection focuses attention to the most critical components at the time. In addition to these condition assessments, functionality assessments can be performed to evaluate user requirement changes, compliance and obsolescence issues. This provides a comprehensive picture of the overall performance of real property assets and their key components.

BUILDER Engineered Management System (EMS)

In September 2013, the Under Secretary of Defense, Frank Kendall, issued a memo indicating the Department of Defense requires a standardized process for facility condition assessments to ensure consistent and reliable data necessary for sound strategic investment decisions in managing the Department's built environment.

Establishing a DoD-wide facility condition assessment process will contribute to a more credible DoD asset management program and will support better buying power by allowing Department leadership to better target fiscal resources to those facilities most in need of investment. Further, adopting a standard process will help ensure that condition data will be audit-ready in accordance with the Under Secretary of Defense (Comptroller)'s "Financial Improvement and Readiness Guidance" issued in March 2013.

The facility condition assessment process used to generate this report is based on BUILDER Engineered Management System (EMS) Version 3. BUILDER EMS was developed by the Engineer Research and Development Center.

The facility condition assessment process addresses the requirements necessary for routine building facility management activities, including long range budgeting and sustainment/restoration/modernization (SRM) planning. This assessment approach provides an objective and generalized framework to help to identify problem areas that will require more investigation through detailed or specialized assessments. There may be times when detailed engineering assessments may be required to diagnose specific problems.

BUILDER is a software application for building asset life cycle management. The primary focus of BUILDER is work plan development. BUILDER stores real property building information and more detailed system inventory is modeled and/or collected which identifies building components and their key life cycle attributes such as the age, material and capacity. Inspections are then performed on the various components to

determine an objective and repeatable Condition Index (CI) measure, which relates the general physical health of the asset.

With information about condition and remaining service life, BUILDER guides the development of short- and long-range work plans based on sound investment strategies, prioritization criteria, and budget constraints. BUILDER consolidates a variety of building-related management issues into a single decision-support package.

The system gives functional managers and decision-makers instant access to building inventory, current building condition indices, and probabilities condition prediction models. It also employs a patented knowledge-based inspection scheduling process. BUILDER improves the allocation process and return of building life cycle investments by directing resources to the most condition critical components to avoid costly repair penalty costs, as well as, the most mission critical components to manage risks of failure.

BUILDER Facility Condition Assessment Process

Facility Condition Assessment (FCA) is one of the primary processes of a facility life cycle asset management program. The FCA process results in a better understanding of the physical condition and readiness of an organization's buildings along with the reliability of its systems and components. It also facilitates the identification of work candidates for facility SRM repair projects. It is a critical aspect of the shift towards a proactive versus reactive facility management strategy. Instead of keeping facilities operational by relying primarily on corrective repairs (after a system or component has failed due to significant loss of function), it focuses on condition-based repairs which can be planned prior to failure. A condition-based approach can result in higher performing facilities at lower life cycle costs.

Prior to an assessment, knowledge of the building systems and components present is necessary, since assessments are done against these components, not against the building as a whole. This information about the systems and components that make up a building is called the BUILDER Inventory. BUILDER has a vast library of predefined components which an assessor will select from, and the inventory collection process involves identifying the type, quantity, and year installed for all pertinent components. These components are also organized into systems and sub-systems according to the UNIFORMAT classification hierarchy. When a specific instance of a component is recorded, this is called a component-section in BUILDER, and represents a single component assembly or collection of like components to be managed as a single unit. The BUILDER facility condition assessment process directly supports the computation of a condition index for building component-sections, known as the Component-Section Condition Index (CSCI), which is the fundamental metric used in BUILDER. The CSCI is aggregated to compute a condition index metric at the system (SCI), building (BCI), and site/organizational levels.

A condition-based facility repair strategy requires condition information be collected at a component level, and that this condition information relate to loss of component function. Every component of a building has a primary function that it performs. This function is the reason that the component was constructed or installed in the building. It may also serve a number of secondary or tertiary functions. For example, for a door component, the primary function is to provide safe entry/egress of authorized movements while limiting unwanted movements of people (security), or other objects (water or moisture). The secondary functions would relate to aesthetics and thermal and air control, among others.

The condition assessment process in BUILDER uses the Direct Rating method.

1. The **Direct Rating** method uses a single qualitative rating for each component based on condition observations. This also results in a condition index metric, which relates to the level of deterioration and the loss of function. This abbreviated Direct Rating approach is often better suited to initial baseline assessments where the components are inventoried, and data is initially loaded into BUILDER.

“identification only”

The following figure illustrates the Direct Rating criteria used in this assessment.

RATING	SRM NEEDS	RATING DEFINITION
Green (+)	Sustainment consisting of possible preventive maintenance (where applicable)	Entire component-section or component-section sample is free of observable or known distress.
Green	Sustainment consisting of possible preventive maintenance (where applicable) and minor repairs (corrective maintenance) to possibly few or some subcomponents.	No component-section or sample serviceability* or reliability* reduction. Some, but not all minor (non-critical) subcomponents may suffer from slight degradation or few major (critical) subcomponents may suffer from slight degradation.
Green (-)		Slight or no serviceability or reliability or reliability reduction overall to the component-section or sample. Some, but not all minor (non-critical) subcomponents may suffer from slight degradation or more than one major (critical) subcomponents may suffer from slight degradation.
Amber (+)	Sustainment or restoration to any of the following: Minor repairs to several sub-components; or Significant repair, rehabilitation or replacement of one or more subcomponents, but not enough to encompass the component-section as a whole; or Combinations thereof.	Component-section or sample serviceability or reliability is degraded, but adequate. A very few major (critical) subcomponents may suffer from moderate deterioration with perhaps a few minor (non-critical) subcomponents suffering from severe deterioration.
Amber		Component-section or sample serviceability or reliability is definitely impaired. Some, but not a majority of major (critical) subcomponents may suffer from moderate deterioration with perhaps many minor (non-critical) subcomponents suffering from severe deterioration.
Amber (-)		Component-section or sample has significant serviceability or reliability loss. Most subcomponents may suffer from moderate degradation or a few major (critical) subcomponents may suffer from severe degradation.
Red (+)	Sustainment or restoration required consisting of major repair, rehabilitation or replacement to the component-section as a whole.	Significant serviceability or reliability reduction in component-section or sample. A majority of subcomponents are severely degraded, and others may have varying degrees of degradation.
Red		Severe serviceability or reliability reduction to the component-section or sample such that it is barely able to perform. Most subcomponents are severely degraded.
Red (-)		Overall component-section degradation is total. Few, if any subcomponents are salvageable. Complete loss of component-section or sample serviceability.

“identification only”

Once the component-sections have been rated with a Direct Rating, BUILDER calculates the Component-Section Condition Index (CSCI) of the component-section. The next step in the process is to create a work plan, which will list the component-sections that need repair or replacement and the estimated cost of the repair or replacement.

To create a work plan, condition standards, policies and a policy sequence are created. The standards serve as thresholds for CSCI and remaining service life. Policies link standards to component-sections and policy sequences link standards and policies together.

The table below summarizes the DoDEA standards and how they are applied to the component-sections for this assessment.

Standard and Component-section Cross-Reference		
Standard	CI Threshold	Component-section
Amber +	80	D4010 FIRE ALARM AND DETECTION SYSTEMS
Amber	71	B3010 ROOF COVERINGS D1010 ELEVATORS AND LIFTS D2010 PLUMBING FIXTURES D3020 HEAT GENERATING SYSTEMS D3030 COOLING GENERATING SYSTEMS D3040 DISTRIBUTION SYSTEMS (A) D3050 TERMINAL & PACKAGE UNITS D3060 CONTROLS & INSTRUMENTATION D3090 OTHER HVAC SYSTEMS AND EQUIPMENT D4020 FIRE SUPP WATER SUPPLY / EQUIP D4030 STANDPIPE SYSTEMS D4040 SPRINKLERS D4050 FIRE PROTECTION SPECIALTIES D4090 OTHER FIRE PROTECTION SYSTEMS D5010 ELECTRICAL SERVICE & DISTRIBUTION D5020 LIGHTING & BRANCH WIRING D5030 COMMUNICATIONS & SECURITY D5090 OTHER ELECTRICAL SERVICES
Amber -	61	B2030 EXTERIOR DOORS C1020 INTERIOR DOORS C3010 WALL FINISHES C3020 FLOOR FINISHES C3030 CEILING FINISHES C3040 INT COATINGS / SPECIAL FINISHES D3010 ENERGY SUPPLY
Red +	50	B2010 EXTERIOR WALLS B2020 EXTERIOR WINDOWS C1030 SPECIALTIES D1020 WEIGHT HANDLING EQUIPMENT D1030 ESCALATORS AND MOVING WALKS D1090 OTHER CONVEYING SYSTEMS D2020 DOMESTIC WATER DISTRIBUTION D2030 SANITARY WASTE D2040 RAIN WATER DRAINAGE D2090 OTHER PLUMBING SYSTEMS D3070 SYSTEMS TESTING & BALANCING
Service Life	40	Paint

“identification only”

For this project, the following building components are not included in the BUILDER Inventory and are not evaluated during the assessment unless significant damage or deterioration was observed or reported.

- A1010 STANDARD FOUNDATIONS
- A1020 SPECIAL FOUNDATIONS
- A1030 SLAB ON GRADE
- A2010 BASEMENT EXCAVATION
- A2020 BASEMENT WALLS
- B1010 FLOOR CONSTRUCTION
- B1020 ROOF CONSTRUCTION
- B2010 EXTERIOR WALLS
- C1010 PARTITIONS
- C2010 STAIR CONSTRUCTION

Damage that is not visible or that is unknown will not be reflected in facility condition index calculations. It is anticipated that unknown damage or deterioration is more likely to be present in older facilities than more modern facilities.

In addition, some building components are concealed or inaccessible. In accordance with BUILDER guidelines, quantities for concealed and inaccessible components have been estimated and recorded in the BUILDER Inventory but have not been rated. When concealed or inaccessible components are encountered, life cycle data contained within BUILDER is used to predict renewal requirements, which are included in facility condition index calculations. Components that are often concealed or inaccessible include:

- D2020 DOMESTIC WATER PIPING
- D2030 SANITARY WASTE PIPING
- D3040 HVAC DISTRIBUTION
- D4010 FIRE ALARM DISTRIBUTION
- D5020 ELECTRICAL BRANCH WIRING

In addition to the building components noted above, if a building component is concealed or inaccessible, life cycle data contained within BUILDER is used to predict renewal requirements.

When a work plan is created, the CSCI of a component-section is compared to its associated standard. If the CSCI is less than or equal to the threshold in the standard, the remaining service life is evaluated. If the service life is less than the standard's remaining service life, BUILDER will add this section to the work plan and generate dollars to estimate a cost for the replacement.

If the CSCI is less than or equal to the threshold in the standard and the service life is greater than the standard's remaining service life, BUILDER will conduct a cost benefit analysis. The cost benefit analysis will determine whether the component-section should be repaired or left to expire at the end of its service life. When BUILDER determines a repair is the correct action, BUILDER will add this section to the work plan and generate dollars to estimate a cost for the repair.

When BUILDER determines taking no action is more cost effective, BUILDER will not add the component-section to the work plan. For example, if the CSCI for an external door component-section is 50 with a remaining service life of five years, BUILDER will compare the CSCI of 50 to the CI Threshold set by DoDEA and determine that 50 is less than the threshold of 61. BUILDER will compare the five years of remaining service life against the zero years of the threshold and determine a cost benefit analysis is required. The results of the cost benefit analysis will typically suggest to take no action and let the component-section run until the end of its service life before generating an item in the work plan.

A typical life cycle of a component-section is explained below.

Condition	Work Plan
CSCI > threshold	Work plan does not generate an item for the component-section
CSCI = threshold or just below it	Work plan will generate a repair item for the component-section
CSCI < threshold and the remaining service life > service life threshold	Work plan will remove the repair item for the component-section. It is too costly to repair so it is better to wait to replace it.
Remaining service life < service life threshold	Work plan will generate a replace item for the component-section

“identification only”

Facility Condition Assessment Data Analysis

In multiple building portfolios and especially with widespread geographic portfolios, it is important to know how building conditions compare. The Condition Index (CI) and Quality Ratings (Q-Ratings) are determined for each building assessed using guidelines shown below.

Condition Index (CI) – A measure of the constructed asset’s condition at a specific point in time with respect to physical condition and ability to support the current occupant or mission. CI is calculated as the ratio of estimated cost of maintenance and repair requirements to Plant Replacement Value (PRV). Maintenance and repair requirements consist of that work necessary to ensure that a constructed asset is restored to a condition substantially equivalent to the originally intended and designed capacity, efficiency or capability. The formula for Condition Index is:

$$CI = 1 - \left(\frac{\text{Requirements}}{\text{PRV}} \right) \times 100$$

Q-Rating Bands – Bands allow OSD, Military Services, and Defense Agencies/Activities to group facilities by condition for the purposes of developing investment strategies.

TABLE 1: Q-RATING DESCRIPTIONS		
Rating Band	Calculated Rating (Condition Index)	General Description
Q-1	100 to 90	Facility new or well-maintained (Good Condition)
Q-2	89 to 80	Facility is satisfactorily maintained (Fair Condition)
Q-3	79 to 60	Facility is under maintained (Poor Condition)
Q-4	59 to 0	Facility should be considered for replacement (Failing Condition)

Requirements – Sum of the work items from BUILDER.

Plant Replacement Value – Cost to design and construct a notional facility to current standards to replace an existing facility on the same site, (reference United Facilities Criteria UFC 3-701-01 23 May 2018, Change 3, 29 July 2019).

BUILDER Report Overview

Outlined below is a summary and description of the reports that are included.

Appendix C - Facility Summary Report – Provides a summation of FCA results. A Building Summary Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating. The purpose of this report is to provide a general overview of the building including key performance indicators. This report was generated using DoDEA's calculated Replacement Cost overwriting the data populated from real property records. This provides a more accurate Replacement Cost due to the inconsistencies with real property reconciliation between DoDEA and the Services. The DoD Facility Pricing Guide and DoDEA measurements for building square footage were used to calculate the Replacement Cost.

Appendix D - System Summary Report – Provides an overview of inspected systems and their condition index rating. A Building System Condition Index (SCI) By System Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating.

Appendix E - Work Items By Building – Provides a list of work items requiring repair or replacement of system/components, including budgets, for project planning purposes. A Work Plan Detail by Year Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating.

Appendix F - Remaining Service Life (RSL) Detail Report – Provides a detailed overview of systems/components, including descriptions, and their respective age, remaining service life and remaining paint life.

Appendix G - Direct Condition Rating Inspection By Section Report – Provides a summary of direct condition ratings for each component-section collected within each facility.

Appendix H - System Inventory Report – Provides a list of details for each component-section collected within each facility.

Appendix I - Fire Inspection Safety Report – This appendix is only applicable when a Fire Inspection Safety Report is provided at the time of the assessment for inclusion in the Facility Condition Assessment Report. The report provides a summary of the recent Fire Inspection to include any deficiencies.

Note: All reports are generated from the DoDEA BUILDER database. In the event line items within a report are compressed and difficult to read, this is a result of how BUILDER generates the report. It is our understanding that CERL is working to update the report format.

“identification only”

Summary of Terms

Acronyms	Description
BCI	Building Condition Index - Measures the condition of the building as a whole. The higher the BCI, the better.
BFI	Building Functionality Index - Measures the functionality of a building as a whole. The higher the BFI, the better.
BPI	Building Performance Index - Measures the overall performance of a building. The higher the BPI, the better.
EA	Each
ESC	Emergency Service Call
FCI	Facility Condition Index - The current maintenance, repair, and replacement deficiencies of the facility divided by the current replacement value of the facility, derives the FCI of a facility. The higher the FCI, the better.
GSF	Gross Square Foot
ISR	Installation Status Report - Measures installation condition against Army-wide standards.
LF	Linear Feet
MBH	Thousands of BTU per hour.
MDI	Mission Dependency Index - Measures how critical a facility is to the overall mission of its owner. The higher the MDI, the more critical.
PERM	Permanent
RELO	Relocatable
RPL	Remaining Paint Life - Displays the remaining paint life, in years, of a section.
RPUID	Real Property Unique Identifier - The unique identification number assigned to each asset.
RSL	Remaining Service Life - Displays the remaining service life, in years, of a section.
SCI	System Condition Index - Measures the condition of a system as a whole. The higher the SCI, the better.
SF	Square Foot
TEMP	Temporary
UM	Unit of Measure

Appendix C

"identification only"

Facility Summary Report

"Identification Only"

114 - Aviano ES Bldg 114

Aviano Hospital-School Annex - Aviano ES

"identification only"



YEAR BUILT: 2005

AREA (SF): 20,049

PLANT REPLACEMENT COST: [REDACTED]

SURVEY DATE: January 2020

TOTAL DEFICIENCIES: \$0

BUILDER(TM) METRIC		SCORE
Facility Condition Index	FCI:	100

153 - Aviano ES Bldg 153

Aviano Hospital-School Annex - Aviano ES



YEAR BUILT: 2002

AREA (SF): 203

PLANT REPLACEMENT COST: [REDACTED]

SURVEY DATE: January 2020

TOTAL DEFICIENCIES: [REDACTED]

BUILDER(TM) METRIC		SCORE
Facility Condition Index	FCI:	100

151 - Aviano Bldg MS/HS 151

Aviano Hospital-School Annex - Unassigned



YEAR BUILT: 2002

AREA (SF): 275,854

PLANT REPLACEMENT COST: [REDACTED]

SURVEY DATE: January 2020

TOTAL DEFICIENCIES: [REDACTED]

BUILDER(TM) METRIC		SCORE
Facility Condition Index	FCI:	99

Appendix D

"identification only"

System Summary Report

"Identification Only"

DoDEA SYSTEM SUMMARY

Aviano Hospital-School Annex

Complex	Building #	Building Name	A10	A20	B10	B20	B30	C10	C20	C30	D10	D20	D30	D40	D50	E10	E20	F10	F20	G10	G20	G30	G40	G90
Aviano ES	114	Aviano ES Bldg 114				85	85	80	88	77		92	80	86	90									
Aviano ES	153	Aviano ES Bldg 153				86	86	88		88														
Unassigned	151	Aviano Bldg MS/HS 151				85	78	78	77	73	86	89	88	80	87	95								

A10 - Foundations

A20 -Basement Construction

B10 - Superstructure

B20 - Exterior Enclosure

B30 - Roofing

C10 - Interior Construction

C20 - Stairs

C30 - Interior Finishes

D10 - Conveying

D20 - Plumbing

D30 - HVAC

D40 - Fire Protection

D50 - Electrical

E10 - Equipment

E20 - Furnishings

F10 - Special Construction

F20 - Selective Building Demo

G10 - Site Preparations

G20 - Site Improvements

G30 - Site Civil / Mech Utilities

G40 - Site Electrical Utilities

G50 - Other Site Construction

Appendix E

"identification only"

Work Items By Building

"Identification Only"



"identification only"

Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

151 - Aviano Bldg MS/HS 151

Unassigned

Year	System	Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description								
-- Description						Completion Date		
2015 B20 EXTERIOR ENCLOSURE								
	B2010 EXTERIOR WALLS	132,580 (SF)	Replace					
	2002 B201001 EXTERIOR CLOSURE E.I.F.S.							
	-- Replace B2010 EXTERIOR WALLS 2002 B201001 EXTERIOR CLOSURE Stucco							
2015 C30 INTERIOR FINISHES								
	C3020 FLOOR FINISHES	85,091 (SF)	Replace					
	2002 C302005 CARPETING General							
	-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General							
2015 D30 HVAC								
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Repair					
	2002 A D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller							
	-- Repair D3030 COOLING GENERATING SYSTEMS Chiller1 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller							
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Repair					
	2002 C D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 270 TN, Air Cooled Screw Liquid Chiller							
	-- Repair D3030 COOLING GENERATING SYSTEMS Chiller3 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller							
2015 D40 FIRE PROTECTION								
	D4010 FIRE ALARM AND DETECTION SYSTEMS	278,700 (SF)	Repair					
	2002 D401001 FIRE ALARM DISTRIBUTION Other							
	-- Repair D4010 FIRE ALARM AND DETECTION SYSTEMS D401001 FIRE ALARM DISTRIBUTION General							
2016 B20 EXTERIOR ENCLOSURE								
	B2010 EXTERIOR WALLS	132,580 (SF)	Replace					
	2002 B201001 EXTERIOR CLOSURE E.I.F.S.							
	-- Replace B2010 EXTERIOR WALLS 2002 B201001 EXTERIOR CLOSURE Stucco							



"identification only"

Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

151 - Aviano Bldg MS/HS 151

Unassigned

Year	System Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description							
-- Description					Completion Date		
2016	C30 INTERIOR FINISHES						
	C3020 FLOOR FINISHES	88,001 (SF)	Replace				
	2002 C302005 CARPETING General						
	-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General						
2016	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Repair				
	2002 A D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller						
	-- Repair D3030 COOLING GENERATING SYSTEMS Chiller1 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Repair				
	2002 B D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller						
	-- Repair D3030 COOLING GENERATING SYSTEMS Chiller2 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Repair				
	2002 C D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 270 TN, Air Cooled Screw Liquid Chiller						
	-- Repair D3030 COOLING GENERATING SYSTEMS Chiller3 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller						
	D3040 DISTRIBUTION SYSTEMS	5,500 (MBH)	Repair				
	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General						
	-- Repair D3040 DISTRIBUTION SYSTEMS D304003 HOT WATER DISTRIBUTION SYSTEMS General						
	D3040 DISTRIBUTION SYSTEMS	100 (TON)	Repair				
	2002 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General						
	-- Repair D3040 DISTRIBUTION SYSTEMS D304006 CHILLED WATER DISTRIBUTION SYSTEMS General						
2016	D40 FIRE PROTECTION						
	D4010 FIRE ALARM AND DETECTION SYSTEMS	278,700 (SF)	Repair				
	2002 D401001 FIRE ALARM DISTRIBUTION Other						
	-- Repair D4010 FIRE ALARM AND DETECTION SYSTEMS D401001 FIRE ALARM DISTRIBUTION General						
2017	B20 EXTERIOR ENCLOSURE						



Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

151 - Aviano Bldg MS/HS 151

Unassigned

Year	System Component	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
Section Description							
-- Description							
B2010	EXTERIOR WALLS	132,680 (SF)	Replace				
2002	B201001 EXTERIOR CLOSURE E.I.F.S.						
-- Replace B2010 EXTERIOR WALLS 2002 B201001 EXTERIOR CLOSURE Stucco							
2017 C10 INTERIOR CONSTRUCTION							
C1010	PARTITIONS	323,423 (SF)	Paint				
2002	C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing						
-- Paint C1010 PARTITIONS 2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing							
2017 C20 STAIRS							
C2010	STAIR CONSTRUCTION	1,243 (LF)	Paint				
2002	C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General						
-- Paint C2010 STAIR CONSTRUCTION C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General							
2017 C30 INTERIOR FINISHES							
C3020	FLOOR FINISHES	85,091 (SF)	Replace				
2002	C302005 CARPETING General						
-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General							
C3030	CEILING FINISHES	66,789 (SF)	Paint				
2002	C303003 PLASTER CEILING FINISHES General						
-- Paint C3030 CEILING FINISHES 2002 C303003 PLASTER CEILING FINISHES General							
2017 D30 HVAC							
D3040	DISTRIBUTION SYSTEMS	1 (EA)	Repair				
2002	M401 AHU6 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU						
-- Repair D3040 DISTRIBUTION SYSTEMS AHU6 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU							
D3040	DISTRIBUTION SYSTEMS	1 (EA)	Repair				
2002	M401 AHU7 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU						
-- Repair D3040 DISTRIBUTION SYSTEMS AHU7 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU							



Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

151 - Aviano Bldg MS/HS 151

Unassigned

Year	System Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description					Completion Date		
-- Description							
	D3040 DISTRIBUTION SYSTEMS	1 (EA)	Repair				
	2002 M403 AHU1 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU						
	-- Repair D3040 DISTRIBUTION SYSTEMS AHU1 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU						
2018	B20 EXTERIOR ENCLOSURE						
	B2010 EXTERIOR WALLS	132,580 (SF)	Paint				
	2002 B201001 EXTERIOR CLOSURE E.I.F.S.						
	-- Paint B2010 EXTERIOR WALLS 2002 B201001 EXTERIOR CLOSURE Stucco						
2018	C20 STAIRS						
	C2010 STAIR CONSTRUCTION	2,003 (LF)	Paint				
	2002 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General						
	-- Paint C2010 STAIR CONSTRUCTION 2002 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General						
2018	C30 INTERIOR FINISHES						
	C3020 FLOOR FINISHES	90,000 (SF)	Replace				
	2002 C302005 CARPETING General						
	-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General						
2018	D50 ELECTRICAL						
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Replace				
	2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations						
	-- Replace D5030 COMMUNICATIONS & SECURITY 2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations						
2019	C30 INTERIOR FINISHES						
	C3020 FLOOR FINISHES	90,000 (SF)	Replace				
	2002 C302005 CARPETING General						
	-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General						



"identification only"

Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

151 - Aviano Bldg MS/HS 151

Unassigned

Year	System	Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description			Completion Date					
-- Description								
2019	D50 ELECTRICAL							
	D5030 COMMUNICATIONS & SECURITY	2 (EA)	Replace					
	2002 D503002 PUBLIC ADDRESS SYSTEMS 100 outlets							
	-- Replace D5030 COMMUNICATIONS & SECURITY 2002 D503002 PUBLIC ADDRESS SYSTEMS 100 outlets							
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Replace					
	2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations							
	-- Replace D5030 COMMUNICATIONS & SECURITY 2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations							
2020	C30 INTERIOR FINISHES							
	C3020 FLOOR FINISHES	90,000 (SF)	Replace					
	2002 C302005 CARPETING General							
	-- Replace C3020 FLOOR FINISHES 2002 C302005 CARPETING General							
2020	D30 HVAC							
	D3040 DISTRIBUTION SYSTEMS	6,896 (MBH)	Replace					
	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General							
	-- Replace D3040 DISTRIBUTION SYSTEMS 2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General							
2020	D50 ELECTRICAL							
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Replace					
	2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations							
	-- Replace D5030 COMMUNICATIONS & SECURITY 2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations							
	D5090 OTHER ELECTRICAL SERVICES	275,854 (SF)	Replace					
	2002 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General							
	-- Replace D5090 OTHER ELECTRICAL SERVICES 2002 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General							



Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Year	System	Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description						Completion Date		
-- Description								
2017 C10 INTERIOR CONSTRUCTION								
	C1010 PARTITIONS	27,454 (SF)	Paint					
	2005 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing							
	-- Paint C1010 PARTITIONS 2005 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing							
2017 C20 STAIRS								
	C2010 STAIR CONSTRUCTION	50 (LF)	Paint					
	2005 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General							
	-- Paint C2010 STAIR CONSTRUCTION C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General							
2017 D30 HVAC								
	D3040 DISTRIBUTION SYSTEMS	1 (EA)	Repair					
	2005 D304008 AIR HANDLING UNITS Central Station - 2000 CFM							
	-- Repair D3040 DISTRIBUTION SYSTEMS AHU2 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU							
	D3040 DISTRIBUTION SYSTEMS	1 (EA)	Repair					
	2005 AHU1 E202 D304008 AIR HANDLING UNITS Indoor Modular - 12,000 CFM, 30 TN Central AHU							
	-- Repair D3040 DISTRIBUTION SYSTEMS AHU1 D304008 AIR HANDLING UNITS Indoor Modular - 12,000 CFM, 30 TN Central AHU							
2017 D50 ELECTRICAL								
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Repair					
	2005 D503003 INTERCOMMUNICATIONS SYSTEMS 12 stations							
	-- Repair D5030 COMMUNICATIONS & SECURITY D503003 INTERCOMMUNICATIONS SYSTEMS 12 stations							
2018 C20 STAIRS								
	C2010 STAIR CONSTRUCTION	50 (LF)	Paint					
	2005 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General							
	-- Paint C2010 STAIR CONSTRUCTION 2005 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General							



"identification only"

Work Items by Building Report



Aviano Hospital-School Annex

Cost Book: Reference

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Year	System	Component	Qty (UM)	Activity	Project	Cost	Status	Score
Section Description								
-- Description						Completion Date		
2018	D40 FIRE PROTECTION							
	D4010	FIRE ALARM AND DETECTION SYSTEMS	20,000 (SF)	Repair				
	2005	D401001 FIRE ALARM DISTRIBUTION Other						
		-- Repair D4010 FIRE ALARM AND DETECTION SYSTEMS						
		2005 D401001 FIRE ALARM DISTRIBUTION Other						

"Identification Only"

Appendix F

"identification only"

Remaining Service Life (RSL) Detail Report

"Identification Only"



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE E.I.F.S.	18	26	4
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	18	39	
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Wall Louver	18	16	
	B2010 EXTERIOR WALLS	2002 B201005 EXTERIOR LOUVERS & SCREENS General	18	8	
	B2010 EXTERIOR WALLS	2002 B201006 BALCONY WALLS & HANDRAILS Ladder	18	6	
	B2010 EXTERIOR WALLS	2002 B201007 EXTERIOR SOFFITS General	18	8	Unknown
	B2010 EXTERIOR WALLS	2002 B201011 SUN CONTROL DEVICES General	18	8	
	B2010 EXTERIOR WALLS	2002 A B201010 EXTERIOR JOINT SEALANT General	18	8	
	B2010 EXTERIOR WALLS	2002 B B201010 EXTERIOR JOINT SEALANT General	18	8	
	B2020 EXTERIOR WINDOWS	2002 B202001 WINDOWS General	18	20	
	B2020 EXTERIOR WINDOWS	2002 B202002 STOREFRONTS General	18	8	
	B2020 EXTERIOR WINDOWS	2002 B202003 CURTAIN WALLS General	18	39	
	B2030 EXTERIOR DOORS	2002 B203001 STEEL DOORS Steel	18	8	
	B2030 EXTERIOR DOORS	2002 B203002 GLAZED DOORS General	18	12	
	B2030 EXTERIOR DOORS	2002 B203090 OTHER EXTERIOR SPECIALTY DOORS Emergency Egress	18	6	
	B2030 EXTERIOR DOORS	2002 B203090 OTHER EXTERIOR SPECIALTY DOORS Other	18	6	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	18	37	
	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	18	4	
	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Single Ply Membrane	18	4	
	B3010 ROOF COVERINGS	2002 B301003 ROOF INSULATION & FILL General	18	2	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM Flashings - Base	18	10	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM Flashings - Cap	18	10	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM General	18	10	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	18	8	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	18	8	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6"	18	8	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Hatches	18	31	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Skylights	18	31	
	B3010 ROOF COVERINGS	2002 A B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	3	13	
	B3010 ROOF COVERINGS	2002 B B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	0	20	
C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing	18	65	18

Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	C1010 PARTITIONS	2002 C101005 INTERIOR WINDOWS Interior Windows	18	26	
	C1020 INTERIOR DOORS	2002 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	18	16	
	C1020 INTERIOR DOORS	2002 C102002 GLAZED INTERIOR DOORS General	18	16	
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Shower	18	8	
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Toilet	18	8	
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Urinal	18	8	
	C1030 SPECIALTIES	2002 C103002 TOILET & BATH ACCESSORIES General	18	6	
	C1030 SPECIALTIES	2002 C103003 MARKER BOARDS & TACK BOARDS General	18	8	
	C1030 SPECIALTIES	2002 C103005 LOCKERS General	18	9	
	C1030 SPECIALTIES	2002 C103008 COUNTERS Laminated Plastic	18	9	
	C1030 SPECIALTIES	2002 C103009 CABINETS Other	18	6	
C20 STAIRS	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior Stairs - Concrete	18	52	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior Stairs - Metal (12	18	27	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Stairs	18	31	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps	18	8	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps - Concrete	18	8	
	C2010 STAIR CONSTRUCTION	2002 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES	18	8	3
C30 INTERIOR FINISHES	C3010 WALL FINISHES	2002 C301004 TILE & TERRAZZO WALL FINISHES Tile	18	31	
	C3020 FLOOR FINISHES	2002 C302001 TILE FLOOR FINISHES Ceramic Tile	18	31	
	C3020 FLOOR FINISHES	2002 C302003 WOOD FLOORING General	18	8	
	C3020 FLOOR FINISHES	2002 C302004 RESILIENT FLOOR FINISHES Composition Sheet	18	7	
	C3020 FLOOR FINISHES	2002 C302005 CARPETING General	11	0	
	C3030 CEILING FINISHES	2002 C303001 ACOUSTICAL CEILING TILES & PANELS General	18	29	
	C3030 CEILING FINISHES	2002 C303003 PLASTER CEILING FINISHES General	18	52	17
	C3030 CEILING FINISHES	2002 C303005 SUSPENSION SYSTEMS General	18	8	
D10 CONVEYING	D1010 ELEVATORS AND LIFTS	2002 D101002 PASSENGER ELEVATORS Hydraulic Elevators - 2500 lb, 5 floors	18	13	
	D1010 ELEVATORS AND LIFTS	2002 D101004 WHEELCHAIR LIFT General	18	6	
D20 PLUMBING	D2010 PLUMBING FIXTURES	2002 D201001 WATERCLOSETS General	18	8	
	D2010 PLUMBING FIXTURES	2002 D201002 URINALS General	18	8	
	D2010 PLUMBING FIXTURES	2002 D201004 SINKS General	18	8	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D2010 PLUMBING FIXTURES	2002 D201004 SINKS Kitchen Sink	18	14	
	D2010 PLUMBING FIXTURES	2002 D201005 SHOWERS/TUBS Shower	18	8	
	D2010 PLUMBING FIXTURES	2002 D201006 DRINKING FOUNTAINS AND COOLERS Water Cooler	18	8	
	D2010 PLUMBING FIXTURES	2002 D201090 OTHER PLUMBING FIXTURES Emergency Eye Wash	18	10	
	D2010 PLUMBING FIXTURES	2002 D201090 OTHER PLUMBING FIXTURES Emergency Shower	18	10	
	D2020 DOMESTIC WATER	2002 D202001 PIPES & FITTINGS General	18	32	
	D2020 DOMESTIC WATER	2002 D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE	18	16	
	D2020 DOMESTIC WATER	2002 D202003 DOMESTIC WATER EQUIPMENT Water Softener	18	4	
	D2020 DOMESTIC WATER	2002 A D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined,	18	20	
	D2020 DOMESTIC WATER	2002 B D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined,	18	20	
	D2020 DOMESTIC WATER	2002 C D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined,	18	20	
	D2020 DOMESTIC WATER	2002 D D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined,	18	20	
	D2020 DOMESTIC WATER	2002 ROOM B2 D202003 DOMESTIC WATER EQUIPMENT Booster Pump - 1	18	10	
	D2030 SANITARY WASTE	2002 D203001 WASTE PIPE & FITTINGS General	18	32	
	D2030 SANITARY WASTE	2002 D203002 VENT PIPE & FITTINGS General	18	2	
	D2030 SANITARY WASTE	2002 D203003 FLOOR DRAINS General	18	8	
D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2002 D302005 EQUIPMENT THERMAL INSULATION General	18	10	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Boiler Feedwater Tank - Shot	18	8	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 100 gal	18	12	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 220 gal	18	12	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 40 gal	18	16	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO1 D302001 BOILERS Gas, Hot Water - 4500-5500 MBH	18	12	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO2 D302001 BOILERS Gas, Hot Water - 4500-5500 MBH	18	12	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO3 D302001 BOILERS Gas, Hot Water - 2500-3500 MBH	18	12	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO4 D302001 BOILERS Gas, Hot Water - 2500-3500 MBH	18	16	
	D3030 COOLING GENERATING	2002 D303001 CHILLED WATER SYSTEMS Chiller, Reciprocating, Air Cooled -	18	2	
	D3030 COOLING GENERATING	2002 A D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Ai	18	8	
	D3030 COOLING GENERATING	2002 B D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN,	18	8	
	D3030 COOLING GENERATING	2002 C D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 270 TN,	6	10	
	D3040 DISTRIBUTION SYSTEMS	2002 D304001 AIR DISTRIBUTION, HEATING & COOLING Ductwork	18	22	
	D3040 DISTRIBUTION SYSTEMS	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General	18	0	
	D3040 DISTRIBUTION SYSTEMS	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS Heat Exchanger, Shell &	18	8	



Remaining Service Life (RSL) Detail Report



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D3040 DISTRIBUTION SYSTEMS	2002 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	2	18	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 2000 CFM	18	10	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 3000 CFM	18	10	
	D3040 DISTRIBUTION SYSTEMS	2002 A D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000	18	5	
	D3040 DISTRIBUTION SYSTEMS	2002 A D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 12,000	18	10	
	D3040 DISTRIBUTION SYSTEMS	2002 B D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000	18	5	
	D3040 DISTRIBUTION SYSTEMS	2002 B D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 12,000	18	10	
	D3040 DISTRIBUTION SYSTEMS	2002 C D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000	18	5	
	D3040 DISTRIBUTION SYSTEMS	2002 D D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000	18	5	
	D3040 DISTRIBUTION SYSTEMS	2002 E D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000	18	5	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 AHU6 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 AHU7 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM,	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF18 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF19 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF5 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF6 D304008 AIR HANDLING UNITS Indoor Modular - 4000 CFM, 10	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF7 D304008 AIR HANDLING UNITS Indoor Modular - 6000 CFM, 15	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M402 AHU8 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM,	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU1 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU1A D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU2 D304008 AIR HANDLING UNITS Indoor Modular - 6000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU3 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU4 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU5 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF1 D304008 AIR HANDLING UNITS Indoor Modular - 3200 CFM, 8	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF10 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF2 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM,	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF3 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU10 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU11 D304008 AIR HANDLING UNITS Rooftop - 15000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU12 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	18	4	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU9 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF EF8 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU1 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU2 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU3 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU4 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	18	4	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating	18	6	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating	18	10	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	18	8	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B3 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating	18	6	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305001 UNIT VENTILATORS Air Curtain	18	8	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305001 UNIT VENTILATORS Make-Up Air Unit - 10,000 CFM, 838 MBH,	18	12	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305002 UNIT HEATERS Hydronic - 300 MBH	18	12	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled	4	6	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION	2002 D401001 FIRE ALARM DISTRIBUTION Other	18	2	
	D4020 FIRE SUPP WATER SUPPLY /	2002 ROOM B4 D402001 FIRE PROTECTION WATER PIPING AND	18	21	
	D4020 FIRE SUPP WATER SUPPLY /	2002 ROOM B4 D402002 FIRE PUMP 5 pump 40 HP, 1000 GPM	18	10	
	D4030 STANDPIPE SYSTEMS	2002 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 8" diam	18	10	
	D4040 SPRINKLERS	2002 D404001 SPRINKLERS AND RELEASING DEVICES Wet Pipe Systems	18	57	
	D4090 OTHER FIRE PROTECTION	2002 D409004 HOOD & DUCT FIRE PROTECTION General	18	13	
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE &	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS Buck-boost, 240 V	18	16	
	D5010 ELECTRICAL SERVICE &	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480	18	26	
	D5010 ELECTRICAL SERVICE &	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480	18	26	
	D5010 ELECTRICAL SERVICE &	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480	18	26	
	D5010 ELECTRICAL SERVICE &	2002 D501004 PANELBOARDS Main lugs, 120/208 V, 100 amp, NQOD	18	16	
	D5010 ELECTRICAL SERVICE &	2002 D501004 PANELBOARDS Main lugs, 120/208 V, 225 amp, NQOD	18	16	
	D5010 ELECTRICAL SERVICE &	2002 D501004 PANELBOARDS Main lugs, 400 amp	18	10	
	D5010 ELECTRICAL SERVICE &	2002 D501004 PANELBOARDS Safety Switch, >100 Amp	18	16	
	D5010 ELECTRICAL SERVICE &	2002 D501004 PANELBOARDS Safety Switch, 30-100 Amp	18	16	
	D5010 ELECTRICAL SERVICE &	2002 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 2, 25	18	21	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM B2 D501006 MOTOR CONTROL CENTERS Motor Control Center -	18	21	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM B5 D501002 SERVICE ENTRANCE EQUIPMENT Electrical Service	18	10	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM B5 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-	18	26	
	D5020 LIGHTING & BRANCH WIRING	2002 D502001 BRANCH WIRING General	18	42	
	D5020 LIGHTING & BRANCH WIRING	2002 D502002 LIGHTING EQUIPMENT Exit Lighting	18	10	
	D5020 LIGHTING & BRANCH WIRING	2002 D502002 LIGHTING EQUIPMENT General	18	10	
	D5030 COMMUNICATIONS & SECURITY	2002 D503002 PUBLIC ADDRESS SYSTEMS 100 outlets	4	10	
	D5030 COMMUNICATIONS & SECURITY	2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations	18	0	
	D5030 COMMUNICATIONS & SECURITY	2002 D503005 SECURITY SYSTEMS General	18	10	
	D5030 COMMUNICATIONS & SECURITY	2002 D503007 CLOCK & PROGRAM SYSTEMS General	4	10	
	D5090 OTHER ELECTRICAL	2002 D509002 EMERGENCY LIGHTING & POWER General	18	10	
	D5090 OTHER ELECTRICAL	2002 D509002 EMERGENCY LIGHTING & POWER Uninterruptible Power	18	13	
	D5090 OTHER ELECTRICAL	2002 D509003 GROUNDING SYSTEMS General	18	32	
	D5090 OTHER ELECTRICAL	2002 D509004 LIGHTNING PROTECTION Unknown	18	26	
	D5090 OTHER ELECTRICAL	2002 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General	18	0	
E10 EQUIPMENT	E1090 OTHER EQUIPMENT	*COLD PAN SINGLE BASIN A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*COLD PAN SINGLE BASIN B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*DISH MACHINE E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*FOOD PROCESSOR A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*FOOD PROCESSOR B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*FREEZER REACH IN 2 DR E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*HOLDING CABINET A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*HOLDING CABINET B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR A E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR B E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR C E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR A E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR B E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR C E109002 FOOD SERVICE EQUIPMENT	18	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER B E109002 FOOD SERVICE EQUIPMENT General	18	13	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER C E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER D E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER E E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER F E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*SLICER E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN D E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR C E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR D E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR E E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*TILT KETTLE A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*TILT KETTLE B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*WALK IN COOLER A E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*WALK IN COOLER B E109002 FOOD SERVICE EQUIPMENT General	18	13	
	E1090 OTHER EQUIPMENT	*WALK IN FREEZER E109002 FOOD SERVICE EQUIPMENT General	18	13	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	15	39	
	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Stucco	15	21	18
	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Wall Louver	15	12	
	B2010 EXTERIOR WALLS	2005 B201007 EXTERIOR SOFFITS General	15	10	Unknown
	B2010 EXTERIOR WALLS	2005 B201010 EXTERIOR JOINT SEALANT General	15	8	
	B2020 EXTERIOR WINDOWS	2005 B202001 WINDOWS Aluminum Windows	15	39	
	B2020 EXTERIOR WINDOWS	2005 B202002 STOREFRONTS General	15	10	
	B2030 EXTERIOR DOORS	2005 B203001 SOLID DOORS Steel	15	8	
	B2030 EXTERIOR DOORS	2005 B203000 OTHER EXTERIOR SPECIALTY DOORS Emergency Egress	15	8	
B30 ROOFING	B3010 ROOF COVERINGS	2005 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	15	37	
	B3010 ROOF COVERINGS	2005 B301002 ROOF INSULATION & FILL General	15	5	
	B3010 ROOF COVERINGS	2005 B301004 FLASHINGS & TRIM Flashings - Embedded Edge Metal	15	13	
	B3010 ROOF COVERINGS	2005 B301004 FLASHINGS & TRIM Flashings - Flashing Penetrations	15	13	
	B3010 ROOF COVERINGS	2005 B301005 GUTTERS & DOWNSPOUTS Downspouts	15	10	
	B3010 ROOF COVERINGS	2005 B301005 GUTTERS & DOWNSPOUTS Gutters	15	10	
	B3010 ROOF COVERINGS	2005 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6"	15	10	
C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	2005 C101001 FIXED PARTITIONS Wall Plaster w/Stud Framing	15	65	Unknown
	C1010 PARTITIONS	2005 C101005 INTERIOR WINDOWS Interior Windows	15	20	
	C1020 INTERIOR DOORS	2005 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	15	21	
	C1020 INTERIOR DOORS	2005 C102002 GLAZED INTERIOR DOORS General	15	16	
	C1030 SPECIALTIES	2005 C103002 TOILET & BATH ACCESSORIES General	15	6	
	C1030 SPECIALTIES	2005 C103003 MARKER BOARDS & TACK BOARDS General	15	8	
	C1030 SPECIALTIES	2005 C103008 COUNTERS Laminated Plastic	15	9	
	C1030 SPECIALTIES	2005 C103009 CABINETS Other	15	6	
C20 STAIRS	C2010 STAIR CONSTRUCTION	2005 C201001 INTERIOR AND EXTERIOR STAIRS Interior Stairs	15	52	
	C2010 STAIR CONSTRUCTION	2005 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES	15	10	Unknown
C30 INTERIOR FINISHES	C3010 WALL FINISHES	2005 C301004 TILE & TERRAZZO WALL FINISHES General	15	31	
	C3020 FLOOR FINISHES	2005 C302001 TILE FLOOR FINISHES Ceramic Tile	15	31	
	C3020 FLOOR FINISHES	2005 C302004 RESILIENT FLOOR FINISHES Composition Sheet	15	5	
	C3020 FLOOR FINISHES	2005 C302010 HARDENERS AND SEALERS Epoxy	15	8	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	C3030 CEILING FINISHES	2005 C303001 ACOUSTICAL CEILING TILES & PANELS General	15	29	
	C3030 CEILING FINISHES	2005 C303005 SUSPENSION SYSTEMS General	15	8	
D20 PLUMBING	D2010 PLUMBING FIXTURES	2005 D201001 WATERCLOSETS General	15	10	
	D2010 PLUMBING FIXTURES	2005 D201002 URINALS General	15	10	
	D2010 PLUMBING FIXTURES	2005 D201003 LAVATORIES General	15	10	
	D2010 PLUMBING FIXTURES	2005 D201004 SINKS Service Sink	15	10	
	D2010 PLUMBING FIXTURES	2005 D201006 DRINKING FOUNTAINS AND COOLERS Drinking Fountain	15	10	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202001 PIPES & FITTINGS General	15	35	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202002 DOMESTIC WATER EQUIPMENT Booster Pump - 5 HP	15	10	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202003 DOMESTIC WATER EQUIPMENT Water Heaters, Commercial,	15	5	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202007 DOMESTIC WATER EQUIPMENT Water Treatment Equipment	15	10	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 A D202002 DOMESTIC WATER EQUIPMENT Storage Tank - Galvanized	15	26	
	D2030 SANITARY WASTE	2005 D203001 WASTE PIPE & FITTINGS General	15	35	
	D2030 SANITARY WASTE	2005 D203002 VENT PIPE & FITTINGS General	15	5	
	D2030 SANITARY WASTE	2005 D203003 FLOOR DRAINS General	15	10	
D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2005 D302004 AUXILIARY EQUIPMENT Boiler Feedwater Tank - Shot chemical	15	10	
	D3020 HEAT GENERATING SYSTEMS	2005 D302004 AUXILIARY EQUIPMENT Expansion Tank - 15 gal	15	16	
	D3020 HEAT GENERATING SYSTEMS	2005 D302005 EQUIPMENT THERMAL INSULATION General	15	10	
	D3020 HEAT GENERATING SYSTEMS	2005 E110 B1 D302001 BOILERS Gas, Hot Water - 500-650 MBH	15	16	
	D3020 HEAT GENERATING SYSTEMS	2005 E110 B2 D302001 BOILERS Gas, Hot Water - 500-650 MBH	15	16	
	D3020 HEAT GENERATING SYSTEMS	2005 E202 D302004 AUXILIARY EQUIPMENT Expansion Tank - 305 gal	15	16	
	D3030 COOLING GENERATING SYSTEMS	2005 D303001 CHILLED WATER SYSTEMS Chiller, Reciprocating, Air Cooled -	5	10	
	D3040 DISTRIBUTION SYSTEMS	2005 D304001 AIR DISTRIBUTION, HEATING & COOLING Ductwork	15	25	
	D3040 DISTRIBUTION SYSTEMS	2005 D304003 HOT WATER DISTRIBUTION SYSTEMS General	15	5	
	D3040 DISTRIBUTION SYSTEMS	2005 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	15	5	
	D3040 DISTRIBUTION SYSTEMS	2005 D304008 AIR HANDLING UNITS Central Station - 2000 CFM	15	8	
	D3040 DISTRIBUTION SYSTEMS	2005 AHU1 E202 D304008 AIR HANDLING UNITS Indoor Modular - 12,000	15	8	
	D3040 DISTRIBUTION SYSTEMS	2005 E202 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump,	15	10	
	D3040 DISTRIBUTION SYSTEMS	2005 E202 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating	15	10	
	D3040 DISTRIBUTION SYSTEMS	2005 EF1 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	15	8	
	D3040 DISTRIBUTION SYSTEMS	2005 EF2 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	15	8	



Remaining Service Life (RSL) Detail Report



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D3040 DISTRIBUTION SYSTEMS	2005 RF1 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	15	8	
	D3050 TERMINAL & PACKAGE UNITS	2005 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 2 ton	15	8	
	D3050 TERMINAL & PACKAGE UNITS	2005 D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled	10	10	
	D3050 TERMINAL & PACKAGE UNITS	2005 E110 D305002 UNIT HEATERS Hydronic - 200 MBH	15	16	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION	2005 D401001 FIRE ALARM DISTRIBUTION Other	15	5	
	D4020 FIRE SUPP WATER SUPPLY	2005 E110 D402001 FIRE PROTECTION WATER PIPING AND EQUIPMENT	15	21	
	D4030 STANDPIPE SYSTEMS	2005 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4" diam	15	10	
	D4040 SPRINKLERS	2005 D404001 SPRINKLERS AND RELEASING DEVICES Wet Pipe Systems	15	60	
	D4090 OTHER FIRE PROTECTION	2005 D409001 HOOD & DUCT FIRE PROTECTION General	15	13	
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501002 SERVICE ENTRANCE EQUIPMENT Electrical Service - 3 Phase,	15	10	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501003 PANEL BOARDS Main lugs, 120/208 V, 100 amp, NQOD	15	16	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501004 PANEL BOARDS Main lugs, 400 amp	15	10	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 4, 100	15	21	
	D5020 LIGHTING & BRANCH WIRING	2005 D502001 BRANCH WIRING General	15	45	
	D5020 LIGHTING & BRANCH WIRING	2005 D502002 LIGHTING EQUIPMENT Exit Lighting	15	10	
	D5020 LIGHTING & BRANCH WIRING	2005 D502002 LIGHTING EQUIPMENT General	15	10	
	D5030 COMMUNICATIONS & DISTRIBUTION	2005 D503002 PUBLIC ADDRESS SYSTEMS 12 outlets	15	10	
	D5030 COMMUNICATIONS & DISTRIBUTION	2005 D503003 INTERCOMMUNICATIONS SYSTEMS 12 stations	15	8	
	D5090 OTHER ELECTRICAL	2005 D509002 EMERGENCY LIGHTING & POWER General	15	10	
	D5090 OTHER ELECTRICAL	2005 D509003 GROUNDING SYSTEMS General	15	35	
	D5090 OTHER ELECTRICAL	2005 D509004 LIGHTNING PROTECTION Unknown	15	26	
	D5090 OTHER ELECTRICAL	2005 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General	15	10	



Remaining Service Life (RSL) Detail Report



Aviano Hospital-School Annex

153 - Aviano ES Bldg 153

Aviano ES (HE5649)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE CIP Concrete	18	39	Unknown
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Other	18	16	
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	18	31	
	B2030 EXTERIOR DOORS	2002 B203007 GATES General	18	8	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	18	37	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	18	8	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	18	8	
C10 INTERIOR	C1010 PARTITIONS	2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing	18	65	Unknown
C30 INTERIOR FINISHES	C3030 CEILING FINISHES	2002 C303002 PLASTER CEILING FINISHES General	18	65	Unknown

"Identification Only"

Appendix G

"identification only"

Direct Condition Rating Inspection By Section Report

"Identification Only"



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
*COLD PAN SINGLE BASIN A E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*COLD PAN SINGLE BASIN B E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*DISH MACHINE E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*FOOD PROCESSOR A E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*FOOD PROCESSOR B E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*FREEZER REACH IN 2 DR E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*HOLDING CABINET A E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*HOLDING CABINET B E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 1 DR A E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 1 DR B E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 1 DR C E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 2 DR A E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
*REFRIGERATOR REACH IN 2 DR B E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*REFRIGERATOR REACH IN 2 DR C E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*SERVING LINE COOLER A E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*SERVING LINE COOLER B E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*SERVING LINE COOLER C E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*SERVING LINE COOLER D E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*SERVING LINE COOLER E E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*SERVING LINE COOLER F E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*SLICER E109002 FOOD SERVICE EQUIPMENT General	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*STEAM COUNTER ELECTRIC MULTI BASIN D E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
*STEAMER 1 DOOR A E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*STEAMER 1 DOOR B E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*STEAMER 1 DOOR C E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*STEAMER 1 DOOR D E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*STEAMER 1 DOOR E E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*TILT KETTLE A E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
*TILT KETTLE B E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*WALK IN COOLER A E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*WALK IN COOLER B E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*WALK IN FREEZER E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
2002 B201001 EXTERIOR CLOSURE E.I.F.S.	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	132,580 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: The paint finish is stained and deteriorated in some locations.	Condition Rating: G- Paint Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	4,452 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 B201001 EXTERIOR CLOSURE Wall Louver	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	156 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 B201005 EXTERIOR LOUVERS & SCREENS General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	108 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+ <i>Paint Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B201006 BALCONY WALLS & HANDRAILS Ladder	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	96 (LF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B201007 EXTERIOR SOFFITS General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	100,443 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+ <i>Paint Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B201011 SUN CONTROL DEVICES General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	832 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B202001 WINDOWS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	471 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i> The awning style hold-open mechanisms were observed to be failing causing windows to not stay in open positions.	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B202002 STOREFRONTS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	1,946 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B202003 CURTAIN WALLS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	1,465 (SF)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 B203001 SOLID DOORS Steel	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	9 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B203002 GLAZED DOORS General	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	7 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 B203090 OTHER EXTERIOR SPECIALTY DOORS	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	57 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: Many dual leaf exterior door coordinators are not functioning properly, preventing closure if leaves are closed improperly. Exterior door finishes are weathered.	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 B203090 OTHER EXTERIOR SPECIALTY DOORS Other	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: The exterior door lock is missing; a hasp and padlock set has been installed to secure the enclosure.	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	B30 ROOFING	B3010 ROOF COVERINGS	64,270 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	B30 ROOFING	B3010 ROOF COVERINGS	31,500 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil	Condition Rating: A-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Inspection Comments: Some roofing areas are very deteriorated. System overall is approaching the end of its statistical life.			
2002 B301002 LOW SLOPE ROOF SYSTEMS Single Ply	B30 ROOFING	B3010 ROOF COVERINGS	1,250 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: The single ply roofing is very deteriorated.	Condition Rating: A-	Used Sampling? No Inspection Source: Inspection	
2002 B301003 ROOF INSULATION & FILL General	B30 ROOFING	B3010 ROOF COVERINGS	106,200 (SF)
Last Inspection Date: 01-Jan-2002 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
2002 B301004 FLASHINGS & TRIM Flashings - Base	B30 ROOFING	B3010 ROOF COVERINGS	2,354 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B301004 FLASHINGS & TRIM Flashings - Cap	B30 ROOFING	B3010 ROOF COVERINGS	2,354 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B301004 FLASHINGS & TRIM General	B30 ROOFING	B3010 ROOF COVERINGS	7,124 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	B30 ROOFING	B3010 ROOF COVERINGS	2,940 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B301005 GUTTERS & DOWNSPOUTS Gutters	B30 ROOFING	B3010 ROOF COVERINGS	2,310 (LF)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 B301006 ROOF OPENINGS AND SUPPORTS Gravity	B30 ROOFING	B3010 ROOF COVERINGS	101 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 B301006 ROOF OPENINGS AND SUPPORTS Hatches	B30 ROOFING	B3010 ROOF COVERINGS	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 B301006 ROOF OPENINGS AND SUPPORTS Skylights	B30 ROOFING	B3010 ROOF COVERINGS	24 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	360,000 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:		Condition Rating: G- Paint Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 C101005 INTERIOR WINDOWS Interior Windows	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	30 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2002 C102001 STANDARD INTERIOR DOORS Wood	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	230 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 C102002 GLAZED INTERIOR DOORS General	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	244 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103001 COMPARTMENTS, CUBICLES & TOILET	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	12 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103001 COMPARTMENTS, CUBICLES & TOILET	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	104 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103001 COMPARTMENTS, CUBICLES & TOILET	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	17 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103002 TOILET & BATH ACCESSORIES General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	394 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103003 MARKER BOARDS & TACK BOARDS General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	650 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C103005 LOCKERS General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	790 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 C103008 COUNTERS Laminated Plastic	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	2,100 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 C103009 CABINETS Other	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	4,500 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior	C20 STAIRS	C2010 STAIR CONSTRUCTION	12 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior	C20 STAIRS	C2010 STAIR CONSTRUCTION	3 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	11 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: The interior tile stairwell nose anti-slip rubber stripping has failed in some areas; and has been capped with textured metal stripping.	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	8 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	12 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C201090 STAIR HANDRAILS, GUARDRAILS AND	C20 STAIRS	C2010 STAIR CONSTRUCTION	2,003 (LF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+ <i>Paint Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C301004 TILE & TERRAZZO WALL FINISHES Tile	C30 INTERIOR FINISHES	C3010 WALL FINISHES	36,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C302001 TILE FLOOR FINISHES Ceramic Tile	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	85,650 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C302003 WOOD FLOORING General	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	2,500 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i> The interior wood floor finish is damaged with scratches across the entire stage area.	<i>Condition Rating:</i> A-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C302004 RESILIENT FLOOR FINISHES Composition	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	32,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 C302005 CARPETING General	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	90,000 (SF)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Condition Rating: R Used Sampling? No Inspector: Edward Gonzalez Inspection Source: Inspection Inspection Comments: The interior carpet floor finish throughout the building is in poor condition.			
2002 C303001 ACOUSTICAL CEILING TILES & PANELS	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	180,000 (SF)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Edward Gonzalez Inspection Source: Inspection Inspection Comments:			
2002 C303003 PLASTER CEILING FINISHES General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	20,000 (SF)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Edward Gonzalez Paint Rating: A+ Inspection Source: Inspection Inspection Comments:			
2002 C303005 SUSPENSION SYSTEMS General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	180,000 (SF)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Edward Gonzalez Inspection Source: Inspection Inspection Comments:			
2002 D101002 PASSENGER ELEVATORS Hydraulic Elevators -	D10 CONVEYING	D1010 ELEVATORS AND LIFTS	2 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: G- Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			
2002 D101004 WHEELCHAIR LIFT General	D10 CONVEYING	D1010 ELEVATORS AND LIFTS	1 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: A Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			
2002 D201001 WATERCLOSETS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	139 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 D201002 URINALS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	30 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201004 SINKS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	260 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201004 SINKS Kitchen Sink	D20 PLUMBING	D2010 PLUMBING FIXTURES	13 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201005 SHOWERS/TUBS Shower	D20 PLUMBING	D2010 PLUMBING FIXTURES	20 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201006 DRINKING FOUNTAINS AND COOLERS Water	D20 PLUMBING	D2010 PLUMBING FIXTURES	22 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201090 OTHER PLUMBING FIXTURES Emergency Eye	D20 PLUMBING	D2010 PLUMBING FIXTURES	3 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D201090 OTHER PLUMBING FIXTURES Emergency	D20 PLUMBING	D2010 PLUMBING FIXTURES	3 (EA)



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			
2002 D202001 PIPES & FITTINGS General	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	86,485 (LF)
Last Inspection Date: 01-Jan-2002 Condition Rating: G+ Used Sampling? No Inspector: Inspection Source: InstallDate Inspection Comments: Original Inspection			
2002 D202003 DOMESTIC WATER EQUIPMENT Storage Tank -	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	2 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: G- Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			
2002 D202003 DOMESTIC WATER EQUIPMENT Water Softener	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	2 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: A Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			
2002 D203001 WASTE PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	43,243 (LF)
Last Inspection Date: 01-Jan-2002 Condition Rating: G+ Used Sampling? No Inspector: Inspection Source: InstallDate Inspection Comments: Original Inspection			
2002 D203002 VENT PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	10,518 (EA)
Last Inspection Date: 01-Jan-2002 Condition Rating: G+ Used Sampling? No Inspector: Inspection Source: InstallDate Inspection Comments: Original Inspection			
2002 D203003 FLOOR DRAINS General	D20 PLUMBING	D2030 SANITARY WASTE	60 (EA)
Last Inspection Date: 21-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: Ryan Ellis Inspection Source: Inspection Inspection Comments:			



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 D302005 EQUIPMENT THERMAL INSULATION General	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	8,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D303001 CHILLED WATER SYSTEMS Chiller,	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i> The chiller is heavily rusted and the coils are damaged.	<i>Condition Rating:</i> R+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D304001 AIR DISTRIBUTION, HEATING & COOLING	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	51,394 (LF)
<i>Last Inspection Date:</i> 01-Jan-2002 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	6,896 (MBH)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i> The rooftop hot water distribution piping is heavily corroded, rusting, and failing. Some sections of piping are completely rusted through the pipe causing leaks.	<i>Condition Rating:</i> R-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D304003 HOT WATER DISTRIBUTION SYSTEMS Heat	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	4 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	690 (TON)
<i>Last Inspection Date:</i> 01-Jan-2018 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2002 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	10 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2002 D305001 UNIT VENTILATORS Air Curtain	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	8 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 D305001 UNIT VENTILATORS Make-Up Air Unit - 10,000	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 D305002 UNIT HEATERS Hydronic - 300 MBH	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	287 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
2002 D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: A Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 D401001 FIRE ALARM DISTRIBUTION Other	D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SYSE	275,854 (SF)
<i>Last Inspection Date:</i> 01-Jan-2002 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2002 D403001 STANDPIPE EQUIPMENT & PIPING Riser	D40 FIRE PROTECTION	D4030 STANDPIPE SYSTEMS	9 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D404001 SPRINKLERS AND RELEASING DEVICES Wet	D40 FIRE PROTECTION	D4040 SPRINKLERS	275,854 (SF)
<i>Last Inspection Date:</i> 01-Jan-2002 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2002 D409004 HOOD & DUCT FIRE PROTECTION General	D40 FIRE PROTECTION	D4090 OTHER FIRE PROTECTION SYSTEME	4 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTI	7 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTI	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTI	3 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	3 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501004 PANELBOARDS Main lugs, 120/208 V, 100 amp,	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	8 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501004 PANELBOARDS Main lugs, 120/208 V, 225 amp,	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	5 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501004 PANELBOARDS Main lugs, 400 amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	4 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501004 PANELBOARDS Safety Switch, >100 Amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	57 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D501004 PANELBOARDS Safety Switch, 30-100 Amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 D501006 MOTOR CONTROL CENTERS Motor Control	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D502001 BRANCH WIRING General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	275,854 (SF)
<i>Last Inspection Date:</i> 01-Jan-2002 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2002 D502002 LIGHTING EQUIPMENT Exit Lighting	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	120 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D502002 LIGHTING EQUIPMENT General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	275,854 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D503002 PUBLIC ADDRESS SYSTEMS 100 outlets	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	2 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i> The intercom was not functioning during the assessment.	<i>Condition Rating:</i> R-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 D503005 SECURITY SYSTEMS General	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D503007 CLOCK & PROGRAM SYSTEMS General	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D509002 EMERGENCY LIGHTING & POWER General	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	275,854 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D509002 EMERGENCY LIGHTING & POWER	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D509003 GROUNDING SYSTEMS General	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	1 (EA)
Last Inspection Date: 01-Jan-2002 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
2002 D509004 LIGHTNING PROTECTION Unknown	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	275,854 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D509006 ENERGY MANAGEMENT CONTROL SYSTEM	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	275,854 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments: The direct digital control system is not functioning. It was reported that the system has not functioned for the past 3 years.	Condition Rating: R-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 A B201010 EXTERIOR JOINT SEALANT General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	14,845 (LF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 A B301002 LOW SLOPE ROOF SYSTEMS Modified	B30 ROOFING	B3010 ROOF COVERINGS	5,280 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 A D202003 DOMESTIC WATER EQUIPMENT Storage Tank	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 A D303001 CHILLED WATER SYSTEMS Chiller, Rotary	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 A D304007 EXHAUST SYSTEMS Fume Hood Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 A D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B B201010 EXTERIOR JOINT SEALANT General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	452 (LF)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B B301002 LOW SLOPE ROOF SYSTEMS Modified	B30 ROOFING	B3010 ROOF COVERINGS	3,900 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G+	Used Sampling? No Inspection Source: Inspection	
2002 B D202003 DOMESTIC WATER EQUIPMENT Storage Tank	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B D303001 CHILLED WATER SYSTEMS Chiller, Rotary	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 B D304007 EXHAUST SYSTEMS Fume Hood Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 B D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 B3 D302004 AUXILIARY EQUIPMENT Boiler Feedwater	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	5 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	4 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 BO1 D302001 BOILERS Gas, Hot Water - 4500-5500	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 BO2 D302001 BOILERS Gas, Hot Water - 4500-5500	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 BO3 D302001 BOILERS Gas, Hot Water - 2500-3500	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B3 BO4 D302001 BOILERS Gas, Hot Water - 2500-3500	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 C D202003 DOMESTIC WATER EQUIPMENT Storage Tank	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 C D303001 CHILLED WATER SYSTEMS Chiller, Rotary	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 C D304007 EXHAUST SYSTEMS Fume Hood Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 D D202003 DOMESTIC WATER EQUIPMENT Storage Tank	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 D D304007 EXHAUST SYSTEMS Fume Hood Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 E D304007 EXHAUST SYSTEMS Fume Hood Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 M401 AHU6 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 AHU7 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 EF18 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 EF19 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 EF5 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 EF6 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M401 EF7 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 M402 AHU8 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 M403 AHU1 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 M403 AHU1A D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 M403 AHU2 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 M403 AHU3 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 M403 AHU4 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 M403 AHU5 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M403 EF1 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M403 EF10 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M403 EF2 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 M403 EF3 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOF AHU10 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOF AHU11 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF AHU12 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF AHU9 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF EF8 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF HVU1 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF HVU2 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOF HVU3 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
2002 ROOF HVU4 D304008 AIR HANDLING UNITS Rooftop -	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D202003 DOMESTIC WATER EQUIPMENT	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	4 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D304003 HOT WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	6 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D304003 HOT WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	3 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	3 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	4 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 ROOM B2 D501006 MOTOR CONTROL CENTERS Motor	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 ROOM B3 D304003 HOT WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2002 ROOM B4 D402001 FIRE PROTECTION WATER PIPING	D40 FIRE PROTECTION	D4020 FIRE SUPP WATER SUPPLY / EQU	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 ROOM B4 D402002 FIRE PUMP 5" pump, 40 HP, 1000	D40 FIRE PROTECTION	D4020 FIRE SUPP WATER SUPPLY / EQU	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 ROOM B5 D501002 SERVICE ENTRANCE EQUIPMENT	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	4 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2002 ROOM B5 D501003 INTERIOR DISTRIBUTION	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	544 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B201001 EXTERIOR CLOSURE Stucco	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	5,440 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G- <i>Paint Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B201001 EXTERIOR CLOSURE Wall Louver	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	88 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B201007 EXTERIOR SOFFITS General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	500 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G- <i>Paint Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B201010 EXTERIOR JOINT SEALANT General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	1,200 (LF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B202001 WINDOWS Aluminum Windows	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	69 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 B202002 STOREFRONTS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	130 (SF)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 B203001 SOLID DOORS Steel	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	3 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2005 B203090 OTHER EXTERIOR SPECIALTY DOORS	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	14 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments: The exterior door finishes are weathering and wearing. Many dual leaf exterior doors have closing coordinators that are not operating properly.	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2005 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	B30 ROOFING	B3010 ROOF COVERINGS	16,950 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 B301003 ROOF INSULATION & FILL General	B30 ROOFING	B3010 ROOF COVERINGS	16,950 (SF)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
2005 B301004 FLASHINGS & TRIM Flashings - Embedded	B30 ROOFING	B3010 ROOF COVERINGS	600 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 B301004 FLASHINGS & TRIM Flashings - Flashing	B30 ROOFING	B3010 ROOF COVERINGS	6 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Inspection Comments:			
2005 B301005 GUTTERS & DOWNSPOUTS Downspouts	B30 ROOFING	B3010 ROOF COVERINGS	266 (LF)
Last Inspection Date: 21-Jan-2020	Condition Rating: G-	Used Sampling? No	
Inspector: Thomas Cihil		Inspection Source: Inspection	
Inspection Comments:			
2005 B301005 GUTTERS & DOWNSPOUTS Gutters	B30 ROOFING	B3010 ROOF COVERINGS	300 (LF)
Last Inspection Date: 21-Jan-2020	Condition Rating: G-	Used Sampling? No	
Inspector: Thomas Cihil		Inspection Source: Inspection	
Inspection Comments:			
2005 B301006 ROOF OPENINGS AND SUPPORTS Gravity	B30 ROOFING	B3010 ROOF COVERINGS	13 (EA)
Last Inspection Date: 21-Jan-2020	Condition Rating: G-	Used Sampling? No	
Inspector: Thomas Cihil		Inspection Source: Inspection	
Inspection Comments:			
2005 C101001 FIXED PARTITIONS Wall - Plaster w/Stud	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	30,000 (SF)
Last Inspection Date: 21-Jan-2020	Condition Rating: G	Used Sampling? No	
Inspector: Edward Gonzalez	Paint Rating: G	Inspection Source: Inspection	
Inspection Comments:			
2005 C101005 INTERIOR WINDOWS Interior Windows	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	6 (EA)
Last Inspection Date: 21-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: Edward Gonzalez		Inspection Source: Inspection	
Inspection Comments:			
2005 C102001 STANDARD INTERIOR DOORS Wood	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	20 (EA)
Last Inspection Date: 21-Jan-2020	Condition Rating: G-	Used Sampling? No	
Inspector: Edward Gonzalez		Inspection Source: Inspection	
Inspection Comments:			
2005 C102002 GLAZED INTERIOR DOORS General	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	17 (EA)



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2005 C103002 TOILET & BATH ACCESSORIES General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	40 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2005 C103003 MARKER BOARDS & TACK BOARDS General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	17 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2005 C103008 COUNTERS Laminated Plastic	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	250 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2005 C103009 CABINETS Other	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	250 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
2005 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 C201090 STAIR HANDRAILS, GUARDRAILS AND	C20 STAIRS	C2010 STAIR CONSTRUCTION	50 (LF)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: G- Paint Rating: A	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 C301004 TILE & TERRAZZO WALL FINISHES General	C30 INTERIOR FINISHES	C3010 WALL FINISHES	4,800 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 C302001 TILE FLOOR FINISHES Ceramic Tile	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	3,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 C302004 RESILIENT FLOOR FINISHES Composition	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	10,236 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 C302010 HARDENERS AND SEALERS Epoxy	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	4,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 C303001 ACOUSTICAL CEILING TILES & PANELS	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	13,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 C303005 SUSPENSION SYSTEMS General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	13,000 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Edward Gonzalez <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D201001 WATERCLOSETS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	16 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D201002 URINALS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	4 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D201003 LAVATORIES General	D20 PLUMBING	D2010 PLUMBING FIXTURES	26 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D201004 SINKS Service Sink	D20 PLUMBING	D2010 PLUMBING FIXTURES	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D201006 DRINKING FOUNTAINS AND COOLERS	D20 PLUMBING	D2010 PLUMBING FIXTURES	4 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D202001 PIPES & FITTINGS General	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	4,835 (LF)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
2005 D202003 DOMESTIC WATER EQUIPMENT Booster Pump	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 D202003 DOMESTIC WATER EQUIPMENT Water Heaters,	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D202003 DOMESTIC WATER EQUIPMENT Water	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D203001 WASTE PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	2,418 (LF)
<i>Last Inspection Date:</i> 01-Jan-2005 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2005 D203002 VENT PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	588 (EA)
<i>Last Inspection Date:</i> 01-Jan-2005 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2005 D203003 FLOOR DRAINS General	D20 PLUMBING	D2030 SANITARY WASTE	6 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D302004 AUXILIARY EQUIPMENT Boiler Feedwater Tank	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	3 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D302004 AUXILIARY EQUIPMENT Expansion Tank - 15	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	3 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2005 D302005 EQUIPMENT THERMAL INSULATION General	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	300 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2005 D303001 CHILLED WATER SYSTEMS Chiller,	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
2005 D304001 AIR DISTRIBUTION, HEATING & COOLING	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	3,735 (LF)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection		Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate	
2005 D304003 HOT WATER DISTRIBUTION SYSTEMS General	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	501 (MBH)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection		Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate	
2005 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	50 (TON)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection		Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate	
2005 D304008 AIR HANDLING UNITS Central Station - 2000	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 2 ton	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	12 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D305006 PACKAGE UNITS A/C Unit, Split Systems	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D401001 FIRE ALARM DISTRIBUTION Other	D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SYSTEMS	20,049 (SF)
<i>Last Inspection Date:</i> 01-Jan-2005 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2005 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4"	D40 FIRE PROTECTION	D4030 STANDPIPE SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D404001 SPRINKLERS AND RELEASING DEVICES Wet	D40 FIRE PROTECTION	D4040 SPRINKLERS	20,049 (SF)
<i>Last Inspection Date:</i> 01-Jan-2005 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2005 D409004 HOOD & DUCT FIRE PROTECTION General	D40 FIRE PROTECTION	D4090 OTHER FIRE PROTECTION SYSTEMS	6 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D501002 SERVICE ENTRANCE EQUIPMENT Electrical	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D501004 PANELBOARDS Main lugs, 120/208 V, 100 amp,	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	6 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D501004 PANELBOARDS Main lugs, 400 amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D501006 MOTOR CONTROL CENTERS Motor Control	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D502001 BRANCH WIRING General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	20,049 (SF)
Last Inspection Date: 01-Jan-2005 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
2005 D502002 LIGHTING EQUIPMENT Exit Lighting	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	18 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 D502002 LIGHTING EQUIPMENT General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	20,049 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 D503002 PUBLIC ADDRESS SYSTEMS 12 outlets	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D503003 INTERCOMMUNICATIONS SYSTEMS 12 stations	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D509002 EMERGENCY LIGHTING & POWER General	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	20,049 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D509003 GROUNDING SYSTEMS General	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	1 (EA)
<i>Last Inspection Date:</i> 01-Jan-2005 <i>Inspector:</i> <i>Inspection Comments:</i> Original Inspection	<i>Condition Rating:</i> G+	<i>Used Sampling?</i> No <i>Inspection Source:</i> InstallDate	
2005 D509004 LIGHTNING PROTECTION Unknown	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	20,049 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 D509006 ENERGY MANAGEMENT CONTROL SYSTEM	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	20,049 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 A D202003 DOMESTIC WATER EQUIPMENT Storage Tank	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 AHU1 E202 D304008 AIR HANDLING UNITS Indoor	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 E110 D305002 UNIT HEATERS Hydronic - 200 MBH	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	2 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 E110 D402001 FIRE PROTECTION WATER PIPING AND	D40 FIRE PROTECTION	D4020 FIRE SUPP WATER SUPPLY / EQU	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 E110 B1 D302001 BOILERS Gas, Hot Water - 500-650	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 E110 B2 D302001 BOILERS Gas, Hot Water - 500-650	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
2005 E202 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 21-Jan-2020 Inspector: Ryan Ellis Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2005 E202 D304003 HOT WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	2 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>		<i>Condition Rating:</i> G- <i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 E202 D304006 CHILLED WATER DISTRIBUTION	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	2 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>		<i>Condition Rating:</i> G- <i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 EF1 E202 D304008 AIR HANDLING UNITS Central Station	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>		<i>Condition Rating:</i> G- <i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 EF2 E202 D304008 AIR HANDLING UNITS Central Station	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>		<i>Condition Rating:</i> G- <i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2005 RF1 E202 D304008 AIR HANDLING UNITS Central Station	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1 (EA)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Ryan Ellis <i>Inspection Comments:</i>		<i>Condition Rating:</i> G- <i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

153 - Aviano ES Bldg 153

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
2002 B201001 EXTERIOR CLOSURE CIP Concrete	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	560 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G- <i>Paint Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B201001 EXTERIOR CLOSURE Other	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	77 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	37 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i> The stone panels at wall base are becoming detached.	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B203007 GATES General	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	53 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	B30 ROOFING	B3010 ROOF COVERINGS	205 (SF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> G-	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	B30 ROOFING	B3010 ROOF COVERINGS	10 (LF)
<i>Last Inspection Date:</i> 21-Jan-2020 <i>Inspector:</i> Thomas Cihil <i>Inspection Comments:</i>	<i>Condition Rating:</i> A+	<i>Used Sampling?</i> No <i>Inspection Source:</i> Inspection	
2002 B301005 GUTTERS & DOWNSPOUTS Gutters	B30 ROOFING	B3010 ROOF COVERINGS	32 (LF)



Direct Condition Rating Inspection Report by Section



Aviano Hospital-School Annex

153 - Aviano ES Bldg 153

Aviano ES (HE5649)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 21-Jan-2020 Inspector: Thomas Cihil Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	527 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: G- Paint Rating: A+	Used Sampling? No Inspection Source: Inspection	
2002 C303003 PLASTER CEILING FINISHES General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	174 (SF)
Last Inspection Date: 21-Jan-2020 Inspector: Edward Gonzalez Inspection Comments:	Condition Rating: G- Paint Rating: A+	Used Sampling? No Inspection Source: Inspection	

"Identification Only"

Appendix H

"identification only"

System Inventory Report

"Identification Only"



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE E.I.F.S.	132,580 (SF)	2002	2002
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	4,452 (SF)	2002	
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Wall Louver	156 (SF)	2002	
	B2010 EXTERIOR WALLS	2002 B201005 EXTERIOR LOUVERS & SCREENS General	108 (SF)	2002	
	B2010 EXTERIOR WALLS	2002 B201006 BALCONY WALLS & HANDRAILS Ladder	96 (LF)	2002	
	B2010 EXTERIOR WALLS	2002 B201007 EXTERIOR SOFFITS General	100,443 (SF)	2002	2002
	B2010 EXTERIOR WALLS	2002 B201011 SUN CONTROL DEVICES General	832 (SF)	2002	
	B2010 EXTERIOR WALLS	2002 A B201010 EXTERIOR JOINT SEALANT General	14,845 (LF)	2002	
	B2010 EXTERIOR WALLS	2002 B B201010 EXTERIOR JOINT SEALANT General	452 (LF)	2002	
	B2020 EXTERIOR WINDOWS	2002 B202001 WINDOWS General	471 (SF)	2002	
	B2020 EXTERIOR WINDOWS	2002 B202002 STOREFRONTS General	1,946 (SF)	2002	
	B2020 EXTERIOR WINDOWS	2002 B202003 CURTAIN WALLS General	1,465 (SF)	2002	
	B2030 EXTERIOR DOORS	2002 B203001 SOLID DOORS Steel	9 (EA)	2002	
	B2030 EXTERIOR DOORS	2002 B203002 GLAZED DOORS General	7 (EA)	2002	
	B2030 EXTERIOR DOORS	2002 B203000 OTHER EXTERIOR SPECIALTY DOORS Emergency Egress Door	57 (EA)	2002	
	B2030 EXTERIOR DOORS	2002 B203090 OTHER EXTERIOR SPECIALTY DOORS Other	1 (EA)	2002	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	64,270 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	31,500 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Single Ply Membrane	1,250 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301003 ROOF INSULATION & FILL General	106,200 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM Flashings - Base	2,354 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM Flashings - Cap	2,354 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301004 FLASHINGS & TRIM General	7,124 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	2,940 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	2,310 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6" Diameter	101 (EA)	2002	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Hatches	2 (EA)	2002	
	B3010 ROOF COVERINGS	2002 B301006 ROOF OPENINGS AND SUPPORTS Skylights	24 (SF)	2002	
	B3010 ROOF COVERINGS	2002 A B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	5,280 (SF)	2017	
	B3010 ROOF COVERINGS	2002 B B301002 LOW SLOPE ROOF SYSTEMS Modified Bitumen	3,900 (SF)	2020	
C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing	360,000 (SF)	2002	2002
	C1010 PARTITIONS	2002 C101005 INTERIOR WINDOWS Interior Windows	30 (EA)	2002	
	C1020 INTERIOR DOORS	2002 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	230 (EA)	2002	
	C1020 INTERIOR DOORS	2002 C102002 GLAZED INTERIOR DOORS General	244 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Shower Compartment	12 (EA)	2002	
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Toilet Partitions	104 (EA)	2002	
	C1030 SPECIALTIES	2002 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Urinal Screen	17 (EA)	2002	
	C1030 SPECIALTIES	2002 C103002 TOILET & BATH ACCESSORIES General	394 (EA)	2002	
	C1030 SPECIALTIES	2002 C103003 MARKER BOARDS & TACK BOARDS General	650 (EA)	2002	
	C1030 SPECIALTIES	2002 C103005 LOCKERS General	790 (EA)	2002	
	C1030 SPECIALTIES	2002 C103008 COUNTERS Laminated Plastic	2,100 (LF)	2002	
	C1030 SPECIALTIES	2002 C103009 CABINETS Other	4,500 (LF)	2002	
C20 STAIRS	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior Stairs - Concrete (12 Riser Flight)	12 (EA)	2002	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Exterior Stairs - Metal (12 Riser Flight)	3 (EA)	2002	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Stairs	11 (EA)	2002	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps	8 (EA)	2002	
	C2010 STAIR CONSTRUCTION	2002 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps - Concrete	12 (EA)	2002	
	C2010 STAIR CONSTRUCTION	2002 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General	2,003 (LF)	2002	2002
C30 INTERIOR FINISHES	C3010 WALL FINISHES	2002 C301004 TILE & TERRAZZO WALL FINISHES Tile	36,000 (SF)	2002	
	C3020 FLOOR FINISHES	2002 C302001 TILE FLOOR FINISHES Ceramic Tile	85,650 (SF)	2002	
	C3020 FLOOR FINISHES	2002 C302003 WOOD FLOORING General	2,500 (SF)	2002	
	C3020 FLOOR FINISHES	2002 C302004 RESILIENT FLOOR FINISHES Composition Sheet	32,000 (SF)	2002	
	C3020 FLOOR FINISHES	2002 C302005 CARPETING General	90,000 (SF)	2009	
	C3030 CEILING FINISHES	2002 C303001 ACOUSTICAL CEILING TILES & PANELS General	180,000 (SF)	2002	
	C3030 CEILING FINISHES	2002 C303003 PLASTER CEILING FINISHES General	20,000 (SF)	2002	2002
	C3030 CEILING FINISHES	2002 C303005 SUSPENSION SYSTEMS General	180,000 (SF)	2002	
D10 CONVEYING	D1010 ELEVATORS AND LIFTS	2002 D101002 PASSENGER ELEVATORS Hydraulic Elevators - 2500 lb, 5 floors	2 (EA)	2002	
	D1010 ELEVATORS AND LIFTS	2002 D101004 WHEELCHAIR LIFT General	1 (EA)	2002	
D20 PLUMBING	D2010 PLUMBING FIXTURES	2002 D201001 WATERCLOSETS General	139 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201002 URINALS General	30 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201004 SINKS General	260 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201004 SINKS Kitchen Sink	13 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201005 SHOWERS/TUBS Shower	20 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D2010 PLUMBING FIXTURES	2002 D201006 DRINKING FOUNTAINS AND COOLERS Water Cooler	22 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201090 OTHER PLUMBING FIXTURES Emergency Eye Wash	3 (EA)	2002	
	D2010 PLUMBING FIXTURES	2002 D201090 OTHER PLUMBING FIXTURES Emergency Shower	3 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 D202001 PIPES & FITTINGS General	86,485 (LF)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 325 gallon, 36" diameter, 81" L.O.A.	2 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 D202003 DOMESTIC WATER EQUIPMENT Water Softener	2 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 1330 gallon, 66" diameter, 107" L.O.A.	1 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 B D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 1330 gallon, 66" diameter, 107" L.O.A.	1 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 C D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 1330 gallon, 66" diameter, 107" L.O.A.	1 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 D D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 1330 gallon, 66" diameter, 107" L.O.A.	1 (EA)	2002	
	D2020 DOMESTIC WATER DISTRIBUTION	2002 ROOM B2 D202003 DOMESTIC WATER EQUIPMENT Booster Pump - 1 HP	4 (EA)	2002	
	D2030 SANITARY WASTE	2002 D203001 WASTE PIPE & FITTINGS General	43,243 (LF)	2002	
	D2030 SANITARY WASTE	2002 D203002 VENT PIPE & FITTINGS General	10,518 (EA)	2002	
	D2030 SANITARY WASTE	2002 D203003 FLOOR DRAINS General	60 (EA)	2002	
D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2002 D302005 EQUIPMENT THERMAL INSULATION General	8,000 (SF)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Boiler Feedwater Tank - Shot chemical feeder, by pass, floor mount, 10 gal	2 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 100 gal	2 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 220 gal	5 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 D302004 AUXILIARY EQUIPMENT Expansion Tank - 40 gal	4 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO1 D302001 BOILERS Gas, Hot Water - 4500-5500 MBH	1 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO2 D302001 BOILERS Gas, Hot Water - 4500-5500 MBH	1 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO3 D302001 BOILERS Gas, Hot Water - 2500-3500 MBH	1 (EA)	2002	
	D3020 HEAT GENERATING SYSTEMS	2002 B3 BO4 D302001 BOILERS Gas, Hot Water - 2500-3500 MBH	1 (EA)	2002	
	D3030 COOLING GENERATING SYSTEMS	2002 D303001 CHILLED WATER SYSTEMS Chiller, Reciprocating, Air Cooled - 20 TN	1 (EA)	2002	
	D3030 COOLING GENERATING SYSTEMS	2002 A D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller	1 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D3030 COOLING GENERATING SYSTEMS	2002 B D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 160 TN, Air Cooled Screw Liquid Chiller	1 (EA)	2002	
	D3030 COOLING GENERATING SYSTEMS	2002 C D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 270 TN, Air Cooled Screw Liquid Chiller	1 (EA)	2014	
	D3040 DISTRIBUTION SYSTEMS	2002 D304001 AIR DISTRIBUTION, HEATING & COOLING Ductwork	51,394 (LF)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS General	6,896 (MBH)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D304003 HOT WATER DISTRIBUTION SYSTEMS Heat Exchanger, Shell & Tube - 240 GPM	4 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	690 (TON)	2018	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	10 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 3000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 A D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 A D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 12,000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 B D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 B D304007 EXHAUST SYSTEMS Kitchen Exhaust/Make-Up Air - 12,000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 C D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 D D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 E D304007 EXHAUST SYSTEMS Fume Hood Exhaust System - 4', 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 AHU6 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 AHU7 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF18 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF19 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF5 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF6 D304008 AIR HANDLING UNITS Indoor Modular - 4000 CFM, 10 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M401 EF7 D304008 AIR HANDLING UNITS Indoor Modular - 6000 CFM, 15 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M402 AHU8 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM, 11 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU1 D304008 AIR HANDLING UNITS Indoor Modular - 7000 CFM, 17.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU1A D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM, 11 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU2 D304008 AIR HANDLING UNITS Indoor Modular - 6000 CFM, 15 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU3 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM, 11 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU4 D304008 AIR HANDLING UNITS Indoor Modular - 4400 CFM, 11 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 AHU5 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF1 D304008 AIR HANDLING UNITS Indoor Modular - 3200 CFM, 8 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF10 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF2 D304008 AIR HANDLING UNITS Indoor Modular - 3000 CFM, 7.5 TN Central AHU	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 M403 EF3 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU10 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU11 D304008 AIR HANDLING UNITS Rooftop - 15000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU12 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF AHU9 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF EF8 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU1 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU2 D304008 AIR HANDLING UNITS Rooftop - 5000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU3 D304008 AIR HANDLING UNITS Rooftop - 10000 CFM	1 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D3040 DISTRIBUTION SYSTEMS	2002 ROOF HVU4 D304008 AIR HANDLING UNITS Rooftop - 2000 CFM	1 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 2-1/2" size, 3 HP, to 150 GPM	6 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 6" size, 25 HP, to 1550 GPM	3 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating Pump, Double Suction - 6" size, 50 HP, to 1200 GPM	3 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B2 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 6" size, 25 HP, to 1550 GPM	4 (EA)	2002	
	D3040 DISTRIBUTION SYSTEMS	2002 ROOM B3 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 2-1/2" size, 3 HP, to 150 GPM	2 (EA)	2002	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305001 UNIT VENTILATORS Air Curtain	8 (LF)	2002	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305001 UNIT VENTILATORS Make-Up Air Unit - 10,000 CFM, 838 MBH, includes standard controls	1 (EA)	2002	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305002 UNIT HEATERS Hydronic - 300 MBH	287 (EA)	2002	
	D3050 TERMINAL & PACKAGE UNITS	2002 D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled Condenser - 2 TON	2 (EA)	2016	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SYSTEMS	2002 D401001 FIRE ALARM DISTRIBUTION Other	275,854 (SF)	2002	
	D4020 FIRE SUPP WATER SUPPLY / EQUIP	2002 ROOM B4 D402001 FIRE PROTECTION WATER PIPING AND EQUIPMENT Backflow Preventer - 8"	1 (EA)	2002	
	D4020 FIRE SUPP WATER SUPPLY / EQUIP	2002 ROOM B4 D402002 FIRE PUMP 6" pump, 40 HP, 1000 GPM	1 (EA)	2002	
	D4030 STANDPIPE SYSTEMS	2002 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 8" diam	9 (EA)	2002	
	D4040 SPRINKLERS	2002 D404001 SPRINKLERS AND RELEASING DEVICES Wet Pipe Systems	275,854 (SF)	2002	
	D4090 OTHER FIRE PROTECTION SYSTEMS	2002 D409004 HOOD & DUCT FIRE PROTECTION General	4 (EA)	2002	
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS Buck-boost, 240 V primary 208/120 V secondary, 45 kVA	7 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480 V primary 120/240 V secondary, 15 kVA	1 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480 V primary 120/240 V secondary, 25 kVA	3 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501003 INTERIOR DISTRIBUTION TRANSFORMERS dry-type, 240/480 V primary 120/240 V secondary, 50 kVA	3 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501004 PANELBOARDS Main lugs, 120/208 V, 100 amp, NQOD	8 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501004 PANELBOARDS Main lugs, 120/208 V, 225 amp, NQOD	5 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501004 PANELBOARDS Main lugs, 400 amp	4 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501004 PANELBOARDS Safety Switch, >100 Amp	57 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501004 PANELBOARDS Safety Switch, 30-100 Amp	1 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 2, 25 HP, 18" high	2 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM R2 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 6, 400 HP, 72" high	1 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM R5 D501002 SERVICE ENTRANCE EQUIPMENT Electrical Service, 3 Phase, 120/208 V, 2000 A	4 (EA)	2002	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2002 ROOM R3 D501003 INTERIOR DISTRIBUTION TRANSFORMER Single-phase, 480 V primary 120/208 V secondary, 150 kVA	2 (EA)	2002	
	D5020 LIGHTING & BRANCH WIRING	2002 D502001 BRANCH WIRING General	275,854 (SF)	2002	
	D5020 LIGHTING & BRANCH WIRING	2002 D502002 LIGHTING EQUIPMENT Exit Lighting	120 (EA)	2002	
	D5020 LIGHTING & BRANCH WIRING	2002 D502002 LIGHTING EQUIPMENT General	275,854 (SF)	2002	
	D5030 COMMUNICATIONS & SECURITY	2002 D503002 PUBLIC ADDRESS SYSTEMS 100 outlets	2 (EA)	2016	
	D5030 COMMUNICATIONS & SECURITY	2002 D503003 INTERCOMMUNICATIONS SYSTEMS 100 stations	1 (EA)	2002	
	D5030 COMMUNICATIONS & SECURITY	2002 D503005 SECURITY SYSTEMS General	1 (EA)	2002	
	D5030 COMMUNICATIONS & SECURITY	2002 D503007 CLOCK & PROGRAM SYSTEMS General	1 (EA)	2016	
	D5090 OTHER ELECTRICAL SERVICES	2002 D509002 EMERGENCY LIGHTING & POWER General	275,854 (SF)	2002	
	D5090 OTHER ELECTRICAL SERVICES	2002 D509002 EMERGENCY LIGHTING & POWER Uninterruptible Power Supply - 10 kVA	1 (EA)	2002	
	D5090 OTHER ELECTRICAL SERVICES	2002 D509003 GROUNDING SYSTEMS General	1 (EA)	2002	
	D5090 OTHER ELECTRICAL SERVICES	2002 D509004 LIGHTNING PROTECTION Unknown	275,854 (SF)	2002	
	D5090 OTHER ELECTRICAL SERVICES	2002 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General	275,854 (SF)	2002	

E10 EQUIPMENT



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	E1090 OTHER EQUIPMENT	*COLD PAN SINGLE BASIN A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*COLD PAN SINGLE BASIN B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*DISH MACHINE E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*FOOD PROCESSOR A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*FOOD PROCESSOR B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*FREEZER REACH IN 2 DR E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*HOLDING CABINET A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*HOLDING CABINET B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 1 DR C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DR C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER D E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER E E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER F E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*SLICER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	



Aviano Hospital-School Annex

151 - Aviano Bldg MS/HS 151

Unassigned

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN D E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR D E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*STEAMER 1 DOOR E E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*TILT KETTLE A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*TILT KETTLE B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*WALK IN COOLER A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*WALK IN COOLER B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	
	E1090 OTHER EQUIPMENT	*WALK IN FREEZER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2002	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	544 (SF)	2005	
	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Stucco	5,440 (SF)	2005	2005
	B2010 EXTERIOR WALLS	2005 B201001 EXTERIOR CLOSURE Wall Louver	88 (SF)	2005	
	B2010 EXTERIOR WALLS	2005 B201007 EXTERIOR SOFFITS General	500 (SF)	2005	2005
	B2010 EXTERIOR WALLS	2005 B201010 EXTERIOR JOINT SEALANT General	1,200 (LF)	2005	
	B2020 EXTERIOR WINDOWS	2005 B202001 WINDOWS Aluminum Windows	69 (EA)	2005	
	B2020 EXTERIOR WINDOWS	2005 B202002 STOREFRONTS General	130 (SF)	2005	
	B2030 EXTERIOR DOORS	2005 B203001 SOLID DOORS Steel	3 (EA)	2005	
	B2030 EXTERIOR DOORS	2005 B203090 OTHER EXTERIOR SPECIALTY DOORS Emergency Glass Door	14 (EA)	2005	
B30 ROOFING	B3010 ROOF COVERINGS	2005 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	16,950 (SF)	2005	
	B3010 ROOF COVERINGS	2005 B301003 ROOF INSULATION & FILL General	16,950 (SF)	2005	
	B3010 ROOF COVERINGS	2005 B301004 FLASHINGS & TRIM Flashings - Embedded Edge Metal	600 (LF)	2005	
	B3010 ROOF COVERINGS	2005 B301004 FLASHINGS & TRIM Flashings - Flashing Penetrations	6 (EA)	2005	
	B3010 ROOF COVERINGS	2005 B301005 GUTTERS & DOWNSPOUTS Downspouts	266 (LF)	2005	
	B3010 ROOF COVERINGS	2005 B301005 GUTTERS & DOWNSPOUTS Gutters	300 (LF)	2005	
	B3010 ROOF COVERINGS	2005 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6" Diameter	13 (EA)	2005	
C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	2005 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing	30,000 (SF)	2005	2015
	C1010 PARTITIONS	2005 C101005 INTERIOR WINDOWS Interior Windows	6 (EA)	2005	
	C1020 INTERIOR DOORS	2005 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	20 (EA)	2005	
	C1020 INTERIOR DOORS	2005 C102002 GLAZED INTERIOR DOORS General	17 (EA)	2005	
	C1030 SPECIALTIES	2005 C103002 TOILET & BATH ACCESSORIES General	40 (EA)	2005	
	C1030 SPECIALTIES	2005 C103003 MARKER BOARDS & TACK BOARD General	17 (EA)	2005	
	C1030 SPECIALTIES	2005 C103008 COUNTERS Laminated Plastic	250 (LF)	2005	
	C1030 SPECIALTIES	2005 C103009 CABINETS Other	250 (LF)	2005	
C20 STAIRS	C2010 STAIR CONSTRUCTION	2005 C201001 INTERIOR AND EXTERIOR STAIRS Interior Stairs	1 (EA)	2005	
	C2010 STAIR CONSTRUCTION	2005 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General	50 (LF)	2005	2010
C30 INTERIOR FINISHES	C3010 WALL FINISHES	2005 C301004 TILE & TERRAZZO WALL FINISHES General	4,800 (SF)	2005	
	C3020 FLOOR FINISHES	2005 C302001 TILE FLOOR FINISHES Ceramic Tile	3,000 (SF)	2005	
	C3020 FLOOR FINISHES	2005 C302004 RESILIENT FLOOR FINISHES Composition Sheet	10,236 (SF)	2005	
	C3020 FLOOR FINISHES	2005 C302010 HARDENERS AND SEALERS Epoxy	4,000 (SF)	2005	



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	C3030 CEILING FINISHES	2005 C303001 ACOUSTICAL CEILING TILES & PANELS General	13,000 (SF)	2005	
	C3030 CEILING FINISHES	2005 C303005 SUSPENSION SYSTEMS General	13,000 (SF)	2005	
D20 PLUMBING	D2010 PLUMBING FIXTURES	2005 D201001 WATERCLOSETS General	16 (EA)	2005	
	D2010 PLUMBING FIXTURES	2005 D201002 URINALS General	4 (EA)	2005	
	D2010 PLUMBING FIXTURES	2005 D201003 LAVATORIES General	26 (EA)	2005	
	D2010 PLUMBING FIXTURES	2005 D201004 SINKS Service Sink	1 (EA)	2005	
	D2010 PLUMBING FIXTURES	2005 D201006 DRINKING FOUNTAINS AND COOLERS Drinking Fountain	4 (EA)	2005	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202001 PIPES & FITTINGS General	4,835 (LF)	2005	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202003 DOMESTIC WATER EQUIPMENT Booster Pump - 5 HP	1 (EA)	2005	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202003 DOMESTIC WATER EQUIPMENT Water Heaters, Commercial, Gas - 95 MBH input, 86 GPH	1 (EA)	2005	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 D202003 DOMESTIC WATER EQUIPMENT Water Treatment Equipment	1 (EA)	2005	
	D2020 DOMESTIC WATER DISTRIBUTION	2005 A D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Galvanized steel, 300 gallon, 36" diameter, 76" L.O.A.	1 (EA)	2005	
	D2030 SANITARY WASTE	2005 D203001 WASTE PIPE & FITTINGS General	2,418 (LF)	2005	
	D2030 SANITARY WASTE	2005 D203002 VENT PIPE & FITTINGS General	588 (EA)	2005	
	D2030 SANITARY WASTE	2005 D203003 FLOOR DRAINS General	6 (EA)	2005	
D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2005 D302004 AUXILIARY EQUIPMENT Boiler Feedwater Tank - Shot chemical feeder, by pass, in-line mount, 177 gal	3 (EA)	2005	
	D3020 HEAT GENERATING SYSTEMS	2005 D302004 AUXILIARY EQUIPMENT Expansion Tank - 15 gal	3 (EA)	2005	
	D3020 HEAT GENERATING SYSTEMS	2005 D302005 EQUIPMENT THERMAL INSULATION General	300 (SF)	2005	
	D3020 HEAT GENERATING SYSTEMS	2005 E110 B1 D302001 BOILERS Gas, Hot Water - 500-650 MBH	1 (EA)	2005	
	D3020 HEAT GENERATING SYSTEMS	2005 E110 B2 D302001 BOILERS Gas, Hot Water - 500-650 MBH	1 (EA)	2005	
	D3020 HEAT GENERATING SYSTEMS	2005 E202 D302004 AUXILIARY EQUIPMENT Expansion Tank - 305 gal	1 (EA)	2005	
	D3030 COOLING GENERATING SYSTEMS	2005 D303001 CHILLED WATER SYSTEMS Chiller, Reciprocating, Air Cooled - 60 TN	1 (EA)	2015	
	D3040 DISTRIBUTION SYSTEMS	2005 D304001 AIR DISTRIBUTION, HEATING & COOLING Ductwork	3,735 (LF)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 D304003 HOT WATER DISTRIBUTION SYSTEMS General	501 (MBH)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	50 (TON)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 D304008 AIR HANDLING UNITS Central Station - 2000 CFM	1 (EA)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 AHU1 E202 D304008 AIR HANDLING UNITS Indoor Modular - 12,000 CFM, 30 TN Central AHU	1 (EA)	2005	



System Inventory Report



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D3040 DISTRIBUTION SYSTEMS	2005 E202 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 2-1/2" size, 3 HP, to 150 GPM	2 (EA)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 E202 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 2-1/2" size, 3 HP, to 150 GPM	2 (EA)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 EF1 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	1 (EA)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 EF2 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	1 (EA)	2005	
	D3040 DISTRIBUTION SYSTEMS	2005 RF1 E202 D304008 AIR HANDLING UNITS Central Station - 5000 CFM	1 (EA)	2005	
	D3050 TERMINAL & PACKAGE UNITS	2005 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 2 ton	12 (EA)	2005	
	D3050 TERMINAL & PACKAGE UNITS	2005 D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled Condenser - 2 TN	1 (EA)	2010	
	D3050 TERMINAL & PACKAGE UNITS	2005 E100 D305002 UNIT HEATERS Hydronic - 200 MBH	2 (EA)	2005	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SYSTEMS	2005 D401001 FIRE ALARM DISTRIBUTION Other	20,049 (SF)	2005	
	D4020 FIRE SUPP WATER SUPPLY / EQUIP	2005 E110 D402001 FIRE PROTECTION WATER PIPING AND EQUIPMENT Backflow Preventer - 8"	1 (EA)	2005	
	D4030 STANDPIPE SYSTEMS	2005 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4" diam	1 (EA)	2005	
	D4040 SPRINKLERS	2005 D404001 SPRINKLERS AND RELEASING DEVICES Wet Pipe Systems	20,049 (SF)	2005	
	D4090 OTHER FIRE PROTECTION SYSTEMS	2005 D409004 HOOD & DUCT FIRE PROTECTION General	6 (EA)	2005	
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501002 SERVICE ENTRANCE EQUIPMENT Electrical Service - 3 Phase, 120/208 V, 1200 A	1 (EA)	2005	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501004 PANELBOARDS Main lugs, 120/208 V, 100 amp, NQOD	6 (EA)	2005	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501004 PANELBOARDS Main lugs, 400 amp	2 (EA)	2005	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	2005 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 4, 100 HP, 30" high	2 (EA)	2005	
	D5020 LIGHTING & BRANCH WIRING	2005 D502001 BRANCH WIRING General	20,049 (SF)	2005	
	D5020 LIGHTING & BRANCH WIRING	2005 D502002 LIGHTING EQUIPMENT Exit Lighting	18 (EA)	2005	
	D5020 LIGHTING & BRANCH WIRING	2005 D502002 LIGHTING EQUIPMENT General	20,049 (SF)	2005	
	D5030 COMMUNICATIONS & SECURITY	2005 D503002 PUBLIC ADDRESS SYSTEMS 12 outlets	1 (EA)	2005	
	D5030 COMMUNICATIONS & SECURITY	2005 D503003 INTERCOMMUNICATIONS SYSTEMS 12 stations	1 (EA)	2005	
	D5090 OTHER ELECTRICAL SERVICES	2005 D509002 EMERGENCY LIGHTING & POWER General	20,049 (SF)	2005	



System Inventory Report



Aviano Hospital-School Annex

114 - Aviano ES Bldg 114

Aviano ES (HE5649)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D5090 OTHER ELECTRICAL SERVICES	2005 D509003 GROUNDING SYSTEMS General	1 (EA)	2005	
	D5090 OTHER ELECTRICAL SERVICES	2005 D509004 LIGHTNING PROTECTION Unknown	20,049 (SF)	2005	
	D5090 OTHER ELECTRICAL SERVICES	2005 D509006 ENERGY MANAGEMENT CONTROL SYSTEM General	20,049 (SF)	2005	

"Identification Only"



System Inventory Report



Aviano Hospital-School Annex

153 - Aviano ES Bldg 153

Aviano ES (HE5649)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE CIP Concrete	560 (SF)	2002	2002
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Other	77 (SF)	2002	
	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE Stone Veneer w/CMU Backup	37 (SF)	2002	
	B2030 EXTERIOR DOORS	2002 B203007 GATES General	53 (SF)	2002	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301001 STEEP SLOPE ROOF SYSTEMS Clay Tile	205 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	10 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	32 (LF)	2002	
C10 INTERIOR	C1010 PARTITIONS	2002 C101001 FIXED PARTITIONS Wall - Plaster w/Stud Framing	527 (SF)	2002	2017
C30 INTERIOR FINISHES	C3030 CEILING FINISHES	2002 C303003 PLASTER CEILING FINISHES General	174 (SF)	2002	2017

"Identification Only"

Appendix I

"identification only"

Fire Safety Inspection Report
"Identification Only"

"identification only"



DEPARTMENT OF THE AIR FORCE
31ST FIGHTER WING (USAFE)

5 Aug 2019

MEMORANDUM FOR DoDEA

FROM: 31 CES/CEF

SUBJECT: DoDEA Fire Safety Assessment Report

1. In accordance with AFI 32-2001, Fire Emergency Services Program, the fire inspectors from 31 CES/CEF conducted an annual assessment on your unit. The purpose was to determine the overall effectiveness of the unit's Fire Prevention program. The focus areas were the fire safety education and training of unit personnel, compliance with program directives, existing or potential fire hazards and fire safety deficiencies in the facilities.
2. Various facility managers accompanied the Fire Inspectors during the assessment. The Fire Prevention Office (FPO) did not conduct a commander in brief.
3. The attached report is divided in two parts. Attachment 1 Facility listing, is a list of facility's identified by the Facility Board belonging to your unit. Attachment 2 Current Fire Safety Deficiencies, is a detailed listing of observed fire hazards and fire safety deficiencies, as well as an area for facility managers to annotate corrective actions taken or proposed.
4. Please review all parts of the report and document the corrective actions taken or planned. Once complete, return the report with supporting documentation of corrective actions and unit commander's signature to the FPO **within 30 days** of receiving report. Submission of a work request or work task from 31 CES Customer Service does not constitute a closing action of a deficiency. Aggressive follow-up by the facility managers must be taken to ensure timely abatement of open hazards and fire safety deficiencies. The FPO will conduct a 10% follow-up inspection within 90 days of the inspection close-out date. If there are any questions, please contact the FPO at 632 7440.

Attachments:

1. Facility Listing
2. Current Fire Safety Deficiencies



"identification only"

ATTACHMENT 1
Facility Listing

Inspection Summary: The listed facilities were inspected for building code and fire safety compliance. When submitting work requests to CES in TRIRIGA, referencing the FILE ID for the listed deficiencies will assist in the coordination process and will reduce the time required for work request completion. Facilities visited are as follows:

BLDG	OCCUPANCY	BLDG	OCCUPANCY
114	Kindergarten	151	Elementary/ Middle/ High School
+			
-			

"Identification Only"

"identification only"

ATTACHMENT 2
Current Fire Safety Deficiencies

Governing reference for Fire Safety Deficiencies (FSD): AFI 32-10141, 3.4.1 - 3.4.3 lists the FSD codes as:

- A. FSD I** includes missing fire protection systems or missing NFPA 101 features in any building or process.
- B. FSD II** includes deficiencies in existing fire protection systems or features in any building or process not covered by paragraph 3.4.1 of this instruction. Any existing fire protection system/feature identified in UFC 3-600-02, *O&M: Inspection, Testing, and Maintenance of Fire Protection Systems*, which is out of service or impaired so as to prevent automatic or manual (manual is applicable only if the system/feature is operated by manual activation) response to a fire event for more than 72 hours shall be considered an FSD II.
- C. FSD III**, all other FSDs not covered under FSD I or FSD II rules IAW AFI 32-10141 are classified as FSD IIIs.

Facility				
B-151, Elementary School				
File ID #		2019-116		
FSD		II		
DEFICIENCY				
Monthly fire extinguishers check in the Elementary School is not conducted as required.				
REFERENCE				
AFMAN 91-203, Air Force Occupational Safety, Fire, and Health Standards - 6.2.4.7. Managers and supervisors at all levels shall ensure a visual inspection is performed and documented monthly for all fire extinguishers under their control.				
RECOMMENDED CORRECTIVE ACTION				
Ensure all fire extinguishers within the facility will be inspected on a monthly basis. Perform the monthly inspection for fire extinguishers required by NFPA 10 and properly document.				
CORRECTIVE ACTION TAKEN				
A WO has been submitted				
+ ▲ - ▼				
Facility				
B-151, High School				
File ID #		2019-116		
FSD		I		
DEFICIENCY				
Two inoperable exit lights in the gym.				
REFERENCE				
NFPA 101, Life Safety Code - 7.10.5.2.1 Every Sign required to be illuminated by 7.10.6.3, 7.10.7, and 7.10.8.1 shall be continuously illuminated as required under the provisions of Section 7.8, unless otherwise provided in 7.10.5.2.2.				
RECOMMENDED CORRECTIVE ACTION				
Replace with new bulbs that can be picked up from CE Self-Help Store on Wednesdays 0900-1600 in bldg 430. If the lights are LED or are not illuminated after replacement of the bulb, submit a service request for CE to have the light checked. Ensure work request states "This work is required to correct a fire safety deficiency".				
CORRECTIVE ACTION TAKEN				
A WO has been submitted				
+ ▲ - ▼				

DEFICIENCY	Coffee pot connected to a multi plug adapter in the in room E-10.
REFERENCE	AFMAN 91-203, Air Force Occupational Safety, Fire, and Health Standards - Chapter 8.4.7, Electrical Safety. High-wattage appliances such as refrigerators, microwaves, coffee makers, heaters, etc, shall be plugged directly into a facility outlet.
RECOMMENDED CORRECTIVE ACTION	Reconfigure room to allow access to wall outlet.
CORRECTIVE ACTION TAKEN	mulit plug has been removed

+

▲

-

▼

I have reviewed and approved all recommend corrective action for the above listed deficiencies.

"Identification Only"

