

Executive Summary — Plant Equipment, Unit Installation & Ductwork

Works completed by SA Quality Ductwork for the reporting week, issued to Climatech for record and coordination.

PROJECT The Garema Hotel (5-Star), ACT	PRINCIPAL CONTRACTOR TP Dynamics	MECHANICAL CONTRACTOR Climatech	SITE SUPERVISOR Keith Morgan
WORKS BY SA Quality Ductwork	REPORTING PERIOD Thu 20 – Wed 26 Aug 2026	SITE CREW P. Augusto, L. Taipe, Eduardo, Anthony	PREPARED BY Pablo Augusto, Supervisor

01 SCOPE OF WORKS DELIVERED

Works this period covered the mechanical plant fit-off — support steelwork, setting of Daikin VRV modules and ducted fan coils on anti-vibration mounts, plenum hanging and insulated ductwork — together with the Ground Floor to Level 1 duct run and the material relocation directed by the supervisor.

- Support steelwork** — unistrut trapeze and goal-post frames installed and levelled to unit footprints (PH-02, 03, 05).
 - Unit setting** — Daikin RWEYQ-TYM VRV modules and FXSQ ducted FCUs set on AV pads and hangers (PH-04, 06, 11, 15).
 - Plenums** — boxes hung on threaded rod with AV hangers, safety wires and flexible connections (PH-10, 13).
 - Ductwork** — insulated rectangular and spiral duct, transitions, VCDs and insulation made good (PH-08, 09, 12).
- Coordination** — supports set clear of hydraulic, fire and electrical services (PH-07, 13).
 - Ground Floor to Level 1** — duct runs installed and connected between GF and Level 1 to the revised drawings.
 - Materials** — duct, dampers and fixings received, checked and staged in the basement store (PH-01).
 - Relocation** — plant relocated to the rooftop store and balance covered, to supervisor direction (PH-16 to PH-22).

02 PROGRESS BY WORK FRONT

WORK FRONT	WORKS PERFORMED	QTY	STATUS
Plant room / riser	Support frames installed; VRV modules set on AV mounts and levelled	—	COMPLETE
Typical floors	Ducted FCUs hung on AV hangers; connection points presented	—	COMPLETE
Typical floors	Plenum boxes hung to soffit with flexible connections	—	IN PROGRESS
Soffit & risers	Insulated duct runs, damper sets and boxes to drawings	—	IN PROGRESS
Ground Floor – L1	Ductwork installed and connected between Ground Floor and Level 1	—	COMPLETE
GF store / rooftop	Plant and cartons relocated to rooftop store; balance covered with tarpaulin	—	COMPLETE
Basement store	Material receipt, check and staging for distribution	—	COMPLETE
Soffit anchors	Anchors inspected and marked — OK / X for replacement	—	DIRECTION REQ.

03 COORDINATION & OBSERVATIONS

- OPEN ITEM — CONCRETE ANCHORS

Existing soffit anchors continue to be found stripped or not holding load, and have been marked on the slab — compliant circled OK, defective marked X (PH-14). Replacement with HKD drop-in anchors is recommended before further hanging.
- Vibration isolation** — units set on AV pads or hangers; final levelling to be re-checked after connection by others.
 - Insulation** — insulation disturbed by supports temporarily made good; permanent reinstatement to be programmed (PH-09).

Pablo Augusto
Supervisor — SA Quality Ductwork

SIGNATURE / DATE

04 SAFETY & COMPLIANCE

- All personnel site-inducted; works under the site SWMS with daily pre-start and toolbox attendance. Elevated work from approved platforms; metal cutting under permit.
- No lost-time injuries, incidents or environmental events recorded.


05 PLANNED WORKS — NEXT PERIOD

- Complete plenum hanging and flexible connections at remaining floors; replace defective soffit anchors with HKD drop-ins, subject to direction.
- Continue insulated duct runs, damper sets and access panels; progressive sign-off.

Keith Morgan
Site Supervisor — Climatech

SIGNATURE / DATE

Record note. 22 photographic records (PH-01 to PH-22) taken on site during the reporting period by SA Quality Ductwork. Levels and dates against each record to be confirmed from the daily works docket before issue.

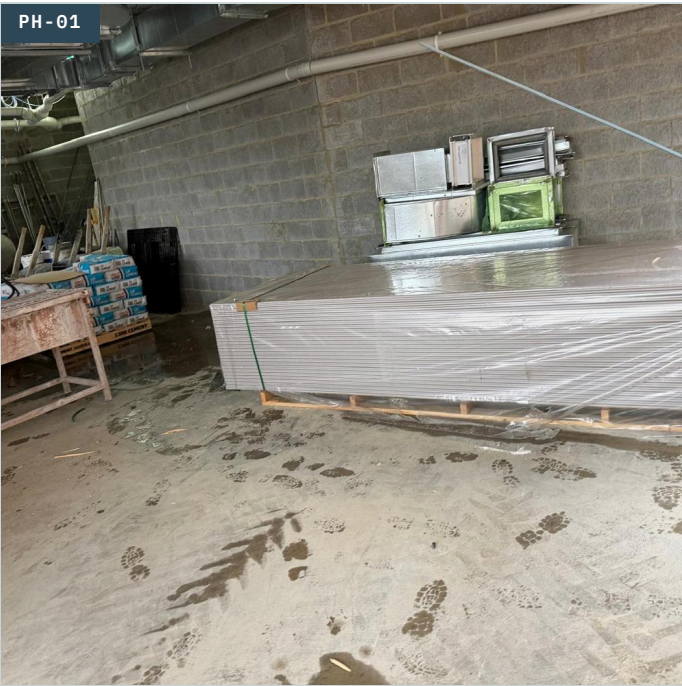


PH-01

MATERIALS

Basement material store

Ductwork, motorised and volume control dampers and plenum boxes received, checked and staged clear of access routes prior to distribution to work fronts.

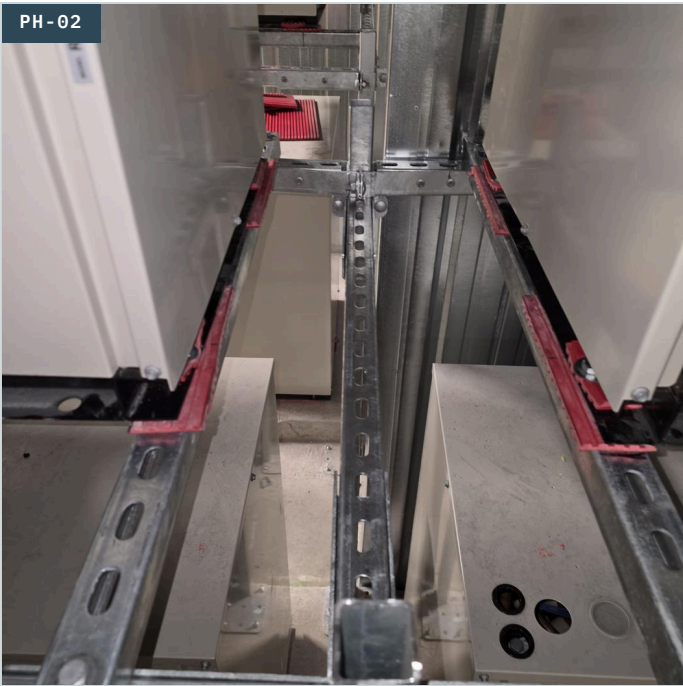

PH-02

SUPPORT STEEL

Support frames — plant area

Galvanised unistrut trapeze and goal-post frames installed to slab and soffit, cross-members bolted and levelled to suit the unit footprints and the services above.



PH-03

SUPPORT STEEL

Frame run — typical arrangement

Repeating frame arrangement set out to a common line and level so units, duct connections and access clearances stay uniform across the run.



PH-04

UNIT SETTING

Daikin RWEYQ10TYM module set

Water-cooled VRV heat pump module (Ser. E001506) positioned, aligned and seated on the support frame, nameplate left visible for commissioning and asset records.

PHOTOGRAPHIC RECORD

SECTION B – VIBRATION ISOLATION, BRACKETRY & DUCT CONNECTION

Works Summary Report 02

THE GAREMA HOTEL · 20-26 AUG 2026




PH-05

VIBRATION

Anti-vibration pads at unit base

Continuous rubber AV pads fitted between the unit base rail and the steel support so the unit bears fully on the isolator — an acoustic requirement for the guest floors.

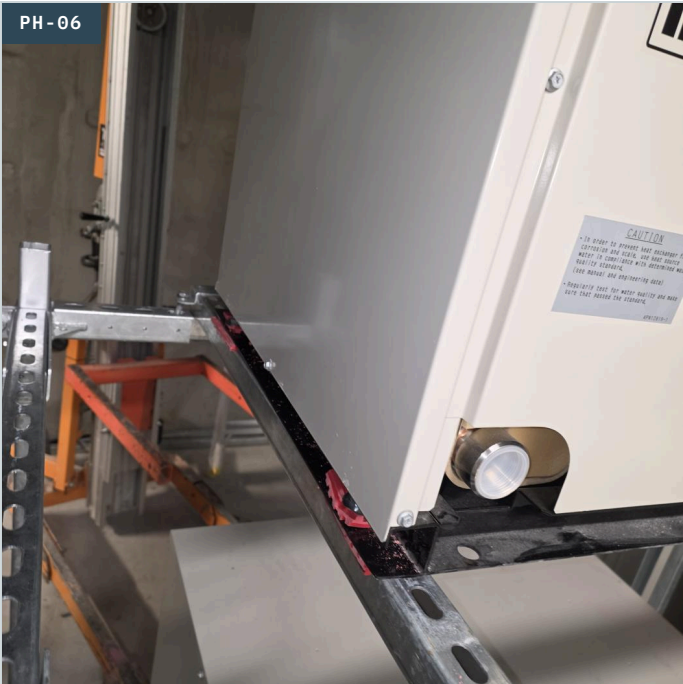


PH-06

UNIT SETTING

Condenser water connection presented

Unit set with condenser water connections capped and presented clear of the frame for connection by the hydraulic trade; manufacturer water-quality label retained.

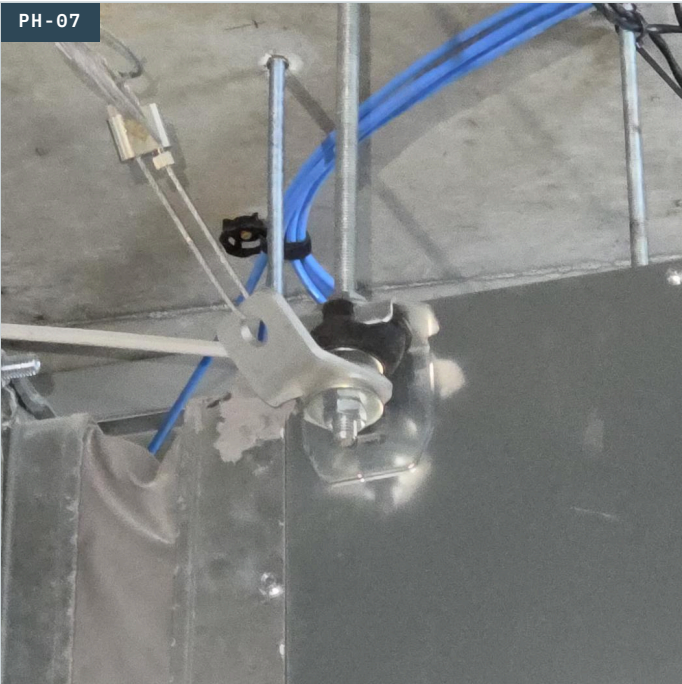


PH-07

BRACKETRY

Support bracket fixed and tightened

Wall bracket bolted off and tensioned, with refrigerant and control cabling dressed and secured to saddles clear of the duct face and the access zone.

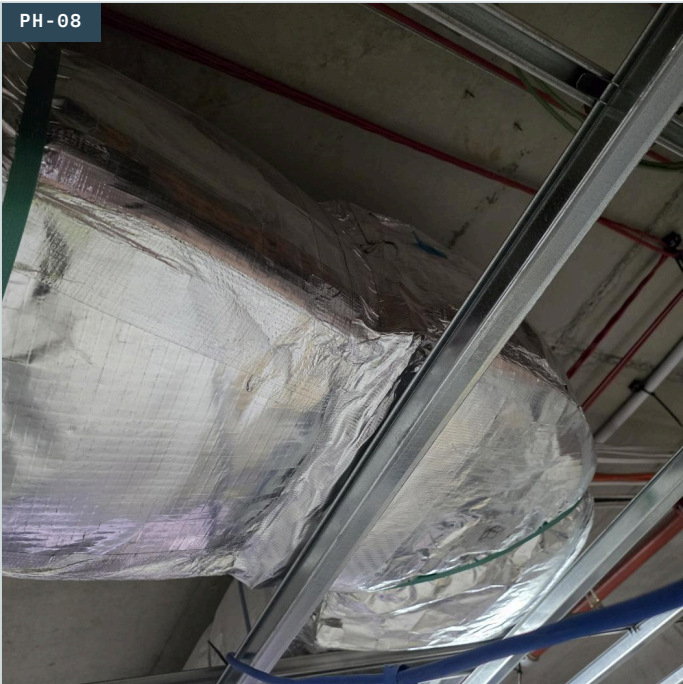


PH-08

DUCTWORK

Insulated duct transition installed

Insulated rectangular duct and transition to spiral installed and supported on unistrut, set out to clear the hydraulic and fire services running above.

PH-09

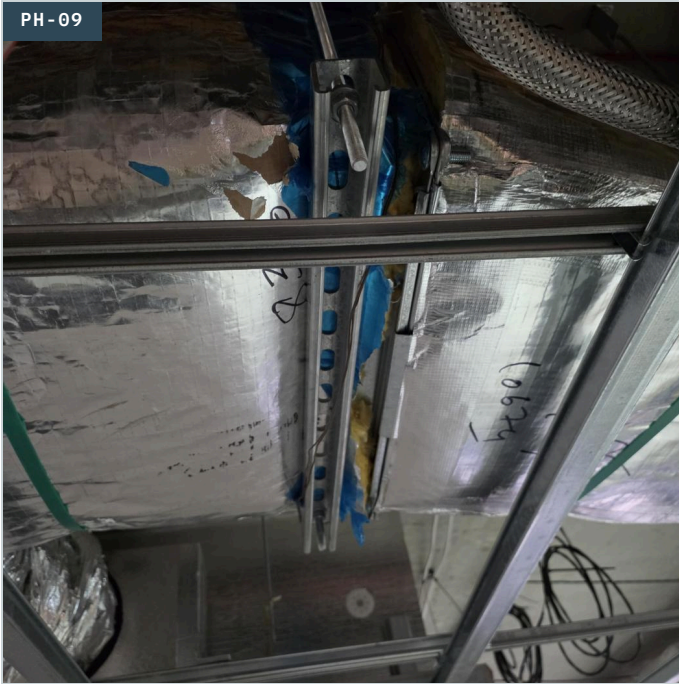

DUCTWORK

Riser duct and damper set

Riser duct supported on threaded rod and unistrut with damper set in position; insulation and vapour barrier temporarily made good at the support penetration.

PH-10




HANGING

Plenum box hung to soffit

Plenum / attenuator box hung from the concrete soffit on threaded rod with rubber-in-shear AV hangers, flexible connection fitted at the duct joint.

PH-11

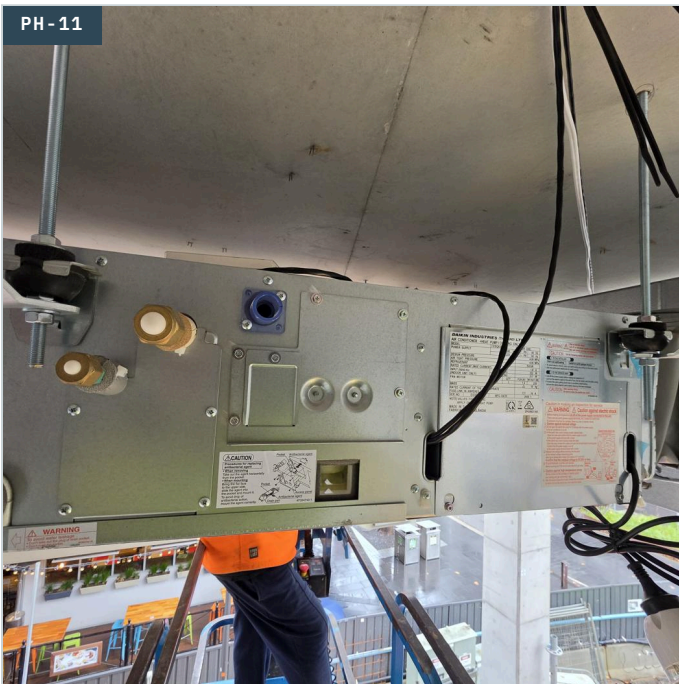

UNIT SETTING

Ducted FCU hung and presented

Daikin FXSQ-series ducted fan coil hung on four threaded rods with AV hangers; refrigerant flares, drain socket and electrical entry left accessible for connection.

PH-12



DUCTWORK

Duct run and boxes to drawings

Duct run with plenum, filter box and spiral connections installed to the issued mechanical set, with open ends protected pending the following connection.



PH-13

FIT-OFF

Cabling and drain presented at unit

Control and power cabling dressed to the hanger line and drain line set to fall, with safety wires fitted to the hung equipment.




PH-14

OPEN ITEM

Anchor inspection marked on slab

Existing soffit anchors inspected and marked in place — compliant anchor circled OK, adjacent defective anchor marked X. Replacement with HKD drop-in anchors recommended.

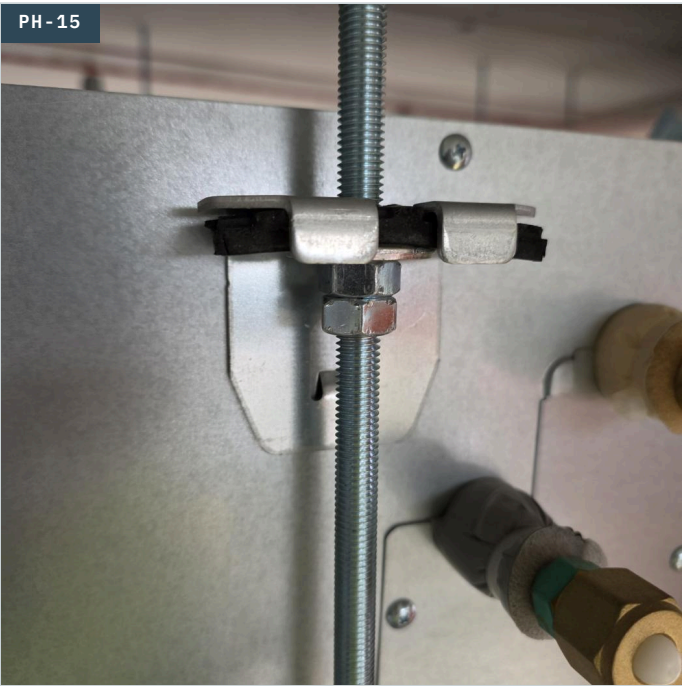

PH-15

VIBRATION

AV hanger detail at unit bracket

Threaded rod hanger double-nutted at the unit bracket with rubber isolation pad between clamp and bracket — typical detail applied across the hung equipment.

06 SUPERVISOR DIRECTION

Rooftop transfer — 26/08

“Take these up to rooftop and store in discussed location.” Filtration skid, control panel and cartons relocated and stored as directed (PH-16, 18–21).

Cover in place — 26/08

“Leave here and cover with blue tarp.” Marked pallet left at the Ground Floor store and covered on site (PH-17, 22).


Directions received by message from Climatch and actioned the same day; screenshots retained as PH-21 and PH-22.

PHOTOGRAPHIC RECORD

SECTION E – MATERIAL RELOCATION & PROTECTION

Works Summary Report 02


THE GAREMA HOTEL · 20-26 AUG 2026

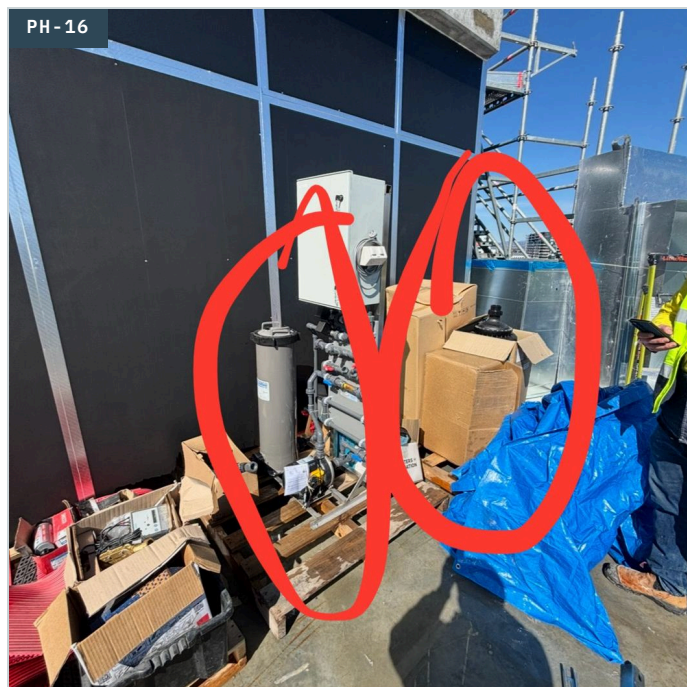

DIRECTION

Items marked for relocation

Filtration skid, control panel and associated cartons at the Ground Floor store, marked up by the site supervisor for transfer to the rooftop store.

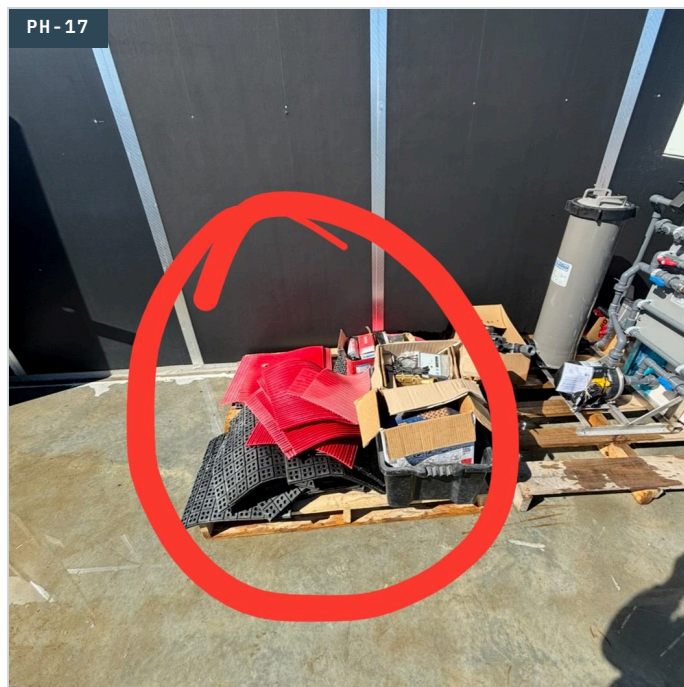

DIRECTION

Pallet marked to remain in place


Pallet of protection matting and fixings marked by the site supervisor to stay at the Ground Floor store and be covered on site rather than relocated.



RELOCATION

Material relocated to rooftop


Marked items transferred to the rooftop and set down in the agreed storage location, clear of the ductwork run and the access route along the wall.

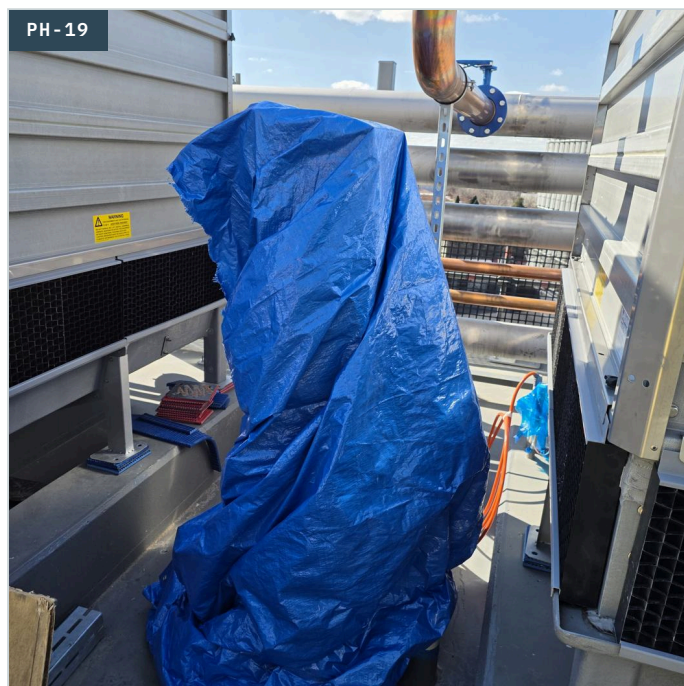

PROTECTION

Stored plant covered on rooftop


Relocated plant covered with tarpaulin on the rooftop deck, clear of the cooling tower platform, the condenser water pipework and the walkway.

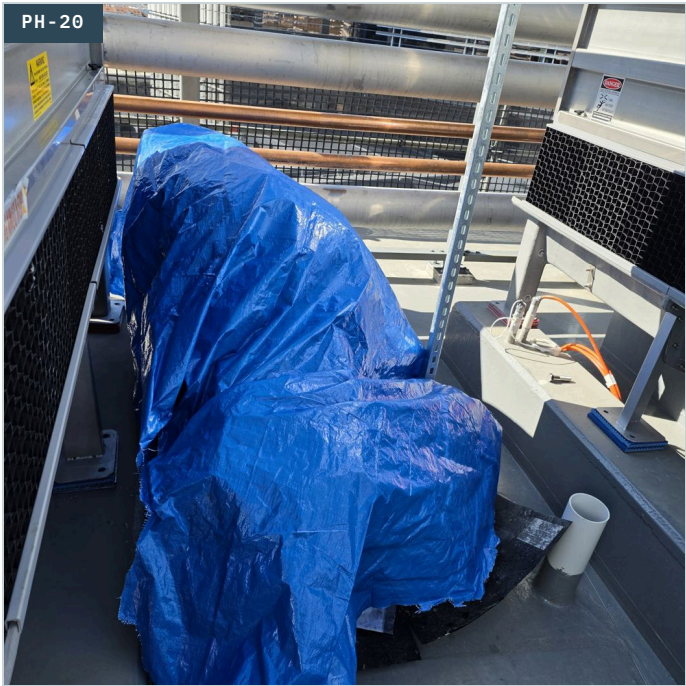

PROTECTION

Second pallet covered and secured


Balance of the relocated material covered and weighted down against wind exposure on the open rooftop, clear of plant access and grated walkways.

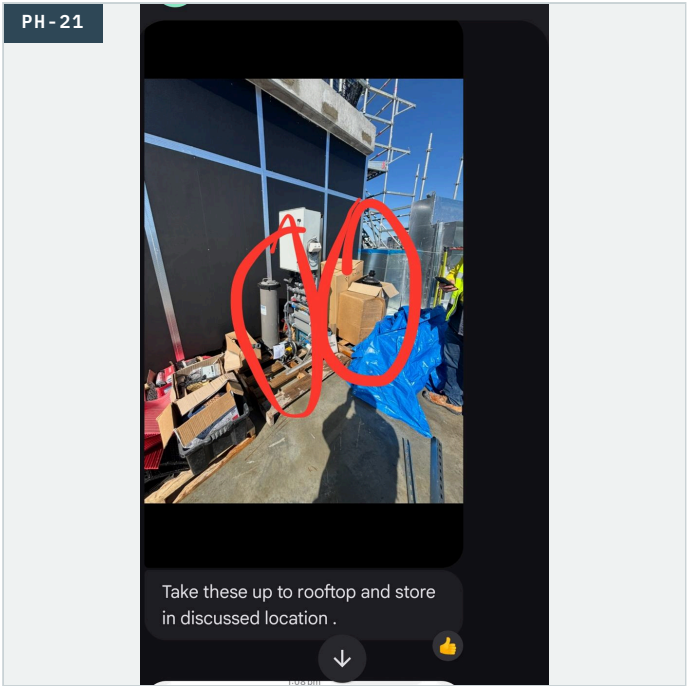

DIRECTION

Supervisor direction — rooftop transfer

Instruction received from Climatech on 26/08: the marked items to be taken up to the rooftop and stored in the agreed location. Works completed same day.

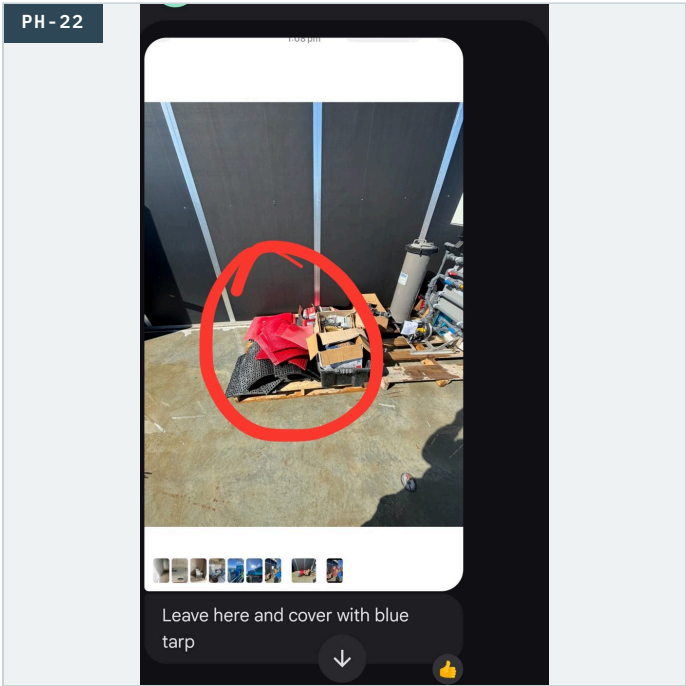

DIRECTION

Supervisor direction — cover in place

Instruction received from Climatech on 26/08: the marked pallet to be left in place and covered with tarpaulin. Works completed same day.

07 DISTRIBUTION & NOTES

Keith Morgan — Climatech

Progress record and direction on open items

Site Management — TP Dynamics

Information — mechanical package progress

Project File — SA Quality Ductwork

Record of works and photographic evidence

This report summarises works performed by SA Quality Ductwork only. Quantities, levels and dates are to be read together with the daily works dockets for the period.

Pablo Augusto

Supervisor — SA Quality Ductwork

SIGNATURE / DATE

Lewis Taipe

Installer — SA Quality Ductwork

SIGNATURE / DATE