

Executive Summary — Plant Equipment, Unit Installation & Ductwork

Works completed by SA Quality Ductwork for the reporting week, issued to Climatech for record and coordination.

PROJECT The Garema Hotel (5-Star) · Canberra ACT	PRINCIPAL CONTRACTOR TP Dynamics	MECHANICAL CONTRACTOR Climatech
SITE SUPERVISOR Keith Morgan — Climatech	WORKS BY SA Quality Ductwork	REPORTING PERIOD Thu 20 – Wed 26 Aug 2026
SITE CREW P. Augusto, L. Taipe, Eduardo, Anthony	PREPARED BY Pablo Augusto, Supervisor	PHOTOGRAPHIC RECORD 15 records — PH-01 to PH-15

01 SCOPE OF WORKS DELIVERED

Works this period focused on the mechanical plant fit-off: support steelwork, setting of Daikin VRV water-cooled modules and ducted fan coils on anti-vibration mounts, hanging of plenum boxes, and connection of insulated ductwork with dampers and access provisions.

- Support steelwork** — unistrut trapeze and goal-post frames installed and levelled to unit footprints (PH-02, 03, 05).
 - Unit setting** — Daikin RWEYQ-TYM VRV modules and FXSQ ducted FCUs set on AV pads and hangers (PH-04, 06, 11, 15).
 - Plenums** — boxes hung on threaded rod with AV hangers, safety wires and flexible connections (PH-10, 13).
- Ductwork** — insulated rectangular and spiral duct, transitions, VCDs and insulation made good (PH-08, 09, 12).
 - Coordination** — supports set clear of hydraulic, fire and electrical services (PH-07, 13).
 - Materials** — duct, dampers and fixings received, checked and staged in the basement store (PH-01).

02 PROGRESS BY WORK FRONT

WORK FRONT	WORKS PERFORMED	QTY	STATUS
Plant room / riser	Support frames installed; VRV modules set on AV mounts and levelled	—	COMPLETE
Typical floors	Ducted FCUs hung on AV hangers; connection points presented	—	COMPLETE
Typical floors	Plenum boxes hung to soffit with flexible connections	—	IN PROGRESS
Soffit & risers	Insulated duct runs, damper sets and boxes to drawings	—	IN PROGRESS
Basement store	Material receipt, check and staging for distribution	—	COMPLETE
Soffit anchors	Anchors inspected and marked — OK / X for replacement	—	DIRECTION REQ.

03 COORDINATION & OBSERVATIONS

OPEN ITEM — CONCRETE ANCHORS

Existing soffit anchors continue to be found stripped or not holding load. Anchors have been inspected and marked on the slab — compliant circled OK, defective marked X (PH-14). Replacement with HKD drop-in anchors is recommended before further hanging; written direction is requested.

- Vibration isolation** — units set on AV pads or hangers; final levelling to be re-checked after connection by others.
- Insulation** — insulation disturbed by supports temporarily made good; permanent reinstatement to be programmed (PH-09).

Pablo Augusto
Supervisor — SA Quality Ductwork

SIGNATURE / DATE

04 SAFETY & COMPLIANCE

- All personnel site-inducted; works under the site SWMS with daily pre-start and toolbox attendance. Elevated work from approved platforms; metal cutting under permit.
- No lost-time injuries, incidents or environmental events recorded for the period.


05 PLANNED WORKS — NEXT PERIOD

- Complete plenum hanging and flexible connections at remaining floors; replace defective soffit anchors with HKD drop-ins and re-hang affected supports, subject to direction.
- Continue insulated duct runs, damper sets and access panels; progressive check and sign-off of completed areas with the site supervisor.

Keith Morgan
Site Supervisor — Climatech

SIGNATURE / DATE

Record note. Photographs taken on site during the reporting period by SA Quality Ductwork. Levels and dates against each record to be confirmed from the daily works dockets before issue to the principal contractor.

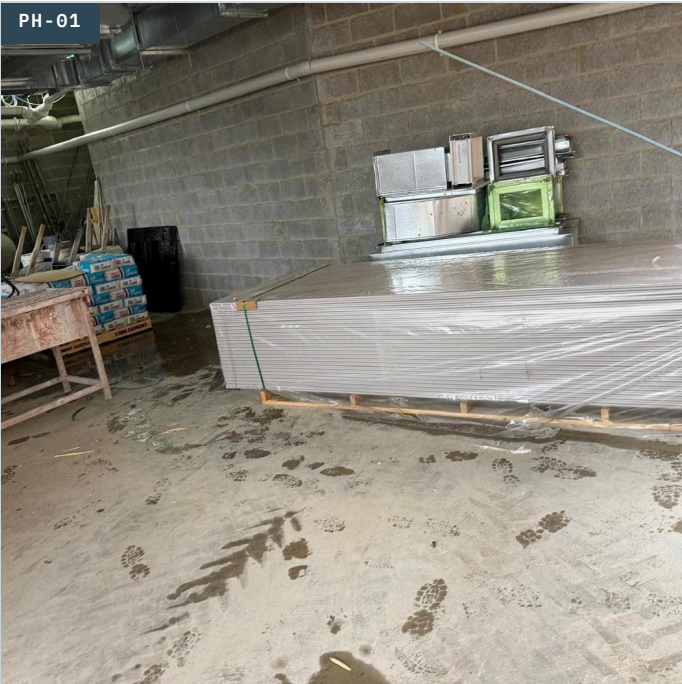


PH-01

MATERIALS

Basement material store

Ductwork, motorised and volume control dampers and plenum boxes received, checked and staged clear of access routes prior to distribution to work fronts.

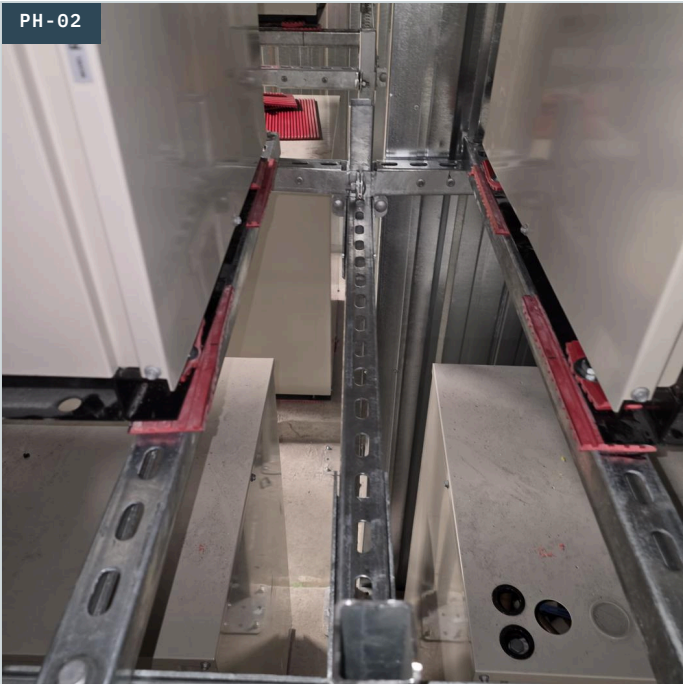

PH-02

SUPPORT STEEL

Support frames — plant area

Galvanised unistrut trapeze and goal-post frames installed to slab and soffit, cross-members bolted and levelled to suit the unit footprints and the services above.



PH-03

SUPPORT STEEL

Frame run — typical arrangement

Repeating frame arrangement set out to a common line and level so units, duct connections and access clearances stay uniform across the run.



PH-04

UNIT SETTING

Daikin RWEYQ10TYM module set

Water-cooled VRV heat pump module (Ser. E001506) positioned, aligned and seated on the support frame, nameplate left visible for commissioning and asset records.

PHOTOGRAPHIC RECORD

SECTION B – VIBRATION ISOLATION, BRACKETRY & DUCT CONNECTION

Works Summary Report 02


THE GAREMA HOTEL · 20-26 AUG
2026



VIBRATION

Anti-vibration pads at unit base


Continuous rubber AV pads fitted between the unit base rail and the steel support so the unit bears fully on the isolator — an acoustic requirement for the guest floors.

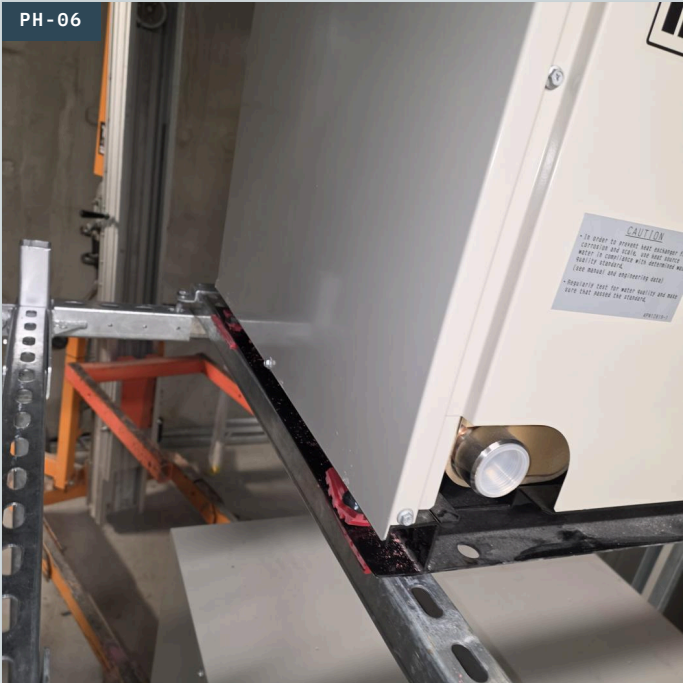

UNIT SETTING

Condenser water connection presented


Unit set with condenser water connections capped and presented clear of the frame for connection by the hydraulic trade; manufacturer water-quality label retained.

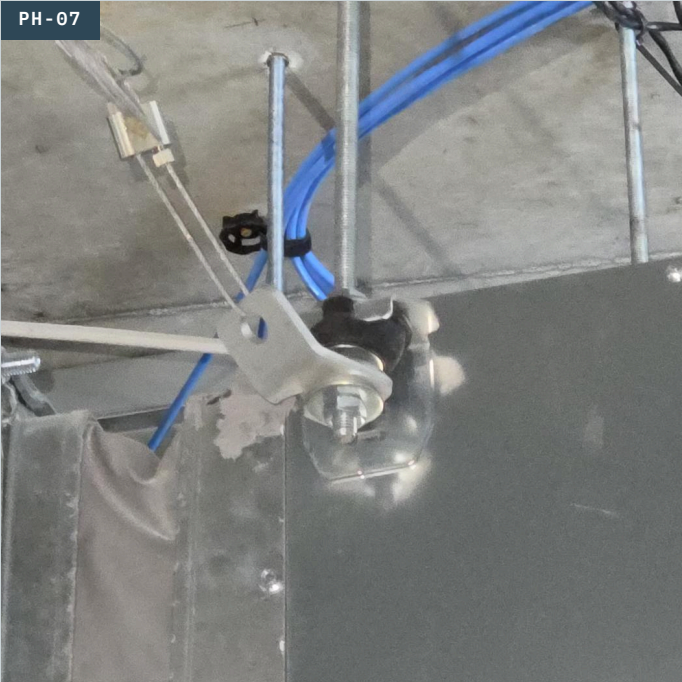

BRACKETRY

Support bracket fixed and tightened

Wall bracket bolted off and tensioned, with refrigerant and control cabling dressed and secured to saddles clear of the duct face and the access zone.

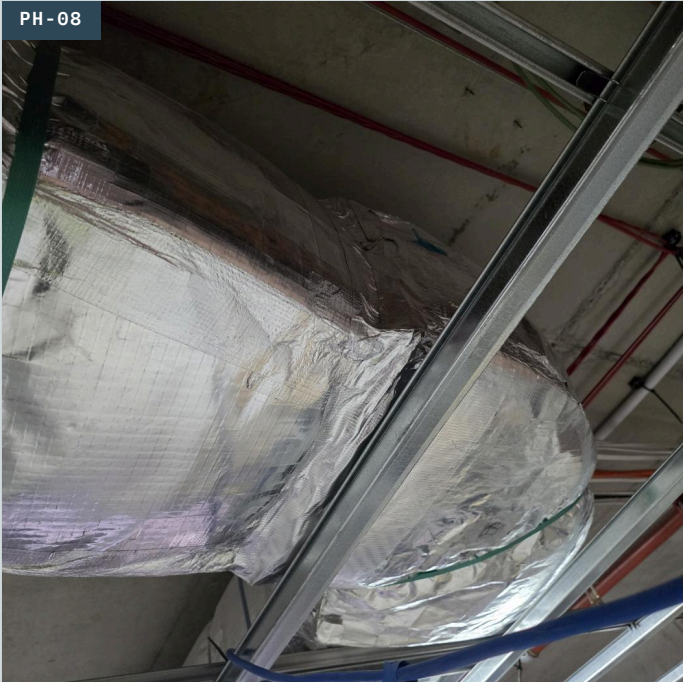


DUCTWORK

Insulated duct transition installed

Insulated rectangular duct and transition to spiral installed and supported on unistrut, set out to clear the hydraulic and fire services running above.

PH-09

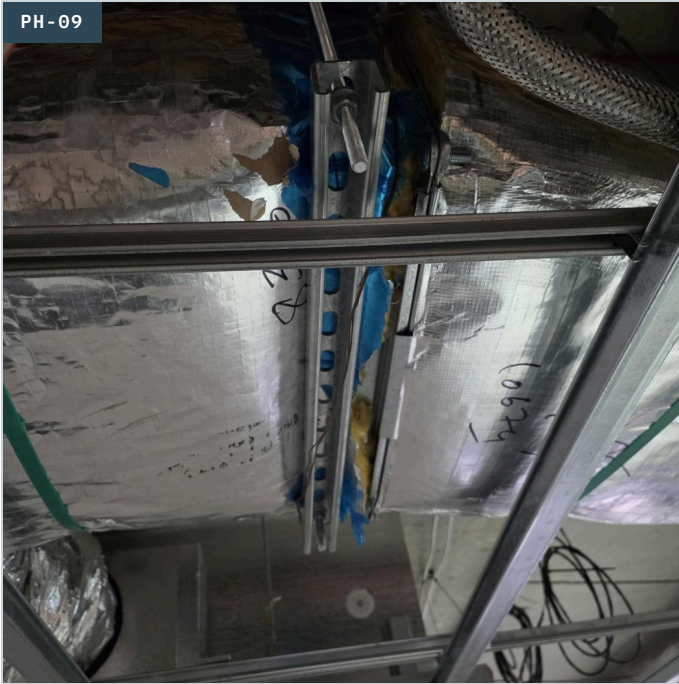

DUCTWORK

Riser duct and damper set

Riser duct supported on threaded rod and unistrut with damper set in position; insulation and vapour barrier temporarily made good at the support penetration.

PH-10




HANGING

Plenum box hung to soffit

Plenum / attenuator box hung from the concrete soffit on threaded rod with rubber-in-shear AV hangers, flexible connection fitted at the duct joint.

PH-11

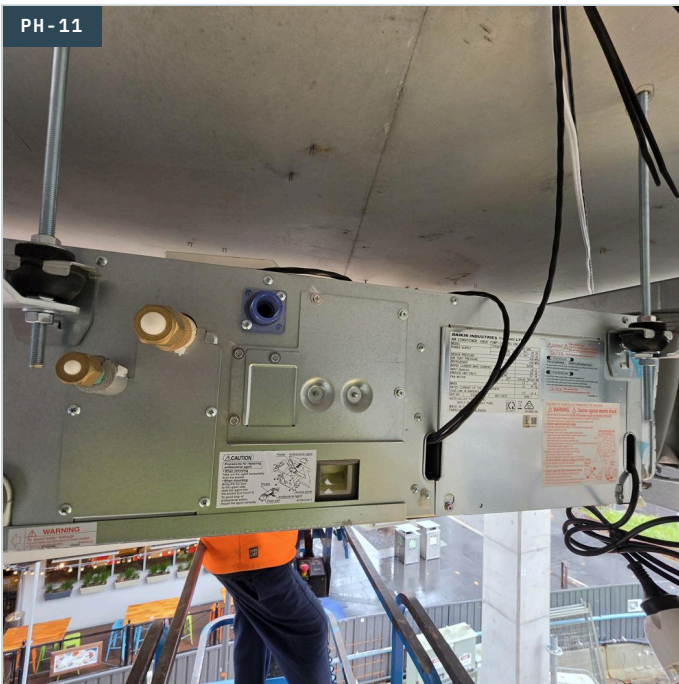

UNIT SETTING

Ducted FCU hung and presented

Daikin FXSQ-series ducted fan coil hung on four threaded rods with AV hangers; refrigerant flares, drain socket and electrical entry left accessible for connection.

PH-12



DUCTWORK

Duct run and boxes to drawings

Duct run with plenum, filter box and spiral connections installed to the issued mechanical set, with open ends protected pending the following connection.



FIT-OFF

Cabling and drain presented at unit

Control and power cabling dressed to the hanger line and drain line set to fall, with safety wires fitted to the hung equipment.



OPEN ITEM

Anchor inspection marked on slab

Existing soffit anchors inspected and marked in place — compliant anchor circled OK, adjacent defective anchor marked X. Replacement with HKD drop-in anchors recommended.



VIBRATION

AV hanger detail at unit bracket

Threaded rod hanger double-nutted at the unit bracket with rubber isolation pad between clamp and bracket — typical detail applied across the hung equipment.

Pablo Augusto
Supervisor — SA Quality Ductwork

SIGNATURE / DATE

06 DISTRIBUTION & NOTES

Keith Morgan — Climatech
Progress record and direction on open items

Site Management — TP Dynamics
Information — mechanical package progress

Project File — SA Quality Ductwork
Record of works and photographic evidence

This report summarises works performed by SA Quality Ductwork only. Quantities, levels and dates are to be read together with the daily works docket for the period. Items marked as open require written direction before the affected works can proceed.

Lewis Taipe
Installer — SA Quality Ductwork

SIGNATURE / DATE