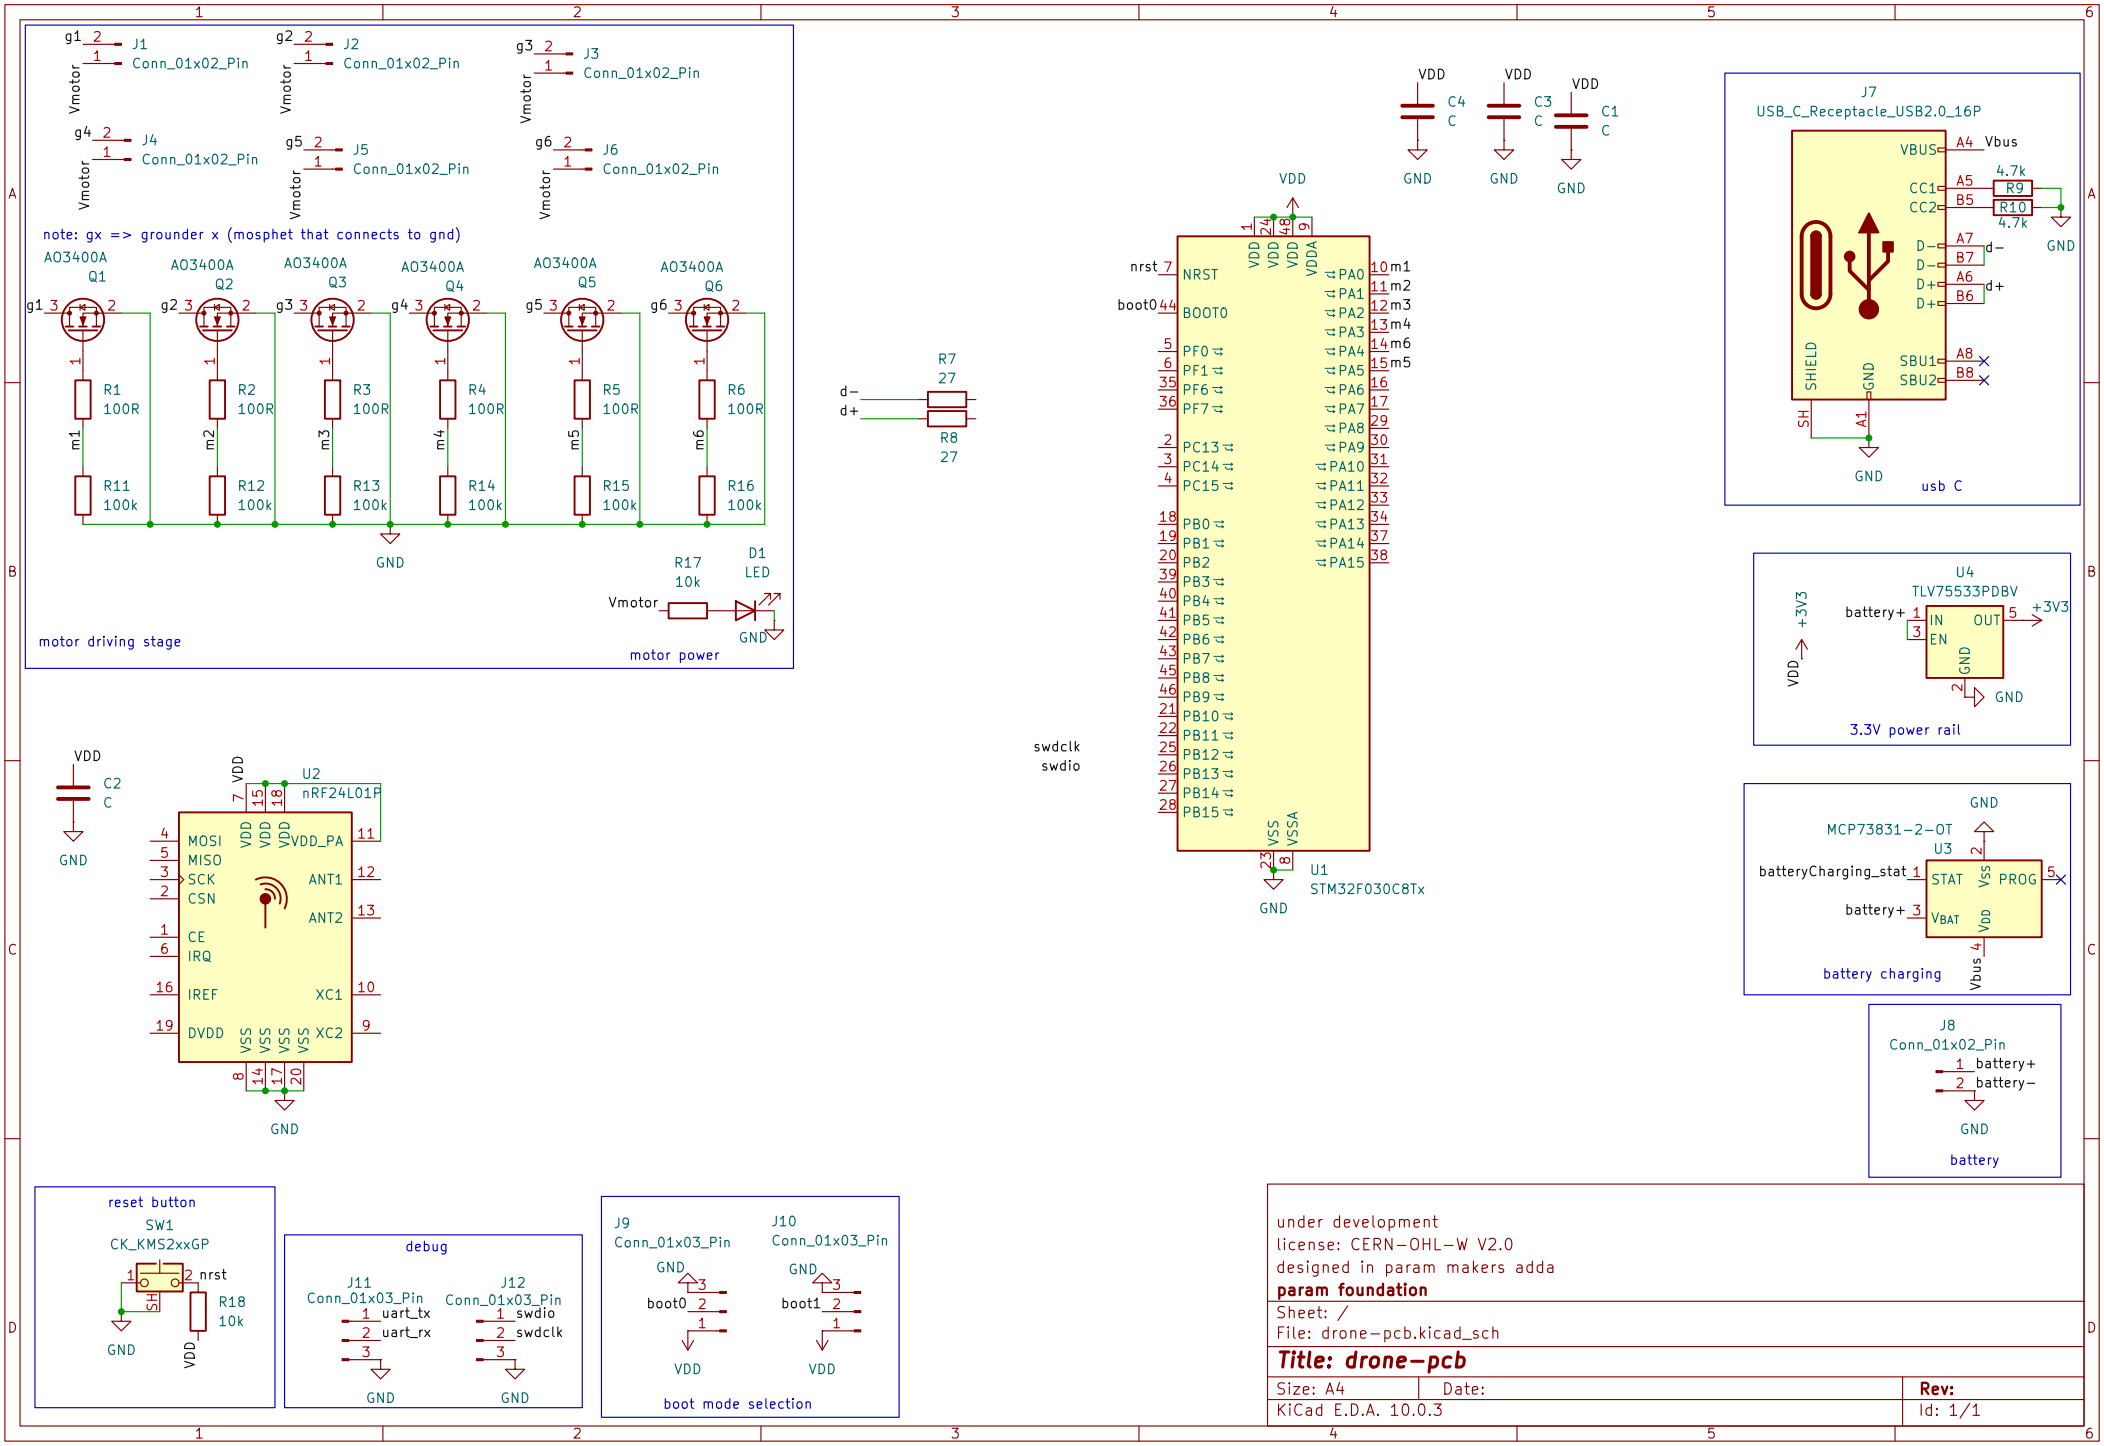

motor driving stage
note: gx => grounder x (mosphet that connects to gnd)
J1 Conn_01x02_Pin
J2 Conn_01x02_Pin
J3 Conn_01x02_Pin
J4 Conn_01x02_Pin
J5 Conn_01x02_Pin
J6 Conn_01x02_Pin
Vmotor
AO3400A
Q1
Q2
Q3
Q4
Q5
Q6
R1 100R
R2 100R
R3 100R
R4 100R
R5 100R
R6 100R
R11 100k
R12 100k
R13 100k
R14 100k
R15 100k
R16 100k
R17 10k
D1 LED
GND
motor power
R7 27
R8 27
d−
d+
VDD
C4 C
C3 C
C1 C
STM32F030C8Tx
U1
nrst
boot0
swdclk
swdio
J7 USB_C_Receptacle_USB2.0_16P
Vbus
4.7k
R9
R10
SHIELD
usb C
U4 TLV75533PDBV
+3V3
3.3V power rail
U2 nRF24L01P
MOSI
MISO
SCK
CSN
CE
IRQ
IREF
DVDD
VDD_PA
ANT1
ANT2
XC1
XC2
C2 C
MCP73831-2-OT
U3
batteryCharging_stat
battery charging
J8 Conn_01x02_Pin
battery+
battery−
battery
reset button
SW1 CK_KMS2xxGP
nrst
R18 10k
debug
J11 Conn_01x03_Pin
J12 Conn_01x03_Pin
uart_tx
uart_rx
swdio
swdclk
J9 Conn_01x03_Pin
J10 Conn_01x03_Pin
boot0
boot1
boot mode selection
under development
license: CERN−OHL−W V2.0
designed in param makers adda
param foundation
Sheet: /
File: drone−pcb.kicad_sch
Title: drone−pcb
Size: A4
Date:
Rev:
KiCad E.D.A. 10.0.3
Id: 1/1