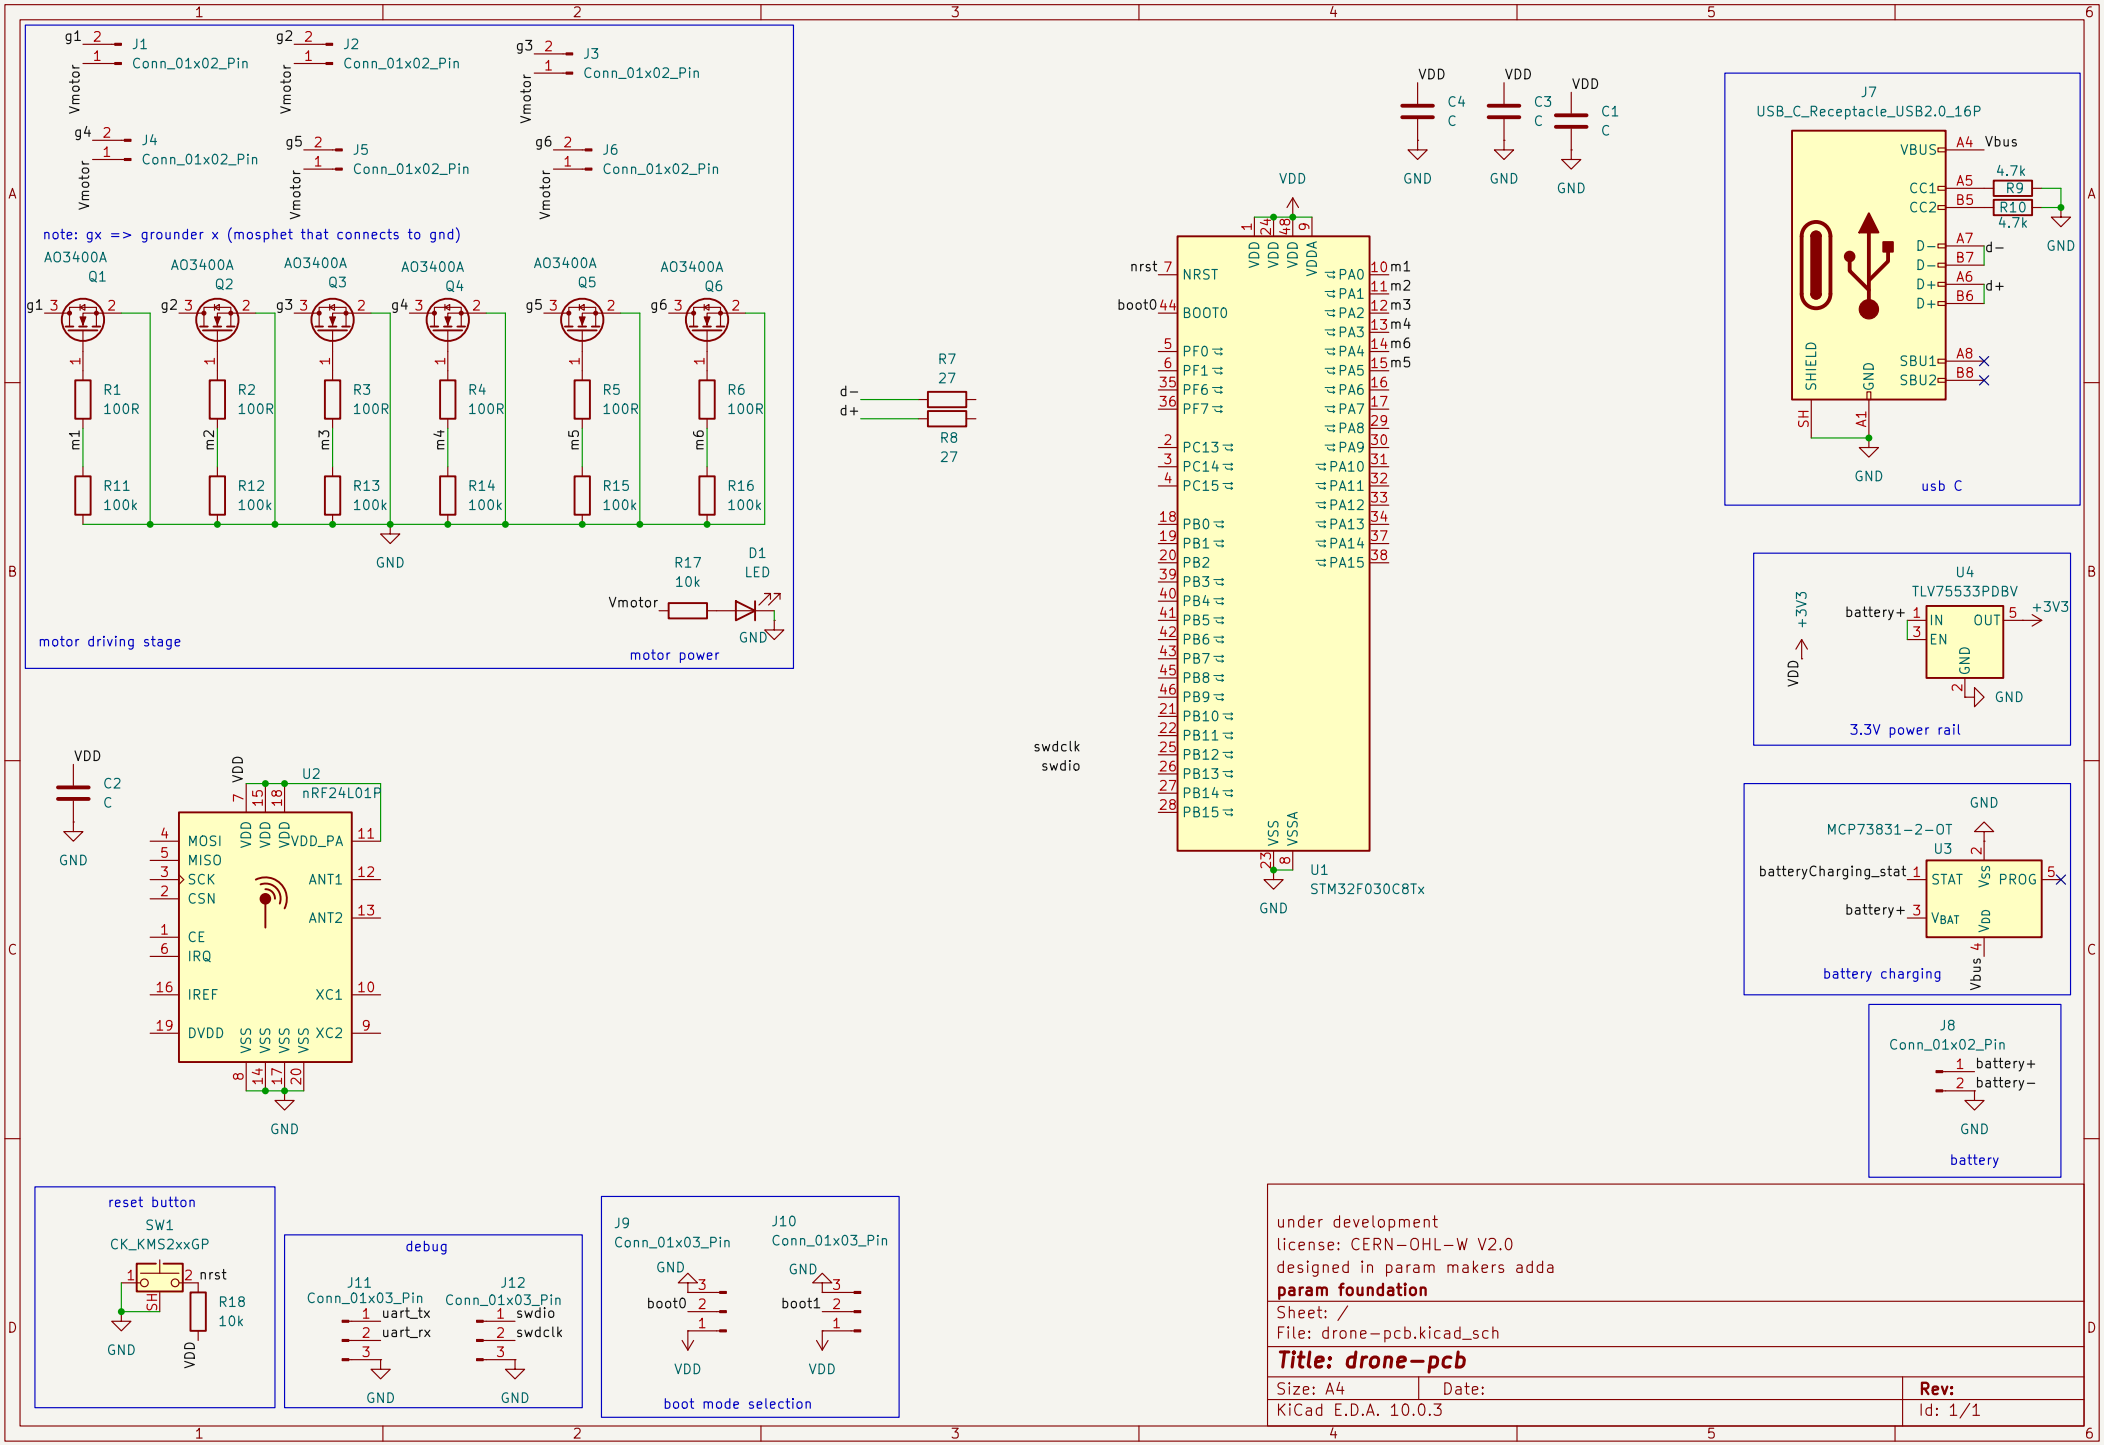

g1 J1 Conn_01x02_Pin
g2 J2 Conn_01x02_Pin
g3 J3 Conn_01x02_Pin
g4 J4 Conn_01x02_Pin
g5 J5 Conn_01x02_Pin
g6 J6 Conn_01x02_Pin
Vmotor
note: gx => grounder x (mosphet that connects to gnd)
AO3400A Q1
AO3400A Q2
AO3400A Q3
AO3400A Q4
AO3400A Q5
AO3400A Q6
R1 100R
R2 100R
R3 100R
R4 100R
R5 100R
R6 100R
R11 100k
R12 100k
R13 100k
R14 100k
R15 100k
R16 100k
m1
m2
m3
m4
m5
m6
GND
R17 10k
D1 LED
motor driving stage
motor power
R7 27
R8 27
d−
d+
VDD
C4 C
C3 C
C1 C
U1 STM32F030C8Tx
nrst
boot0
swdclk
swdio
PA0 m1
PA1 m2
PA2 m3
PA3 m4
PA4 m5
PA5 m6
J7 USB_C_Receptacle_USB2.0_16P
VBUS Vbus
CC1 4.7k R9
CC2 4.7k R10
D− d−
D+ d+
SHIELD
SBU1
SBU2
usb C
U4 TLV75533PDBV
battery+
+3V3
3.3V power rail
U2 nRF24L01P
MOSI
MISO
SCK
CSN
CE
IRQ
IREF
DVDD
VDD_PA
ANT1
ANT2
XC1
XC2
C2 C
MCP73831-2-OT
U3
batteryCharging_stat
STAT
PROG
VBAT
battery charging
J8 Conn_01x02_Pin
battery
reset button
SW1 CK_KMS2xxGP
R18 10k
nrst
debug
J11 Conn_01x03_Pin
J12 Conn_01x03_Pin
uart_tx
uart_rx
swdio
swdclk
J9 Conn_01x03_Pin
J10 Conn_01x03_Pin
boot0
boot1
boot mode selection
under development
license: CERN−OHL−W V2.0
designed in param makers adda
param foundation
Sheet: /
File: drone−pcb.kicad_sch
Title: drone−pcb
Size: A4
Date:
Rev:
Id: 1/1
KiCad E.D.A. 10.0.3