





1	2	3	4	5	6
A					A
B					B
C					C
D					D
1	2	3	4	5	6

Sheet: /CM5/ File: cm5.kicad_sch		
Title:		
Size: A4	Date:	Rev:
KiCad E.D.A. 10.0.3		Id: 2/4

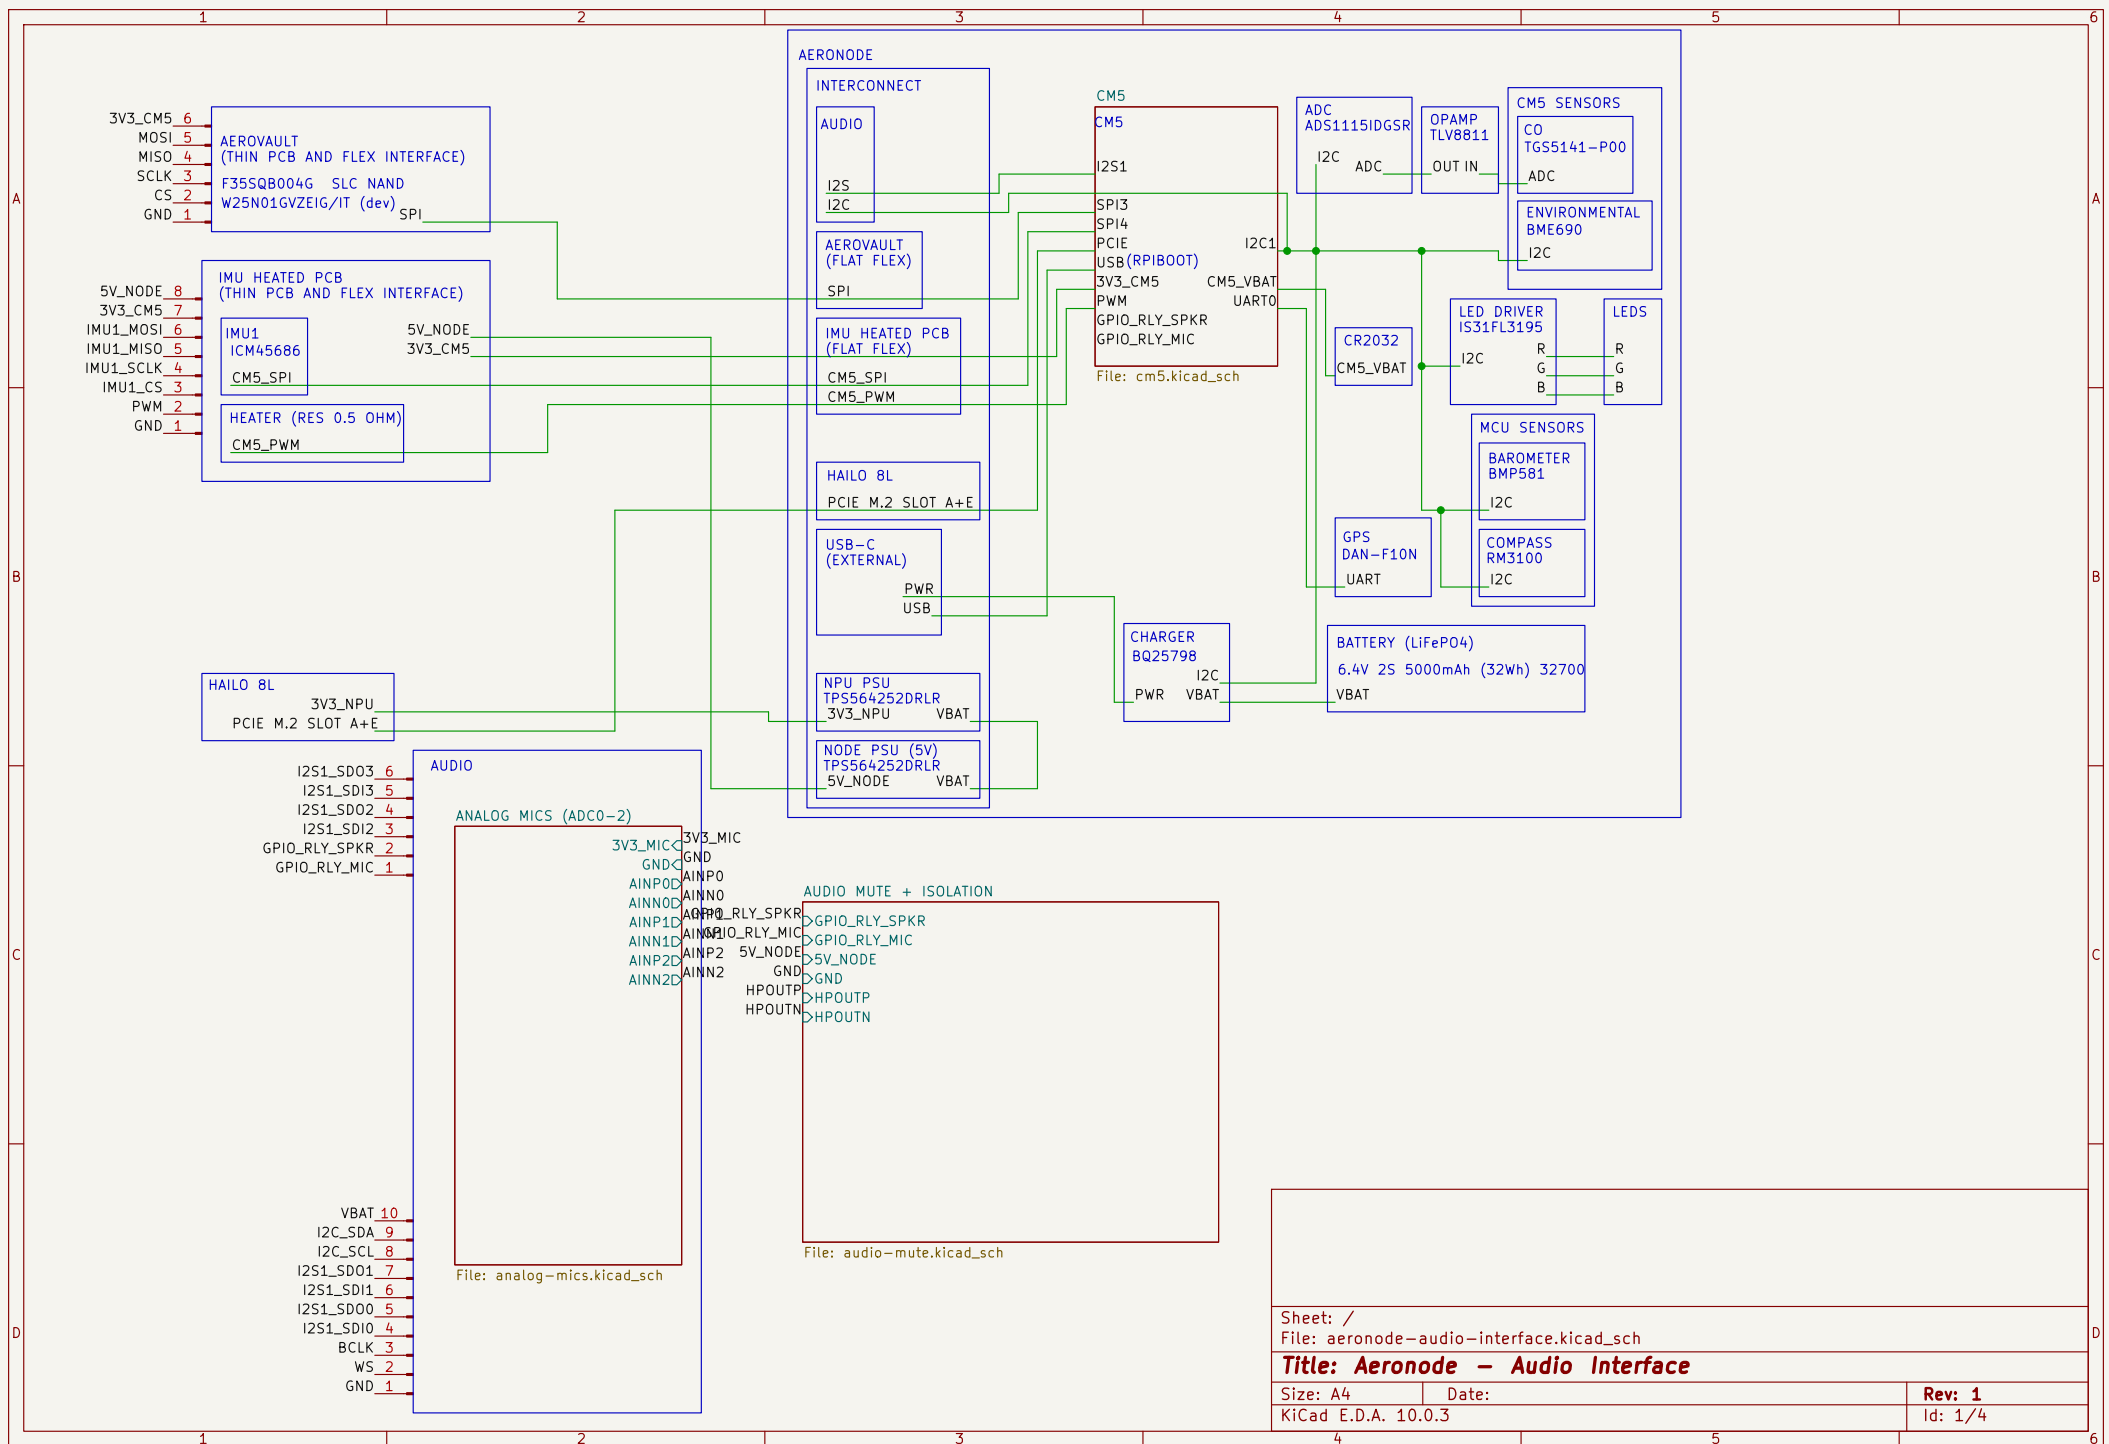

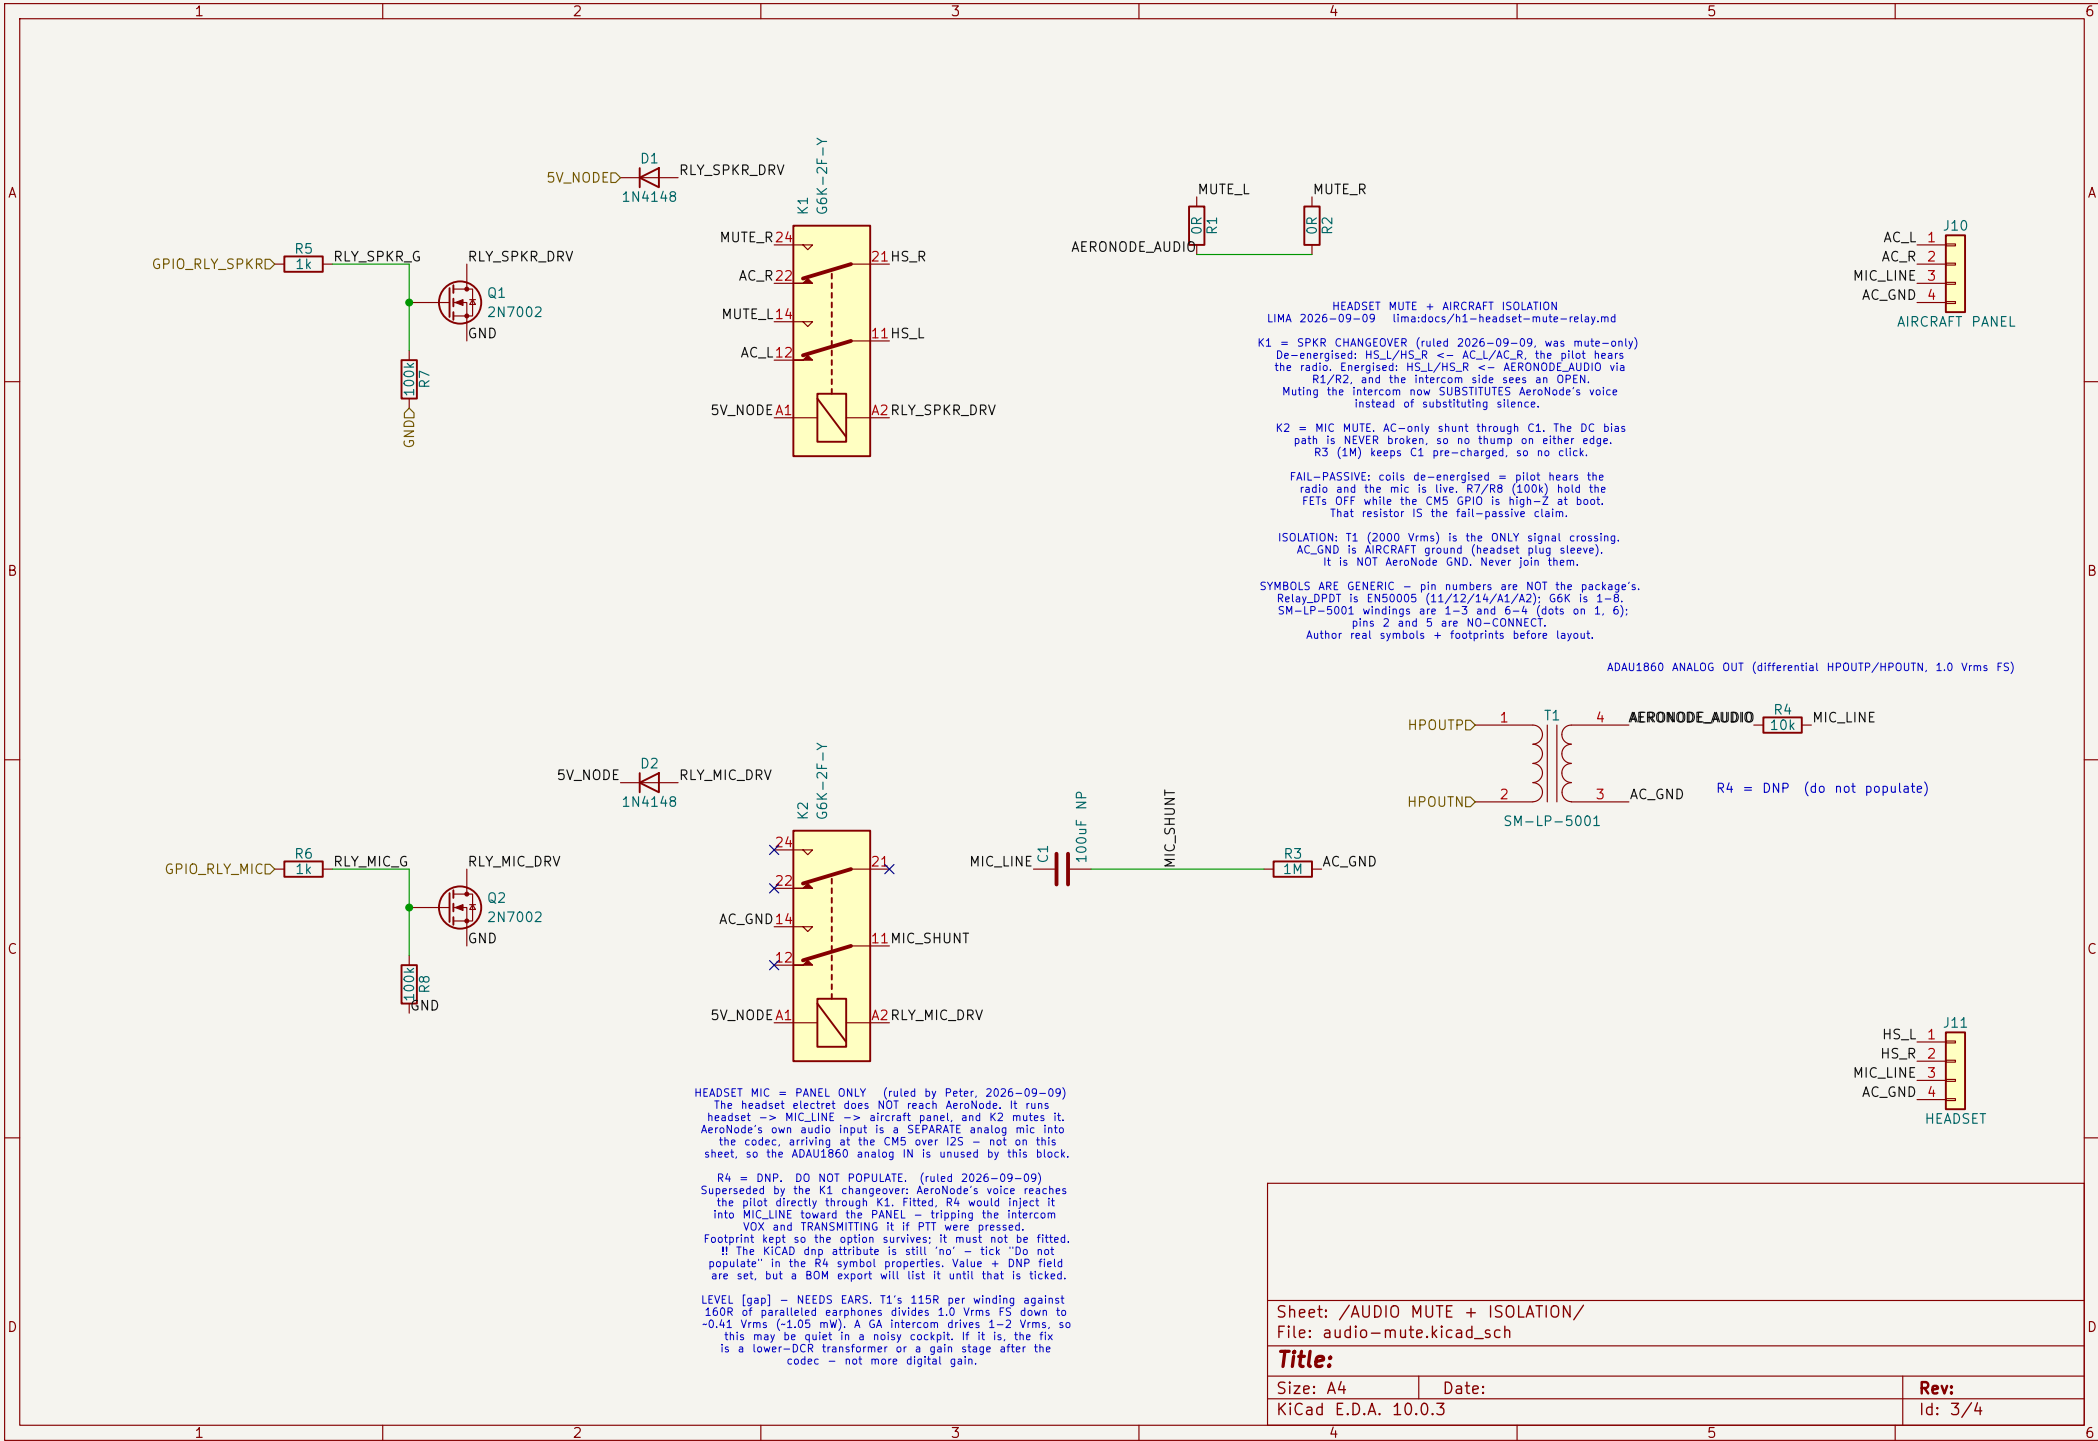

switching, or the ANC output needs its own always-on path. See section 19. T1 is NOT a blocker - I first read its 200 Hz-4 kHz spec band as a hard limit, but that is Bourns' 600R telecom condition. Into 160R from a low-Z drive the calculated corner is 3.4 Hz (-0.02 dB at 50 Hz). [gap] LF distortion unmeasured. LATENCY: at 48 kHz the ADC->DSP->DAC loop is -1 ms, too slow for feedforward above a few hundred Hz. Run ANC through FastDSP at a high rate - the datasheet characterises it at 768 kHz for exactly this.

Id: 4/4