
SE-2, 13 JUL 2023 to 10 AUG 2023

WAAS	APP CRS	Rwy Idg	5502
CH 49008	AII CKS	TDŹE	18
W05A	045°	Apt Elev	18

RNAV (GPS) RWY 5 CURRITUCK COUNTY RGNL (ONX)

Baro-VNAV NA when using Oceana NAS/Apollo Soucek altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 49°C (120°F). DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Procedure NA when tethered balloon located approximately 11.4 NM southwest of airport is flying. When local altimeter setting not received, use Oceana NAS/Apollo Soucek altimeter setting and increase all DA 59 feet, and all MDA 60 feet; increase LNAV Cat. C and D visibility ¼ mile.

MISSED APPROACH: Climb to 2000 direct HABKI and hold.

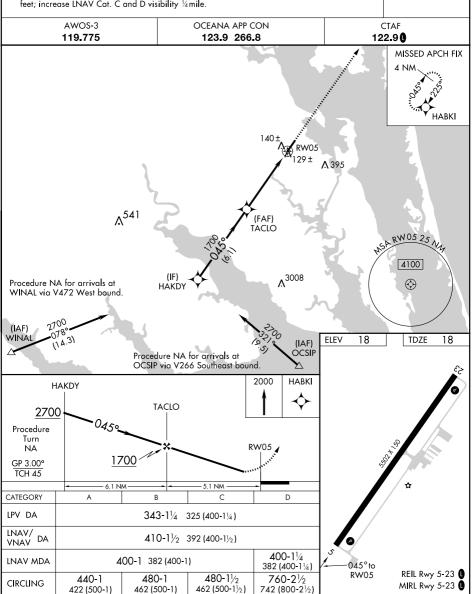

CURRITUCK, NORTH CAROLINA Orig-A 20MAY21

CURRITUCK COUNTY RGNL (ONX) RNAV (GPS) RWY 5