NW-1, 13 JUL 2023 to


10 AUG 2023

WAAS CH 99337 APP CRS TDZE 3851
W32A APP CRS APP Elev 3858

## RNAV (GPS) RWY 32 CUT BANK INTL (CTB)

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C (-13°F) or above 51°C (124°F). DME/DME RNP-0.3 NA. MISSED APPROACH: Climb to 4400 then A climbing right turn to 11000 direct WEBVO and hold. UNICOM ASOS SALT LAKE CITY CENTER 119.025 123.0 (CTAF) ( 133.4 285.4 3904 **RW32** 4368 WEDAP **AĞRYN CUT BANK** 1.4 NM to 6300 MOPT RW32 6300 to EPILE .232° (17.2) 139° (8.3) (FAF) MALCO MISSED APCH FIX WEBVC **■** 259° · · RW32 25 Ny 7 NM (IF/IAF) ÉPILE 6500 **7 NM (** 

(IAF)

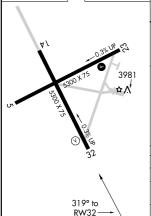

TDZE

3851

3858

**ELEV** 

PĖNRY BRADZ 4400 WEBVO 7 NM 11000 VGSI and RNAV glidepath not coincident Holding Pattern (VGSI Angle 3.00/TCH 42). Δ MALCO 6300 \* LNAV only WEDAP 5400 1.4 NM to RW32 \*0.8 NM to RW32 5400 ~, RW32 4320\* GP 3.00° TCH 53

(IAF)

-0.8 NM- 0.6 NM - 3.3 NM -6 NM CATEGORY D I PV 4051-1 DA 200 (200-1) LNAV/ DΑ 4101-1 250 (300-1) VNAV 4160-1 309 (400-1) LNAV MDA

4320-1

462 (500-1)

CUT BANK, MONTANA Orig-B 07DEC17

MIRL Rwys 5-23 and 14-32

REIL Rwy 320

CUT BANK INTL (CTB)
RNAV (GPS) RWY 32

4620-2 1/2

762 (800-21/2)

4400-11/2

542 (600-11/2)

4280-1

422 (500-1)

**C** CIRCLING