
WAAS Rwy Idg 4400 APP CRS CH 61116 894 **TDZE** 087° **W08A** Apt Elev 894

## RNAV (GPS) RWY 8 LAKEFIELD (CQA)

DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Baro-VNAV NA. Use Wapakoneta altimeter setting. When not received use James M Cox Dayton Intl altimeter setting and increase all DA 73 feet and all MDA 80 feet; increase LPV Cats A/B/C visibility 1/4 mile, A NA

MISSED APPROACH: Climb to 3000 direct EVOZU and via track

LINAV/VINAV Cats A/B		12/° to ICREB and hold.		
AXV AWOS-3-PT <b>128,325</b>	COLUMBUS APP CON 118.425 352.05	UNICOM <b>122.8</b> (CTAF)		123.3 🕻

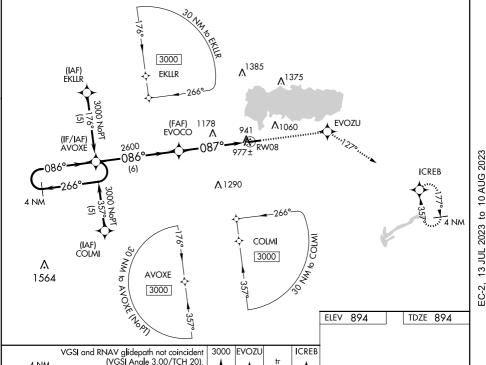

4 NM Holding Patte		OXE EVO		127°	
3000	<u>−266°</u> 086° <del>→</del>	0860	. RV	<b>V</b> 08	97.5
GP 3.00° TCH 40		2600	<b>1</b> 08>°		2 A400 X 75
		- 6 NM	5.2 NM —	-	087°
CATEGORY	Α	В	С	D	
LPV DA	1221-11/4 327 (400-11/4)		NA		
LNAV/ VNAV DA	1278-11/4 384 (400-11/4)			NA	
LNAV MDA	1440-1	546 (600-1)	1440-1½ 546 (600-1½)	NA	
CIRCLING	1440-1	546 (600-1)	1480-11/2	NA	REIL Rwys 8 and 26 (1) MIRL Rwy 8-26 (1)

CELINA, OHIO Orig-A 02DEC21

LAKEFIELD (CQA)RNAV (GPS) RWY 8

MIRL Rwy 8-26 (

586 (600-11/2)