RNAV (RNP) Z RWY 16R

DENVER INTL (DEN)

APP CRS	Rwy ldg	16000
173°	TDZE	5326
	Apt Elev	5434

GPS required. Simultaneous approach authorized.
For uncompensated Baro-VNAV systems, procedure NA below -25°C (-13°F) or above 46°C (116°F). Use of FD or AP providing RNAV track guidance required during simultaneous operations.

MALSR

MISSED APPROACH: Climb to 5900 then climbing right turn to 10000 direct BINBE and hold, continue climb-in-hold to 10000.

D-ATIS	DENVER APP CON	DENVER TOWER	GND CON	CLNC DEL	CPDLC
ARR 125.6 379.9 DEP 134.025	119.3 307.3 (NORTH) 120.35 379.3 (SOUTH)	135.3 351.95	121.35 379.175	118.75	

RADAR REQUIRED

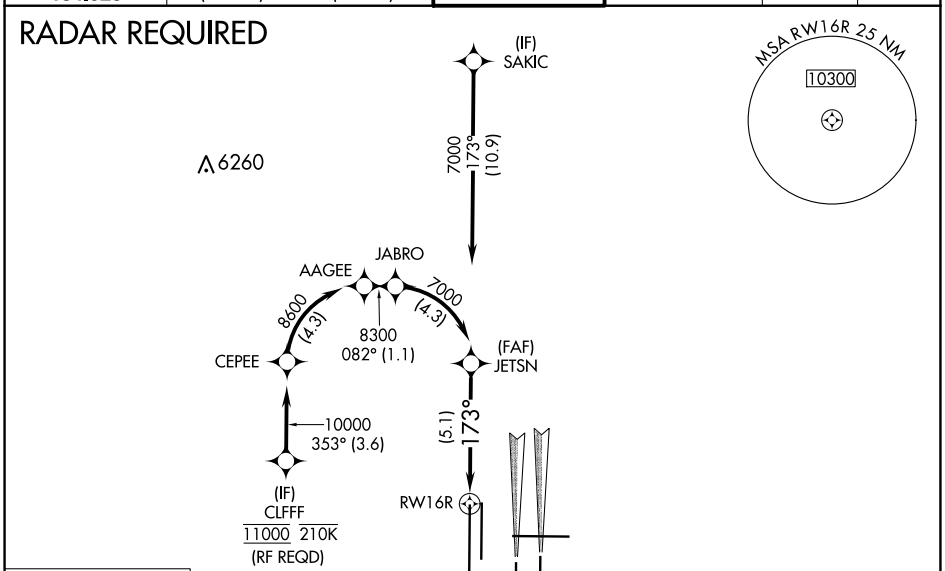

MISSED APCH FIX

5900	10000	BINBE

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).

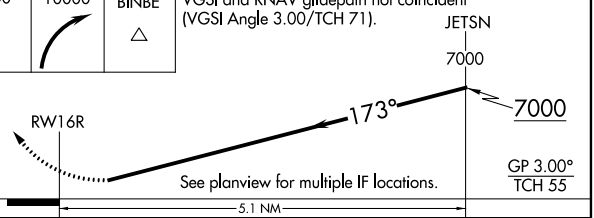

CATEGORY	A	B	C	D
RNP 0.10 DA	5586/50 260 (200-1)			
RNP 0.30 DA	5651/50 325 (300-1)			

AUTHORIZATION REQUIRED

ELEV 5434 D TDZE 5326

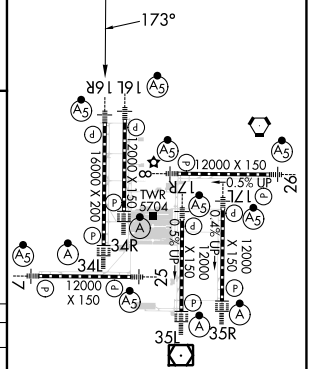

HIRL all Rwys
TDZ/CL Rwys 7, 16L, 16R, 17R, 26, 34L, 34R, 35L, 35R

SW-1, 13 JUL 2023 to 10 AUG 2023

SW-1, 13 JUL 2023 to 10 AUG 2023