Dell PowerFlex 3.6.2 Release Notes

PowerFlex 3.6.2

Rev. 01
August 2023
These release notes contain supplemental information about this release.

- Revision history....2
- Product description....2
- New and changed features....2
- Support deprecation....4
- Fixed issues....4
- Software packages....5
- Install and upgrade....7
- Known issues and limitations....9
- Operating system known issues and limitations....12
- Additional resources....13

DELL Technologies

Revision history

Revision history for PowerFlex3.6.2 release notes

Table 1. PowerFlex3.6.2 release notes revision history

Revision	Date	Description
01	August 10, 2023	Release of PowerFlex 3.6.2

Product description

PowerFlex is a software-defined storage platform designed to significantly reduce operational and infrastructure complexity. It empowers organizations to move faster by delivering flexibility, elasticity, and simplicity with predictable performance and resiliency at scale.

The PowerFlex family provides a foundation that combines compute as well as high performance storage resources in a managed unified fabric. PowerFlex comes in fully managed flexible deployment options for rack or appliance that enable Server SAN, HCI, and storage only architectures. PowerFlex can now be deployed in the public cloud. A Ready Node option is also available. PowerFlex is ideal for high performance applications and databases, building an open private cloud, or consolidating resources in heterogeneous environments.

New and changed features

Learn about new and changed features in this version of PowerFlex.

New features for PowerFlex

Learn about the new features introduced in PowerFlex 3.6.2 software.

- PowerFlex is now available as a consumption model in the public cloud. PowerFlex 3.6.0.4 is supported on AWS.
- PowerPath 7.4 for Linux now supports PowerFlex devices. PowerPath Migration enabler can be used for data migration across PowerFlex and other PowerPath supported storage array classes.
  NOTE: Only PowerFlex SCSI devices are supported. Since PowerFlex devices have only a single path, PowerFlex takes care of load balancing across different SDS.
- A new alert, `SDS_EXCEEDED_IMM_TIMEOUT`, is displayed if `SDS name <NAME> SDS Id <nnn>` is running with Instant Maintenance Mode (IMM), exceeding the configured duration. It places the system at risk for a second failure of another node and might lead to data unavailability.

Important

The following aspects of PowerFlex 3.6.2 must be understood before deploying or upgrading your system:

1. CloudIQ integration
   - Discovering a PowerFlex system in CloudIQ requires the system to be registered with Secure remote services. In the PowerFlex Installer, **Maintain** tab, ensure that the PowerFlex system is registered with Secure remote services and that **Send data to CloudIQ** is enabled.
   - After installing a *new* PowerFlex system with PowerFlex version 3.6, it takes 24 hours until data is available in CloudIQ. Systems *upgrading* to PowerFlex 3.6 will appear in CloudIQ within an hour of enabling the **Send data to CloudIQ** option.
   - PowerFlex appliance and rack systems need PowerFlex Manager version "H" in order to be discovered in CloudIQ.
2. Replication enhancements
   - Bi-directional replication between two sites only is supported.
   - See the PowerFlex Sizer for sizing guidelines for correct replication system specifications, including WAN bandwidth sizing. When using the PowerFlex Sizer, take into account existing workload and existing hardware, and the possible need to add additional nodes to enable replication without impacting the current workload.

- Replication capability has higher I/O overhead, as explained in the v3.6 *Getting to Know PowerFlex Guide* (Replication section) and the white paper Dell EMC PowerFlex: Introduction to Replication. See these recommendations in order to size your system correctly, and ensure that you have sufficient existing storage capabilities to enable this ability.

3. Network resiliency improvements
   - Proactive network path error detection requires SDC to be at v3.6 or later.
4. Upgrade Paths
   - Upgrade from PowerFlex version 3.0.x and 3.5.x to version 3.6 are supported.
   - Older PowerFlex/ VxFlex operating system versions must be upgraded to version 3.0.x prior to upgrading to version 3.6.
5. vSphere plug-in End-of-Support-Life
   - The PowerFlex vSphere plug-in continues to be supported with vSphere versions 6.5 and 6.7, however it reaches end-of-support-life when vSphere 6.5 and 6.7 reach end-of-support by VMware. For details on the last release of vSphere plug-in due to end of general support for ESXi 6.5 and 6.7 by VMware, see: Announcing End of General Support for vSphere 6.5.x and vSphere 6.7.x (89305). Also note the new issue in the *Known Issues* section that is related to vSphere Plug-in.
   - The PowerFlex vSphere plug-in does not support vSphere 7 hyperconverged (HCI) configurations.

Changed features

Learn about the enhanced features for this version of PowerFlex.

Updated operating system support matrix

The following operating systems are added to the support matrix in this release:

- RHEL 8.8
- REHL 9.2

The operating systems support software only customers for the following components:

- MDM
- SDS
- SDR
- SDC
- LIA

Further to SDC only, the following operating systems support are being added:

- Windows 2022
- vSphere 7.0U3i

For more operating system-related information and supported components, see the PowerFlex simple support matrix: https://elabnavigator.dell.com/eln/modernHomeSSM

Oracle JRE and OpenJDK support

- Oracle JRE 1.8 build 322
- OpenJDK JDK 8 build 322.b06
- OpenJDK 11.0.12.07 (Linux-based servers only)
- Presentation server—The Java version must be upgraded to Java 11 before upgrading the presentation server.

NOTE: The next patch version of PowerFlex Manager will not support Java version 1.8. Dell Technologies recommends upgrading to Java version 11 for PowerFlex Gateway or Installation Manager.

Support deprecation

Learn about the features that are no longer supported in PowerFlex 3.6.2.

Background scanner events and alerts

Some events and alerts for the background scanner feature were deprecated, and replaced with different ones. See the *PowerFlex v3.5.1.2 Release Notes*, "Documentation" section, for details.

DAS Cache

DAS Cache is no longer supported for PowerFlex running on any operating systems.

System Analysis Tool

The System Analysis Tool is no longer included in PowerFlex.

AMS

Systems managed by AMS system will not be able to upgrade to PowerFlex v3.5 or later. Prior to performing an upgrade, contact PowerFlex Product Management for possible alternatives.

NOTE: AMS artifacts will be removed from the support site. For guidance, contact PowerFlex Product Management.

VxFlex OS GUI client

The GUI from versions earlier than v3.5 of this product is no longer supported and cannot be upgraded. From v3.5 and later, a new GUI must be deployed/upgraded instead.

Deprecated operating systems

For the most current information, see the *Dell Technologies Simple Support Matrix* at https://elabnavigator.dell.com/eln/modernHomeSSM/.

Fixed issues

The following table lists the issues that are fixed in PowerFlex3.6.2.

NOTE: If an issue was reported by customers, the customers' Service Request numbers appear in the "Issue number & SR number" column, and correlate between customer-reported issues and the PowerFlex issue number.

Table 2. Fixed issues

Issue number & SR number	Problem summary
SCI-67443 SR# 142260496	When a Replication Consistency Group (RCG) switchover or failover is performed, an alert message, "The RCG consistent image is too large to be consumed by the destination in one piece" is displayed.

Table 2. Fixed issues (continued)

Issue number & SR number	Problem summary
SCI-72026 SR# 160212006	MDM and SDS have open sockets to a SDC that is disconnected owing to a broadcast storm.
SCI-62134 SR# 21581712	SDSs fail to exit Instant Maintenance Mode (IMM) during upgrade owing to an issue with cloudlister and enter restart loop.
SCI-74807 SR# 168446713	Secure vulnerability for PowerFlex and is exploitable (CWE ID 200).
SCI-73036 SR# 163764138	Clear text password in presentation server configuration file—`/etc/mgmt-server/.config/mgmt-server`.
SCI-74621 SR# 167101662	MDM does not start a forward rebuild if a comb has Partial Device Error (PDE).
SCI-73811	PowerFlex sends the information alert, DRL Mode: DRL_MODE_NON_VOLATILE, to customer alert system after PowerFlex 3.6.x version is deployed.
SCI-73891 SR# 165777881	MDM event logs report DAX device errors in several SDS nodes.
SCI-75243	Apache CVE-2023-24998 recommends upgrading Tomcat to version 8.5.88. The fix is upgraded to 8.5.90.
SCI-74975	PowerFlex presentation server user interface displays an error when Java versions other than version 11 are used.
SCI-73643	Hardware awareness does not display device details when a SDS device is added by the SCSI ID.
SCI-73208	Function roll log files with the same starting name are not deleted and break the rotation.
SCI-72479	Vulnerable version of BSAFE Crypto-J 6.2.3 used in PowerFlex.
SCI-72411 SR# 161806413	Presentation server is not reachable after upgrading to 3.6.0.7 from 3.6.0.4.

Software packages

Learn about the contents of the PowerFlex 3.6.2 software packages.

Download location

The PowerFlex 3.6.2 complete software package, containing all the packages listed below, can be downloaded from the following location:

https://www.dell.com/support/home/en-us/product-support/product/scaleio/overview

Table 3. Software packages

Package Name	Operating System	GW	MDM	SDS	SDR	SDC	LIA	Xcache	Content
RHEL_OEL7	Red Hat / CentOS / Oracle Linux	X	X	X	X	X	X	X	Core components for Red Hat, CentOS and Oracle Linux 7.x.

Table 3. Software packages (continued)

Package Name	Operating System	GW	MDM	SDS	SDR	SDC	LIA	Xcache	Content
									Oracle Linux 7.8 and higher includes KVM.
RHEL8_OEL8	Red Hat / CentOS / Oracle Linux	X	X	X	X	X	X	X	Core components for Red Hat, CentOS and Oracle Linux 8.x. Oracle Linux includes KVM.
RHEL_OEL9	Red Hat / CentOS / Oracle Linux		X	X	X	X	X		Core components for Red Hat, CentOS and Oracle Linux 9.x.
CENTOS 7.9									
CentOS Stream 8		X	X	X	X	X	X	X	Core components for CentOS Stream 8
CentOS Stream 9			X	X	X	X	X		Core components for CentOS Stream 9
SLES11.4	SUSE Linux	X				X			SDC component for SLES 11 SP4
SLES12.5		X	X	X	X	X	X	X	Core components for SLES 12 SP5
SLES15.2	SUSE Linux	X	X	X	X	X	X	X	Core components for SLES 15 SP2
SLES15.3	SUSE Linux	X	X	X	X	X	X	X	Core components for SLES 15 SP3
SLES15.4	SUSE Linux		X	X	X	X	X		Core components for SLES 15 SP4
Ubuntu18.04	Ubuntu	X	X	X	X	X	X	X	Core components for Ubuntu 18.04
Ubuntu20.04	Ubuntu	X	X	X	X	X	X	X	Core components for Ubuntu 20.04
Ubuntu22.04	Ubuntu		X	X	X	X	X		Core components for Ubuntu 22.04.x LTS
XEN 7.1	XenServer / Citrix Hypervisor		X	X	X	X	X		Core components for Citrix XenServer 7.1.2 LTSR
XEN 8.0			X	X	X	X			Core components for Citrix Hypervisor 8.1 and 8.2
Complete_VMware_SW	vSphere	X	X	X	X	X			Contains all PowerFlex, VMware-related software artifacts (OVA file, drv_cfg file, SVM patching, SDC package, vSphere plug-in, and VASA provider) **NOTE:** PowerFlex vSphere plug-in is not compatible

Table 3. Software packages (continued)

Package Name	Operating System	GW	MDM	SDS	SDR	SDC	LIA	Xcache	Content
									with ESXi 7.0 and later.
Complete_Windows_SW	Windows Server	X				X	X		Contains all Microsoft Windows (2012-2019) server related software artifacts, including the gateway and CSV deployment templates
RHEL CoreOS	CoreOS					X			SDC component for RHEL CoreOS
CoreOS						X			SDC component for CoreOS
AIX7.2	AIX					X			SDC component for IBM AIX 7.2
Presentation_Server									Contains PowerFlex WebUI server (Linux and Ubuntu)
Gateway_for_Linux		X							PowerFlex Gateway, which includes the following: Installer, Gateway (for REST API, Alerts, SNMP/ESRS) for Linux/Ubuntu (can be used to deploy PowerFlex on Linux-based operating systems only). CSV deployment templates are also included
GPG-RPM-KEY									Contains RPM key (RSA for Linux, DSA for Xen) to authenticate the RPM packages using manual install/upgrade procedure

NOTE:

- Please refer to the latest PowerFlex simple support matrix at https://elabnavigator.dell.com/eln/modernHomeSSM
- PowerFlex version 3.5 and later provides a Web UI. GUI packages are no longer available.

Install and upgrade

PowerFlex 3.6.2 can be installed on a clean system or used as an upgrade. Learn important information about installing or upgrading to this version.

Installation

For complete instructions for installing PowerFlex, see the *Deploy PowerFlex Guide*.

Licensing

PowerFlex use requires a license. Call your Dell Technologies account representative to purchase a license for PowerFlex.

Upgrade

The following table lists the versions from which the upgrade can be performed:

Table 4. Upgrade support matrix

ScaleIO / VxFlex OS / PowerFlex base version	Upgrade path	Supporting documentation
v2.0.1.4, v2.6.x	Two-step upgrade flow: 1. Upgrade to latest version of v3.0.1.x 2. Upgrade to v3.6.0.x	*Upgrade VxFlex OS to v3.0.x Guide* *Upgrade PowerFlex to v3.6 Guide*
v3.0, v3.0.0.x, v3.0.1.x, v3.5.x, v3.6, v3.6.0.x	Single-step upgrade from: ● VxFlex OS v3.0/v3.0.0.x/v3.0.1.x ● PowerFlex v3.5.x ● PowerFlex v3.6.0.x to PowerFlex v3.6.1	*Upgrade PowerFlex to v3.6 Guide*

CloudLink support

PowerFlex version	CloudLink version	Description of change
3.6.0.6 and later	7.1.5	Existing CloudLink install base with the original device path logic: /dev/sd*X*.
3.6.0.2, 3.6.0.3, 3.6.04, and 3.6.0.5	7.1.3	CloudLink 7.1.3 enables a new device path logic for encrypted devices, using /dev/disk/by-id/wwn-*<unique_id>*.
3.0.1.x all versions 3.5.x.x, all versions 3.6 3.6.0.1	7.1 7.0	The CloudLink versions maintain legacy support for the existing CloudLink install base with the original device path logic: /dev/sd*X*.

PowerFlex 3.6.0.2 supports migration and upgrade flows from CloudLink 7.1 to CloudLink 7.1.2 or CloudLink 7.1.3.

Following are the expected upgrade flow for systems with CloudLink:

- Upgrade PowerFlex to 3.6.0.6.
- For CloudLink 7.1 / 7.0, upgrade to CloudLink 7.1.5.
- For CloudLink 7.1.2 / 7.1.3 / 7.1.4, upgrade to CloudLink 7.1.5 with support assistance.

PowerFlex 3.6.0.6 supports migration and upgrade flows from CloudLink 7.1 to CloudLink 7.1.5.

CloudLink 7.1.5 changes the disk-mapping logic to use /dev/sd*X* compared to what was introduced in the CloudLink 7.1.2 to 7.1.4 versions. This version removes support for /dev/disk/by– id from CloudLink which reverts to a /dev/sd*X* device mapping.

Customers who migrated to CloudLink 7.1.3 and adopted /dev/disk/by-id logic must open a support call as documented in *Dell PowerFlex v3.6.x CloudLink for SDS Devices*. This helps in reverting to /dev/sd*X* device mapping and helps adopt the CloudLink 7.1.5.

Customers using the earlier CloudLink releases (CloudLink 7.1.1 or earlier) can adopt the CloudLink 7.1.5 by using the existing device mapping.

Due to key updates, it is recommended that you adopt the latest CloudLink 7.1.5 for usage with PowerFlex for Data at Rest Encryption.

Supported operating systems

The user documentation contains a list of supported operating systems. For the most current information, see the *Dell Technologies Simple Support Matrices* at https://elabnavigator.dell.com/eln/modernHomeSSM, **Storage** option.

SDC compatibility

By design, the PowerFlex SDC in this release is compatible with previously released systems that are currently supported (for example, VxFlex OS v3.0.1). In addition, the PowerFlex system (backend) in this release is backward compatible with previously released SDC versions that are currently supported.

Some limitations may apply to mixed-version systems, such as:

- Replication is not supported on SDC releases earlier than PowerFlex v3.5.
- The CHAP component authentication feature cannot be enabled unless every MDM, SDC, and SDS in the system is at least version 3.5, and conversely, if the feature is enabled, no pre-v3.5 SDCs can be added.
- Fine Granularity Storage Pool-based volumes cannot be mapped to a ScaleIO/VxFlex operating system v2.x SDC.
- Snapshot Policy management is not available with SDC releases earlier than VxFlex operating system v3.0.

Known issues and limitations

The following table lists known issues and limitations that exist in PowerFlex 3.6.2.

NOTE: If an issue was reported by customers, the customers' Service Request numbers appear in the "Issue number & SR number" column, and serve to correlate between customer-reported issues and the PowerFlex issue number.

Table 5. Known issues and limitations—PowerFlex Custom Node

Issue number & SR number	Problem summary	Workaround
SCI-62961	Disk slot information for PowerEdge nodes introduced in PowerFlex 3.6 does not work on R650/R6525/R750 nodes with HBA355.	Use iDRAC or perccli to get the disk slot information.

Table 6. Known issues and limitations—PowerFlex Gateway

Issue number & SR number	Problem summary	Workaround
SCI-66203 SR# v989309	The AutoComplete attribute is not disabled for passwords in form-based authentication. If the browser is used in a shared computing environment where more than one person may use the browser, "autocomplete" values may be retrieved or submitted by an unauthorized user.	None
SCI-58953	When running the PowerFlex Gateway on an Internet Explorer 11 browser, LIA Authentication gets stuck in "Loading..." status when retrieving system topology.	Use Chrome or Firefox browsers to perform this action.
SCI-58471	PowerFlex Gateway Tomcat log rotations do not work after an upgrade. At build time, the "server.xml" file is defined as a "noreplace-config file" in the RPM. During an upgrade, the RPM mechanism will automatically detect if the file was previously edited or not. If the file was edited, it will not be overwritten during upgrade, and the new file will be created with the ".rpmnew" suffix.	Edit the file "server.xml" manually, and change the log rotation rules. For more information, see the PowerFlex Troubleshooting Guide, "Some PowerFlex Gateway log files fail to rotate" topic.
SCI-57810	The PowerFlex Gateway Maintenance operation screen might show an invalid LIA authentication for a containerized SDC when connecting to the	None

Table 6. Known issues and limitations—PowerFlex Gateway (continued)

Issue number & SR number	Problem summary	Workaround
	system. This should appear as N/A, and can be ignored.	
SCI-57304	PowerFlex Installer (also known as the PowerFlex Gateway) is exposed to issue HSTS Missing From HTTPS Server, CVE: https://nvd.nist.gov/vuln/detail/CVE-2017-7789	None
SCI-54887	When performing the log collection using the PowerFlex Gateway with the "exception only" check box marked, the log collection fails.	Perform log collection with the default settings using the PowerFlex Gateway.
SCI-54799	If Auto Collect logs is configured in the system during an NDU session, when the NDU ends, the PowerFlex Installer displays a button asking to start the first phase of the NDU, even though the previous one was completed successfully (instead of displaying the "Mark operation as done" button).	Disable auto log collection prior to starting the NDU, and run the NDU. After NDU completion, enable auto log collection again.

Table 7. Known issues and limitations—MDM

Issue number & SR number	Problem summary	Workaround
SCI-60885	When using SRA, the PowerFlex Gateway password and the MDM password must be the same. Otherwise. one of the following errors is displayed on the SRM/SRA UI: SRA command 'discoverArrays' failed. General exception No further information available SRA command 'discoverArrays' failed. general error check logs for detail	Change the PowerFlex Gateway and MDM user passwords simultaneously. Ensure that they have admin permissions and the same password.
SCI-69646	By default, Python3 is installed on Ubuntu and is located in `/usr/bin/python3`. During the execution of the command `/opt/emc/scaleio/mdm/diag/dump_and_balance_check.py --username XXXXX --password YYYYY --approve_certificate --scripts_path=/opt/emc/scaleio/mdm/diag/`, the following error is encountered: `bash: /opt/emc/scaleio/mdm/diag/dump_and_balance_check.py: /usr/bin/python: bad interpreter: No such file or directory.`	Add "3" at the start of the Python script.

Table 8. Known issues and limitations—Presentation server

Issue number & SR number	Problem summary	Workaround
SCI-75461	PowerFlex 3.6.2 web interface running on Java version 1.8 displays error.	Deploy PowerFlex Presentation server only on Java version 11.
SCI-60813	When connecting a presentation server from PowerFlex version 3.6 to a PowerFlex 3.5 system, some of the UI functionality does not work as expected.	Use the matching version of the presentation server.

Table 8. Known issues and limitations—Presentation server (continued)

Issue number & SR number	Problem summary	Workaround
		In an upgrade flow, see the upgrade guide for guidelines about when and how to upgrade the presentation server.

Table 9. Known issues and limitations—SDC

Issue number & SR number	Problem summary	Workaround
SCI-57752	The SDC rpm package for SLES15.X installs without any issues. However, after installation, when checking if the SDC driver's scini service is loaded, the following confusing state is returned: service scini status service: no such service scini This is a false positive status alert.	None
SCI-69559	SDC installed with flash vSphere plug-in fails without any recovery due to end of support by VMware for ESXi 6.7.x and 6.5.x. For details, see Announcing end of general support for vSphere 6.5.x and vSphere 6.7.x (89305).	None
SCI-69251 SR# 151250184	PowerFlex SDC on ESXi versions 6.5 and 6.7 fail to install on ESXi version 6.7U3 and later. For example: `root: ERROR: vmware.esximage.Errors.InstallationError: ('EMC_bootbank_scaleio-sdc-esx6.x_3.6-500.106', "('EMC_bootbank_scaleio-sdc-esx6.x_3.6-500.106', 'Could not find a trusted signer: unable to get local issuer certificate')").` For details, see vSphere VIB signing related updates (76276).	Perform these procedures to complete the installation: • **Option 1**: Update the ESXi version to 6.7U3 or higher and try to reinstall the SDC. • **Option 2**: Use the SDC version that supports the older ESXi version, for example: PowerFlex 3.6.0.4.
SCI-71000	The SDC system service in SLES15.x is renamed to **scini** to maintain consistency with other Linux distributions. However, when upgrading to the latest version (scini.service), the earlier version (sdc.service) remains in use. This conflict prevents the SDC from loading.	Ensure to disable and remove the earlier SDC service manually and then, restart the latest scini service. Perform the following procedures: 1. systemctl disable sdc.service 2. rm /usr/lib/systemd/system/sdc.service 3. systemctl restart scini.service

Table 10. Known issues and limitations—SDR

Issue number & SR number	Problem summary	Workaround
SCI-62047	A replication failover on an RCG that is still in the initial copy phase may not present all volume members at the remote target location.	Wait for all volumes in the RCG to complete their initial copy phase before performing the failover operation for that RCG.

Table 11. Known issues and limitations—SDS

Issue number & SR number	Problem summary	Workaround
SCI-63216	When adding NVMe devices using the by-id path similar to the following: dev/disk/by-id/nvme-Dell_Express_Flash_NVMe_P4610_1.6TB_SFF_BTLN950106ZB1P6AGN the MDM blocks the addition due to the error: new_device_path too long, MDM supports up to 63 characters.	Use the alternative name path in by-id location with nvme-eui in the path. For example: /dev/disk/by-id/nvme-eui.01000000010000005cd2e448b0b75151

Table 12. Known issues and limitations—vVols

Issue number & SR number	Problem summary	Workaround
SCI-54057	Unmapping a VMware virtual volume, and then immediately afterwards trying to overwrite its content, might generate the error: "volume n is in use".	None. Try again shortly after, because some volume operations are performed in an asynchronous fashion.

Operating system known issues and limitations

Learn about known issues and limitations for specific operating systems.

Table 13. Known issues and limitations—operating systems


Issue number & SR number	Problem summary	Workaround
VXFV-296	Mixing the Mellanox CX-6 100GbE NIC driver with the Broadcom PCIe/OCP 25GbE NIC driver is not supported.	Remove the `bnxt_en` driver and install the Mellanox driver.
VXFV-283	iDRAC support for "Prepare for Removal" on PowerEdge R650/R6525/R750/ nodes fails.	NVMe hot-swap on Linux operating systems is supported. Skip the Prepare for Removal step in iDRAC.
VXFV-265	During execution of the command `create-namespace` with 4k alignment on RHEL 8.4, the following error is encountered: Warning: namespace0.0 unable to validate alignment	This is a false notification. The command result is as expected, and the resulting DAX device can be used with PowerFlex acceleration devices.
VXFV-243	Upgrade of a RedHat-based operating system to RHEL 8.3 fails if the node contains NVDIMMs. This is due to a known issue on RHEL 8.3: https://access.redhat.com/documentation/en-us/red_hat_enterprise_linux/8/html-single/8.3_release_notes/index#known-issue_installer-and-image-creation	Follow the procedures described in "RHEL/CentOS upgrade to version 8.3" in the Upgrade Dell PowerFlex.
VXFV-360	The device name appears incorrectly as Non PCI device instead of iDRAC, but the current and baseline versions are accurate (6.00.30.201 and 6.00.30.202, respectively).	Dell recommends upgrading the OME catalog to the latest version.
—	PowerFlex nodes running CPLD 1.0.7 stop responding during Power On Self-Test (POST) when upgrading to certain RCM or IC packages that include BIOS 1.8.2 and iDRAC 6.00.30.202.	Before upgrading to the latest supported version of PowerFlex, ensure that the PowerFlex nodes are running CPLD 1.0.8 or later. For details, see https://www.dell.com/support/kbdoc/en-us/000205925.

Additional resources

Use these resources to find more information about this product, get support and provide feedback.

Product information

For documentation, release notes, software updates, or information about Dell products, go to Dell Online Support at:
https://www.dell.com/support/home/en-us/product-support/product/scaleio/overview

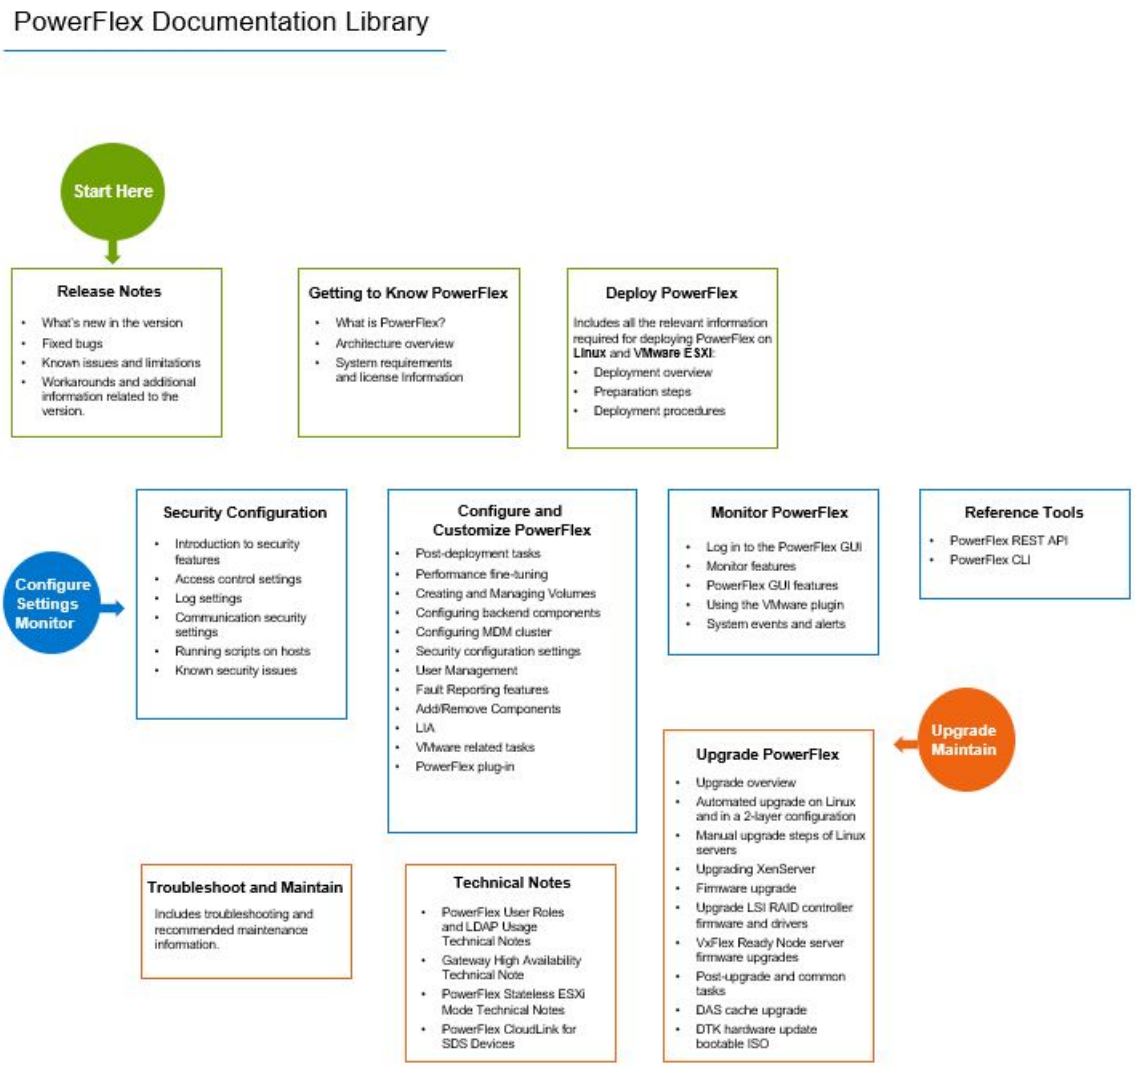

Where to get support

Go to Dell Online Support and click **Support**. You will see several options for contacting Dell Technical Support. Note that to open a service request, you must have a valid support agreement. Contact your Dell sales representative for details about obtaining a valid support agreement or with questions about your account.

Notes, cautions, and warnings

NOTE: A NOTE indicates important information that helps you make better use of your product.

CAUTION: A CAUTION indicates either potential damage to hardware or loss of data and tells you how to avoid the problem.

WARNING: A WARNING indicates a potential for property damage, personal injury, or death.

© 2023 Dell Inc. or its subsidiaries. All rights reserved. Dell Technologies, Dell, and other trademarks are trademarks of Dell Inc. or its subsidiaries. Other trademarks may be trademarks of their respective owners.