NOCTUO

PRODUCT CARD

GRIP

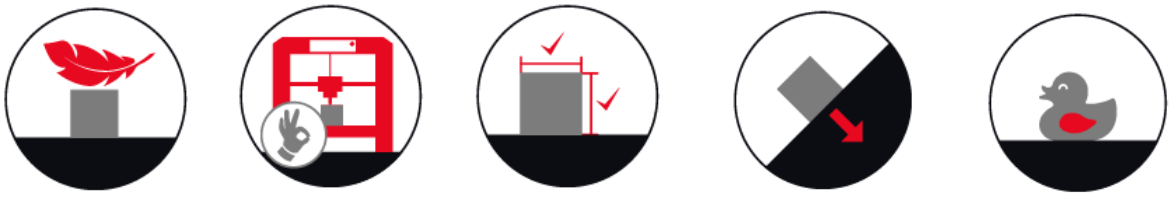

soft-touch surface finish | exceptionally easy to print | low shrinkage | high dynamic friction | made with materials compliant with the EN 713 toy safety standard

1. GENERAL INFORMATION ABOUT THE PRODUCT

GRIP is unique, high-adhesive, universal elastic material with a hardness of 88 ShA. It has distinguished features – 'soft touch' surface and high dynamic friction, which makes it perfect for grip surfaces, gaskets or toys. GRIP prints are not slippery as it is while using most of the flexible materials in 3D printing and they have barely visible layers bonding. GRIP is also characterized by wide range of work temperatures.

Main GRIP features:

- easy to print,
- high dynamic friction,
- minimal shrinkage,
- nice to touch print surface (soft-touch),
- entirely made of raw materials that meet the EU 10/2011 and the EN 71/3 standard (regarding the safety of toys).

2. TECHNICAL PARAMETERS

CHARACTERISTICS	TEST METHOD	TEST CONDITIONS	IU	VALUE
	ISO			
PHYSICAL				
Density	1183	-	g/cm^3	1.10
MECHANICAL				
Hardness	7619-1	-	ShA	88
Tensile strength	37, S2	200mm/min	MPa	5.5

Elongation at break	37, S2	200mm/min	%	400
Tear resistance	34-1, B	-	N/mm	30.0

Tests have been done in 23°C, if it's not marked differently.

3. RECOMMENDATION OF PRINTING

GRIP does not require drying before using. As a settings starting point, you can use ABS profile with reduced accelerations. Cooling during printing shouldn't be necessary. If the adhesion to the table is not satisfactory, double-sided tape can be used. If the bottom of the print is curling, reduce the acceleration when printing the first layer.

Recommended parameters of printing:

Hotend temperature	230 - 260 °C
Bed temperature	45 - 80 °C depends on the surface
Print speed	< 70 mm/s

4. SAFETY NOTES

Exhaust fan is recommended.
Air filters in printer is recommended.
GRIP needs to be used only in well ventilated conditions.
Inhaling fumes generated during the printing must be avoided.

Generating fumes during the printing depends mainly on printing temperature. In case of visibly raising emission level, the printing needs to end. Check the hotend temperature and efficiency of the control system before using it next time.

In proper using conditions, the product doesn't endanger health.

It's forbidden to set fire!

Detailed safety information available in SDS.