

DEALER SERVICE BULLETIN JANUARY 2009 REPLACEMENT REMOTES

PLEASE FORWARD TO:

Dealer Service

□ SERVICE MANAGER □ WARRANTY MANAGER □ PARTS MANAGER

As a product improvement, in 2007 Carefree migrated from the 418 MHz remote system to the 433 MHz remote. The chart on the next page is a quick reference guide that describes the various remote/receiver combinations and the availability of components for replacement purposes.

SUMMARY:

418 MHz remotes and receivers:

• Limited component quantities available. When stock is depleted, it will be necessary to upgrade the system to 433 MHz. Use SR0014, kit contains receiver and key FOB.

Interim 433 MHz:

Remotes: Gray button key FOBS marked 433 MHz - limited quantities available. When stock
is depleted it will be necessary to upgrade to the latest 433 MHz configuration; use SR0014, kit
contains receiver and key FOB.


NOTE: The 433 MHz key FOB (with antenna) does not work with the RR version 1 receiver. It will be necessary to replace the receiver and key FOB.

• Receivers: Receivers marked "RR version 1" are discontinued and unavailable. Use R060429-002 marked "RR version 2".

NOTE: The RR version 2 receiver is compatible with both the gray button 433 MHz key FOB and the key FOB w/ antenna.

Current Configuration:

- Remote: R060622-001 433 MHz key FOB w/ antenna.
- Receiver: R060429-002 433 MHz receiver marked "RR version 2".

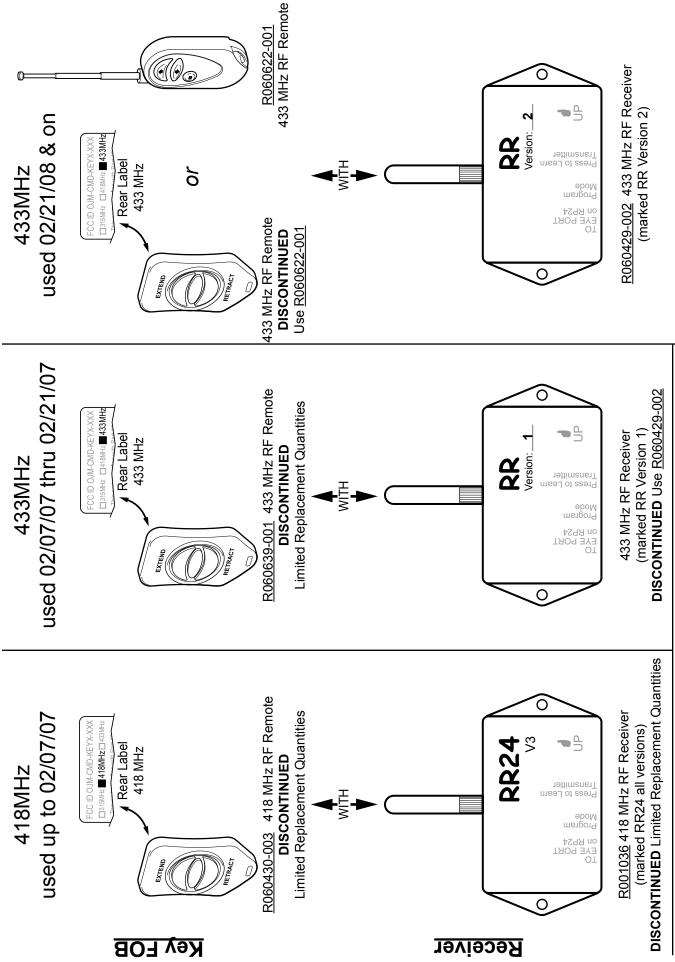

To update the remote to the latest 433 MHz configuration, order SR0014. Kit contains one (1) R060429-002 Receiver and one (1) R060622-001 Key FOB