HW3 Problem 1 - Steering enable FSM
Pranav Krovi (pkrovi)

Defaults: C=0, E=0, R=0; stay in current state unless an arrow says otherwise.
State outputs and / edge actions override defaults immediately (Mealy outputs).

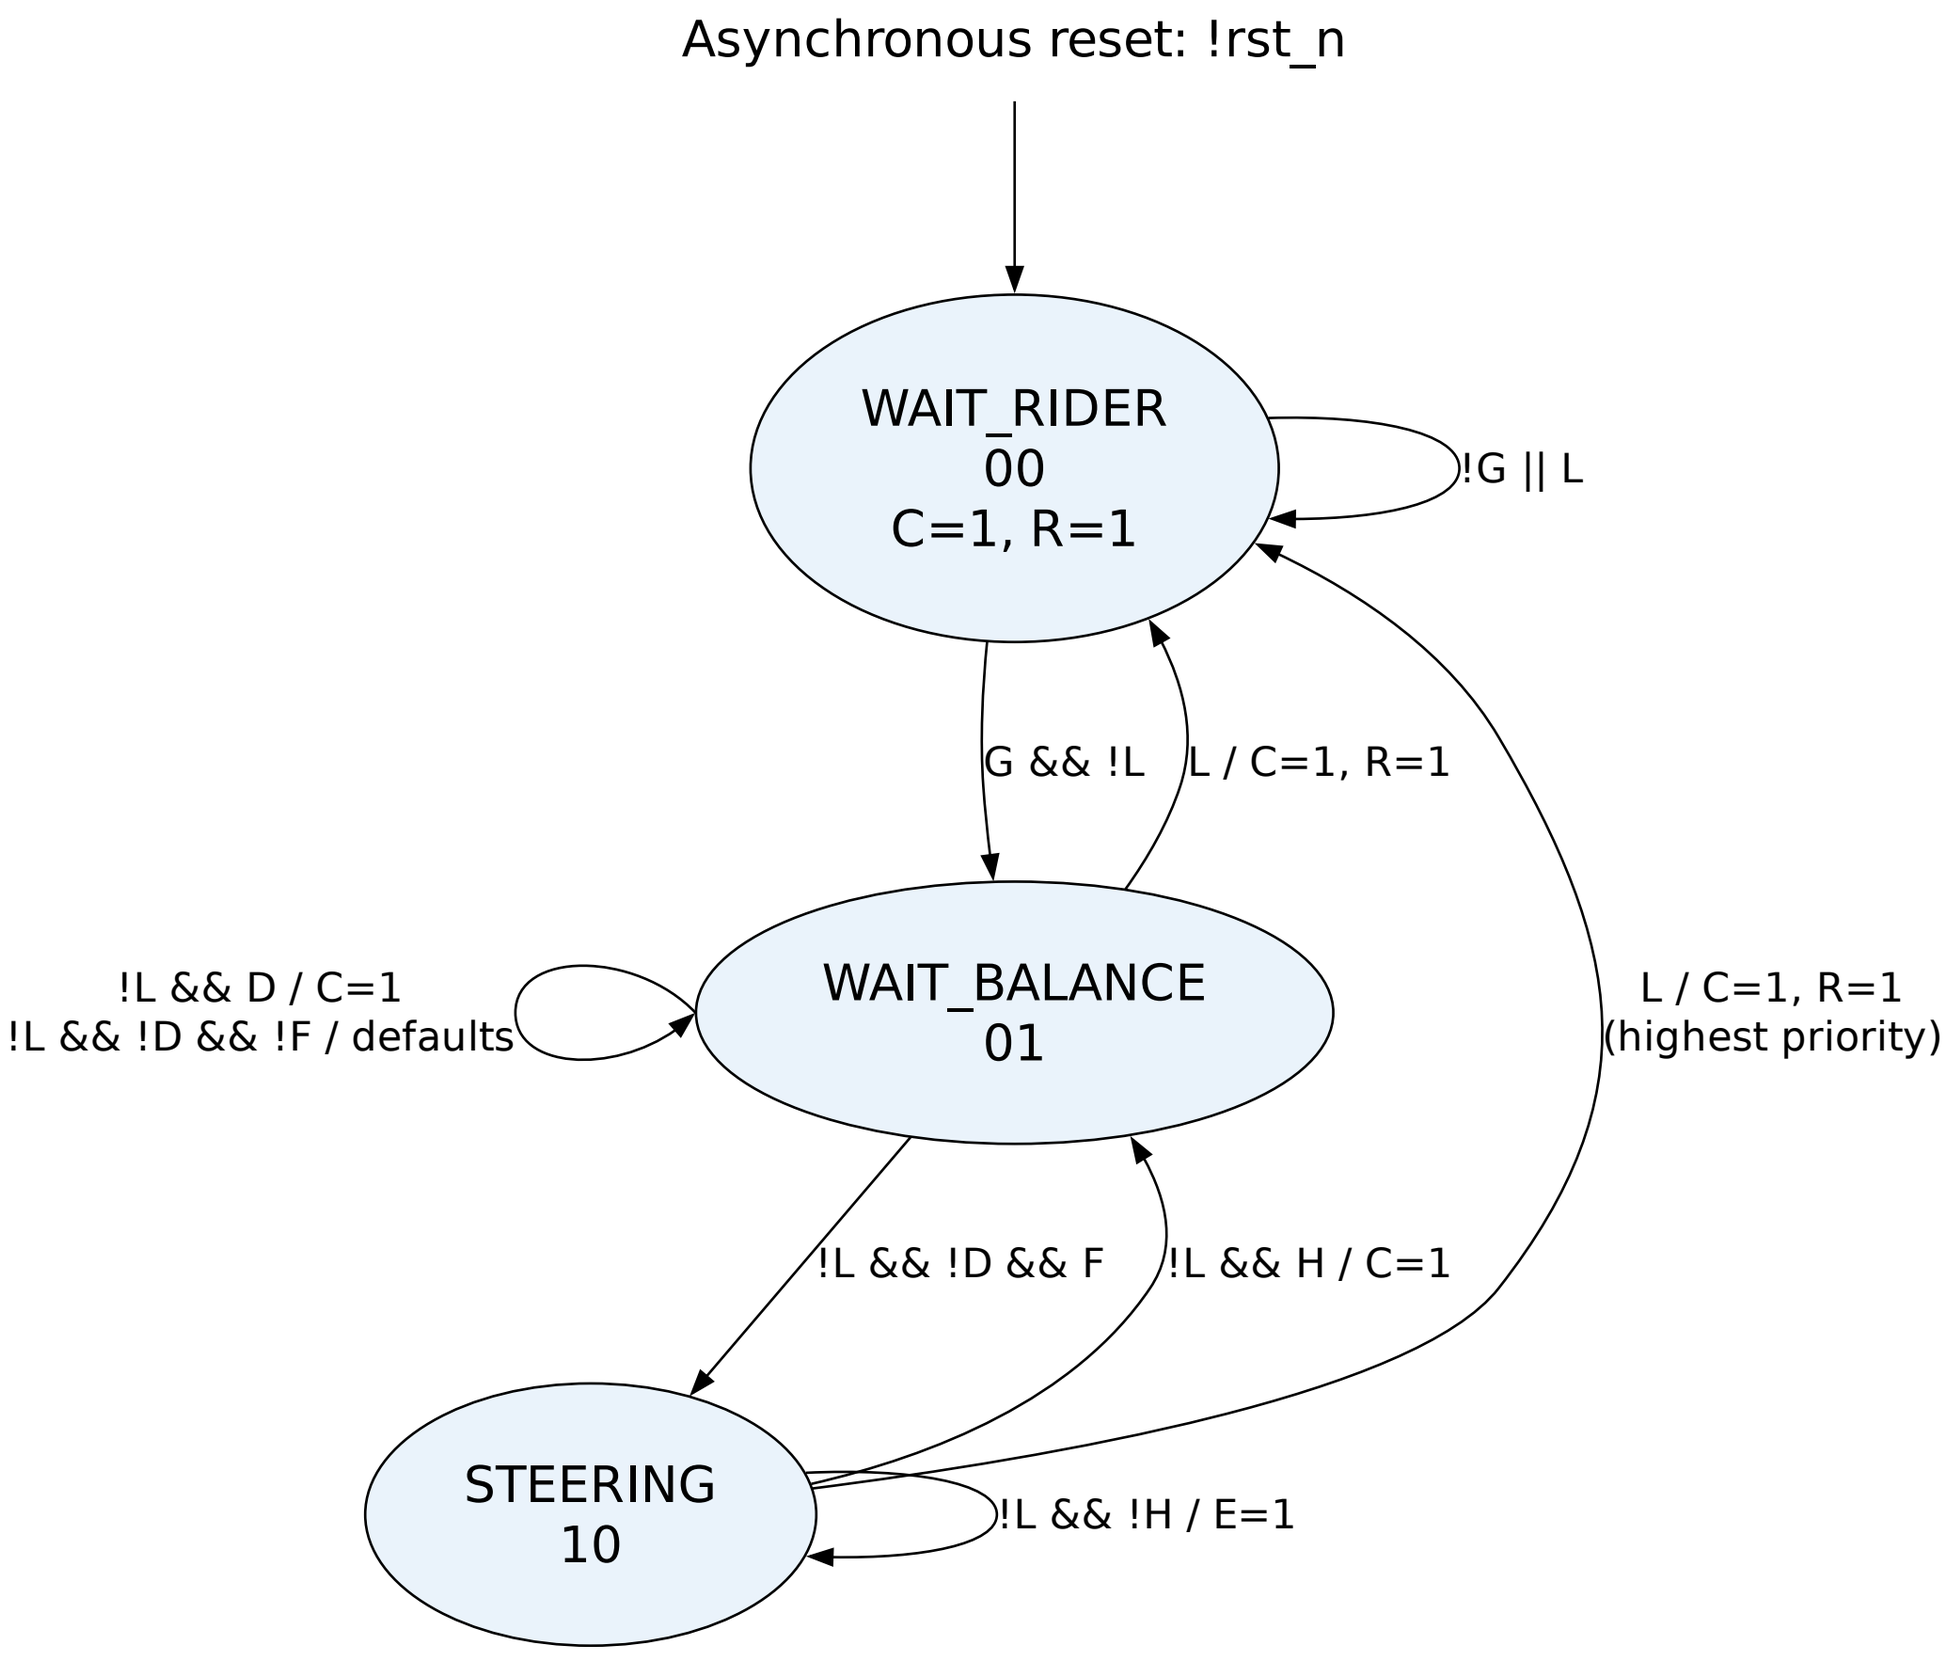

Inputs: G=sum_gt_min, L=sum_lt_min, D=diff_gt_1_4, H=diff_gt_15_16, F=tmr_full
Outputs: C=clr_tmr, E=en_steer, R=rider_off
G and L are hysteresis thresholds, not complements.
While waiting, imbalance D takes priority over timer expiration F.
Timer clears on every cycle with C=1; it must time a fresh 1.3 s of balance.
Illegal state 11: C=1, R=1, E=0, next state WAIT_RIDER.