


# **LIDAR Inspection Report of MNB ch.917+650**

**Bridge No:** MNB - 918/4

**Bridge Chainage:** 917+650 (CKRP)

**Latitude/Longitude:** 24.98031, 74.72372

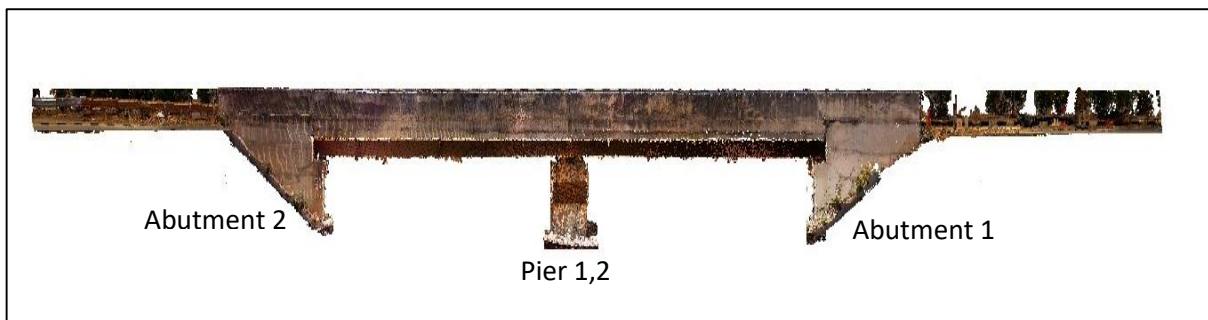


➤ **Bridge Details**

- **Bridge No:** 918/4
- **Chainage:** 917+650
- **Structure type:** MNB

➤ **Project Details**

- **CKRP:** Chittorgarh to kota
- **State:** Rajasthan NH 27
- **Zone:** RJ-06


## LiDAR View:

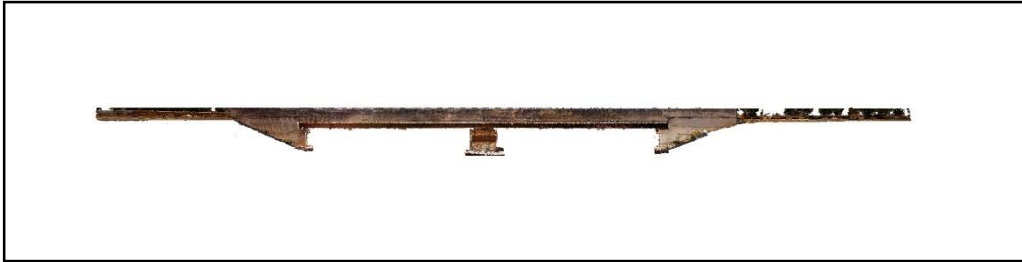


Side View



Top View

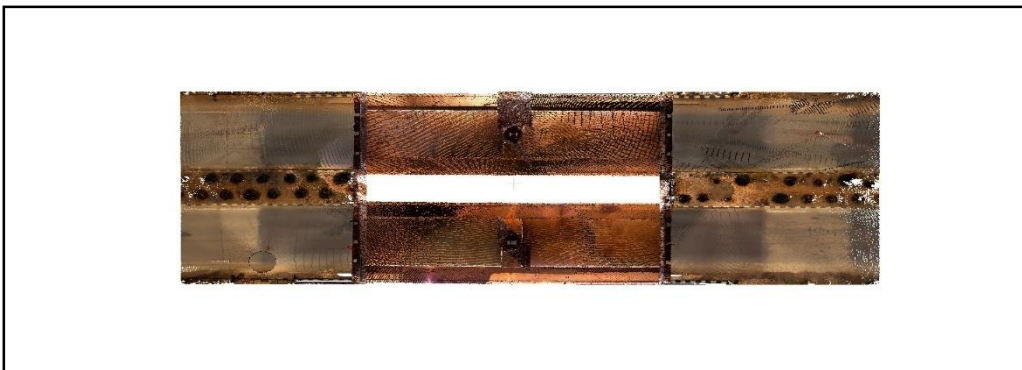

Bottom View

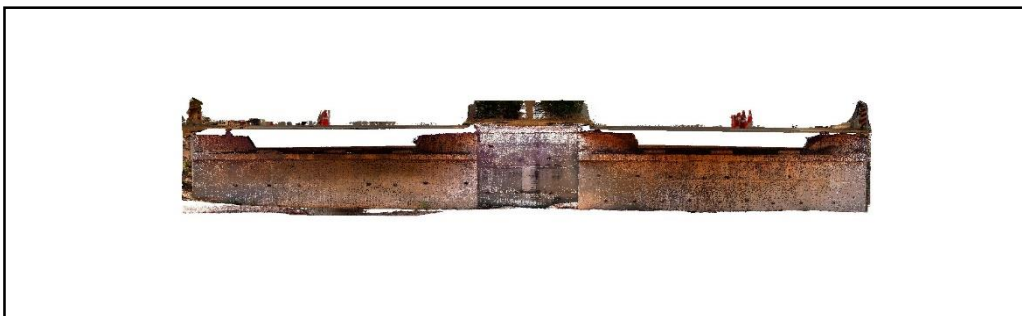

Front View

## Structural Measurements

### 1. Height

| Measurement                 | Value  |
|-----------------------------|--------|
| Ground level to Slab bottom | 3.30 m |
| Abutment bottom to Road     | 4.50 m |

### 2. Length

|     | Abutment to Abutment | Span 1  | Span 2  |
|-----|----------------------|---------|---------|
| LHS | 30.05 m              | 15.01 m | 15.04 m |
| RHS | 30.05 m              | 15.01 m | 15.04 m |

Deck Width (LHS): 97.4 m

Deck Width (RHS): 9.74 m

### 3. Width Between Piers to Abutment

| Measurement | Abutment 1 to Pier 1 | Pier 1 to Abutment 2 |
|-------------|----------------------|----------------------|
| Value       | 13.97 m              | 13.92 m              |

## Technical Scope of LiDAR Inspection

| Category                                      | Details                                                                                                                                                    |
|-----------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>1. Accuracy Setup and Scan Planning</b>    |                                                                                                                                                            |
| Equipment Deployed                            | <b>Trimble X9</b> – High-performance terrestrial laser scanner with automatic calibration, IP65-rated rugged build, and in-field registration capability   |
| Point Cloud Density                           | Configured for high-density capture with sub-centimeter resolution suitable for fine structural detailing                                                  |
| Measurement Accuracy                          | <b>±1 mm</b> at close range (<60 m); optimal for bridge spans, elevated members, and fascia with scan range up to <b>150 meters</b>                        |
| Coverage Strategy                             | Comprehensive planning to prioritize critical structural components including abutments, piers, bearings, and deck; ensured overlap to minimize occlusion  |
| <b>2. Field Setup and Scanning Approach</b>   |                                                                                                                                                            |
| Site Configuration                            | Multiple scan positions arranged for 360° coverage including underside views; referenced globally using <b>GNSS/RTK and Ground Control Points (GCPs)</b>   |
| Execution Environment                         | Scans executed during low-traffic, clear weather conditions to minimize external noise and vibration-related scan distortion                               |
| Safety Measures                               | Operational safety ensured by advance site clearance, barricading, and coordination with local authorities for traffic management                          |
| <b>3. Data Resolution and Quality Control</b> |                                                                                                                                                            |
| Resolution Application                        | Utilized Trimble X9's high-resolution scan settings for capturing large-span structures, vertical components, and minor surface irregularities             |
| Gap Management                                | Conducted supplementary scans from alternate angles; point cloud refinement and merging handled in <b>Trimble RealWorks</b> and <b>Trimble Perspective</b> |
| Data Validation                               | Outlier filtering and noise reduction applied; <b>registration error maintained &lt;5 mm RMSE</b> for consistent dimensional reliability                   |

## Equipment Specifications:

| Feature                      | Trimble X9                                      |
|------------------------------|-------------------------------------------------|
| Scan Speed                   | 1,000,000 pts/sec                               |
| Time to Complete a Full Scan | 4-6 minutes per setup (depending on resolution) |
| Point Cloud Accuracy         | ±3 mm at 20m                                    |
| Maximum Scanning Range       | 150m                                            |
| Field Workflow               | Auto-calibration                                |
| Imaging                      | Standard HDR                                    |
| Durability                   | IP55                                            |


## Table of Content

| <b>Sr. No.</b> | <b>Description</b>              | <b>Page No.</b> |
|----------------|---------------------------------|-----------------|
| 0.             | Phase 1 – Scope of Deliverables | 7               |
| 1.             | Structure Layout                | 8               |
| 2.             | Layout Legends                  | 9               |
| 3.             | Distress Nomenclature           | 10              |
| 4.             | Observation Sheet               | 10              |
| 5.             | Photos                          | 15              |

## 0. Phase 1 – Scope of Deliverables

| Work Stage                     | Scope / Deliverables                                                     | Location in Report                          |
|--------------------------------|--------------------------------------------------------------------------|---------------------------------------------|
| Accuracy Setup & Scan Planning | Specification of accuracy levels, point cloud density, and scan coverage | Technical Scope of LiDAR Inspection         |
| Technical Setup                | Preparation for LiDAR equipment deployment                               | Technical Scope of LiDAR Inspection         |
| Objective Framing              | Component prioritization for scanning                                    | Structural Measurements + Observation Sheet |
| Field Data Collection          | LiDAR data acquisition                                                   | Structure Layout + Photos                   |
| Resolution Analysis            | Data density and resolution analysis                                     | Technical Scope of LiDAR Inspection         |
| Gap Filling                    | Quality enhancement of point cloud                                       | Embedded in Visual/Photo Section            |
| Point Cloud Analysis           | Structural details and interpretation                                    | Observation Sheet + Distress Photos         |

## 1. Structure Layout

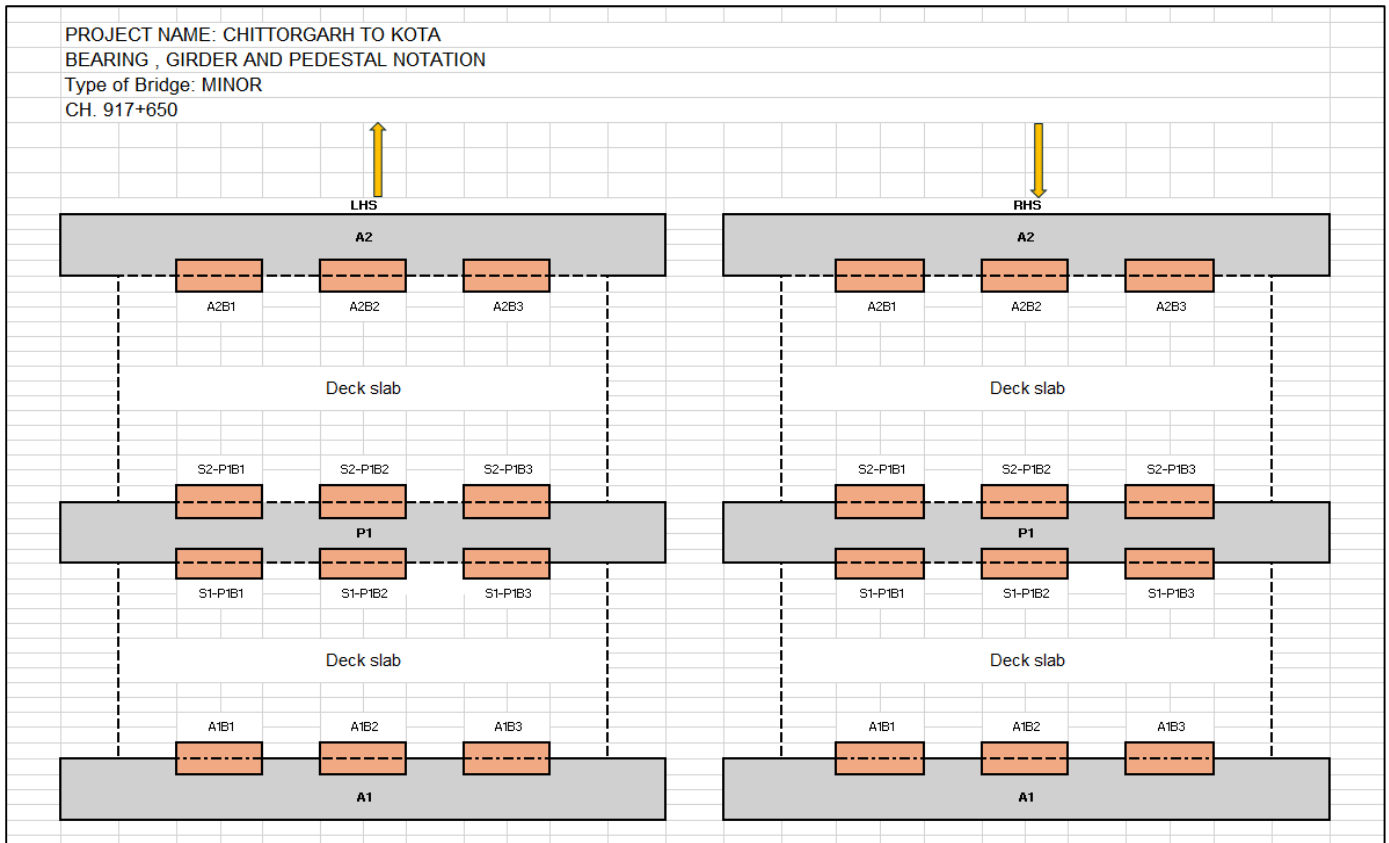

## 2. Layout Legends

| S. No | Description               | Notation |
|-------|---------------------------|----------|
| 1     | Abutment                  | AB       |
| 2     | Foundation of Abutment    | AF       |
| 3     | Abutment Cap              | AC       |
| 4     | Bearing Pedestal          | BP       |
| 5     | Bearings                  | BR       |
| 6     | Foundation of Pier        | PF       |
| 7     | Pier                      | PR       |
| 8     | Pier Cap                  | PC       |
| 9     | Span                      | SP       |
| 10    | Slab span                 | SL       |
| 11    | Box Girder span           | BG       |
| 12    | I Girder                  | IG       |
| 13    | Rectangular Girder        | RG       |
| 14    | Square Girder             | SG       |
| 15    | T Beam Girders            | TB       |
| 16    | Concrete Deck             | CC       |
| 17    | Bituminous Deck           | BD       |
| 18    | Slab b/n girders          | BS       |
| 19    | Cross Girders             | CG       |
| 20    | Railing LHS               | RL       |
| 21    | Railing RHS               | RR       |
| 22    | Footpath LHS              | FL       |
| 23    | Footpath RHS              | RR       |
| 24    | Expansion Joints          | EJ       |
| 25    | Pourable/Crack Joint Seal | PJ       |
| 26    | Compression Joint Seal    | CJ       |
| 27    | Assembly Joint Seal       | AJ       |
| 28    | Strip Seal Joint          | SJ       |
| 29    | Drainage Spouts           | DS       |
| 30    | Wing Wall                 | WW       |
| 31    | Reinforced earth wall     | RE       |
| 32    | Approach Slab             | AS       |

### 3. Distress Nomenclature

| Legend | Description                               | Legend    | Description         |
|--------|-------------------------------------------|-----------|---------------------|
| BG     | Bulging                                   | SC        | Steel Corroded      |
| CRA    | Map Crack/ Crazing                        | SE        | Steel Exposed       |
| RC     | Crack along main reinforcement            | SPE       | Seepage Evident     |
| RP     | Crack perpendicular to Main Reinforcement | SPM       | Seepage Marks       |
|        |                                           | SL        | Scaling             |
| MC     | Minor Crack                               | SG/(G)(S) | Sag in Girder, Slab |
| WC     | Wide Crack                                | EFF       | Efflorescence       |
| SPL    | Spalling                                  | STL       | Settlement          |
| DL     | Delaminated Section                       | H         | Hollow Section      |
| HC     | Honey Combing                             | VEG       | Vegetation Growth   |
| TL     | Tilt                                      | PD        | Pedestal Damage     |

## 4. Observations

**LHS:**

| Element Name | Observation | Location of Distress | Photo No. | Units | Distress Details |      |      | Area of Repair (Sq./RM T/m3) |
|--------------|-------------|----------------------|-----------|-------|------------------|------|------|------------------------------|
|              |             |                      |           |       | L(M)             | B(M) | D(M) |                              |
| Abutment 1   | Damage      |                      | 1         |       | 1.04             | 1.74 |      | 1.809                        |

**RHS:**

| Element Name | Observation    | Location of Distress | Photo No. | Units | Distress Details |      |       | Area of Repair (Sq./RM T/m3) |
|--------------|----------------|----------------------|-----------|-------|------------------|------|-------|------------------------------|
|              |                |                      |           |       | L(M)             | B(M) | D(M)  |                              |
| Abutment 2   | Damage         |                      | 2         |       | 0.30             | 0.20 |       | 0.06                         |
| Abutment 2   | Scaling        |                      | 3         |       | 1.01             | 0.58 |       | 0.585                        |
| Pier 1       | Hollow section |                      | 4         |       | 0.66             | 0.05 | 0.041 | 0.0013                       |
| Abutment 1   | Damage         |                      | 5         |       | 2.04             | 0.32 |       | 0.652                        |



## Observation sheet Non- Structural Elements

| Sl. No. | Description                           | Distress Notation | Observation | Location |       | Distress Details |       |       | Area of Repair |
|---------|---------------------------------------|-------------------|-------------|----------|-------|------------------|-------|-------|----------------|
|         |                                       |                   |             | X (m)    | Y (m) | L (m)            | W (m) | D (m) | Sqm            |
| 1       | Return wall                           |                   | OK          |          |       |                  |       |       |                |
| 2       | Riding return wall                    |                   | NA          |          |       |                  |       |       |                |
| 3       | Wing wall                             |                   | NA          |          |       |                  |       |       |                |
| 4       | Butterfly walls at top of median wall |                   | NA          |          |       |                  |       |       |                |
| 5       | Dirt wall at top of abutment          |                   | Ok          |          |       |                  |       |       |                |
| 6       | Gabion walls                          |                   | NA          |          |       |                  |       |       |                |
| 7       | Hazard Marker sign board              |                   | OK          |          |       |                  |       |       |                |
| 8       | Hand railing                          |                   | NA          |          |       |                  |       |       |                |
| 9       | Crash barrier                         |                   | OK          |          |       |                  |       |       |                |
| 10      | Median wall                           |                   | NA          |          |       |                  |       |       |                |
| 11      | Pipe Hand Railing (on crash Barrier)  |                   | OK          |          |       |                  |       |       |                |
| 12      | Cleaning of expansion joints          |                   | OK          |          |       |                  |       |       |                |
| 13      | Wheel guard (Mounted & Unmounted)     |                   | NA          |          |       |                  |       |       |                |
| 14      | Footpath                              |                   | OK          |          |       |                  |       |       |                |
| 15      | Drainage Spouts                       |                   | Choked      |          |       |                  |       |       |                |
| 16      | Drainage Spout Grating                |                   | Choked      |          |       |                  |       |       |                |
| 17      | Drainage Spout Extension Pipe         |                   | OK          |          |       |                  |       |       |                |
| 18      | Weep Holes                            |                   | NA          |          |       |                  |       |       |                |
| 19      | Fascia Panel                          |                   | NA          |          |       |                  |       |       |                |



| Sl. No. | Description                      | Distress Notation | Observation | Location |       | Distress Details |       |       | Area of Repair |
|---------|----------------------------------|-------------------|-------------|----------|-------|------------------|-------|-------|----------------|
|         |                                  |                   |             | X (m)    | Y (m) | L (m)            | W (m) | D (m) | Sqm            |
| 20      | Friction Slab                    |                   | Ok          |          |       |                  |       |       |                |
| 21      | Approach slab including PCC      |                   | OK          |          |       |                  |       |       |                |
| 22      | Backfilling below Approach slab  |                   | OK          |          |       |                  |       |       |                |
| 23      | Stone Pitching in quarter coning |                   | NA          |          |       |                  |       |       |                |
| 24      | Filling in quarter coning        |                   | NA          |          |       |                  |       |       |                |
| 25      | Rigid apron                      |                   | NA          |          |       |                  |       |       |                |
| 26      | Curtain wall                     |                   | NA          |          |       |                  |       |       |                |
| 27      | Flexible apron                   |                   | NA          |          |       |                  |       |       |                |
| 28      | Vent clearance                   |                   | NA          |          |       |                  |       |       |                |
| 29      | Toe wall of Quarter coning       |                   | NA          |          |       |                  |       |       |                |
| 30      | RCC drains in tunnel             |                   | NA          |          |       |                  |       |       |                |
| 31      | Cover slab of RCC drains         |                   | NA          |          |       |                  |       |       |                |
| 32      | RCC portal of tunnel             |                   | NA          |          |       |                  |       |       |                |
| 33      | Counter fort wall                |                   | NA          |          |       |                  |       |       |                |
| 34      | Booths structure                 |                   | NA          |          |       |                  |       |       |                |
| 35      | RCC Booth guard                  |                   | NA          |          |       |                  |       |       |                |
| 36      | C.C Panels including PCC         |                   | NA          |          |       |                  |       |       |                |
| 37      | Pipe drain                       |                   | NA          |          |       |                  |       |       |                |
| 38      | Pipe drain cover                 |                   | NA          |          |       |                  |       |       |                |
| 39      | Drain openings                   |                   | NA          |          |       |                  |       |       |                |

## **CH: 917+650 – MNB**




**DISTRESS PHOTOS**

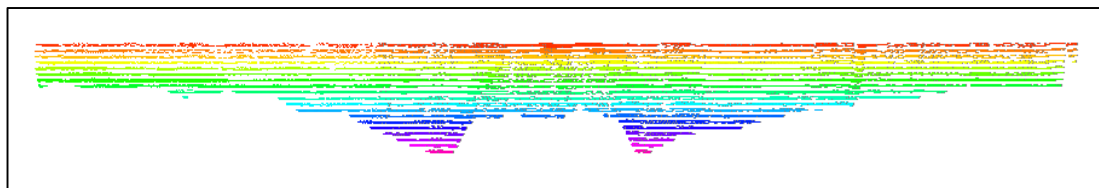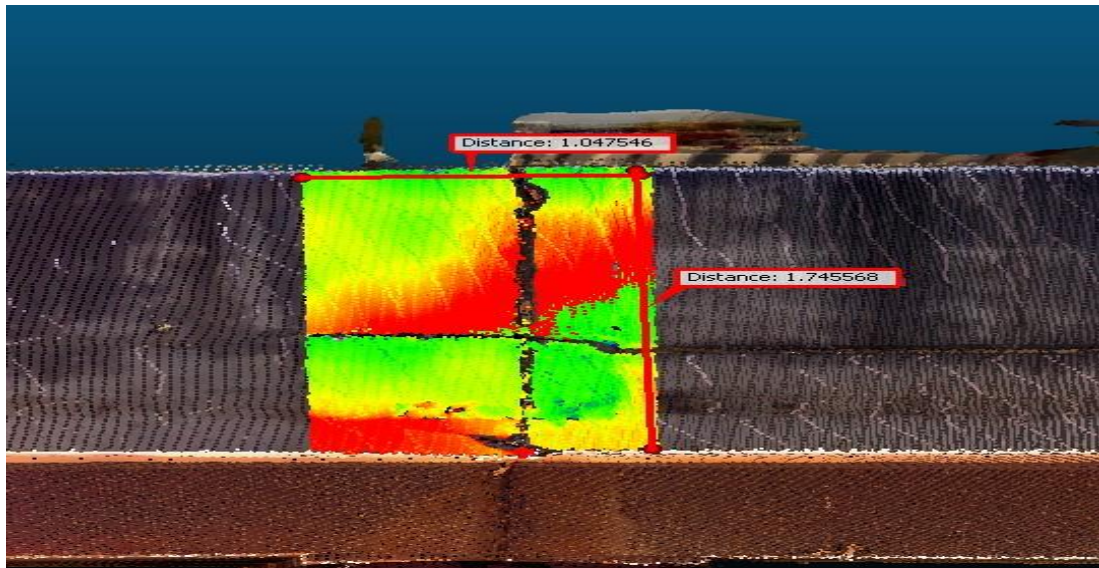



**1. Steel exposed observed at Abutment 1 to Pear 1 span near expansion joint, measuring 1.04 m in length and 1.74 m in width, covering an area of 1.809 m<sup>2</sup>.**

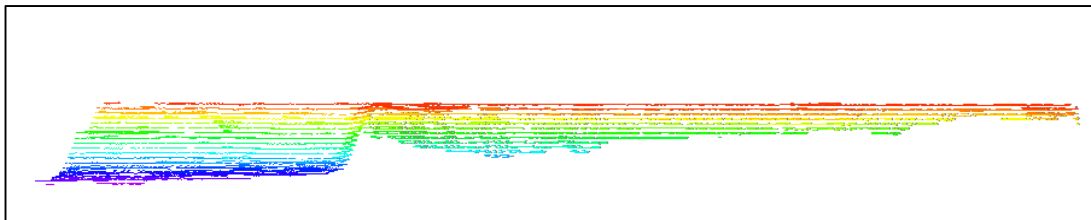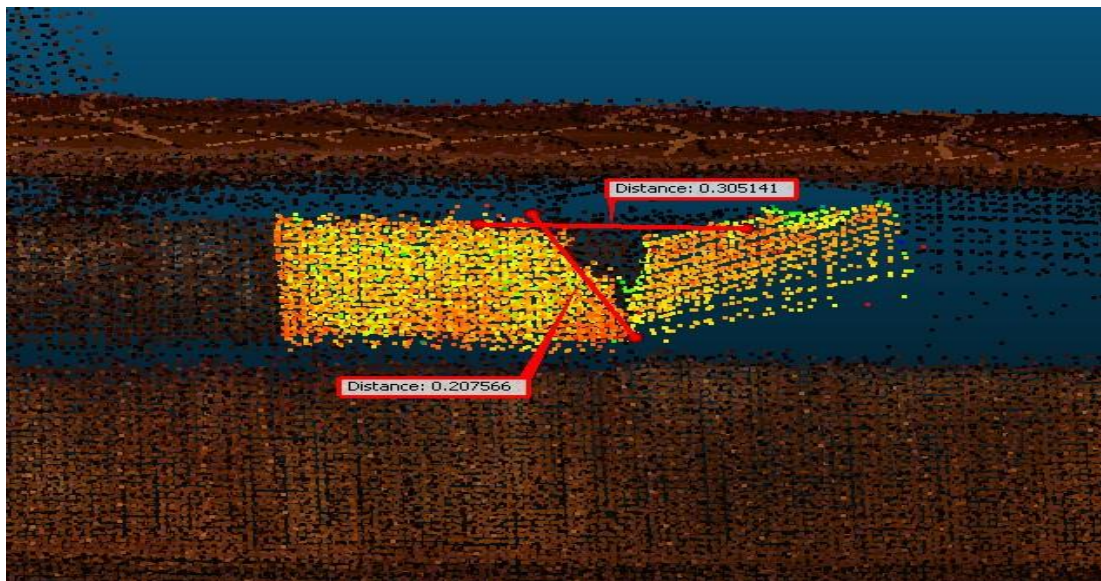



2. Damage is observed at A2 RHS Bearing 1 , measuring 0.30 m in length and 0.20 m in width, covering an area of 0.06 m<sup>2</sup>.

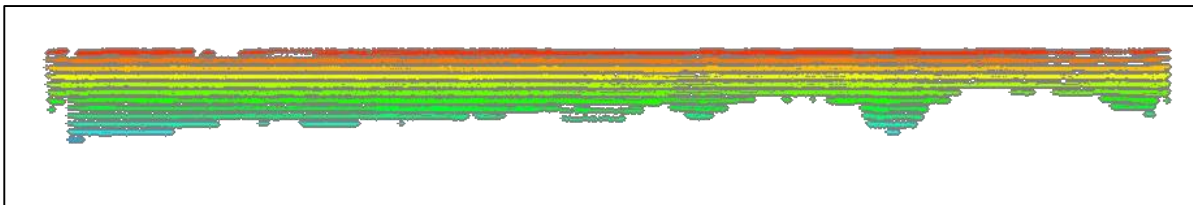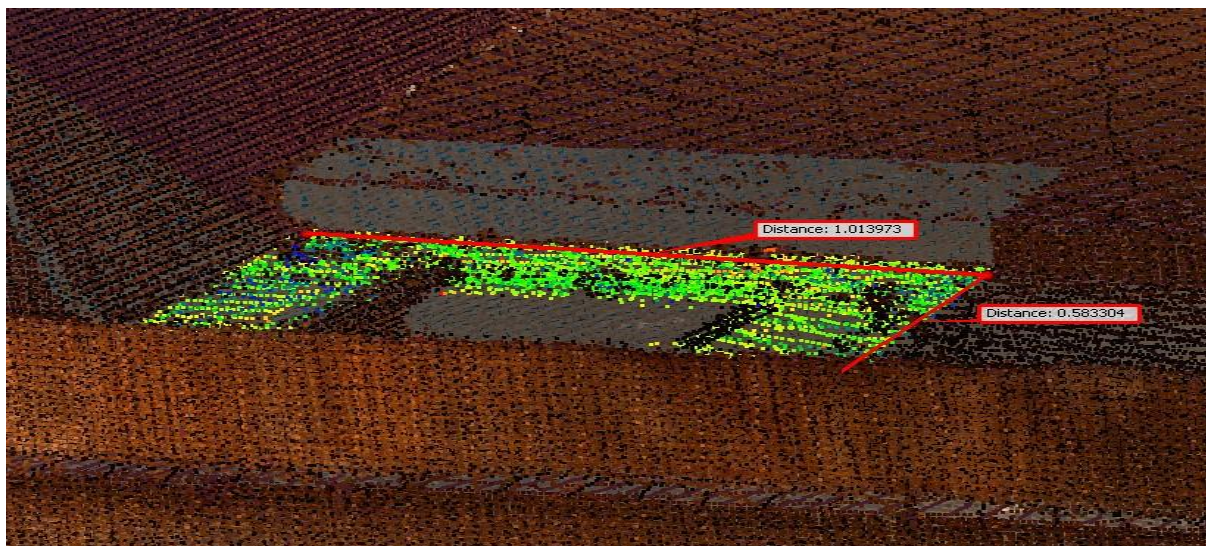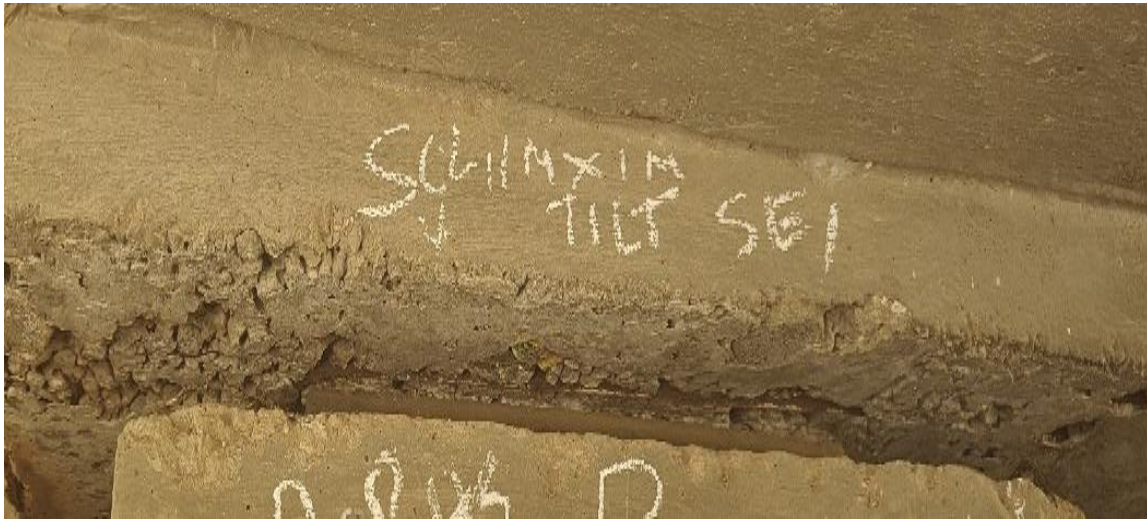

- 3. Scaling is observed at Abutment 2 RHS Bearing 1 , measuring 1.01 m in length and 0.58 m in width, covering an area of 0.585 m<sup>2</sup>.**

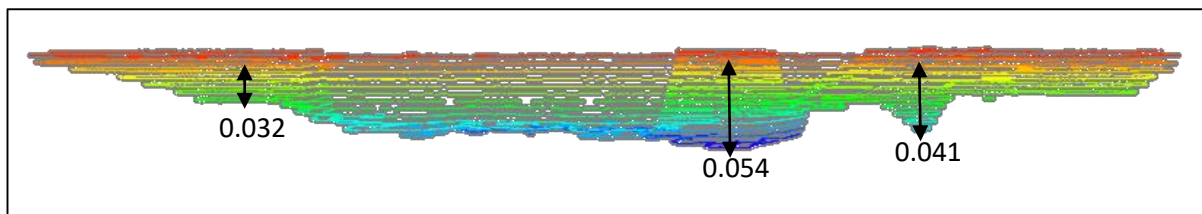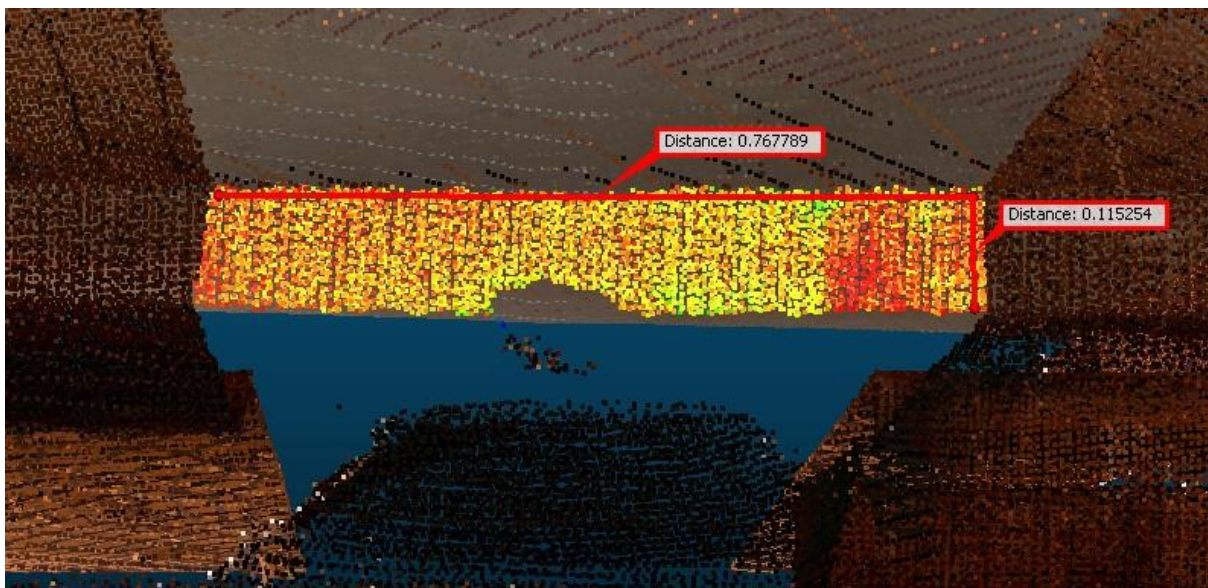

**4. Hollow section observed on A2 (LHS), measuring 0.76 m in length and 0.11 m in width. Depth ranges from 0.032 m (min) to 0.054 m (max), with an average depth of 0.08 m. The calculated volume of the distress is 0.0013 m<sup>3</sup>.**

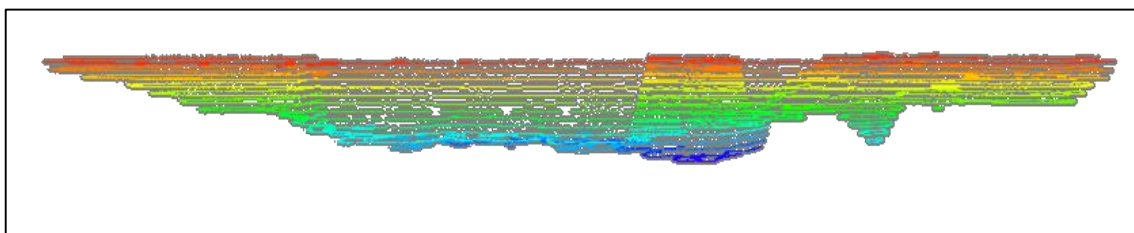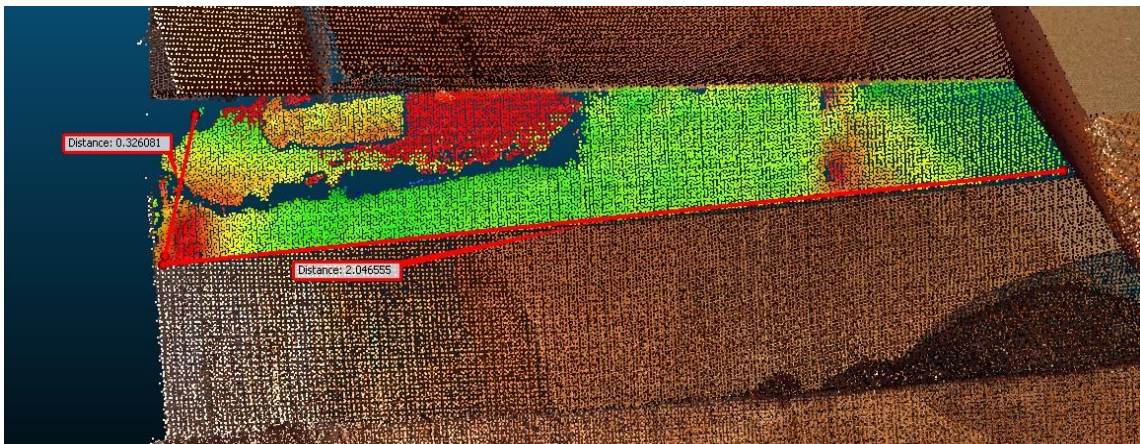

- 5. Damage is observed at Abutment 1 RHS dirt wall, measuring 2.04 m in length and 0.32 m in width, covering an area of 0.652 m<sup>2</sup>.**