


## **Keyestudio 4wd tb6612 Motor Driver Shield**

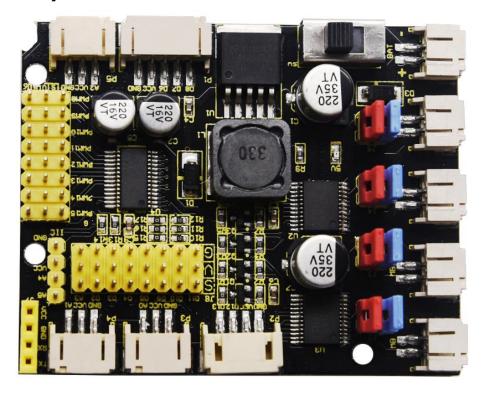

### **Description**

When DIY smart car, the motor driver board is required. We particularly design this driver board compatible UNO R3 control board.

It is powerful and has following features:

- 1. Design in stacked style, only need to stack on UNO R3 control board which save space and facilitate to connect.
- 2.The two TB6612FNG chips on driver board can drive motor to rotate and 4 DC motors as well, which is convenient.
- 3. It comes with a PCA9685 chip(IIC address:0x47) which can output 16 channel PWM output, 8 of which is intend for controlling rotation speed and direction of 4 motors, the another 8 PWM output is led to by 3pin head of 2.54mm pitch and

control other devices like servo motor.

4. Driver board expands D11/D10/D9/D5/D4/D3/D2/A3 pins of UNO R3 control

board into 3pin head of 2.54mm pitch, leads to I2C communication port by 4pin

head and serial communication port by 4pin female header, which facilitate to link

with Bluetooth module.

5. Driver board comes with 5 PH2.0mm-2P anti-reverse interfaces for external

power and 4 motors; 3 PH2.0mm-3P, 1 PH2.0mm-4P and 1 PH2.0mm-5P

interfaces for connecting to sensors/ modules.

4. Power supply IC is LM2596S-5.0, with massive loading capacity, maximum

current can reach 3A and drive multiple servos.

5. The built-in DIP switch on driver board enhances to control external supply.

8. 8 jumper caps of driver board decide the rotation direction of motor. For

instance, when 2 jumper caps of MA motor is connected in vertical way instead of

horizontal way, its rotation direction is opposite.

9. Driver board can drive DC motor up to 12v. The voltage of drive motor is set

by external power supply and test code. For example, when the external supply is

DC 12V, set the PWM to maximum value and the corresponding driving voltage is

12 V.

**Parameters:** 

Working voltage: DC 8-12V

Drive current: up to 3A

2



Maximum power: 10W

Working temperature: -20 °C  $\sim$  + 60 °C


White interface type: PH2.0 (-2P -3P -4P -5P)

Pin header / female spacing: 2.54mm

Size: 68.7mm \* 55mm


Environmental protection attributes: ROHS

## **Pin Description:**

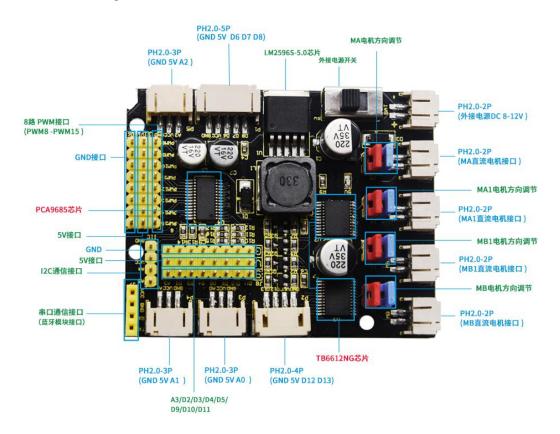

# **Connection Diagram**



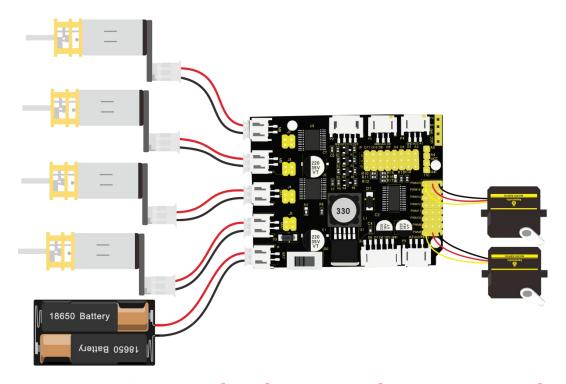

Note: PWM8-PWM15 is only connected to 2 servos on above diagram, in the code , PWM8-PWM15 controls 8 servos to test.

Adjust rotation	Adjust rotation speed	Status
direction		
pwm.setPWM(0,0,4	pwm.setPWM(1,0,10	MB motor turns
095)	24)	clockwise
pwm.setPWM(0,0,0)	pwm.setPWM(1,0,20	MB motor turns
	48)	counterclockwise
pwm.setPWM(2,0,4	pwm.setPWM(3,0,10	MB1 motor turns
095)	24)	clockwise
pwm.setPWM(2,0,0)	pwm.setPWM(3,0,20	MB1 motor turns



	48)	counterclockwise
pwm.setPWM(4,0,4	pwm.setPWM(5,0,10	MA1 motor turns
095)	24)	clockwise
pwm.setPWM(4,0,0)	pwm.setPWM(5,0,20	MA1 motor turns
	48)	counterclockwise
pwm.setPWM(6,0,4	pwm.setPWM(7,0,10	MA motor turns
095)	24)	clockwise
pwm.setPWM(6,0,0)	pwm.setPWM(7,0,20	MA motor turns
	48)	counterclockwise

### **Test Code**

Note: 1. attention data setting when adjusting speed, for instance, when external supply is DC 8V, if the maximum drive voltage of drive motor is 5V, set the maximum value of PWM to 4096\*5/8=2560. The value can't exceed 2560, otherwise external motor will damage.

2. Before uploading test code, need to place library file in the directory of compiler installation, otherwise fail to compile, such as: C:\Program Files\Arduino\libraries

#include <Wire.h>

#include <Adafruit\_PWMServoDriver.h>

```
Adafruit_PWMServoDriver pwm = Adafruit_PWMServoDriver(0x47);
int value;
void setup()
{
  pwm.begin();
  pwm.setPWMFreq(60);
 }
 void servo_1(int servopin,int myangle)
 {
   value=map(myangle,0,180,102,512);
   pwm.setPWM(servopin,0,value);
  }
 void servo_2()
 {
  for(int a=8;a<=15;a++)
  {
  servo_1(a,0);//cite pulse function
  delay(300);
  servo_1(a,180);//cite pulse function
  delay(300);
  }
```

```
}
void motor()
{
   pwm.setPWM(0,0,4095);
   pwm.setPWM(1,0,1024);
   pwm.setPWM(2,0,4095);
   pwm.setPWM(3,0,1024);
   pwm.setPWM(4,0,4095);
   pwm.setPWM(5,0,1024);
   pwm.setPWM(6,0,4095);
   pwm.setPWM(7,0,1024);
   delay(5000);
   pwm.setPWM(0,0,0);
   pwm.setPWM(1,0,2048);
   pwm.setPWM(2,0,0);
   pwm.setPWM(3,0,2048);
   pwm.setPWM(4,0,0);
   pwm.setPWM(5,0,2048);
   pwm.setPWM(6,0,0);
   pwm.setPWM(7,0,2048);
   delay(5000);
   pwm.setPWM(1,0,0);
```



```
pwm.setPWM(3,0,0);
pwm.setPWM(5,0,0);
pwm.setPWM(7,0,0);

}

void loop()
{
    motor();
    servo_2();
}
```

### **Test Result**

Upload test code on UNO R3 control board, wire according to connection diagram and power on. When DIP switch of driver board is dialed to BAT end, the external 4 motors rotate clockwise for 5s, counterclockwise for 5s and stops; moreover, 8 external servos rotate to 0  $^{\circ}$  then 180  $^{\circ}$ , and loop the previous action alternately.

#### Resource

https://fs.keyestudio.com/KS0489