

Sheetname: CPU

CPU MC68000
CLOCK 16MHZ
DATA AND ADDRESS BUFFERS
HALT AND RESET
DTACK GLUE LOGIC
INTERRUPT

Sheetname: MEMORY

ROM 16kBytes
RAM 1MBytes

Sheetname: FOUR UARTS

TG16C554
4 UARTS.

File: fourUarts.kicad_sch

Sheetname: cpuNoBuffer


CPU MC68000
CLOCK 16MHZ
HALT AND RESET
DTACK GLUE LOGIC
INTERRUPT


File: cpuNoBuffer.kicad_sch

UART CONTROL




File: uart_control.kicad_sch

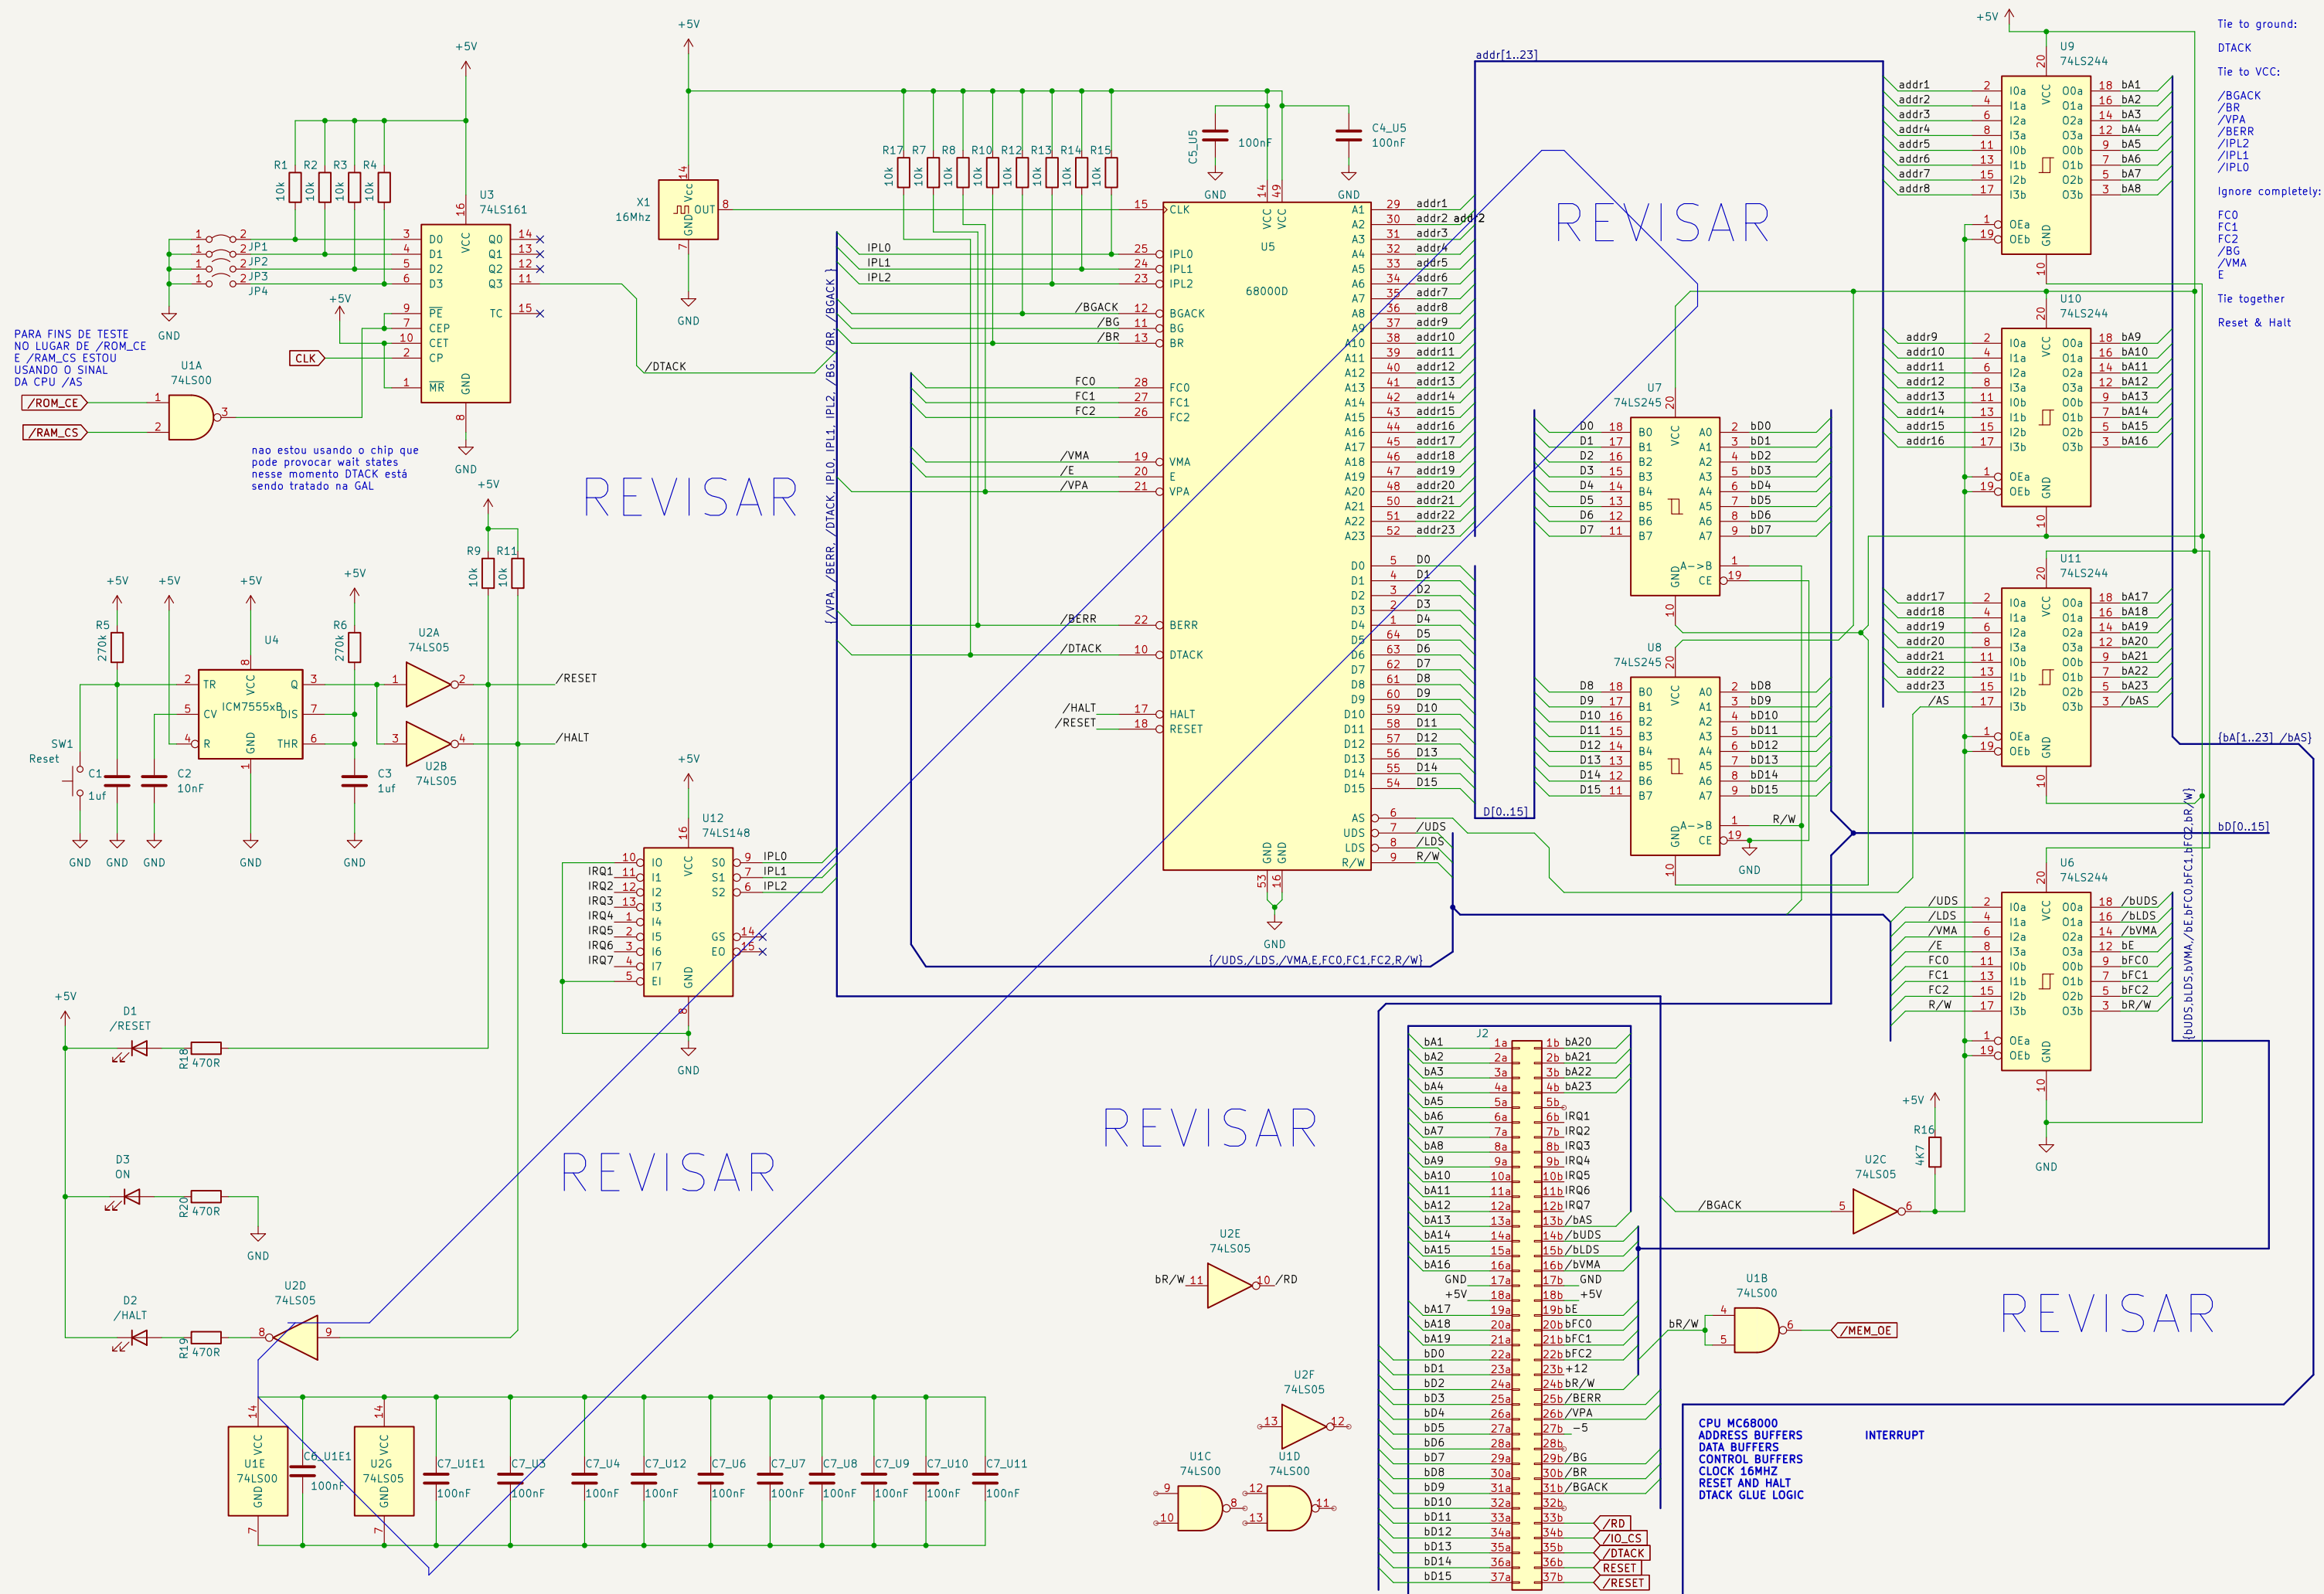


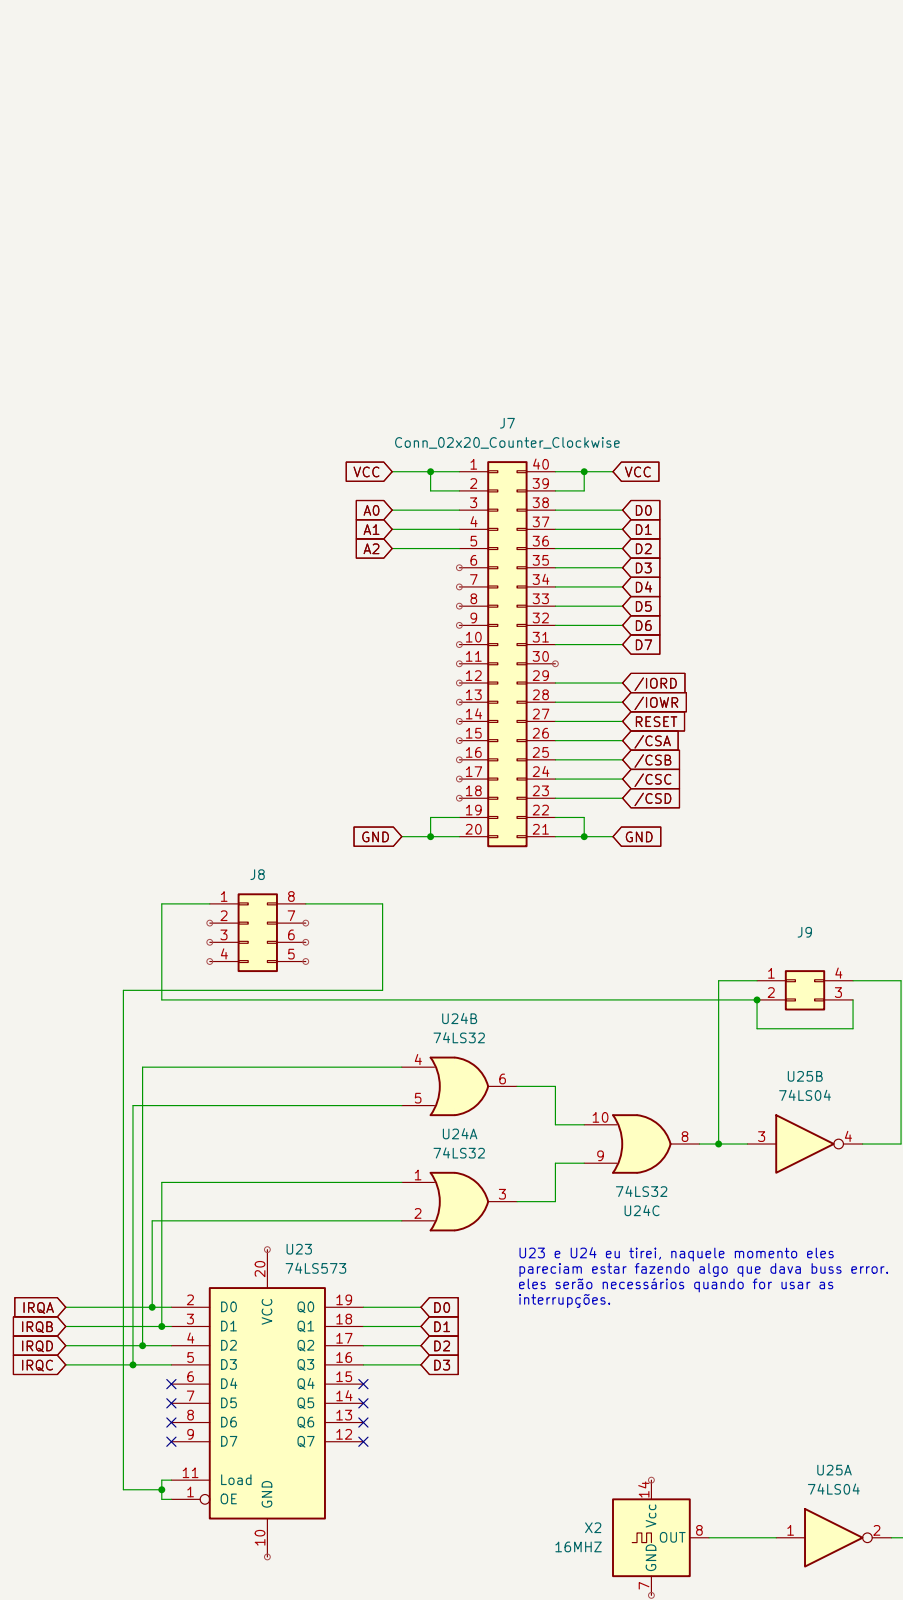

U23 e U24 eu tirei, naquele momento eles pareciam estar fazendo algo que dava buss error, eles serão necessários quando for usar as interrupções.

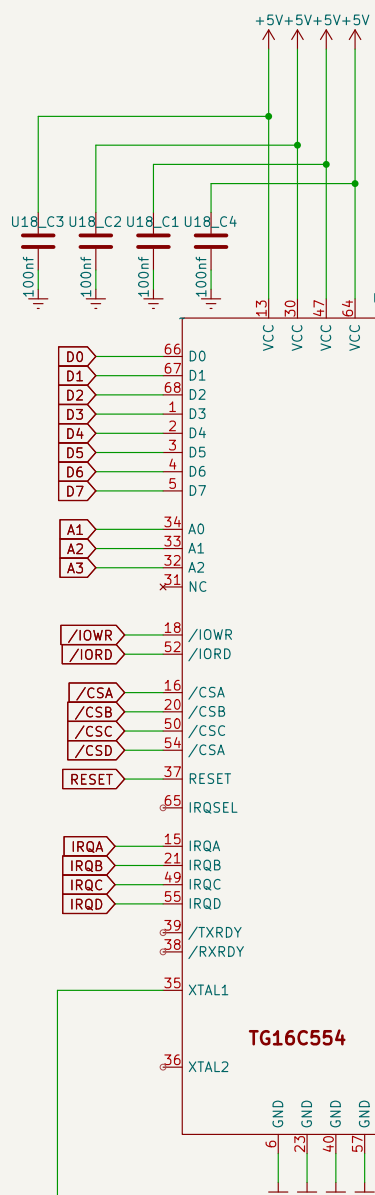


TG16C554

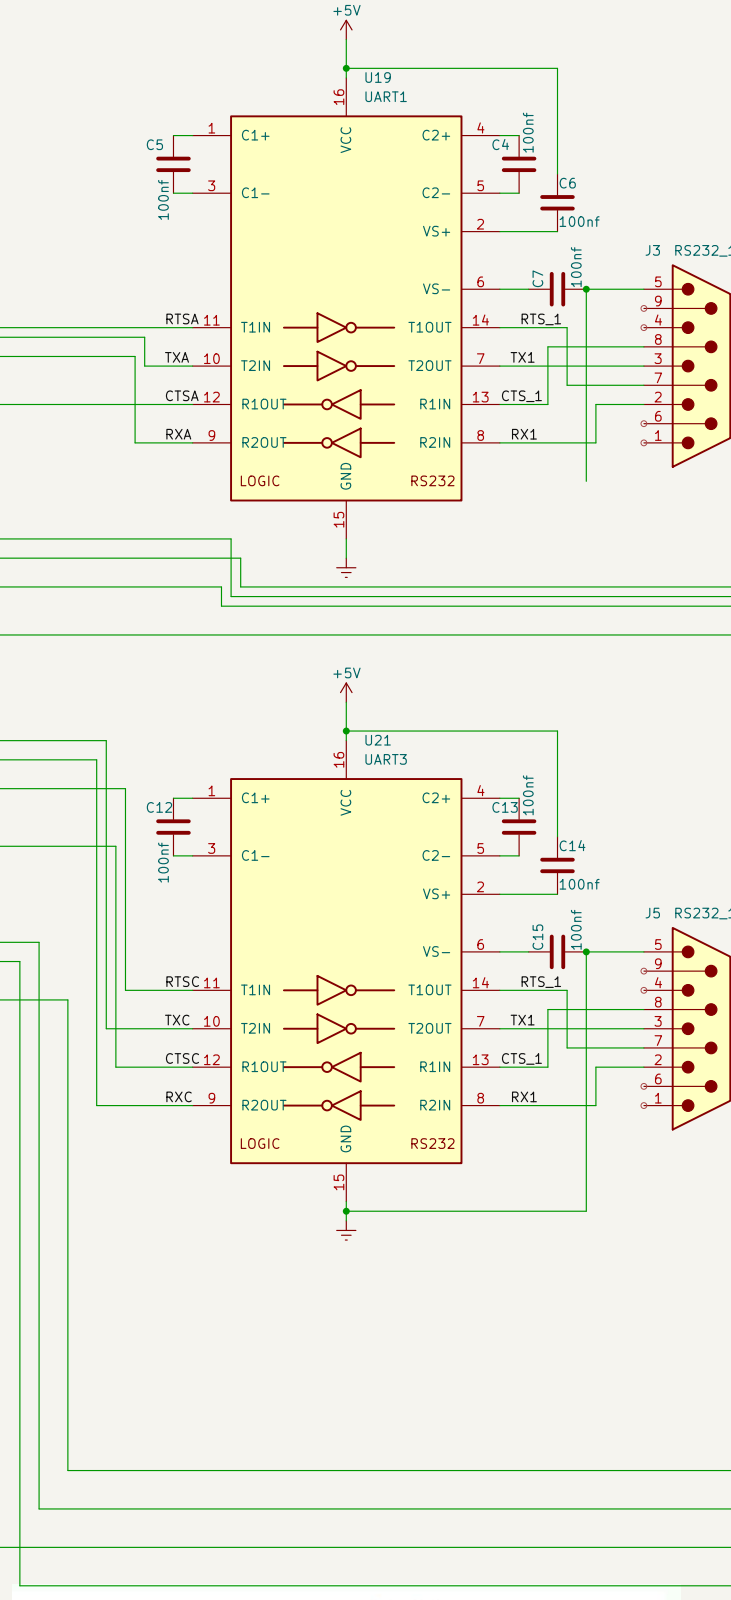


RS232 Pin Out

Connector:
D-Sub Male 9 pins

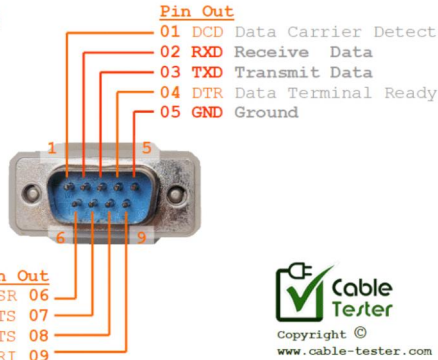

Cable Tester
Copyright ©
www.cable-tester.com

- 0 - por o soquete do ci intrq
- 1 - por todos os capacitores 100nf
- 2 - por todos os terras
- 3 - por todos os vccs
- 4 - por todos os pullups com opção de pulldown
- 5 - por o oscilador
- 6 - por o ci intrq
- 7 - ligar o clock
- 8 - ligar a cpu ao halt reset
- 9 - ligar os leds

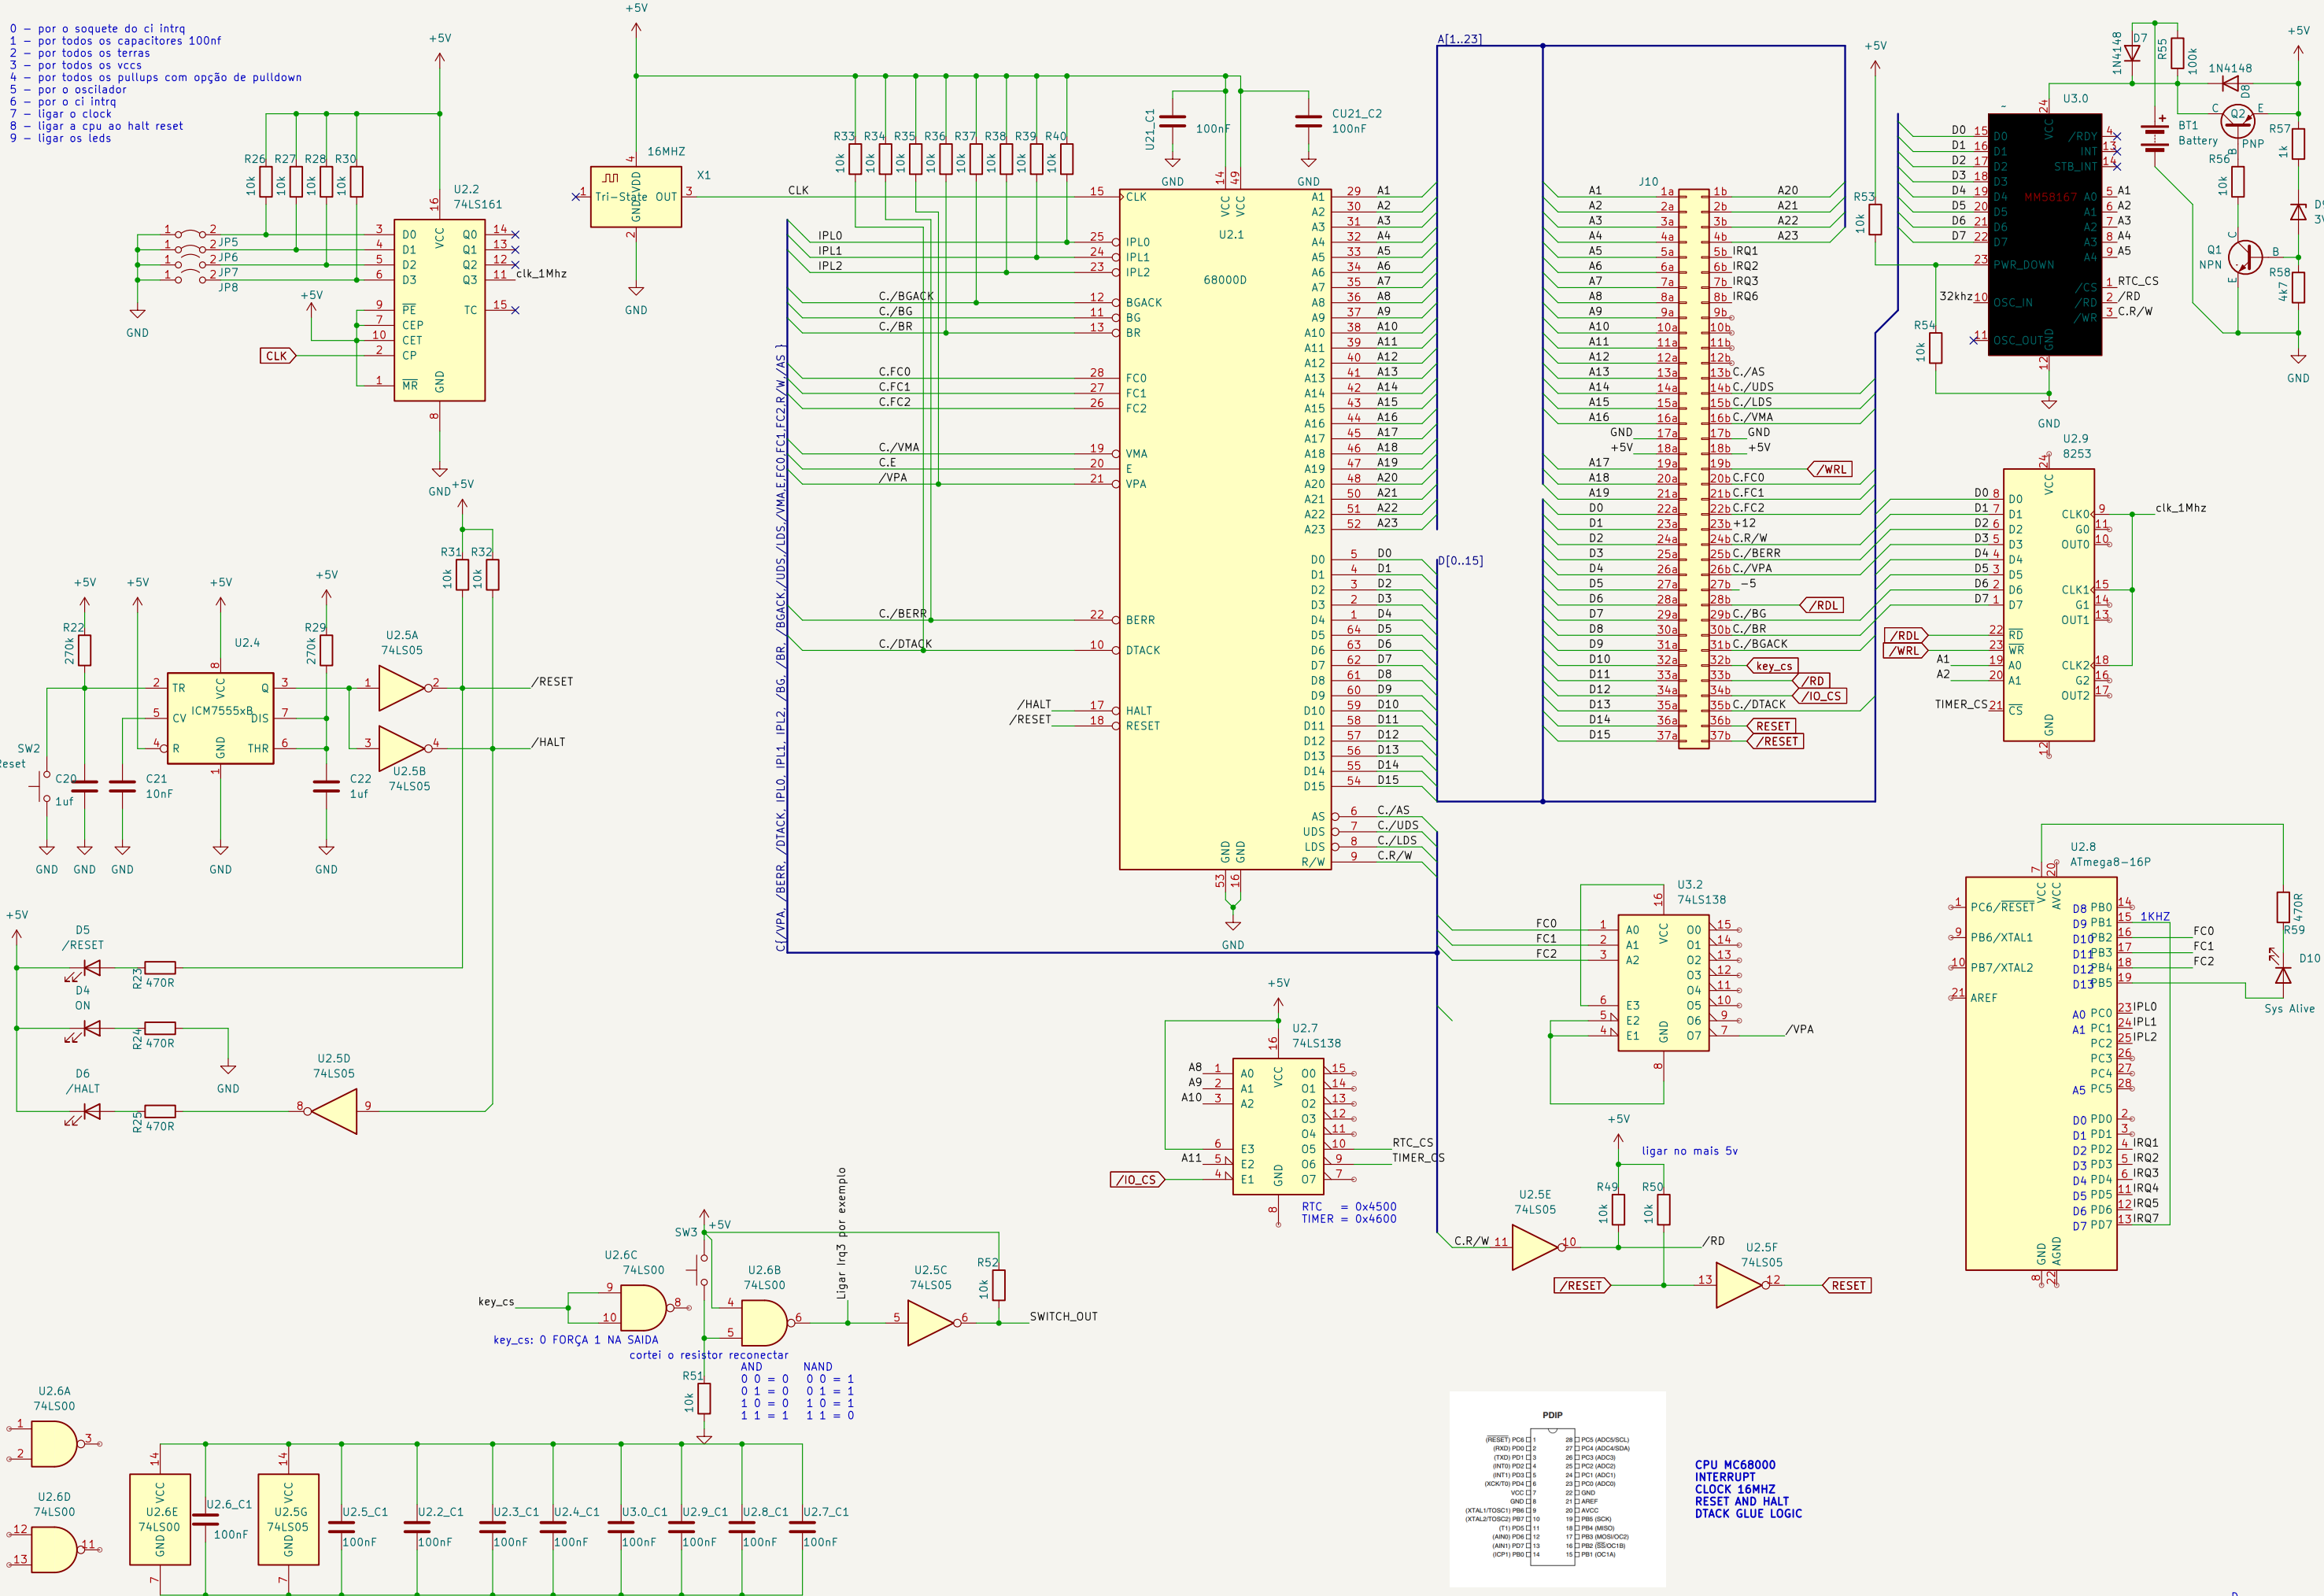

UART1 - 0x4000 até 0x20FF = UART_CS1
UART2 - 0x4100 até 0x21FF = UART_CS2
UART3 - 0x4200 até 0x22FF = UART_CS3
UART4 - 0x4300 até 0x23FF = UART_CS4
key - 0x4400 até 0x44ff = key_cs na leitura
Led - 0x4400 até 0x44ff = LED_CS na escrita

