Individual Printer Performance and Anomaly Report

EPR-003

Digital Press A · KonicaJet 6120 · Plant 1 - Hall B

PRINTER INFORMATION

Printer ID	EPR-003
Printer name	Digital Press A
Model	KonicaJet 6120
Machine type	Digital
Location	Plant 1 - Hall B
Installed	2021-03-12
Last recorded status	IDLE
Status mix over period	IDLE 421, PRINTING 436, MAINTENANCE 7
Total telemetry readings	864
Monitoring period	2026-10-15 00:00:00 to 2026-10-17 23:55:00
Report generated	2026-10-26 13:43:37.905

CONFIGURED SENSOR THRESHOLD LIMITS

SENSOR	LOWER LIMIT	UPPER LIMIT	SEVERITY
Temperature (°C)	—	65.0	CRITICAL
Humidity (%)	30.0	70.0	WARNING
Ink level (%)	15.0	—	WARNING
Paper stock (%)	10.0	—	INFO
Motor RPM (rpm)	—	7500.0	WARNING
Vibration (mm/s)	—	3.5	CRITICAL
Power (kW)	—	24.3	WARNING
Paper jams (count)	—	2.0	CRITICAL

SENSOR PERFORMANCE SUMMARY

SENSOR (UNIT)	MIN	AVG	MAX	LAST VALUE	BREACH READINGS
Temperature (°C)	30.4	38.68	72.7	31.5	14
Humidity (%)	36.9	48.37	84.5	52.9	8
Ink level (%)	64.2	78.73	97.6	64.2	0
Paper stock (%)	29.4	46.80	69.0	29.4	0
Motor RPM (rpm)	0.0	2925.51	6239.0	169.0	0
Vibration (mm/s)	0.1	0.72	6.6	0.2	11
Power (kW)	1.4	9.92	31.4	1.6	17
Throughput (ppm)	0.0	56.49	126.0	0.0	0
Paper jams (count)	0.0	0.00	1.0	0.0	0

ANOMALY DETECTION SUMMARY

Labelled anomalous readings	56 of 864 readings (6.5%)
Raw threshold-breach readings	50 readings with at least one sensor out of bounds
Anomaly types	VIBRATION_SPIKE: 11 · OVERHEAT: 20 · HUMIDITY_SPIKE: 8 · POWER_SURGE: 17
Detected anomaly events	190 fired by the live detector (window=3 consecutive readings), last at 2026-10-15 10:55:00
Alerts in alerts.csv	50 total · 25 CRITICAL

Counts intentionally differ: labelled readings are dataset ground-truth episodes; breach readings are raw out-of-bounds values; detected events are spawned only after one metric stays out of bounds for 3 consecutive readings.

SENSOR PERFORMANCE GRAPHS

TEMPERATURE OVER TIME (°C)

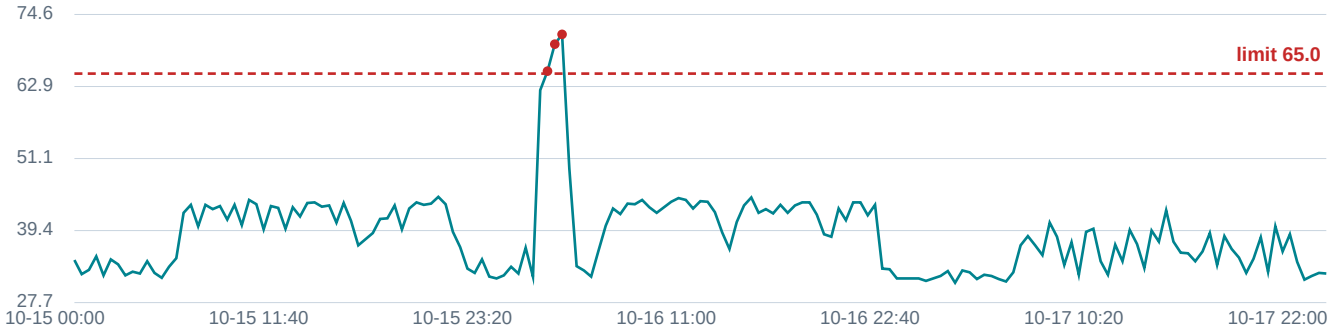

173 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

VIBRATION OVER TIME (MM/S)

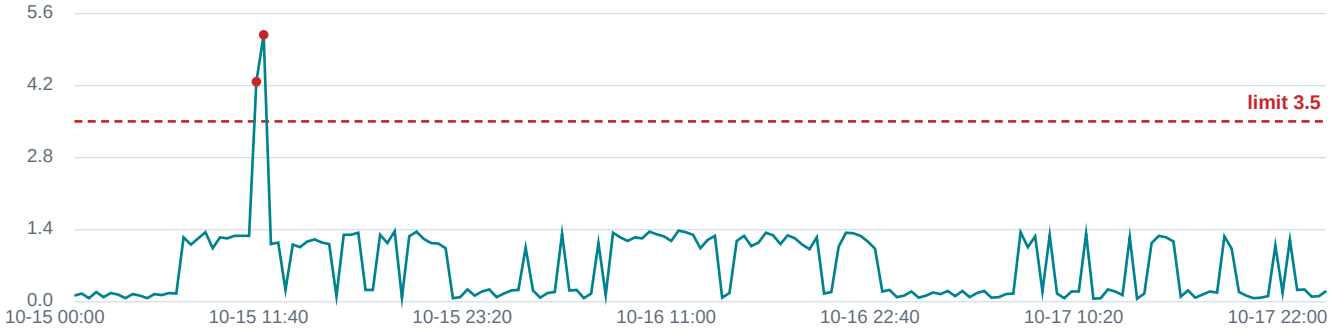

173 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

MOTOR RPM OVER TIME (RPM)

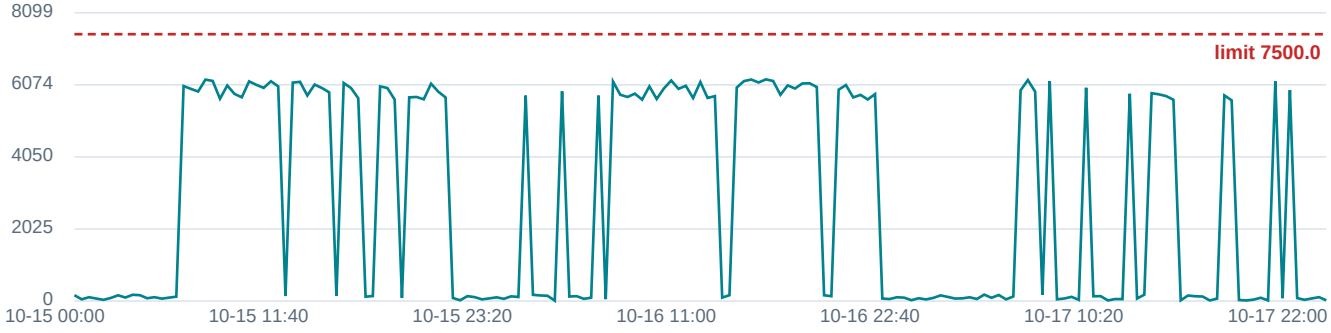

173 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

ALERT HISTORY

TIMESTAMP	METRIC	VALUE	THRESHOLD	SEVERITY	MESSAGE
2026-10-16 18:15	power_kw	26.4	24.3	WARNING	Power draw above limit
2026-10-16 18:10	power_kw	29.2	24.3	WARNING	Power draw above limit
2026-10-16 18:05	power_kw	27.6	24.3	WARNING	Power draw above limit
2026-10-16 18:00	power_kw	27.9	24.3	WARNING	Power draw above limit
2026-10-16 17:55	power_kw	27.5	24.3	WARNING	Power draw above limit
2026-10-16 17:50	power_kw	26.5	24.3	WARNING	Power draw above limit
2026-10-16 17:45	power_kw	27.7	24.3	WARNING	Power draw above limit
2026-10-16 17:40	power_kw	27.3	24.3	WARNING	Power draw above limit
2026-10-16 17:35	power_kw	31.2	24.3	WARNING	Power draw above limit
2026-10-16 17:30	power_kw	29.2	24.3	WARNING	Power draw above limit
2026-10-16 17:25	power_kw	27.0	24.3	WARNING	Power draw above limit
2026-10-16 17:20	power_kw	30.4	24.3	WARNING	Power draw above limit
2026-10-16 17:15	power_kw	27.5	24.3	WARNING	Power draw above limit
2026-10-16 17:10	power_kw	28.7	24.3	WARNING	Power draw above limit
2026-10-16 17:05	power_kw	25.7	24.3	WARNING	Power draw above limit
2026-10-16 17:00	power_kw	26.4	24.3	WARNING	Power draw above limit
2026-10-16 16:55	power_kw	31.4	24.3	WARNING	Power draw above limit
2026-10-16 08:25	humidity_pct	83.6	70.0	WARNING	Humidity above limit
2026-10-16 08:20	humidity_pct	84.5	70.0	WARNING	Humidity above limit
2026-10-16 08:15	humidity_pct	80.5	70.0	WARNING	Humidity above limit
2026-10-16 08:10	humidity_pct	80.8	70.0	WARNING	Humidity above limit
2026-10-16 08:05	humidity_pct	78.6	70.0	WARNING	Humidity above limit

Showing latest 22 of 50 alerts, newest first. The full history is available in alerts.csv.

SUMMARY & RECOMMENDATIONS

This printer shows a labelled-anomaly rate of 6.5%, in line with the fleet-wide 6.0%.

Temperature was out of bounds on 14 reading(s) (limit 65.0 °C, max seen 72.7 °C). Recommend checking the cooling system and ventilation of Plant 1 - Hall B.

Vibration was out of bounds on 11 reading(s) (limit 3.5 mm/s, max seen 6.6 mm/s). Recommend inspecting mechanical components such as bearings, mounts and drive belts.

Power draw exceeded its limit on 17 reading(s) (limit 24.3 kW, max seen 31.4 kW). Recommend checking electrical load and supply stability.

Humidity fell outside the 30–70% band on 8 reading(s). Recommend reviewing site climate control.

Note: recommendations are rule-based responses to threshold breaches present in the monitored data. They are maintenance suggestions, not confirmed diagnoses.