Individual Printer Performance and Anomaly Report

EPR-008

Large Format · EpsonSure 9900 · Plant 2 - Hall C

PRINTER INFORMATION

Printer ID	EPR-008
Printer name	Large Format
Model	EpsonSure 9900
Machine type	Large-format
Location	Plant 2 - Hall C
Installed	2021-08-17
Last recorded status	IDLE
Status mix over period	IDLE 422, PRINTING 414, OFFLINE 8, MAINTENANCE 12, ERROR 8
Total telemetry readings	864
Monitoring period	2026-10-15 00:00:00 to 2026-10-17 23:55:00
Report generated	2026-10-26 13:54:50.718

CONFIGURED SENSOR THRESHOLD LIMITS

SENSOR	LOWER LIMIT	UPPER LIMIT	SEVERITY
Temperature (°C)	—	60.0	CRITICAL
Humidity (%)	30.0	70.0	WARNING
Ink level (%)	15.0	—	WARNING
Paper stock (%)	10.0	—	INFO
Motor RPM (rpm)	—	3200.0	WARNING
Vibration (mm/s)	—	3.0	CRITICAL
Power (kW)	—	12.2	WARNING
Paper jams (count)	—	2.0	CRITICAL

SENSOR PERFORMANCE SUMMARY

SENSOR (UNIT)	MIN	AVG	MAX	LAST VALUE	BREACH READINGS
Temperature (°C)	28.0	34.87	42.4	29.2	0
Humidity (%)	36.6	48.20	59.7	52.0	0
Ink level (%)	11.4	53.39	89.1	74.8	1
Paper stock (%)	44.2	61.91	83.3	44.2	0
Motor RPM (rpm)	0.0	1257.66	3646.0	27.0	11
Vibration (mm/s)	0.1	0.55	5.6	0.1	10
Power (kW)	0.7	4.85	9.7	0.9	0
Throughput (ppm)	0.0	18.92	42.0	0.0	0
Paper jams (count)	0.0	0.03	5.0	0.0	5

ANOMALY DETECTION SUMMARY

Labelled anomalous readings	48 of 864 readings (5.6%)
Raw threshold-breach readings	27 readings with at least one sensor out of bounds
Anomaly types	OFFLINE: 8 · VIBRATION_SPIKE: 11 · PAPER_JAM_BURST: 8 · INK_LEAK_DROP: 10 · MOTOR_OVERSPEED: 11
Detected anomaly events	126 fired by the live detector (window=3 consecutive readings), last at 2026-10-16 01:10:00
Alerts in alerts.csv	35 total · 23 CRITICAL

Counts intentionally differ: labelled readings are dataset ground-truth episodes; breach readings are raw out-of-bounds values; detected events are spawned only after one metric stays out of bounds for 3 consecutive readings.

SENSOR PERFORMANCE GRAPHS

TEMPERATURE OVER TIME (°C)

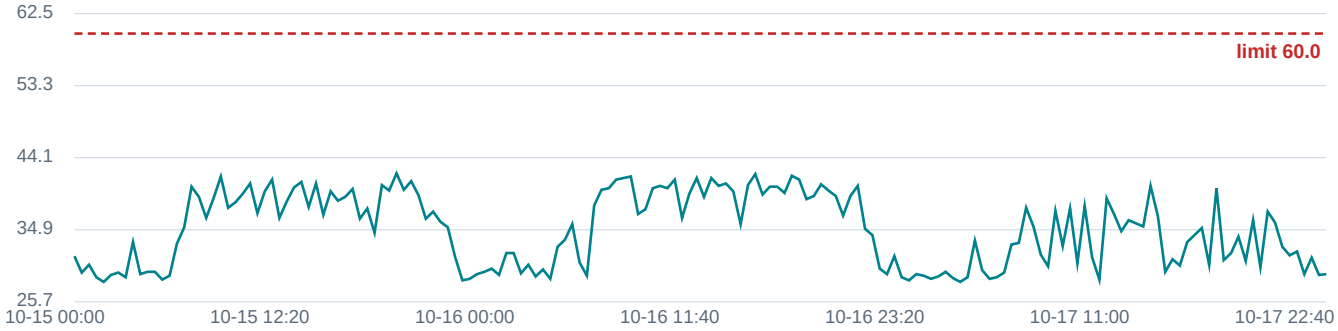

172 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

VIBRATION OVER TIME (MM/S)

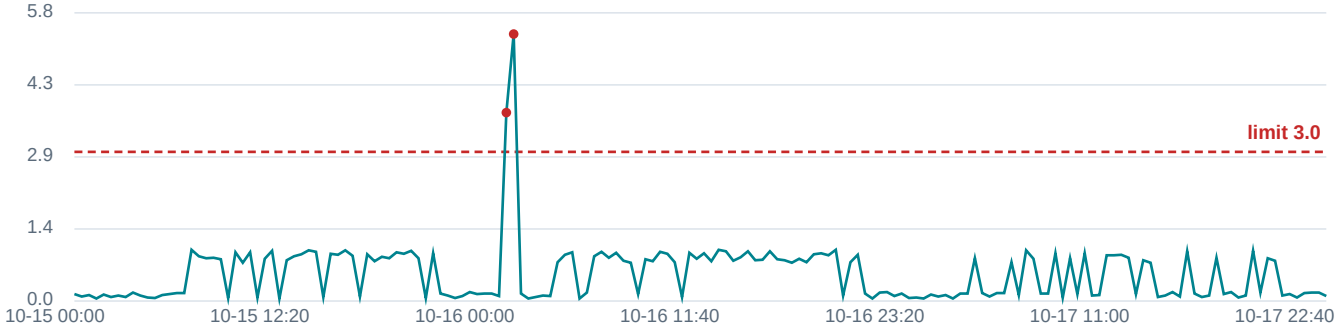

172 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

MOTOR RPM OVER TIME (RPM)

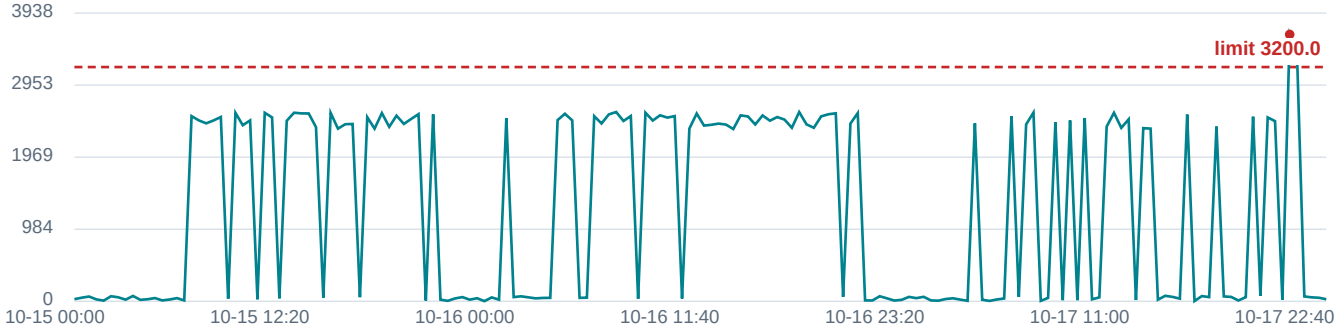

172 plotted readings · red dots = labelled anomaly also breaching this sensor's limit

ALERT HISTORY

TIMESTAMP	METRIC	VALUE	THRESHOLD	SEVERITY	MESSAGE
2026-10-17 22:30	motor_rpm	3606.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:25	motor_rpm	3325.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:20	motor_rpm	3483.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:15	motor_rpm	3384.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:10	motor_rpm	3297.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:05	motor_rpm	3576.0	3200.0	WARNING	Motor speed above limit
2026-10-17 22:00	motor_rpm	3524.0	3200.0	WARNING	Motor speed above limit
2026-10-17 21:55	motor_rpm	3576.0	3200.0	WARNING	Motor speed above limit
2026-10-17 21:50	motor_rpm	3646.0	3200.0	WARNING	Motor speed above limit
2026-10-17 21:45	motor_rpm	3458.0	3200.0	WARNING	Motor speed above limit
2026-10-17 21:40	motor_rpm	3378.0	3200.0	WARNING	Motor speed above limit
2026-10-17 17:50	ink_level_pct	11.4	15.0	WARNING	Ink level low
2026-10-17 10:45	paper_jams	4.0	2.0	CRITICAL	Repeated paper jams
2026-10-17 10:35	paper_jams	3.0	2.0	CRITICAL	Repeated paper jams
2026-10-17 10:30	paper_jams	4.0	2.0	CRITICAL	Repeated paper jams
2026-10-17 10:25	paper_jams	4.0	2.0	CRITICAL	Repeated paper jams
2026-10-17 10:20	paper_jams	5.0	2.0	CRITICAL	Repeated paper jams
2026-10-16 01:45	vibration_mm_s	5.6	3.0	CRITICAL	Excessive vibration - inspect bearings
2026-10-16 01:40	vibration_mm_s	5.4	3.0	CRITICAL	Excessive vibration - inspect bearings
2026-10-16 01:35	vibration_mm_s	5.2	3.0	CRITICAL	Excessive vibration - inspect bearings
2026-10-16 01:30	vibration_mm_s	4.6	3.0	CRITICAL	Excessive vibration - inspect bearings
2026-10-16 01:25	vibration_mm_s	4.5	3.0	CRITICAL	Excessive vibration - inspect bearings

Showing latest 22 of 35 alerts, newest first. The full history is available in alerts.csv.

SUMMARY & RECOMMENDATIONS

This printer shows a labelled-anomaly rate of 5.6%, in line with the fleet-wide 6.0%.

Vibration was out of bounds on 10 reading(s) (limit 3.0 mm/s, max seen 5.6 mm/s). Recommend inspecting mechanical components such as bearings, mounts and drive belts.

Motor speed exceeded its limit on 11 reading(s) (limit 3200 rpm, max seen 3646 rpm). Recommend verifying drive settings and motor load.

Paper jams exceeded 2 per interval on 5 reading(s). Recommend checking feed rollers and media quality.

Ink level dropped below the 15.0% floor on 1 reading(s) (min seen 11.4%). Recommend scheduling ink replenishment.

8 reading(s) were logged with the machine OFFLINE. Recommend investigating connectivity or power availability during those windows.

Note: recommendations are rule-based responses to threshold breaches present in the monitored data. They are maintenance suggestions, not confirmed diagnoses.