



State Farm
P.O. Box 106169
Atlanta, GA 30348-6169
Fax: 1-844-236-3646
statefarmfireclaims@statefarm.com

Structural Damage Claim Policy

This estimate is priced based on estimated market pricing for the cost of materials, labor, and other factors at the time of the loss.

Adjustments in market pricing and timing of the repairs may impact the final cost of covered repairs. Should you or the contractor you select have questions concerning our estimate, please contact us. If your contractor's estimate is higher than ours, you should contact us prior to beginning repairs. State Farm will work with you and your contractor to determine the actual and necessary cost of covered repairs at the time repairs will be completed, subject to policy terms, conditions and limits.

- We want you to receive quality repair work to restore the damages to your property.
- We will provide you with a detailed estimate of the scope of the damage and costs of repairs. Should the contractor you select have questions concerning our estimate, they should contact your claim representative directly.
- Depending upon the complexity of your repair, our estimate may or may not include an allowance for general contractor's overhead and profit. If you have questions regarding general contractor's overhead and profit and whether general contractor services are appropriate for your loss, please contact your claim representative before proceeding with repairs.
- There may be building codes, ordinances, laws, or regulations that affect the repairs of your property. These items may or may not be covered by your policy. Please contact your claim representative if you have any questions regarding coverage which may be available under your policy.
- State Farm® cannot authorize any contractor to proceed with work on your property. Repairs should proceed only with your authorization.
- State Farm does not guarantee the quality of the workmanship of any contractor or guarantee that the work will be accomplished within any specific time frame.
- It is understood that the contractor is hired by you, our insured, and that they work for you - not State Farm.

If you have any questions or need additional information regarding your claim, please contact your claim representative immediately.

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

Insured: SABBINENI, PRAVEEN KUMAR
Property: 205 Terra Manor Trl
Georgetown, TX 78628-3766
Home: 217-503-8494
Cellular: 217-503-8494
Type of Loss: Fire
Deductible: \$6,142.00
Date of Loss: 7/6/2025
Date Inspected: 7/9/2025

Estimate: 43-87F8-12B1
Claim Number: 4387F812B
Policy Number: 72KAJ4130
Price List: TXAU28_JUL25
Restoration/Service/Remodel

Summary for Coverage A - Dwelling - 33 Fire, Lightning, & Removal

Line Item Total	94,904.07
Material Sales Tax	1,599.22
Subtotal	96,503.29
General Contractor Overhead	9,650.69
General Contractor Profit	9,650.69
Cleaning Sales Tax	58.05
Replacement Cost Value (Including General Contractor Overhead and Profit)	115,862.72
Less Depreciation (Including Taxes)	(20,326.57)
Less Deductible	(6,142.00)
Net Actual Cash Value Payment	\$89,394.15

Maximum Additional Amounts Available If Incurred:

Total Line Item Depreciation (Including Taxes)	20,326.57
Replacement Cost Benefits	20,326.57
Total Maximum Additional Amount Available If Incurred	20,326.57
Total Amount of Claim If Incurred	\$109,720.72

ALEXANDER, DOMINIQUE
844-458-4300 x 3098349982

ALL AMOUNTS PAYABLE ARE SUBJECT TO THE TERMS, CONDITIONS AND LIMITS OF YOUR POLICY.



Explanation of Building Replacement Cost Benefits
Homeowner Policy
Coverage A - Dwelling - 33 Fire, Lightning, & Removal

To: Name: SABBINENI, PRAVEEN KUMAR
 Address: 205 Terra Manor Trl
 City: Georgetown
 State/Zip: TX, 78628-3766

Insured:	SABBINENI, PRAVEEN KUMAR	Claim Number:	4387F812B
Date of Loss:	7/6/2025	Cause of Loss:	FIRE

Your insurance policy provides replacement cost benefits for some or all of the loss or damage to your dwelling or structures. Replacement cost benefits pays the actual and necessary cost of repair or replacement, without a deduction for depreciation, subject to your policy's limit of liability. To receive replacement cost benefits you must:

1. Complete the actual repair or replacement of the damaged part of the property within two years of the date of loss;
2. Promptly notify us after the work has been completed; and
3. Confirm completion of repair or replacement, by submitting invoices, receipts or other documentation to your agent or claim office.

Until these requirements have been satisfied, our payment(s) to you will be for the actual cash value of the damaged part of the property, which may include a deduction for depreciation.

Without waiving the above requirements, we will consider paying replacement cost benefits prior to actual repair or replacement if we determine repair or replacement costs will be incurred because repairs are substantially under way or you present a signed contract acceptable to us.

The estimate to repair or replace your damaged property is \$115,862.72 . The enclosed claim payment to you of \$89,394.15 is for the actual cash value of the damaged property at the time of loss, less any deductible that may apply. We determined the actual cash value by deducting depreciation from the estimated repair or replacement cost. Our estimate details the depreciation applied to your loss. Based on our estimate, the additional amount available to you for replacement cost benefits (recoverable depreciation) is \$ 20,326.57 .

If you cannot have the repairs completed for the repair/replacement cost estimated, please contact your claim specialist prior to beginning repairs.


All policy provisions apply to your claim.

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

Level 2

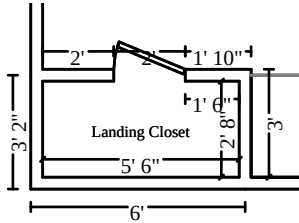


Landing Closet

Height: 10'

163.75 SF Walls	14.78 SF Ceiling
178.54 SF Walls & Ceiling	14.78 SF Floor
16.38 LF Ceil. Perimeter	16.38 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
1. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
178.54 SF	1.20	3.09	43.48	260.82	3/15 yrs Avg.	(43.47) 20.00%	217.35
2. Seal (1 coat) & paint (1 coat) baseboard							
16.38 LF	1.91	0.20	6.30	37.79	3/15 yrs Avg.	(6.30) 20.00%	31.49
3. Carpet pad							
14.78 SF	0.66	0.66	2.10	12.51	3/10 yrs Avg.	(3.13) 30.00%	9.38
4. Carpet							
28.00 SF	3.82	6.88	22.78	136.62	3/10 yrs Avg.	(34.15) 30.00%	102.47
Totals: Landing Closet		10.83	74.66	447.74		87.05	360.69

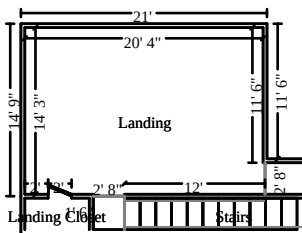

Landing

Height: 10'

641.85 SF Walls	290.01 SF Ceiling
931.86 SF Walls & Ceiling	290.01 SF Floor
66.60 LF Ceil. Perimeter	63.92 LF Floor Perimeter

Missing Wall

2' 8" X 10'

Opens into LANDING1

Missing Wall


2' 8 1/4" X 10'

Opens into HALLWAY

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
5. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
931.86 SF	1.20	16.14	226.86	1,361.23	3/15 yrs Avg.	(226.88) 20.00%	1,134.35
6. Baseboard - 4 1/4"							
63.92 LF	5.08	14.08	67.76	406.55	3/150 yrs Avg.	(6.77) 2.00%	399.78

CONTINUED - Landing

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
7. Seal (1 coat) & paint (1 coat) baseboard							
63.92 LF	1.91	0.79	24.58	147.46	3/15 yrs Avg.	(24.58) 20.00%	122.88
* 8. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55
9. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
10. Carpet pad							
290.01 SF	0.66	12.92	40.86	245.19	3/10 yrs Avg.	(61.30) 30.00%	183.89
11. Carpet							
320.33 SF	3.82	78.75	260.50	1,562.91	3/10 yrs Avg.	(390.73) 30.00%	1,172.18
Totals: Landing		123.97	638.40	3,830.31		728.09	3,102.22

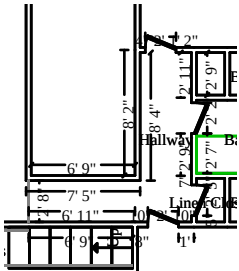

Hallway

Height: 9'

366.09 SF Walls
 422.30 SF Walls & Ceiling
 40.68 LF Ceil. Perimeter

56.20 SF Ceiling
 56.20 SF Floor
 40.68 LF Floor Perimeter

Missing Wall

2' 8 1/4" X 9'

Opens into LANDING

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
12. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
422.30 SF	1.20	7.32	102.82	616.90	3/15 yrs Avg.	(102.81) 20.00%	514.09
13. Seal (1 coat) & paint (1 coat) baseboard							
40.68 LF	1.91	0.50	15.64	93.84	3/15 yrs Avg.	(15.64) 20.00%	78.20
* 14. Seal & paint door trim & jamb - (per side)							
4.00 EA	40.05	1.95	32.44	194.59	3/15 yrs Avg.	(32.43) 20.00%	162.16

State Farm

SABBINENI, PRAVEEN KUMAR


43-87F8-12B1

CONTINUED - Hallway

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
15. Seal & paint door slab only (per side)							
4.00 EA	47.79	3.21	38.88	233.25	3/15 yrs Avg.	(38.87) 20.00%	194.38
16. Carpet pad							
56.20 SF	0.66	2.50	7.92	47.51	3/10 yrs Avg.	(11.88) 30.00%	35.63
17. Carpet							
75.75 SF	3.82	18.62	61.60	369.59	3/10 yrs Avg.	(92.40) 30.00%	277.19
Totals: Hallway		34.10	259.30	1,555.68		294.03	1,261.65


Stairs

Height: 17'



598.01 SF Walls
648.40 SF Walls & Ceiling
40.19 LF Ceil. Perimeter

50.39 SF Ceiling
64.06 SF Floor
41.12 LF Floor Perimeter

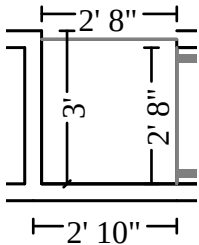

Subroom: Landing1 (2)

Height: 12' 6"

71.10 SF Walls
78.71 SF Walls & Ceiling
5.69 LF Ceil. Perimeter

7.61 SF Ceiling
7.61 SF Floor
5.69 LF Floor Perimeter

Missing Wall

2' 8 1/4" X 12' 6"

Opens into STAIRS

Missing Wall

2' 8" X 12' 6"

Opens into LANDING

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
18. Carpet pad							
71.67 SF	0.66	3.19	10.10	60.59	3/10 yrs Avg.	(15.15) 30.00%	45.44
19. Carpet							
96.66 SF	3.82	23.76	78.60	471.60	3/10 yrs Avg.	(117.90) 30.00%	353.70


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Stairs

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
20. Step charge for "waterfall" carpet installation							
16.00 EA	10.36	0.87	33.34	199.97	3/10 yrs Avg.	(49.99) 30.00%	149.98
21. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
727.11 SF	1.20	12.60	177.02	1,062.15	3/15 yrs Avg.	(177.03) 20.00%	885.12
22. Seal & paint stair stringer - one side							
46.80 LF	5.57	1.85	52.52	315.05	3/15 yrs Avg.	(52.51) 20.00%	262.54
Totals: Stairs		42.27	351.58	2,109.36		412.58	1,696.78

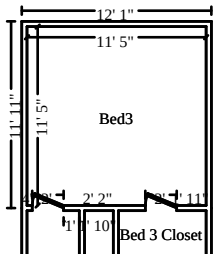

Bed3

Height: 9'

410.72 SF Walls	130.16 SF Ceiling
540.88 SF Walls & Ceiling	130.16 SF Floor
45.64 LF Ceil. Perimeter	45.64 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
23. Batt insulation - 4" - R13 - paper / foil faced							
48.00 SF	1.24	3.33	12.56	75.41	3/150 yrs Avg.	(1.26) 2.00%	74.15
24. 1/2" drywall - hung, taped, heavy texture, ready for paint							
48.00 SF	3.72	3.33	36.38	218.27	3/150 yrs Avg.	(3.64) 2.00%	214.63
25. Baseboard - 4 1/4"							
6.00 LF	5.08	1.32	6.36	38.16	3/150 yrs Avg.	(0.64) 2.00%	37.52
26. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
540.88 SF	1.20	9.37	131.70	790.13	3/15 yrs Avg.	(131.68) 20.00%	658.45
27. Seal (1 coat) & paint (1 coat) baseboard							
45.64 LF	1.91	0.57	17.56	105.30	3/15 yrs Avg.	(17.54) 20.00%	87.76
28. R&R Ceiling fan & light							
1.00 EA	508.09	12.48	104.12	624.69	3/20 yrs Avg.	(74.60) 15.00%	550.09


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bed3

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
29. Carpet pad							
130.16 SF	0.66	5.80	18.34	110.05	3/10 yrs Avg.	(27.51) 30.00%	82.54
30. Carpet							
146.67 SF	3.82	36.06	119.28	715.62	3/10 yrs Avg.	(178.90) 30.00%	536.72
Totals: Bed3		72.26	446.30	2,677.63		435.77	2,241.86

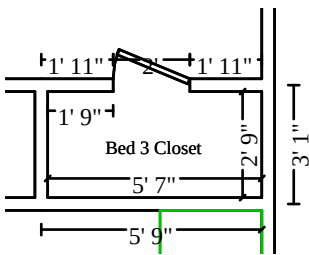

Bed 3 Closet

Height: 9'


150.28 SF Walls	15.44 SF Ceiling
165.72 SF Walls & Ceiling	15.44 SF Floor
16.70 LF Ceil. Perimeter	16.70 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
31. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
165.72 SF	1.20	2.87	40.36	242.09	3/15 yrs Avg.	(40.34) 20.00%	201.75
32. Seal (1 coat) & paint (1 coat) baseboard							
16.70 LF	1.91	0.21	6.42	38.53	3/15 yrs Avg.	(6.42) 20.00%	32.11
* 33. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55
34. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
35. Carpet pad							
15.44 SF	0.66	0.69	2.18	13.06	3/10 yrs Avg.	(3.27) 30.00%	9.79
36. Carpet							
28.75 SF	3.82	7.07	23.38	140.28	3/10 yrs Avg.	(35.07) 30.00%	105.21
Totals: Bed 3 Closet		12.13	90.18	540.93		102.93	438.00

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

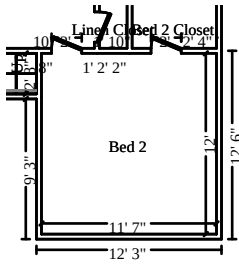


Bed 2

Height: 9'

423.94 SF Walls	138.64 SF Ceiling
562.58 SF Walls & Ceiling	138.64 SF Floor
47.10 LF Ceil. Perimeter	47.10 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
37. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
562.58 SF	1.20	9.75	136.98	821.83	3/15 yrs Avg.	(136.97) 20.00%	684.86
38. Seal (1 coat) & paint (1 coat) baseboard							
47.10 LF	1.91	0.58	18.12	108.66	3/15 yrs Avg.	(18.11) 20.00%	90.55
39. Carpet pad							
138.64 SF	0.66	6.18	19.54	117.22	3/10 yrs Avg.	(29.30) 30.00%	87.92
40. Carpet							
160.25 SF	3.82	39.40	130.32	781.88	3/10 yrs Avg.	(195.47) 30.00%	586.41
Totals: Bed 2		55.91	304.96	1,829.59		379.85	1,449.74

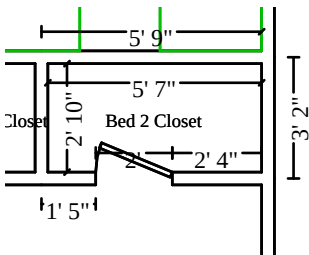

Bed 2 Closet

Height: 9'

151.50 SF Walls	15.82 SF Ceiling
167.32 SF Walls & Ceiling	15.82 SF Floor
16.83 LF Ceil. Perimeter	16.83 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
41. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
167.32 SF	1.20	2.90	40.74	244.42	3/15 yrs Avg.	(40.74) 20.00%	203.68
42. Seal (1 coat) & paint (1 coat) baseboard							
16.83 LF	1.91	0.21	6.48	38.84	3/15 yrs Avg.	(6.47) 20.00%	32.37
* 43. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bed 2 Closet

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
44. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
45. R&R Ceiling fan & light							
1.00 EA	508.09	12.48	104.12	624.69	3/20 yrs Avg.	(74.60) 15.00%	550.09
46. Carpet pad							
15.82 SF	0.66	0.70	2.22	13.36	3/10 yrs Avg.	(3.34) 30.00%	10.02
47. Carpet							
28.75 SF	3.82	7.07	23.38	140.28	3/10 yrs Avg.	(35.07) 30.00%	105.21
Totals: Bed 2 Closet		24.65	194.78	1,168.56		178.05	990.51

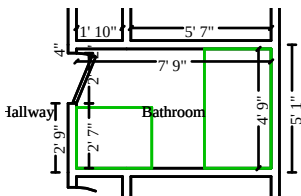

Bathroom

Height: 9'

158.47 SF Walls	36.81 SF Ceiling
195.28 SF Walls & Ceiling	16.96 SF Floor
25.00 LF Ceil. Perimeter	9.53 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
48. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
195.28 SF	1.20	3.38	47.54	285.26	3/15 yrs Avg.	(47.55) 20.00%	237.71
49. Seal (1 coat) & paint (1 coat) baseboard							
9.53 LF	1.91	0.12	3.66	21.98	3/15 yrs Avg.	(3.66) 20.00%	18.32
50. R&R Vanity top - one sink - cultured marble							
4.00 LF	103.34	20.36	86.76	520.48	3/20 yrs Avg.	(61.87) 15.00%	458.61
Includes: One-piece cultured marble vanity top with molded sink and 4" backsplash, caulk, and installation labor. Labor cost to remove a cultured marble vanity top and to discard in a job-site waste receptacle.							
51. P-trap assembly - Detach & reset							
1.00 EA	94.10	0.00	18.82	112.92			112.92
52. Seal & paint vanity - inside and out							
4.00 LF	47.79	1.88	38.62	231.66	3/15 yrs Avg.	(38.61) 20.00%	193.05


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bathroom

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
53. Detach & Reset Cabinet knob or pull							
3.00 EA	2.96	0.00	1.78	10.66			10.66
54. Final cleaning - construction - Residential							
16.96 SF	0.36	0.60	1.22	7.93			7.93
Totals: Bathroom		26.34	198.40	1,190.89		151.69	1,039.20

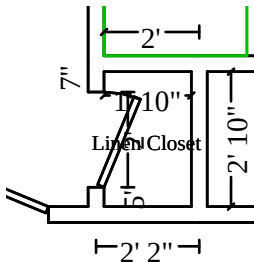

Linen Closet

Height: 9'

84.00 SF Walls	5.19 SF Ceiling
89.19 SF Walls & Ceiling	5.19 SF Floor
9.33 LF Ceil. Perimeter	9.33 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
55. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
89.19 SF	1.20	1.55	21.72	130.30	3/15 yrs Avg.	(21.72) 20.00%	108.58
56. Seal (1 coat) & paint (1 coat) baseboard							
9.33 LF	1.91	0.12	3.58	21.52	3/15 yrs Avg.	(3.58) 20.00%	17.94
57. Carpet pad							
5.19 SF	0.66	0.23	0.72	4.38	3/10 yrs Avg.	(1.10) 30.00%	3.28
58. Carpet							
15.58 SF	3.82	3.83	12.66	76.01	3/10 yrs Avg.	(19.01) 30.00%	57.00
Totals: Linen Closet		5.73	38.68	232.21		45.41	186.80

Area Totals: Level 2

3,219.71 SF Walls	761.07 SF Ceiling	3,980.78 SF Walls and Ceiling
754.88 SF Floor	847.15 Total Area	312.91 LF Floor Perimeter
754.88 Floor Area	161.78 Exterior Perimeter	330.14 LF Ceil. Perimeter
1,674.25 Exterior Wall Area	of Walls	2,315.79 Interior Wall Area

Total: Level 2	408.19	2,597.24	15,582.90			2,815.45	12,767.45
-----------------------	---------------	-----------------	------------------	--	--	-----------------	------------------

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

Main Level



Entry/Foyer

Height: 19' 4"

1,203.20 SF Walls	165.33 SF Ceiling
1,368.53 SF Walls & Ceiling	165.33 SF Floor
72.67 LF Ceil. Perimeter	46.89 LF Floor Perimeter

Missing Wall	9' 6 3/8" X 19' 3 5/8"	Opens into KITCHEN
Missing Wall	5' 9" X 19' 3 5/8"	Opens into LIVING_ROOM
Missing Wall - Goes to Floor	10' 6" X 6' 8"	Opens into FORMAL_DININ

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
59. 1/2" - drywall per LF - up to 2' tall							
46.89 LF	12.87	5.42	121.78	730.67	3/150 yrs Avg.	(12.18) 2.00%	718.49
60. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
1,368.53 SF	1.20	23.71	333.18	1,999.13	3/15 yrs Avg.	(333.19) 20.00%	1,665.94
61. Casing - 2 1/4"							
20.00 LF	2.80	2.59	11.72	70.31	3/150 yrs Avg.	(1.17) 2.00%	69.14
62. Seal & paint door/window trim & jamb - Large (per side)							
1.00 EA	47.15	0.58	9.56	57.29	3/15 yrs Avg.	(9.55) 20.00%	47.74
63. Baseboard - 6"							
46.89 LF	6.25	13.89	61.40	368.35	3/150 yrs Avg.	(6.14) 2.00%	362.21
64. Seal (1 coat) & paint (1 coat) baseboard							
46.89 LF	1.91	0.58	18.04	108.18	3/15 yrs Avg.	(18.03) 20.00%	90.15
65. Seal 1 coat & paint 1coat French door slab only (per side)							
2.00 EA	91.28	1.58	36.84	220.98	3/15 yrs Avg.	(36.83) 20.00%	184.15
66. R&R Tile floor covering - per specs from ind. tile analysis							
165.33 SF	9.95	10.78	331.18	1,986.99	3/100 yrs Avg.	(34.44) 3.00%	1,952.55
67. Floor leveling cement - Light							
165.33 SF	2.24	12.96	76.66	459.96	3/50 yrs Avg.	(23.00) 6.00%	436.96
68. Final cleaning - construction - Residential							
165.33 SF	0.36	5.89	11.90	77.31			77.31
Totals: Entry/Foyer		77.98	1,012.26	6,079.17		474.53	5,604.64

43-87F8-12B1



Height: 8'


Page: 13

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
76. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
820.38 SF	1.20	14.21	199.74	1,198.41	3/15 yrs Avg.	(199.73) 20.00%	998.68
77. R&R Ceiling fan & light - High grade							
1.00 EA	625.40	22.15	129.52	777.07	3/20 yrs Avg.	(93.65) 15.00%	683.42
78. Baseboard - 6"							
61.17 LF	6.25	18.12	80.08	480.51	3/150 yrs Avg.	(8.01) 2.00%	472.50
79. Seal (1 coat) & paint (1 coat) baseboard							
61.17 LF	1.91	0.76	23.52	141.11	3/15 yrs Avg.	(23.52) 20.00%	117.59
80. R&R Tile floor covering - per specs from ind. tile analysis							
331.04 SF	9.95	21.58	663.10	3,978.53	3/100 yrs Avg.	(68.98) 3.00%	3,909.55
81. Floor leveling cement - Light							
331.04 SF	2.24	25.95	153.50	920.98	3/50 yrs Avg.	(46.05) 6.00%	874.93
82. Final cleaning - construction - Residential							
331.04 SF	0.36	11.80	23.84	154.81			154.81
Totals: Living Room		114.57	1,273.30	7,651.42		439.94	7,211.48

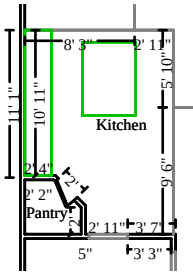

Kitchen

Height: 8' 9"

170.16 SF Walls	153.61 SF Ceiling
323.77 SF Walls & Ceiling	131.61 SF Floor
34.06 LF Ceil. Perimeter	9.52 LF Floor Perimeter

Missing Wall - Goes to Floor	2' 10 13/16" X 6' 8"	Opens into FORMAL_DININ
Missing Wall	9' 6 3/8" X 8' 9"	Opens into ENTRY_FOYER
Missing Wall	5' 9 5/8" X 8' 9"	Opens into LIVING_ROOM
Missing Wall	2' 11" X 8' 9"	Opens into LIVING_ROOM
Missing Wall	8' 3" X 8' 9"	Opens into BREAKFAST

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
83. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
323.77 SF	1.20	5.61	78.82	472.95	3/15 yrs Avg.	(78.82) 20.00%	394.13
84. Baseboard - 6"							
9.52 LF	6.25	2.82	12.46	74.78	3/150 yrs Avg.	(1.25) 2.00%	73.53

State Farm

SABBINENI, PRAVEEN KUMAR


43-87F8-12B1

CONTINUED - Kitchen

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
85. Seal (1 coat) & paint (1 coat) baseboard							
9.52 LF	1.91	0.12	3.66	21.96	3/15 yrs Avg.	(3.66) 20.00%	18.30
86. Detach & Reset Cooktop - electric							
1.00 EA	254.21	0.00	50.84	305.05			305.05
87. Detach & Reset Microwave drawer							
1.00 EA	201.63	0.00	40.32	241.95			241.95
88. Detach & Reset Built-in oven							
1.00 EA	345.46	0.00	69.10	414.56			414.56
89. Detach & Reset Dishwasher							
1.00 EA	368.00	0.00	73.60	441.60			441.60
90. Detach & Reset Refrigerator - top freezer - 22 to 24 cf							
1.00 EA	60.05	0.00	12.02	72.07			72.07
91. Countertop - Granite or Marble							
43.83 SF	72.36	109.89	656.28	3,937.71	3/150 yrs Avg.	(65.63) 2.00%	3,872.08
Includes: Granite or marble countertop and/or backsplash, sink cutouts, caulk, and installation labor.							
92. Add on for undermount sink cutout & polish - single basin							
1.00 EA	192.55	0.00	38.52	231.07	3/150 yrs Avg.	(3.85) 2.00%	227.22
Includes: Additional labor charge to cut out for undermount sink and polish edging in natural stone.							
93. Detach & Reset Sink - single							
1.00 EA	236.22	0.07	47.26	283.55			283.55
Includes: On-site storage, caulking, and labor.							
94. Cabinetry - lower (base) units							
10.00 LF	261.93	177.60	559.38	3,356.28	3/50 yrs Avg.	(167.82) 6.00%	3,188.46
Includes: Factory built, pre-finished (stained, painted, etc.) cabinets and installation labor.							
Quality: Average grade plywood/particleboard box construction (1/2" - 3/4") with simulated wood grain or white veneer on interior.							
Doors, drawer fronts, and face frames of hardwood or paint-grade construction. Hardware consists of concealed hinges and side mount drawer hardware. Veneer/ply toe kicks.							
95. R&R Cabinetry - upper (wall) units							
16.00 LF	183.90	168.96	622.28	3,733.64	3/50 yrs Avg.	(177.81) 6.00%	3,555.83
Includes: Factory built, pre-finished (stained, painted, etc.) cabinets and installation labor. Labor cost to remove upper cabinets and to discard in a job-site waste receptacle.							
Quality: Average grade plywood/particleboard box construction (1/2" - 3/4") with simulated wood grain or white veneer on interior.							
Doors, drawer fronts, and face frames of hardwood or paint-grade construction. Hardware consists of concealed hinges.							
96. R&R Cabinet knob or pull							
24.00 EA	10.91	7.01	53.78	322.63	3/20 yrs Avg.	(35.14) 15.00%	287.49
97. Seal & paint cabinetry - lower - inside and out							
10.00 LF	57.82	4.97	116.64	699.81	3/15 yrs Avg.	(116.63) 20.00%	583.18

CONTINUED - Kitchen

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
98. Seal & paint cabinetry - upper - inside and out							
16.00 LF	49.42	6.64	159.46	956.82	3/15 yrs Avg.	(159.47) 20.00%	797.35
99. R&R Tile floor covering - per specs from ind. tile analysis							
131.61 SF	9.95	8.58	263.62	1,581.72	3/100 yrs Avg.	(27.42) 3.00%	1,554.30
100. Floor leveling cement - Light							
131.61 SF	2.24	10.31	61.02	366.14	3/50 yrs Avg.	(18.31) 6.00%	347.83
101. Final cleaning - construction - Residential							
131.61 SF	0.36	4.69	9.48	61.55			61.55
Totals: Kitchen		507.27	2,928.54	17,575.84		855.81	16,720.03

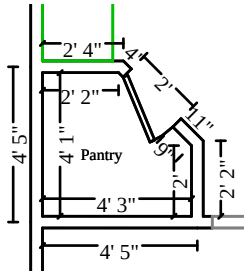

Pantry

Height: 9'

138.86 SF Walls	15.16 SF Ceiling
154.02 SF Walls & Ceiling	15.16 SF Floor
15.43 LF Ceil. Perimeter	15.43 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
102. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
154.02 SF	1.20	2.67	37.50	224.99	3/15 yrs Avg.	(37.49) 20.00%	187.50
* 103. Seal & paint door trim & jamb - Large (per side)							
3.00 EA	47.15	1.73	28.64	171.82	3/15 yrs Avg.	(28.64) 20.00%	143.18
104. Seal & paint door slab only (per side)							
3.00 EA	47.79	2.41	29.16	174.94	3/15 yrs Avg.	(29.15) 20.00%	145.79
105. Seal (1 coat) & paint (1 coat) baseboard							
15.43 LF	1.91	0.19	5.94	35.60	3/15 yrs Avg.	(5.93) 20.00%	29.67
106. R&R Tile floor covering - per specs from ind. tile analysis							
15.16 SF	9.95	0.99	30.36	182.19	3/100 yrs Avg.	(3.16) 3.00%	179.03


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Pantry

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
107. Floor leveling cement - Light							
15.16 SF	2.24	1.19	7.04	42.19	3/50 yrs Avg.	(2.11) 6.00%	40.08
108. Final cleaning - construction - Residential							
15.16 SF	0.36	0.54	1.10	7.10			7.10
Totals: Pantry		9.72	139.74	838.83		106.48	732.35

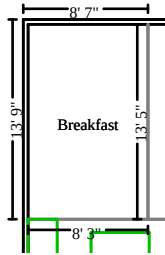

Breakfast

Height: 9'

210.48 SF Walls	110.69 SF Ceiling
321.17 SF Walls & Ceiling	110.69 SF Floor
43.33 LF Ceil. Perimeter	21.67 LF Floor Perimeter

Missing Wall

8' 3" X 9'

Opens into KITCHEN

Missing Wall

13' 5" X 9'

Opens into LIVING_ROOM

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
109. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
321.17 SF	1.20	5.56	78.20	469.16	3/15 yrs Avg.	(78.19) 20.00%	390.97
* 110. Seal & paint door trim & jamb - Large (per side)							
3.00 EA	47.15	1.73	28.64	171.82	3/15 yrs Avg.	(28.64) 20.00%	143.18
111. Seal & paint door slab only (per side)							
3.00 EA	47.79	2.41	29.16	174.94	3/15 yrs Avg.	(29.15) 20.00%	145.79
112. Seal (1 coat) & paint (1 coat) baseboard							
21.67 LF	1.91	0.27	8.34	50.00	3/15 yrs Avg.	(8.33) 20.00%	41.67
113. R&R Tile floor covering - per specs from ind. tile analysis							
110.69 SF	9.95	7.21	221.72	1,330.30	3/100 yrs Avg.	(23.07) 3.00%	1,307.23
114. Floor leveling cement - Light							
110.69 SF	2.24	8.68	51.34	307.97	3/50 yrs Avg.	(15.40) 6.00%	292.57
115. Final cleaning - construction - Residential							
110.69 SF	0.36	3.95	7.98	51.78			51.78


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Breakfast

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
Totals: Breakfast		29.81	425.38	2,555.97		182.78	2,373.19

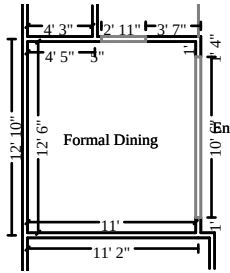

Formal Dining

Height: 9'

333.66 SF Walls	137.50 SF Ceiling
471.16 SF Walls & Ceiling	137.50 SF Floor
47.00 LF Ceil. Perimeter	33.60 LF Floor Perimeter

Missing Wall - Goes to Floor

10' 6" X 6' 8"

Opens into ENTRY_FOYER

Missing Wall - Goes to Floor

2' 10 13/16" X 6' 8"


Opens into KITCHEN

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
116. 1/2" - drywall per LF - up to 2' tall							
33.60 LF	12.87	3.88	87.26	523.57	3/150 yrs Avg.	(8.73) 2.00%	514.84
117. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
471.16 SF	1.20	8.16	114.72	688.27	3/15 yrs Avg.	(114.71) 20.00%	573.56
118. Baseboard - 6"							
33.60 LF	6.25	9.95	44.00	263.95	3/150 yrs Avg.	(4.40) 2.00%	259.55
119. Seal (1 coat) & paint (1 coat) baseboard							
33.60 LF	1.91	0.42	12.92	77.52	3/15 yrs Avg.	(12.92) 20.00%	64.60
120. R&R Tile floor covering - per specs from ind. tile analysis							
137.50 SF	9.95	8.96	275.42	1,652.51	3/100 yrs Avg.	(28.65) 3.00%	1,623.86
121. Floor leveling cement - Light							
137.50 SF	2.24	10.78	63.76	382.54	3/50 yrs Avg.	(19.13) 6.00%	363.41
122. Final cleaning - construction - Residential							
137.50 SF	0.36	4.90	9.90	64.30			64.30
Totals: Formal Dining		47.05	607.98	3,652.66		188.54	3,464.12

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

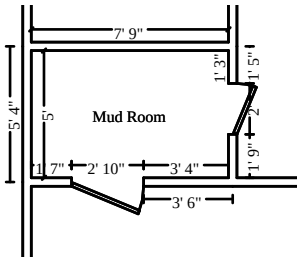


Mud Room

Height: 9'

229.50 SF Walls	38.75 SF Ceiling
268.25 SF Walls & Ceiling	38.75 SF Floor
25.50 LF Ceil. Perimeter	25.50 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
123. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
268.25 SF	1.20	4.65	65.32	391.87	3/15 yrs Avg.	(65.31) 20.00%	326.56
* 124. Seal & paint door trim & jamb - Large (per side)							
3.00 EA	47.15	1.73	28.64	171.82	3/15 yrs Avg.	(28.64) 20.00%	143.18
125. Seal & paint door slab only (per side)							
3.00 EA	47.79	2.41	29.16	174.94	3/15 yrs Avg.	(29.15) 20.00%	145.79
126. Seal & paint bookcase							
50.00 SF	3.21	2.81	32.66	195.97	3/15 yrs Avg.	(32.66) 20.00%	163.31
127. Baseboard - 6"							
25.50 LF	6.25	7.55	33.40	200.33	3/150 yrs Avg.	(3.34) 2.00%	196.99
128. Seal (1 coat) & paint (1 coat) baseboard							
25.50 LF	1.91	0.32	9.80	58.83	3/15 yrs Avg.	(9.80) 20.00%	49.03
129. R&R Tile floor covering - per specs from ind. tile analysis							
38.75 SF	9.95	2.53	77.62	465.71	3/100 yrs Avg.	(8.08) 3.00%	457.63
130. Floor leveling cement - Light							
38.75 SF	2.24	3.04	17.96	107.80	3/50 yrs Avg.	(5.39) 6.00%	102.41
131. Final cleaning - construction - Residential							
38.75 SF	0.36	1.38	2.80	18.13			18.13
Totals: Mud Room		26.42	297.36	1,785.40		182.37	1,603.03

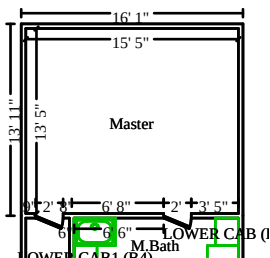

Master

Height: 9'


519.00 SF Walls	206.84 SF Ceiling
725.84 SF Walls & Ceiling	206.84 SF Floor
57.67 LF Ceil. Perimeter	57.67 LF Floor Perimeter

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
132. R&R Ceiling fan & light							
1.00 EA	508.09	12.48	104.12	624.69	3/20 yrs Avg.	(74.60) 15.00%	550.09
133. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
725.84 SF	1.20	12.58	176.72	1,060.31	3/15 yrs Avg.	(176.72) 20.00%	883.59
134. Baseboard - 3 1/4"							
57.67 LF	4.21	8.99	50.36	302.14	3/150 yrs Avg.	(5.04) 2.00%	297.10
135. Seal (1 coat) & paint (1 coat) baseboard							
57.67 LF	1.91	0.71	22.18	133.04	3/15 yrs Avg.	(22.17) 20.00%	110.87
* 136. Paint door trim & jamb - 1 coat (per side)							
1.00 EA	27.02	0.35	5.48	32.85	3/15 yrs Avg.	(5.47) 20.00%	27.38
137. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
138. Carpet pad							
206.84 SF	0.66	9.21	29.14	174.86	3/10 yrs Avg.	(43.71) 30.00%	131.15
139. Carpet							
206.84 SF	3.82	50.85	168.20	1,009.18	3/10 yrs Avg.	(252.30) 30.00%	756.88
140. Final cleaning - construction - Residential							
206.84 SF	0.36	7.37	14.90	96.73			96.73
Totals: Master		103.34	580.82	3,492.11		589.73	2,902.38

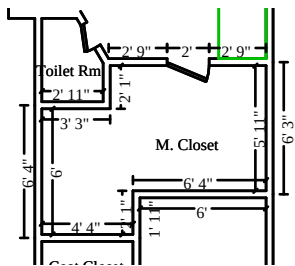

M. Closet

Height: 9'

336.50 SF Walls	65.82 SF Ceiling
402.33 SF Walls & Ceiling	65.82 SF Floor
37.39 LF Ceil. Perimeter	37.39 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
141. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
402.33 SF	1.20	6.97	97.96	587.73	3/15 yrs Avg.	(97.95) 20.00%	489.78
142. Baseboard - 3 1/4"							
37.39 LF	4.21	5.83	32.64	195.88	3/150 yrs Avg.	(3.27) 2.00%	192.61


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - M. Closet

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
143. Seal (1 coat) & paint (1 coat) baseboard							
37.39 LF	1.91	0.46	14.38	86.25	3/15 yrs Avg.	(14.37) 20.00%	71.88
* 144. Paint door trim & jamb - 1 coat (per side)							
1.00 EA	27.02	0.35	5.48	32.85	3/15 yrs Avg.	(5.47) 20.00%	27.38
145. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
146. Carpet pad							
65.82 SF	0.66	2.93	9.26	55.63	3/10 yrs Avg.	(13.91) 30.00%	41.72
147. Carpet							
65.82 SF	3.82	16.18	53.52	321.13	3/10 yrs Avg.	(80.28) 30.00%	240.85
148. Final cleaning - construction - Residential							
65.82 SF	0.36	2.35	4.74	30.79			30.79
Totals: M. Closet		35.87	227.70	1,368.57		224.97	1,143.60

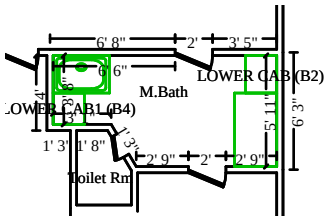

M.Bath

Height: 9'

221.90 SF Walls	62.05 SF Ceiling
283.95 SF Walls & Ceiling	41.12 SF Floor
34.70 LF Ceil. Perimeter	16.53 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
149. Detach & Reset Bath accessory							
1.00 EA	17.71	0.00	3.54	21.25			21.25
150. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
283.95 SF	1.20	4.92	69.12	414.78	3/15 yrs Avg.	(69.13) 20.00%	345.65
151. Seal (1 coat) & paint (1 coat) baseboard							
16.53 LF	1.91	0.20	6.36	38.13	3/15 yrs Avg.	(6.35) 20.00%	31.78


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - M.Bath

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
* 152. Paint door trim & jamb - 1 coat (per side)							
1.00 EA	27.02	0.35	5.48	32.85	3/15 yrs Avg.	(5.47) 20.00%	27.38
153. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
154. Final cleaning - construction - Residential							
41.12 SF	0.36	1.46	2.96	19.22			19.22
Totals: M.Bath		7.73	97.18	584.54		90.67	493.87

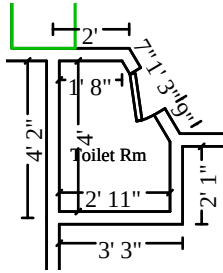

Toilet Rm

Height: 9'


115.67 SF Walls	10.23 SF Ceiling
125.90 SF Walls & Ceiling	10.23 SF Floor
12.85 LF Ceil. Perimeter	12.85 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
155. Detach & Reset Bath accessory							
1.00 EA	17.71	0.00	3.54	21.25			21.25
156. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
125.90 SF	1.20	2.18	30.66	183.92	3/15 yrs Avg.	(30.66) 20.00%	153.26
157. Seal (1 coat) & paint (1 coat) baseboard							
12.85 LF	1.91	0.16	4.94	29.64	3/15 yrs Avg.	(4.94) 20.00%	24.70
* 158. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55
159. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
Totals: Toilet Rm		3.63	56.98	341.78		53.43	288.35

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

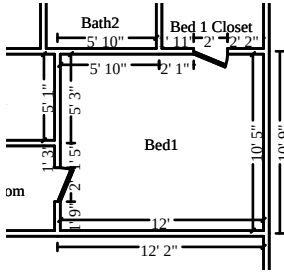


Bed1

Height: 9'

403.50 SF Walls	125.00 SF Ceiling
528.50 SF Walls & Ceiling	125.00 SF Floor
44.83 LF Ceil. Perimeter	44.83 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
160. R&R Ceiling fan & light							
1.00 EA	508.09	12.48	104.12	624.69	3/20 yrs Avg.	(74.60) 15.00%	550.09
161. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
528.50 SF	1.20	9.16	128.68	772.04	3/15 yrs Avg.	(128.67) 20.00%	643.37
162. Baseboard - 3 1/4"							
44.83 LF	4.21	6.99	39.14	234.86	3/150 yrs Avg.	(3.91) 2.00%	230.95
163. Seal (1 coat) & paint (1 coat) baseboard							
44.83 LF	1.91	0.55	17.24	103.42	3/15 yrs Avg.	(17.24) 20.00%	86.18
164. Carpet pad							
125.00 SF	0.66	5.57	17.62	105.69	3/10 yrs Avg.	(26.42) 30.00%	79.27
165. Carpet							
125.00 SF	3.82	30.73	101.64	609.87	3/10 yrs Avg.	(152.47) 30.00%	457.40
166. Final cleaning - construction - Residential							
125.00 SF	0.36	4.45	9.00	58.45			58.45
Totals: Bed1		69.93	417.44	2,509.02		403.31	2,105.71

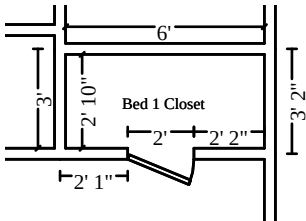

Bed 1 Closet

Height: 9'

159.00 SF Walls	17.00 SF Ceiling
176.00 SF Walls & Ceiling	17.00 SF Floor
17.67 LF Ceil. Perimeter	17.67 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
----------	------------	-----	-------	-----	-----------------------	------------------	-----


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bed 1 Closet

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
167. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
176.00 SF	1.20	3.05	42.86	257.11	3/15 yrs Avg.	(42.85) 20.00%	214.26
168. Baseboard - 3 1/4"							
17.67 LF	4.21	2.76	15.44	92.59	3/150 yrs Avg.	(1.55) 2.00%	91.04
169. Seal (1 coat) & paint (1 coat) baseboard							
17.67 LF	1.91	0.22	6.80	40.77	3/15 yrs Avg.	(6.79) 20.00%	33.98
170. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
* 171. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55
172. Carpet pad							
17.00 SF	0.66	0.76	2.40	14.38	3/10 yrs Avg.	(3.60) 30.00%	10.78
173. Carpet							
17.00 SF	3.82	4.18	13.82	82.94	3/10 yrs Avg.	(20.73) 30.00%	62.21
174. Final cleaning - construction - Residential							
17.00 SF	0.36	0.60	1.22	7.94			7.94
Totals: Bed 1 Closet		12.86	100.38	602.70		93.35	509.35

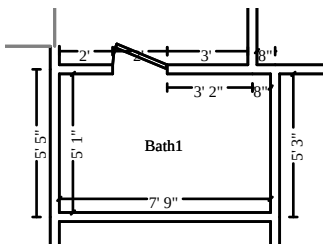

Bath1

Height: 9'

231.00 SF Walls	39.40 SF Ceiling
270.40 SF Walls & Ceiling	39.40 SF Floor
25.67 LF Ceil. Perimeter	25.67 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
175. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
270.40 SF	1.20	4.68	65.84	395.00	3/15 yrs Avg.	(65.84) 20.00%	329.16


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bath1

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
176. Seal (1 coat) & paint (1 coat) baseboard							
25.67 LF	1.91	0.32	9.86	59.21	3/15 yrs Avg.	(9.87) 20.00%	49.34
177. Toilet - Detach & reset							
1.00 EA	382.55	0.79	76.68	460.02			460.02
Includes: On site storage, wax ring, brass mounting bolts, caulking, bag, and labor.							
178. R&R Vanity top - one sink - cultured marble							
4.00 LF	103.34	20.36	86.76	520.48	3/20 yrs Avg.	(61.87) 15.00%	458.61
Includes: One-piece cultured marble vanity top with molded sink and 4" backsplash, caulk, and installation labor. Labor cost to remove a cultured marble vanity top and to discard in a job-site waste receptacle.							
179. P-trap assembly - Detach & reset							
1.00 EA	94.10	0.00	18.82	112.92			112.92
180. Seal & paint vanity - inside and out							
4.00 LF	47.79	1.88	38.62	231.66	3/15 yrs Avg.	(38.61) 20.00%	193.05
181. Detach & Reset Cabinet knob or pull							
3.00 EA	2.96	0.00	1.78	10.66			10.66
182. R&R Tile floor covering - per specs from ind. tile analysis							
39.40 SF	9.95	2.57	78.94	473.54	3/100 yrs Avg.	(8.21) 3.00%	465.33
183. Floor leveling cement - Light							
39.40 SF	2.24	3.09	18.28	109.63	3/50 yrs Avg.	(5.49) 6.00%	104.14
184. Final cleaning - construction - Residential							
39.40 SF	0.36	1.40	2.84	18.42			18.42
Totals: Bath1		35.09	398.42	2,391.54		189.89	2,201.65

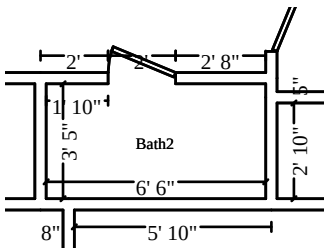

Bath2

Height: 9'

178.22 SF Walls	22.11 SF Ceiling
200.33 SF Walls & Ceiling	22.11 SF Floor
19.80 LF Ceil. Perimeter	19.80 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
185. Detach & Reset Bath accessory							
1.00 EA	17.71	0.00	3.54	21.25			21.25


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Bath2

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
186. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
200.33 SF	1.20	3.47	48.78	292.65	3/15 yrs Avg.	(48.77) 20.00%	243.88
187. Seal (1 coat) & paint (1 coat) baseboard							
19.80 LF	1.91	0.25	7.62	45.69	3/15 yrs Avg.	(7.61) 20.00%	38.08
* 188. Seal & paint door trim & jamb - (per side)							
1.00 EA	40.05	0.49	8.12	48.66	3/15 yrs Avg.	(8.11) 20.00%	40.55
189. Seal & paint door slab only (per side)							
1.00 EA	47.79	0.80	9.72	58.31	3/15 yrs Avg.	(9.72) 20.00%	48.59
Totals: Bath2		5.01	77.78	466.56		74.21	392.35

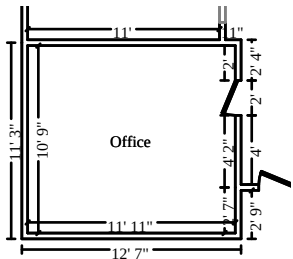

Office

Height: 9'

407.72 SF Walls	127.94 SF Ceiling
535.65 SF Walls & Ceiling	127.94 SF Floor
45.30 LF Ceil. Perimeter	45.30 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
190. Batt insulation - 4" - R13 - unfaced batt							
535.65 SF	1.05	28.72	118.22	709.37	3/150 yrs Avg.	(11.82) 2.00%	697.55
191. Blown-in insulation - 12" depth - R30							
127.94 SF	1.64	12.67	44.50	266.99	3/150 yrs Avg.	(4.45) 2.00%	262.54
192. 1/2" drywall - hung, taped, floated, ready for paint							
407.72 SF	3.13	20.86	259.42	1,556.44	3/150 yrs Avg.	(25.94) 2.00%	1,530.50
193. 5/8" drywall - hung, taped, floated, ready for paint							
127.94 SF	3.25	7.18	84.60	507.59	3/150 yrs Avg.	(8.46) 2.00%	499.13
194. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
535.65 SF	1.20	9.28	130.42	782.48	3/15 yrs Avg.	(130.42) 20.00%	652.06


State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Office

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
195. Smoke detector							
1.00 EA	85.87	2.53	17.68	106.08	3/10 yrs Avg.	(26.52) 30.00%	79.56
196. R&R Recessed light fixture							
4.00 EA	196.65	12.04	159.72	958.36	3/20 yrs Avg.	(111.57) 15.00%	846.79
197. Baseboard - 6"							
45.30 LF	6.25	13.42	59.30	355.85	3/150 yrs Avg.	(5.93) 2.00%	349.92
198. Seal (1 coat) & paint (1 coat) baseboard							
45.30 LF	1.91	0.56	17.42	104.50	3/15 yrs Avg.	(17.41) 20.00%	87.09
199. R&R Tile floor covering - per specs from ind. tile analysis							
127.94 SF	9.95	8.34	256.26	1,537.61	3/100 yrs Avg.	(26.66) 3.00%	1,510.95
200. Floor leveling cement - Light							
127.94 SF	2.24	10.03	59.32	355.94	3/50 yrs Avg.	(17.80) 6.00%	338.14
201. Final cleaning - construction - Residential							
127.94 SF	0.36	4.56	9.22	59.84			59.84
Totals: Office		130.19	1,216.08	7,301.05		386.98	6,914.07

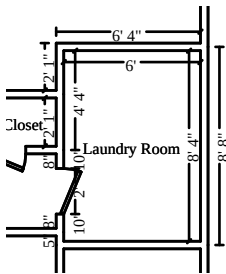

Laundry Room

Height: 9'

258.56 SF Walls	50.19 SF Ceiling
308.75 SF Walls & Ceiling	50.19 SF Floor
28.73 LF Ceil. Perimeter	28.73 LF Floor Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
202. Detach & Reset Washer/Washing Machine - Top-loading							
1.00 EA	58.42	0.00	11.68	70.10			70.10
203. Detach & Reset Dryer - Electric							
1.00 EA	45.03	0.00	9.00	54.03			54.03
204. Seal/prime (1 coat) then paint (1 coat) the walls and ceiling							
308.75 SF	1.20	5.35	75.18	451.03	3/15 yrs Avg.	(75.17) 20.00%	375.86

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

CONTINUED - Laundry Room

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
* 205. Seal & paint door trim & jamb - Large (per side)							
3.00 EA	47.15	1.73	28.64	171.82	3/15 yrs Avg.	(28.64) 20.00%	143.18
206. Seal & paint door slab only (per side)							
3.00 EA	47.79	2.41	29.16	174.94	3/15 yrs Avg.	(29.15) 20.00%	145.79
207. Baseboard - 6"							
28.73 LF	6.25	8.51	37.62	225.69	3/150 yrs Avg.	(3.76) 2.00%	221.93
208. Seal (1 coat) & paint (1 coat) baseboard							
28.73 LF	1.91	0.36	11.06	66.29	3/15 yrs Avg.	(11.04) 20.00%	55.25
209. R&R Tile floor covering - per specs from ind. tile analysis							
50.19 SF	9.95	3.27	100.54	603.20	3/100 yrs Avg.	(10.46) 3.00%	592.74
210. Floor leveling cement - Light							
50.19 SF	2.24	3.93	23.26	139.62	3/50 yrs Avg.	(6.99) 6.00%	132.63
211. Final cleaning - construction - Residential							
50.19 SF	0.36	1.79	3.62	23.48			23.48
Totals: Laundry Room		27.35	329.76	1,980.20		165.21	1,814.99

Debris Removal

0.00 SF Walls	0.00 SF Ceiling	0.00 SF Walls & Ceiling
0.00 SF Floor	0.00 SF Short Wall	0.00 LF Floor Perimeter
0.00 SF Long Wall		0.00 LF Ceil. Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
212. Tandem axle dump trailer - per load - including dump fees							
1.00 EA	320.87	0.00	64.18	385.05			385.05
Totals: Debris Removal		0.00	64.18	385.05		0.00	385.05

HVAC

0.00 SF Walls	0.00 SF Ceiling	0.00 SF Walls & Ceiling
0.00 SF Floor	0.00 SF Short Wall	0.00 LF Floor Perimeter

State Farm

SABBINENI, PRAVEEN KUMAR
0.00 SF Long Wall

43-87F8-12B1
0.00 LF Ceil. Perimeter

QUANTITY	UNIT PRICE	TAX	GCO&P	RCV	AGE/LIFE CONDITION	DEPREC. DEP %	ACV
* 213. HVACI (Bid Item)							
1.00 EA	31,881.04 *	0.00	6,376.20	38,257.24	Avg.	(12,752.42) 40.00%	25,504.82
Totals: HVAC		0.00	6,376.20	38,257.24		12,752.42	25,504.82
Area Totals: Main Level							
6,480.77 SF Walls		2,094.51 SF Ceiling			8,575.28 SF Walls and Ceiling		
2,051.59 SF Floor		2,248.11 Total Area			613.78 LF Floor Perimeter		
2,051.59 Floor Area		242.00 Exterior Perimeter			717.33 LF Ceil. Perimeter		
2,440.79 Exterior Wall Area		of Walls			6,480.77 Interior Wall Area		
Total: Main Level		1,249.08	16,704.14	100,279.82		17,511.12	82,768.70
Line Item Totals: 43-87F8-12B1		1,657.27	19,301.38	115,862.72		20,326.57	95,536.15

Grand Total Areas:

9,700.48 SF Walls	2,855.58 SF Ceiling	12,556.06 SF Walls and Ceiling
2,806.47 SF Floor		926.68 LF Floor Perimeter
		1,047.47 LF Ceil. Perimeter
2,806.47 Floor Area	3,095.25 Total Area	8,796.56 Interior Wall Area
4,115.03 Exterior Wall Area	403.78 Exterior Perimeter of Walls	

Trade Summary

Includes all applicable Tax, General Contractor O&P, and Labor Minimums

DESCRIPTION	LINE ITEM QTY	REPL. COST TOTAL	GCO&P	ACV	NON-REC. DEPREC.	MAX ADDL. AMT AVAIL.
APP APPLIANCES						
Detach & Reset Cooktop - electric	1.00 EA	\$305.05	\$50.84	\$305.05	\$0.00	\$0.00
Detach & Reset Dryer - Electric	1.00 EA	\$54.03	\$9.00	\$54.03	\$0.00	\$0.00
Detach & Reset Dishwasher	1.00 EA	\$441.60	\$73.60	\$441.60	\$0.00	\$0.00
Detach & Reset Microwave drawer	1.00 EA	\$241.95	\$40.32	\$241.95	\$0.00	\$0.00
Detach & Reset Built-in oven	1.00 EA	\$414.56	\$69.10	\$414.56	\$0.00	\$0.00
Detach & Reset Refrigerator - top freezer - 22 to 24 cf	1.00 EA	\$72.07	\$12.02	\$72.07	\$0.00	\$0.00
Detach & Reset Washer/Washing Machine - Top-loading	1.00 EA	\$70.10	\$11.68	\$70.10	\$0.00	\$0.00
TOTAL APPLIANCES		\$1,599.36	\$266.56	\$1,599.36	\$0.00	\$0.00
CAB CABINETRY						
Countertop - Granite or Marble	43.83 SF	\$3,937.71	\$656.28	\$3,872.08	\$0.00	\$65.63
Add on for undermount sink cutout & polish - single basin	1.00 EA	\$231.07	\$38.52	\$227.22	\$0.00	\$3.85
Cabinet knob or pull	24.00 EA	\$281.15	\$46.86	\$246.01	\$0.00	\$35.14
Detach & Reset Cabinet knob or pull	6.00 EA	\$21.32	\$3.56	\$21.32	\$0.00	\$0.00
Cabinetry - lower (base) units	10.00 LF	\$3,356.28	\$559.38	\$3,188.46	\$0.00	\$167.82
Cabinetry - upper (wall) units	16.00 LF	\$3,556.24	\$592.72	\$3,378.43	\$0.00	\$177.81
TOTAL CABINETRY		\$11,383.77	\$1,897.32	\$10,933.52	\$0.00	\$450.25
CLN CLEANING						
Final cleaning - construction - Residential	1,629.54 SF	\$762.07	\$117.38	\$762.07	\$0.00	\$0.00
TOTAL CLEANING		\$762.07	\$117.38	\$762.07	\$0.00	\$0.00
DMO GENERAL DEMOLITION						
Remove Cabinet knob or pull	24.00 EA	\$41.48	\$6.92	\$41.48	\$0.00	\$0.00
Remove Cabinetry - upper (wall) units	16.00 LF	\$177.40	\$29.56	\$177.40	\$0.00	\$0.00
Tandem axle dump trailer - per load - including dump fees	1.00 EA	\$385.05	\$64.18	\$385.05	\$0.00	\$0.00
Remove Tile floor covering - per specs from ind. tile analysis	1,156.80 SF	\$4,261.65	\$710.28	\$4,261.65	\$0.00	\$0.00
Remove Ceiling fan & light	2.00 EA	\$55.70	\$9.28	\$55.70	\$0.00	\$0.00
Remove Ceiling fan & light	2.00 EA	\$55.70	\$9.28	\$55.70	\$0.00	\$0.00
Remove Ceiling fan & light - High grade	1.00 EA	\$27.85	\$4.64	\$27.85	\$0.00	\$0.00
Remove Recessed light fixture	4.00 EA	\$65.80	\$10.96	\$65.80	\$0.00	\$0.00
Remove Vanity top - one sink - cultured marble	8.00 LF	\$50.88	\$8.48	\$50.88	\$0.00	\$0.00
TOTAL GENERAL DEMOLITION		\$5,121.51	\$853.58	\$5,121.51	\$0.00	\$0.00

Note: Slight variances may be found within report sections due to rounding

Date: 8/29/2025 12:24 PM

Page: 30

Trade Summary

Includes all applicable Tax, General Contractor O&P, and Labor Minimums

DESCRIPTION	LINE ITEM QTY	REPL. COST TOTAL	GCO&P	ACV	NON-REC. DEPREC.	MAX ADDL. AMT AVAIL.
DRY DRYWALL						
1/2" drywall - hung, taped, floated, ready for paint	407.72 SF	\$1,556.44	\$259.42	\$1,530.50	\$0.00	\$25.94
1/2" drywall - hung, taped, heavy texture, ready for paint	48.00 SF	\$218.27	\$36.38	\$214.63	\$0.00	\$3.64
5/8" drywall - hung, taped, floated, ready for paint	127.94 SF	\$507.59	\$84.60	\$499.13	\$0.00	\$8.46
1/2" - drywall per LF - up to 2' tall	80.49 LF	\$1,254.24	\$209.04	\$1,233.33	\$0.00	\$20.91
TOTAL DRYWALL		\$3,536.54	\$589.44	\$3,477.59	\$0.00	\$58.95
ELE ELECTRICAL						
Smoke detector	1.00 EA	\$106.08	\$17.68	\$79.56	\$0.00	\$26.52
TOTAL ELECTRICAL		\$106.08	\$17.68	\$79.56	\$0.00	\$26.52
FCC FLOOR COVERING - CARPET						
Carpet	414.66 SF	\$2,023.12	\$337.18	\$1,517.34	\$0.00	\$505.78
Carpet	900.74 SF	\$4,394.79	\$732.50	\$3,296.09	\$0.00	\$1,098.70
Carpet pad	737.91 SF	\$623.87	\$103.98	\$467.89	\$0.00	\$155.98
Carpet pad	414.66 SF	\$350.56	\$58.42	\$262.92	\$0.00	\$87.64
Step charge for "waterfall" carpet installation	16.00 EA	\$199.97	\$33.34	\$149.98	\$0.00	\$49.99
TOTAL FLOOR COVERING - CARPET		\$7,592.31	\$1,265.42	\$5,694.22	\$0.00	\$1,898.09
FCT FLOOR COVERING - CERAMIC TILE						
Floor leveling cement - Light	1,156.80 SF	\$3,218.34	\$536.40	\$3,057.39	\$0.00	\$160.95
Tile floor covering - per specs from ind. tile analysis	1,156.80 SF	\$9,641.09	\$1,606.88	\$9,400.04	\$0.00	\$241.05
TOTAL FLOOR COVERING - CERAMIC TILE		\$12,859.43	\$2,143.28	\$12,457.43	\$0.00	\$402.00
FEE PERMITS AND FEES						
HVACI (Bid Item)	1.00 EA	\$38,257.24	\$6,376.20	\$25,504.82	\$0.00	\$12,752.42
TOTAL PERMITS AND FEES		\$38,257.24	\$6,376.20	\$25,504.82	\$0.00	\$12,752.42
FNC FINISH CARPENTRY / TRIMWORK						
Baseboard - 3 1/4"	157.56 LF	\$825.47	\$137.58	\$811.70	\$0.00	\$13.77
Baseboard - 4 1/4"	69.92 LF	\$444.71	\$74.12	\$437.30	\$0.00	\$7.41
Baseboard - 6"	250.71 LF	\$1,969.46	\$328.26	\$1,936.63	\$0.00	\$32.83
Casing - 2 1/4"	20.00 LF	\$70.31	\$11.72	\$69.14	\$0.00	\$1.17
TOTAL FINISH CARPENTRY / TRIMWORK		\$3,309.95	\$551.68	\$3,254.77	\$0.00	\$55.18
FNH FINISH HARDWARE						
Detach & Reset Bath accessory	3.00 EA	\$63.75	\$10.62	\$63.75	\$0.00	\$0.00

Note: Slight variances may be found within report sections due to rounding

Date: 8/29/2025 12:24 PM

Page: 31

Trade Summary

Includes all applicable Tax, General Contractor O&P, and Labor Minimums

DESCRIPTION	LINE ITEM QTY	REPL. COST TOTAL	GCO&P	ACV	NON-REC. DEPREC.	MAX ADDL. AMT AVAIL.
FNH FINISH HARDWARE						
TOTAL FINISH HARDWARE		\$63.75	\$10.62	\$63.75	\$0.00	\$0.00
INS INSULATION						
Blown-in insulation - 12" depth - R30	127.94 SF	\$266.99	\$44.50	\$262.54	\$0.00	\$4.45
Batt insulation - 4" - R13 - unfaced batt	535.65 SF	\$709.37	\$118.22	\$697.55	\$0.00	\$11.82
Batt insulation - 4" - R13 - paper / foil faced	48.00 SF	\$75.41	\$12.56	\$74.15	\$0.00	\$1.26
TOTAL INSULATION		\$1,051.77	\$175.28	\$1,034.24	\$0.00	\$17.53
LIT LIGHT FIXTURES						
Ceiling fan & light	2.00 EA	\$1,193.68	\$198.96	\$1,044.48	\$0.00	\$149.20
Ceiling fan & light	2.00 EA	\$1,193.68	\$198.96	\$1,044.48	\$0.00	\$149.20
Ceiling fan & light - High grade	1.00 EA	\$749.22	\$124.88	\$655.57	\$0.00	\$93.65
Recessed light fixture	4.00 EA	\$892.56	\$148.76	\$780.99	\$0.00	\$111.57
TOTAL LIGHT FIXTURES		\$4,029.14	\$671.56	\$3,525.52	\$0.00	\$503.62
MBL MARBLE - CULTURED OR NATURAL						
Vanity top - one sink - cultured marble	8.00 LF	\$990.08	\$165.04	\$866.34	\$0.00	\$123.74
TOTAL MARBLE - CULTURED OR NATURAL		\$990.08	\$165.04	\$866.34	\$0.00	\$123.74
PLM PLUMBING						
P-trap assembly - Detach & reset	2.00 EA	\$225.84	\$37.64	\$225.84	\$0.00	\$0.00
Detach & Reset Sink - single	1.00 EA	\$283.55	\$47.26	\$283.55	\$0.00	\$0.00
Toilet - Detach & reset	1.00 EA	\$460.02	\$76.68	\$460.02	\$0.00	\$0.00
TOTAL PLUMBING		\$969.41	\$161.58	\$969.41	\$0.00	\$0.00
PNT PAINTING						
Seal (1 coat) & paint (1 coat) baseboard	289.23 LF	\$667.27	\$111.24	\$556.08	\$0.00	\$111.19
Seal (1 coat) & paint (1 coat) baseboard	510.01 LF	\$1,176.59	\$196.16	\$980.54	\$0.00	\$196.05
Seal & paint bookcase	50.00 SF	\$195.97	\$32.66	\$163.31	\$0.00	\$32.66
Seal & paint door slab only (per side)	13.00 EA	\$758.04	\$126.36	\$631.69	\$0.00	\$126.35
Seal & paint door slab only (per side)	13.00 EA	\$758.07	\$126.36	\$631.75	\$0.00	\$126.32
Paint door trim & jamb - 1 coat (per side)	3.00 EA	\$98.55	\$16.44	\$82.14	\$0.00	\$16.41
Seal & paint door trim & jamb - (per side)	10.00 EA	\$486.55	\$81.16	\$405.46	\$0.00	\$81.09
Seal & paint door trim & jamb - (per side)	1.00 EA	\$48.66	\$8.12	\$40.55	\$0.00	\$8.11
Seal & paint door trim & jamb - Large (per side)	12.00 EA	\$687.28	\$114.56	\$572.72	\$0.00	\$114.56
Seal & paint door/window trim & jamb - Large (per side)	1.00 EA	\$57.29	\$9.56	\$47.74	\$0.00	\$9.55
Seal 1 coat & paint 1coat French door slab only	2.00 EA	\$220.98	\$36.84	\$184.15	\$0.00	\$36.83

Note: Slight variances may be found within report sections due to rounding

Date: 8/29/2025 12:24 PM

Page: 32

Trade Summary

Includes all applicable Tax, General Contractor O&P, and Labor Minimums

DESCRIPTION	LINE ITEM QTY	REPL. COST TOTAL	GCO&P	ACV	NON-REC. DEPREC.	MAX ADDL. AMT AVAIL.
PNT PAINTING						
(per side)						
Seal & paint cabinetry - lower - inside and out	10.00 LF	\$699.81	\$116.64	\$583.18	\$0.00	\$116.63
Seal/prime (1 coat) then paint (1 coat) the walls and ceiling	4,111.73 SF	\$6,006.44	\$1,001.12	\$5,005.37	\$0.00	\$1,001.07
Seal/prime (1 coat) then paint (1 coat) the walls and ceiling	7,279.32 SF	\$10,633.62	\$1,772.32	\$8,861.37	\$0.00	\$1,772.25
Seal & paint stair stringer - one side	46.80 LF	\$315.05	\$52.52	\$262.54	\$0.00	\$52.51
Seal & paint cabinetry - upper - inside and out	16.00 LF	\$956.82	\$159.46	\$797.35	\$0.00	\$159.47
Seal & paint vanity - inside and out	8.00 LF	\$463.32	\$77.24	\$386.10	\$0.00	\$77.22
TOTAL PAINTING		\$24,230.31	\$4,038.76	\$20,192.04	\$0.00	\$4,038.27
TOTALS		\$115,862.72	\$19,301.38	\$95,536.15	\$0.00	\$20,326.57

Note: Slight variances may be found within report sections due to rounding

Date: 8/29/2025 12:24 PM

Page: 33

State Farm

SABBINENI, PRAVEEN KUMAR

43-87F8-12B1

Recap by Room

Estimate: 43-87F8-12B1

Area: Level 2

Landing Closet	362.25	0.38%
Landing	3,067.94	3.23%
Hallway	1,262.28	1.33%
Stairs	1,715.51	1.81%
Bed3	2,159.07	2.28%
Bed 3 Closet	438.62	0.46%
Bed 2	1,468.72	1.55%
Bed 2 Closet	949.13	1.00%
Bathroom	966.15	1.02%
Linen Closet	187.80	0.20%

Area Subtotal: Level 2

12,577.47 13.25%

Area: Main Level

Entry/Foyer	4,988.93	5.26%
Coat Closet	378.25	0.40%
Living Room	6,263.55	6.60%
Kitchen	14,140.03	14.90%
Pantry	689.37	0.73%
Breakfast	2,100.78	2.21%
Formal Dining	2,997.63	3.16%
Mud Room	1,461.62	1.54%
Master	2,807.95	2.96%
M. Closet	1,105.00	1.16%
M.Bath	479.63	0.51%
Toilet Rm	281.17	0.30%
Bed1	2,021.65	2.13%
Bed 1 Closet	489.46	0.52%
Bath1	1,958.03	2.06%
Bath2	383.77	0.40%
Office	5,954.78	6.27%
Laundry Room	1,623.09	1.71%
Debris Removal	320.87	0.34%
HVAC	31,881.04	33.59%

Area Subtotal: Main Level


82,326.60 86.75%

Subtotal of Areas

94,904.07 100.00%

Total

94,904.07 100.00%

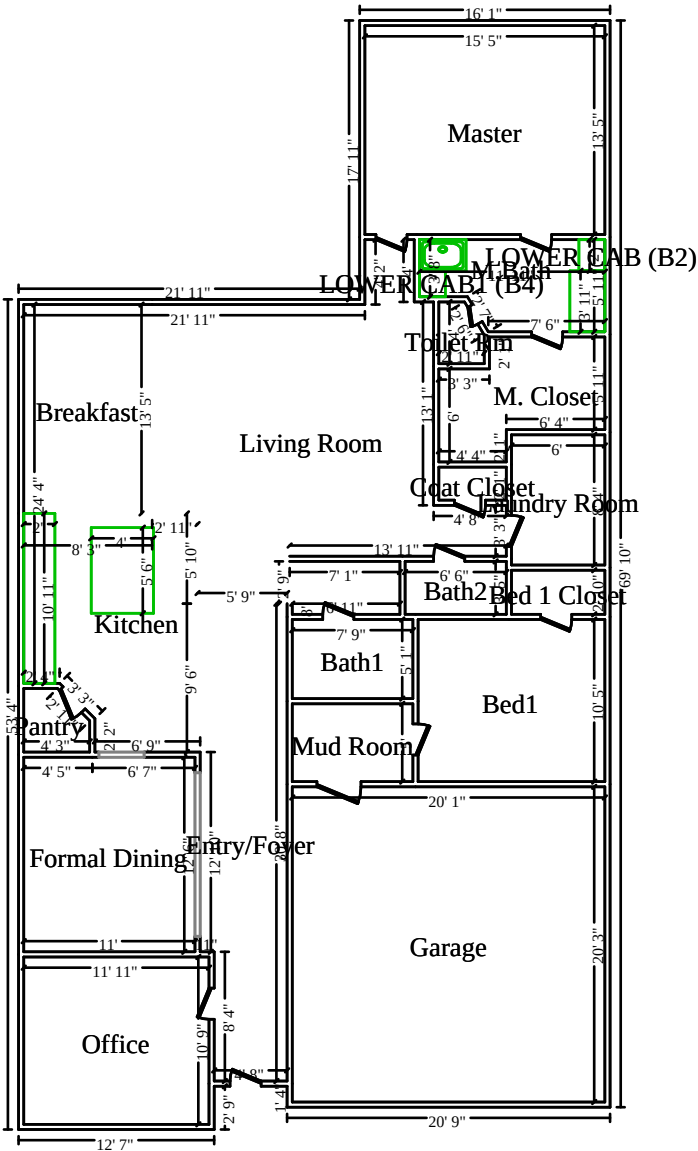

Main Level

