


SPLICE P	LATE	& B	OLT	TABLE					
Mark	Qty Top	Bot	Int	Туре	Dia	Length	Width	Thick	Length
SP-1 SP-2	4	4 4	0	A325 A325	1.000 0.625		8" 6"	5/8" 1/2"	4'-0 1/4" 2'-4 5/8"

MEMBER	TABLE			
	Web Depth	Web Plate	Outside Flange	Inside Flange
Mark	Start/End	Thick Length	W x Thk x Length	W x Thk x Length
RF1-1	15.0/38.0	0.164 131.2	8 x 1/4" x 168.7	8 x 1/2" x 133.1
	38.0/38.0		8 x 1/2" x 46.6	'
RF1-2	39.0/22.0		6 x 5/16" x 316.3	6 x 1/2" x 105.4
	22.0/22.0	0.150 218.8	,	6 x 3/8" x 215.0

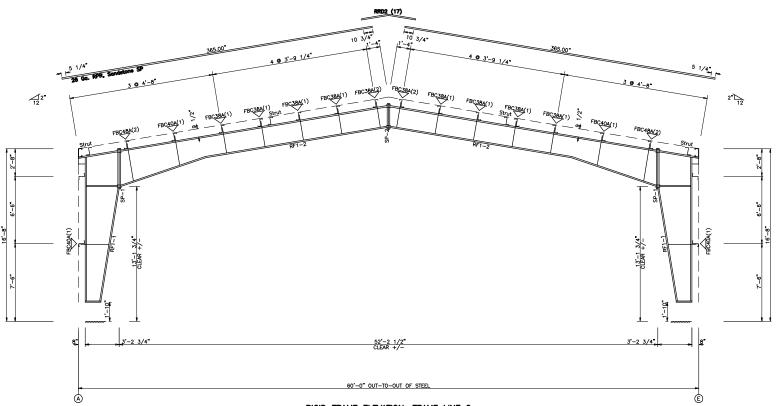

RIGID FRAME ELEVATION: FRAME LINE 2

GENERAL NOTES

- 1. INDICATES FLANGE BRACING LOCATIONS. (1) = ONE SIDE; (2) = TWO SIDES.
- IF FLANGE BRACING IS REQUIRED ON BOTH SIDES OF AN EXPANDABLE RIGID FRAME, THE OPPOSITE SIDE FLANGE BRACES WILL HAVE TO BE INSTALLED AT THE TIME OF FUTURE EXPANSION. THESE FLANGE BRACES HAVE BEEN PROVIDED, AS REQUIRED, FOR THIS FUTURE CONDITION.
- RIGID FRAMES SHALL HAVE 50% OF THEIR BOLTS INSTALLED AND TIGHTENED ON BOTH SIDES OF THE WEB ADJACENT TO EACH FLANGE BEFORE THE HOISTING EQUIPMENT IS RELEASED.
- 4. INTERIOR COLUMN METAL TAG IS ORIENTED TOWARD THE LOW EAVE OF THE BUILDING.

BROLEGIANE BROLE DURBANO 60 EAST LAYTON, UT CASTOREWAR ROCKWAR ROCKAMOUNTAIN STRUCTURES MORGAN, UT	Anchor Bolts for C		200	1	4	-
ENCLE DONDANO DO EASTORN, UT CUSTORIENWE ROCKY MOUNTAIN STRUCTURES MORGAN, UT		Anchor Bolts for Construction MBS CDC	BS CDC	Ē	180	03/20/2023
CESTOMER WINE ROCKY MOUNTAIN STRUCTURES MORGAN, UT	305 NDUSTRIAL PARKINA, WATERLOO, IN 45793 Building Department Review		OCO SBW	MFM	03	03/20/2023
CONCREWME ROCKY MOUNTAIN STRUCTURES MORGAN, UT	PHONE: (280) 837-7891 FAX: (280) 837-7384 REV 1 Anchor Boll	REV 1 Anchor Bolts for Const. MBS CDC	BS CDC	MFM	35	05/03/2023
MORGAN, UT			MBS	Ā	85	05/03/2023
MORGAN, UT		W	MBS CDC	MFM	02	05/04/2023
	1050 WALEY LANE, BRGHAM CITY, 01 84-302 PHONE: (425) 919—3100 FAX: (435) 919—3101					
SHEET JOB NUMBER SHEET TITLE						
3						

