

GENERAL NOTES:

CO BUILDING SYSTEMS RECOMMENDS THAT AT LEAST ONE BRACED BAY BE INSTALLED PRIOR TO OTHER FRAME LINES. THIS INCLUDES EAVE STRUTS, PURLIN STRUTS, WIND BENTS, AND BRACE CABLE/ROD OVER THE COMPLETE BAY. FAILURE TO DO SO MAY RESULT IN SERIOUS DAMAGE TO THE STRUCTURE AND/OR BODILY INJURY.

BOLT TABLE: FRAME LINE A					PLATE SIZE	
LOCATION	QUAN	TYPE	DIA	LENGTH	WIDTH THICK	LENGTH
Strut	2	Δ325	3/4"	1 1/2"	0.313	

TRIM TABLE FRAME LINE A

♦ID	MARK	COLOR	SENT LENGTH	FIELD-CUT LENGTH	DETAIL
123456	314 811 821 831 754 BBTM1	Burnished Slate Burnished Slate Burnished Slate Burnished Slate Burnished Slate Galvanized	15'-8" 17'-5" 4" 20'-6" 20'-6"	15'-8" 17'-5" 4" 20'-6" 20'-6"	TRIM_810 TRIM_150 TRIM_100 TRIM_100 TRIM_801 TRIM_801
		MEMB			

FRAME LINE A

E-1 E-2 E-3 G-21 G-22 G-23 G-24 ST-1 CB-1 CB-2 CB-3 GB-1

10E09_14 10E09_14 10E09_14 Z825_16

Z825_14 Z825_16 Z825_16 Z825_14

2825_14 08B14 1.25RD 1.25RD 1.25RD c635_16

SYSTEMS





IAS ACCREDITED
~

ACCREDITE
HANGAR
NO NO

LENGTH

21'-2 3/4"
21'-2 1/2"
21'-2 3/4"
22'-4 1/2"
22'-4 1/2"
22'-4 1/2"
22'-4 1/2"
20'-8"
20'-0"
7'-5 3/4"
7'-0 1/2"
7'-8"

CONNECTION PLATES
FRAME LINE A
DID MARK/PART
1 ESP
2 GBC4

CONSTRUCT WAY IT 84601 FRAMING WESTLAND (1331 SKY \supset SIDEWALL PROVO,

HANGAR

AIRCRAF

							_
REVISIONS	DESCRIPTION						
	REV DATE:						
	REV	\triangleleft	⋖	∢	∢	₫	٧



Dillon Corey Dillon Corey Thurston


Date: 2024.02.29

Thurston

DESIGN: DT DRAFT: CC CHECK: DATE: 2/12/24

^{JOB} #24011110

HEET	8	OF	14	REV (

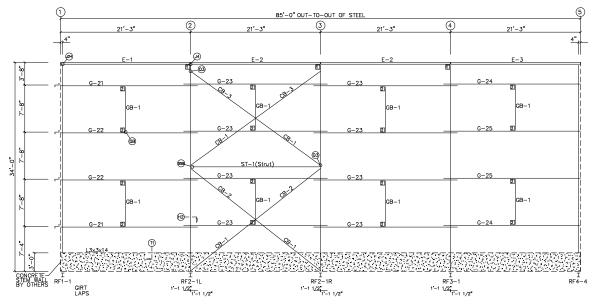

SIDEWALL FRAMING: FRAME LINE A

	1	(Gutter with 3 downspouts)	
♦		INSULATED METAL PANELS KINGSPAN KS SHADOWINE WITH 2" CORE EXTERIOR'S LE MEDOSSED 2469 — DIRITWOOD INTERIOR'S SL EMBOSSED 2660 — IMPERIAL WHITE EXTERIOR TRIM: BURNISHED ET BY CO BUILDINOS INTERIOR TRIM: IMPERIAL WHITE BY KINGSPAN SEE PANEL FASTENING SCHEDULE BY KINGSPAN	
	i 1	i Para-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana- Bana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-a-sana-	

SIDEWALL SHEETING & TRIM: FRAME LINE A

GENERAL NOTES:

CO BUILDING SYSTEMS RECOMMENDS THAT AT LEAST ONE BRACED BAY BE INSTALLED PRIOR TO OTHER FRAME LINES. THIS INCLUDES EAVE STRUTS, PURLIN STRUTS, WIND BENTS, AND BRACE CABLE/ROD OVER THE COMPLETE BAY. FAILURE TO DO SO MAY RESULT IN SERIOUS DAMAGE TO THE STRUCTURE AND/OR BODILY INJURY.

GIRT LAPS

BOLT TABLE: FRAME LINE G					PLATE SIZE	
LOCATION	QUAN	TYPE	DIA	LENGTH	WIDTH THICK	LENGTH
Strut	2	A325	3/4"	1 1/2"	0.313	

TRIM	TABLE
FRAM	IF LINE

			OFNIT		
♦ID M	ARK	COLOR	SENT LENGTH	FIELD-CUT LENGTH	DETAIL
2 8 3 8 4 8 5 7		Burnished Slate Burnished Slate Burnished Slate Burnished Slate Burnished Slate Galvanized	15'-8" 17'-5" 4" 20'-6" 20'-6"	15'-8" 17'-5" 4" 20'-6" 20'-6"	TRIM_810 TRIM_150 TRIM_100 TRIM_100 TRIM_801 TRIM_801

MEMBER FRAME	TABLE LINE G		
MARK	PART	LENGT	Ή
E-1 E-2 E-3 G-21 G-22 G-23 G-24 G-25 ST-1 CB-1 CB-1 CB-3 GB-1	10E09_1 10E09_1 10E09_1 12825_16 Z825_16 Z825_16 Z825_14 08B14 1.25RD 1.25RD 1.25RD c635_16	4 21'-2 4 21'-2 22'-4 22'-4 23'-6 22'-4 22'-4 20'-8 20'-0 7'-5	1/2" 1/2" 1/2" 1/2"

CONNECTION PLATES
FRAME LINE G
DID MARK/PART
1 ESP
2 GBC4

		85*-	0" OUT-TO-OUT OF STEEL				1
21'-3"	4	21'-3"	<u> </u>	21'-3"	2	21'-3"	
E-1		E-2		E-2		E-3	4"
G-21 ZI	G-2	3 2)	G-23	2 3		24	
GB-1		GB-1	4.7	GB-1 CB-3		GB-1	į
G-22 2	G-2	3 🛛	G-23			25 2	
				ST-1(Strut)	6		ļ
G-22	G-2	3 🔃	G-23	21 /	G-	25 [2]	
GB-1		GB-1	CB1.2	GB-1 08-2		GB-1	İ
G-21 Z	⊕7 _{G-2}	3 🗵	G-23		G-	24 2	
(a)				Q			ļ.

RF2-1L

1-1 1/27

SIDEWALL FRAMING: FRAME LINE G

RF2-1R

1'-1 1<u>/2"</u> 1'-1 1/2"

RF3-1

1'-1 1<u>/2"</u> 1'-1 1/2"

,	(Gutter with 3 downspoute)	
◆	INSULATED METAL PANELS KINGSPAN KS SHADOWING WITH 2" CORE EXTERIOR: SL EMBOSSED 28 0 — DRIFTWOOD INTERIOR: SL EMBOSSED 28 0 — IMPERIAL WHITE EXTERIOR TRUM: BURNISHED 3LAFE BY CO BUILDINGS INTERIOR TRUM: BURNISHED STATE BY CO BUILDINGS INTERIOR TRUM: SEE PANEL PASTENING SCHEDULE BY KINGSPAN	\diamondsuit

SIDEWALL SHEETING & TRIM: FRAME LINE G

HANGAR WESTLAND CONSTRUCTION 1331 SKY WAY PROVO, UT 84601 FRAMING HANGAR AIRCRAFT SIDEWALL REVISIONS DESCRIPTION No. 13269023-2202 DILLON COREY THURSTON Dillon Corey Digitally signed by Dillon Corey Thur Date: 2024.02.29

> DESIGN: DT DRAFT: CC CHECK: DATE: 2/12/24

24011110 SHEET 9 OF 14 REV (

BUILDING SYSTEMS INC.

MBMA

