


GENERAL NOTES:

CO BUILDING SYSTEMS RECOMMENDS THAT AT LEAST ONE BRACED BAY BE INSTALLED PRIOR TO OTHER FRAME LINES. THIS INCLUDES EAVE STRUTS, PURLIN STRUTS, WIND BENTS, AND BRACE CABLE/ROD OVER THE COMPLETE BAY. FAILURE TO DO SO MAY RESULT IN SERIOUS DAMAGE TO THE STRUCTURE AND/OR BODILY INJURY.


MEMBER	TABLE	
FRAME I	LINE A	
MARK	PART	LENGTH
E-1	E845 14	5'-0 1/2"
E-2	E845_14	12'-7 1/2"
E-3	E845 14	13'-7 1/2"
E-4	E845 12	23'-4 1/2"
E-5	E845 12	25'-10 1/2"
E-6	E845 14	10'-0 1/2"
E-17	E845 14	2'-0"
G-6	Z825 16	15'-4 1/2"
G-7	Z825_16	16'-6"
G-8	Z825_16	26'-3"
G-9	Z825_10 Z825_16	28'-9"
		12'-1 1/2"
G-10	Z825_16	18'-1 3/4"
LCB-3	L 0.25 CBL	1 10 - 1 .0 / 4

CONNECTION PLATES
FRAME LINE A


DID MARK/PART
1 GC35

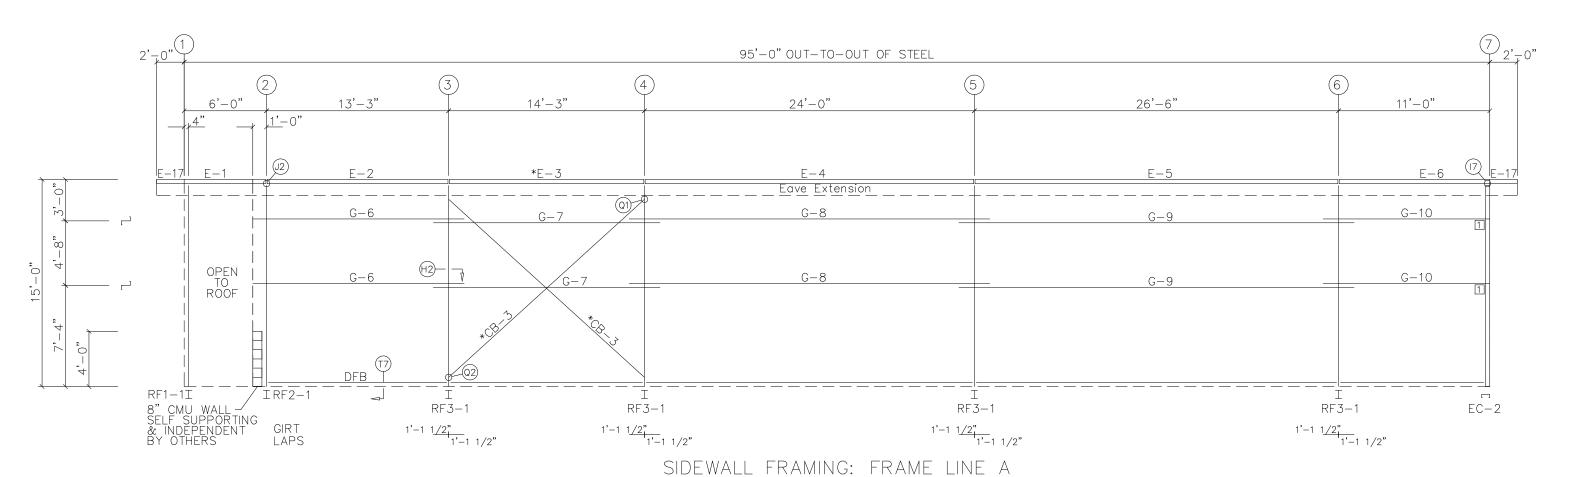

* ITEMS MARKED WITH "*" ARE PART OF THE SEISMIC LOAD RESISTING SYSTEM (SLRS)

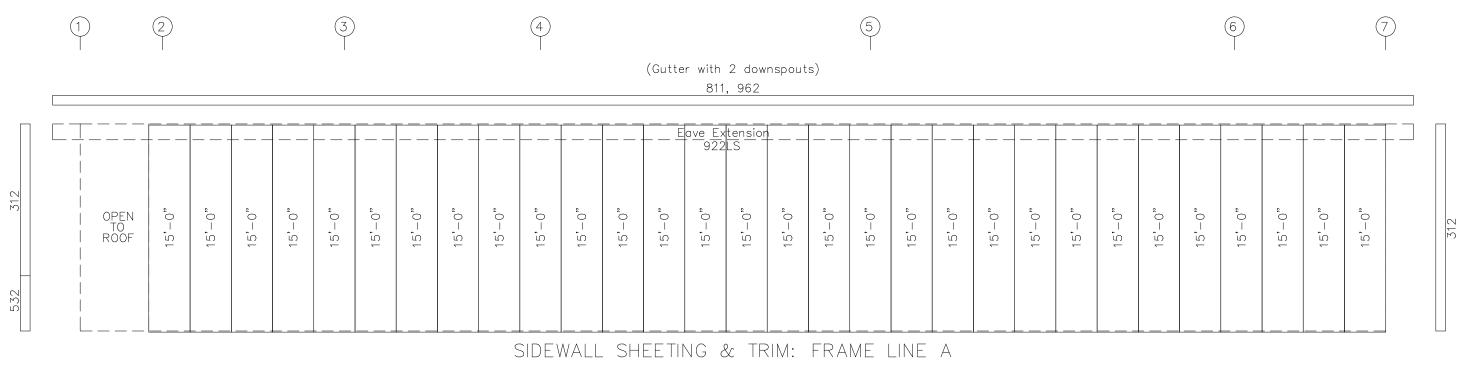

SHEETING & IKIM: FKAME LI PANELS: 26 Ga. PBR — Brown

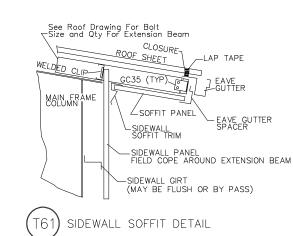


SYSTEMS INC.

METAL BUILDING MANUFACTURERS ASSOCIATION MEMBER

ACCREDITED Metal Building Systems AC 472

BUILDING

	REVISIONS	SIDEWALL FRAMING
	DESCRIPTION	
		BAKK CANINE CLOB
		NOTWAN DAAR OLD
		MESKULE, NY KKOZ,
		CANINE CLOM

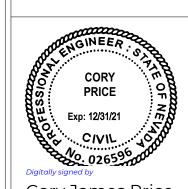

Cory James Price 2021-06-10 08:06:17 -0600

DESIGN: CP DRAFT: DP CHECK: DATE: 5/27/21

JOB # 21044921

SHEET OF 13 REV

