


Barrel jack is Center-Negative (guitar pedal convention)
 Battery is only switched on when no power is inserted and when input jack is inserted.



Signal Ground is buffered mid-supply (4.5V) bias voltage, to be treated as a virtual ground from initial biasing to final coupling capacitor stage

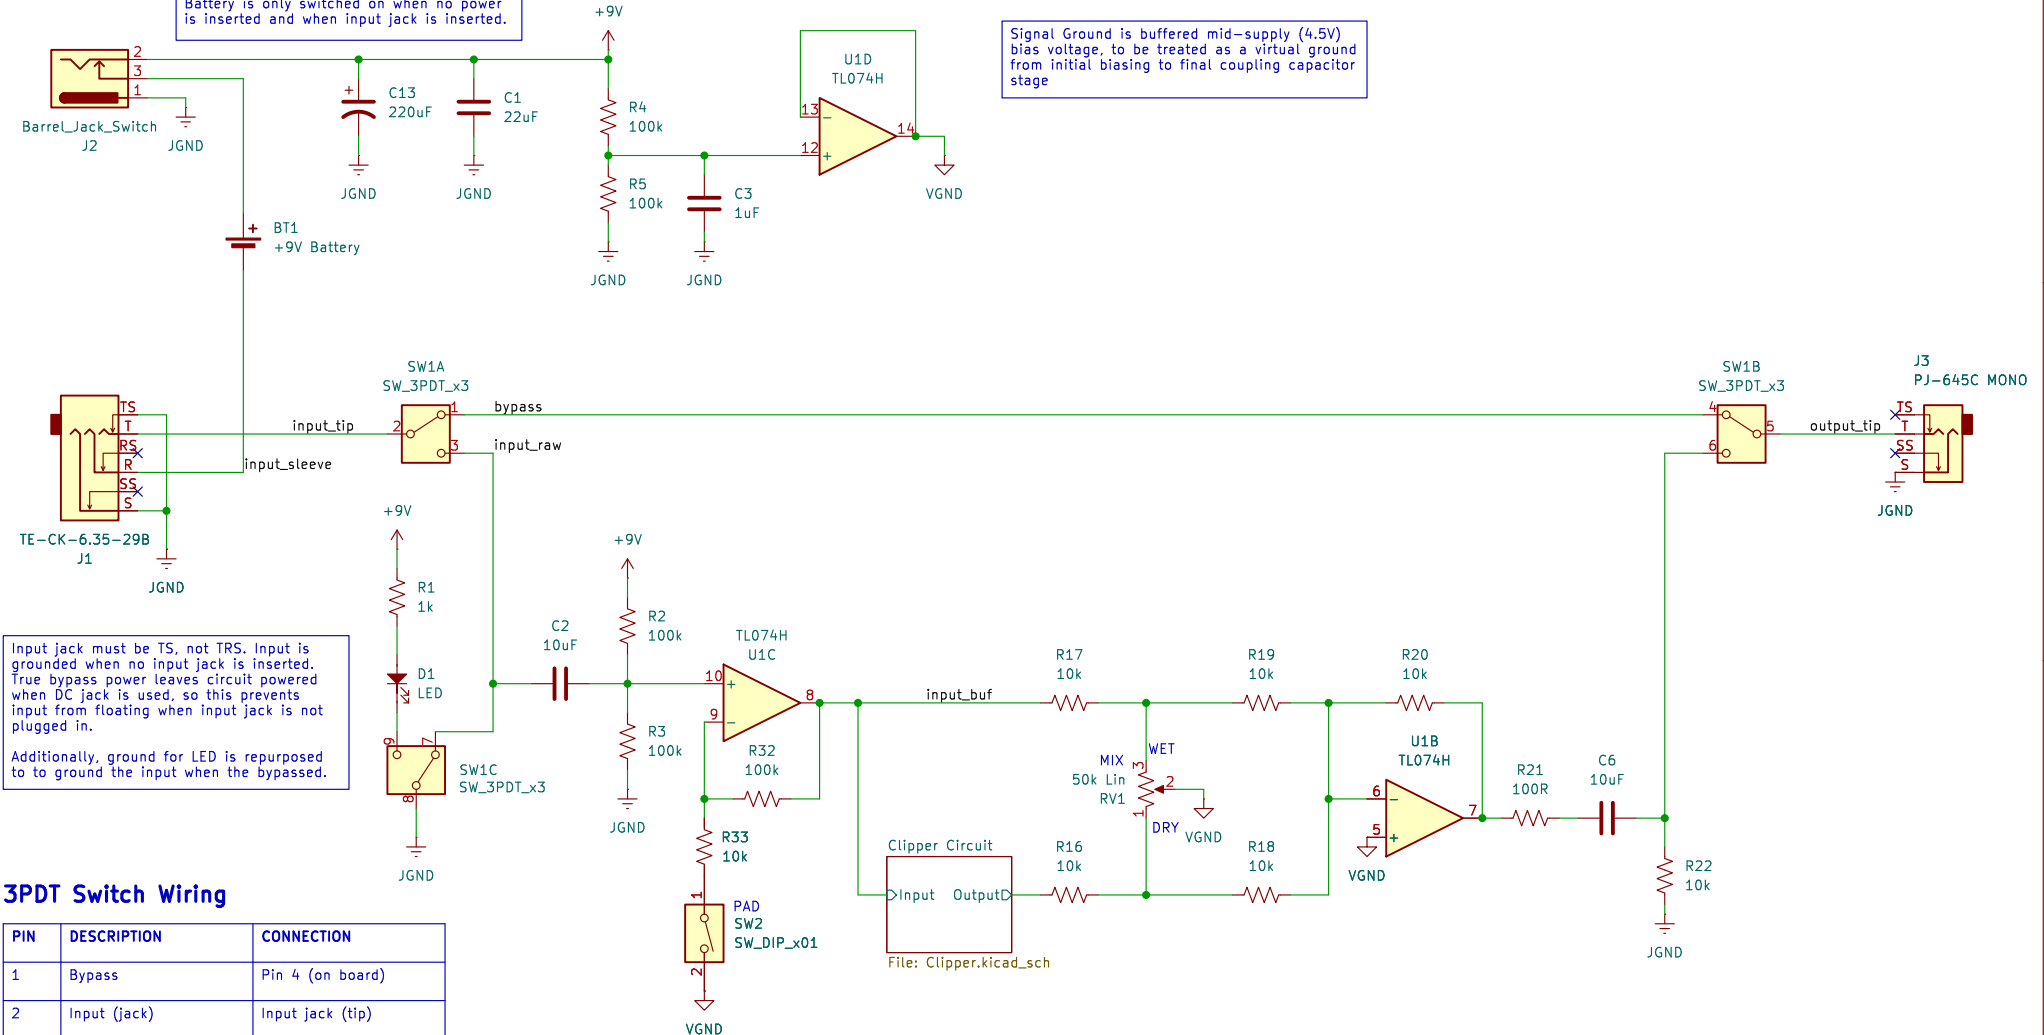

Input jack must be TS, not TRS. Input is grounded when no input jack is inserted. True bypass power leaves circuit powered when DC jack is used, so this prevents input from floating when input jack is not plugged in.
 Additionally, ground for LED is repurposed to to ground the input when the bypassed.

3PDT Switch Wiring

PIN	DESCRIPTION	CONNECTION
1	Bypass	Pin 4 (on board)
2	Input (jack)	Input jack (tip)
3	Input (board)	Input pad (on board)
4	Bypass	Pin 1 (on board)
5	Output (jack)	Output jack (tip)
6	Output (board)	Output pad (on board)
7	Input (board)	Input pad (on board)
8	Ground (LED/Input)	GND pad (on board)
9	LED Cathode	Cathode pad (on board)

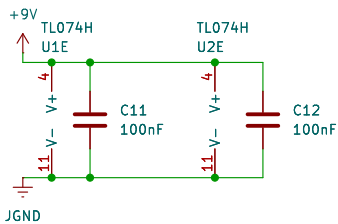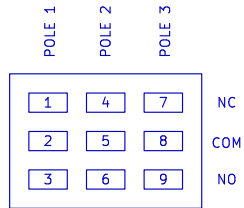

Osprey Instruments

Sheet: /
 File: OCD.kicad_sch

Title: Over-Complicated Distortion (OCD)

Size: A4
 KiCad E.D.A. 9.0.3

Date: 2025-10-26

Rev: B
 Id: 1/2



