
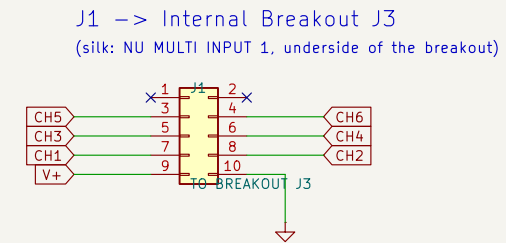


No supply on this board: both rails arrive on J1.



J1 IS 1:1 WITH BREAKOUT J3 – PINS 1-2 NOT FITTED

Verified against [cycfi/nu @ github.com/cycfi/nu](https://github.com/cycfi/nu) -- [nu_capsule/nu_preamp.sch](#) and [internal_breakout/internal_breakout.sch](#), silk 'INTERNAL BREAKOUT V2.5'.

Breakout J3, pin for pin:

- 1 = CH7 not fitted (shared with J4 pin 7/8)
- 2 = CH8 not fitted (shared with J4 pin 7/8)
- 3 = CH5
- 4 = CH6
- 5 = CH3
- 6 = CH4
- 7 = CH1
- 8 = CH2
- 9 = V+
- 10 = GND

Reversed, a 2x5 maps pin n to pin $11-n$, so the two empty positions land on V+ and GND: a backwards cable delivers no supply rather than the wrong one. Nothing is damaged.

No components fitted. Each capsule carries its own 100 nF (C1) + 4.7 uF (C2) across VCC1, on the capsule, and pin 1 of its power header is Schottky protected on the capsule. There is nothing left for this board to do.

V+ passed through from breakout J3 pin 9 (PWR SELECT)

