




FEATURE	X	Y	Z / DIRECTION
Clamp 1: 2 bolts / nut pockets	+/-12.150	0.000	Z axis
Clamp 2: 2 bolts / nut pockets	+/-12.150	24.375	Z axis
Clamp 3: 2 bolts / nut pockets	+/-12.150	64.595	Z axis
Key 4: spring socket	-9.800	53.595	13.700 / +X
Key 5: spring socket	-9.800	37.850	13.700 / +X
Key 6: spring socket	-9.800	11.000	13.700 / +X
Key 4: paired hinge bores	-11.200	53.595 +/- 3.800	11.100 / Y
Key 5: paired hinge bores	-11.200	37.850 +/- 3.800	11.100 / Y
Key 6: paired hinge bores	-11.200	11.000 +/- 3.800	11.100 / Y

FEATURE DEFINITIONS / PROPOSED FITS	
1	Coordinate origin: X=whistle axis; Y=foot-end clamp centre; Z=base.
2	+Y points toward mouthpiece. All coordinates match supplied STEP.
3	6 bolt holes: diameter 2.40 THRU; proposed +0.05 / -0.00.
4	6 nut pockets from underside: 4.30 AF x 1.90 deep; proposal +/-0.05.
5	Nut pocket flat normals parallel X. Nominal nut 4.00 AF x 1.60.
6	Pocket roof Z=1.90; lug top Z=3.50; roof thickness 1.60.
7	3 spring sockets: diameter 2.40 x 1.50 full-diameter depth.
8	Socket floor X=-8.300; flat floor required, drill tip not included.
9	6 hinge bores: CAD diameter 1.10 through 3.00-thick ears; FIT ON HOLD.
10	Each hinge pair: 4.60 clear axial gap; 10.60 outer span.
11	Common hinge axis X=-11.200, Z=11.100. Verify all six coaxial.
12	3 whistle seats: R7.150, axis X=0 / Z=11.100, axial width 6.00.
13	Seat radius proposed +/-0.02; all seats share one axis.
14	Key spacing 4-5=15.745 / 5-6=26.850 nominal; MEASUREMENT HOLD.

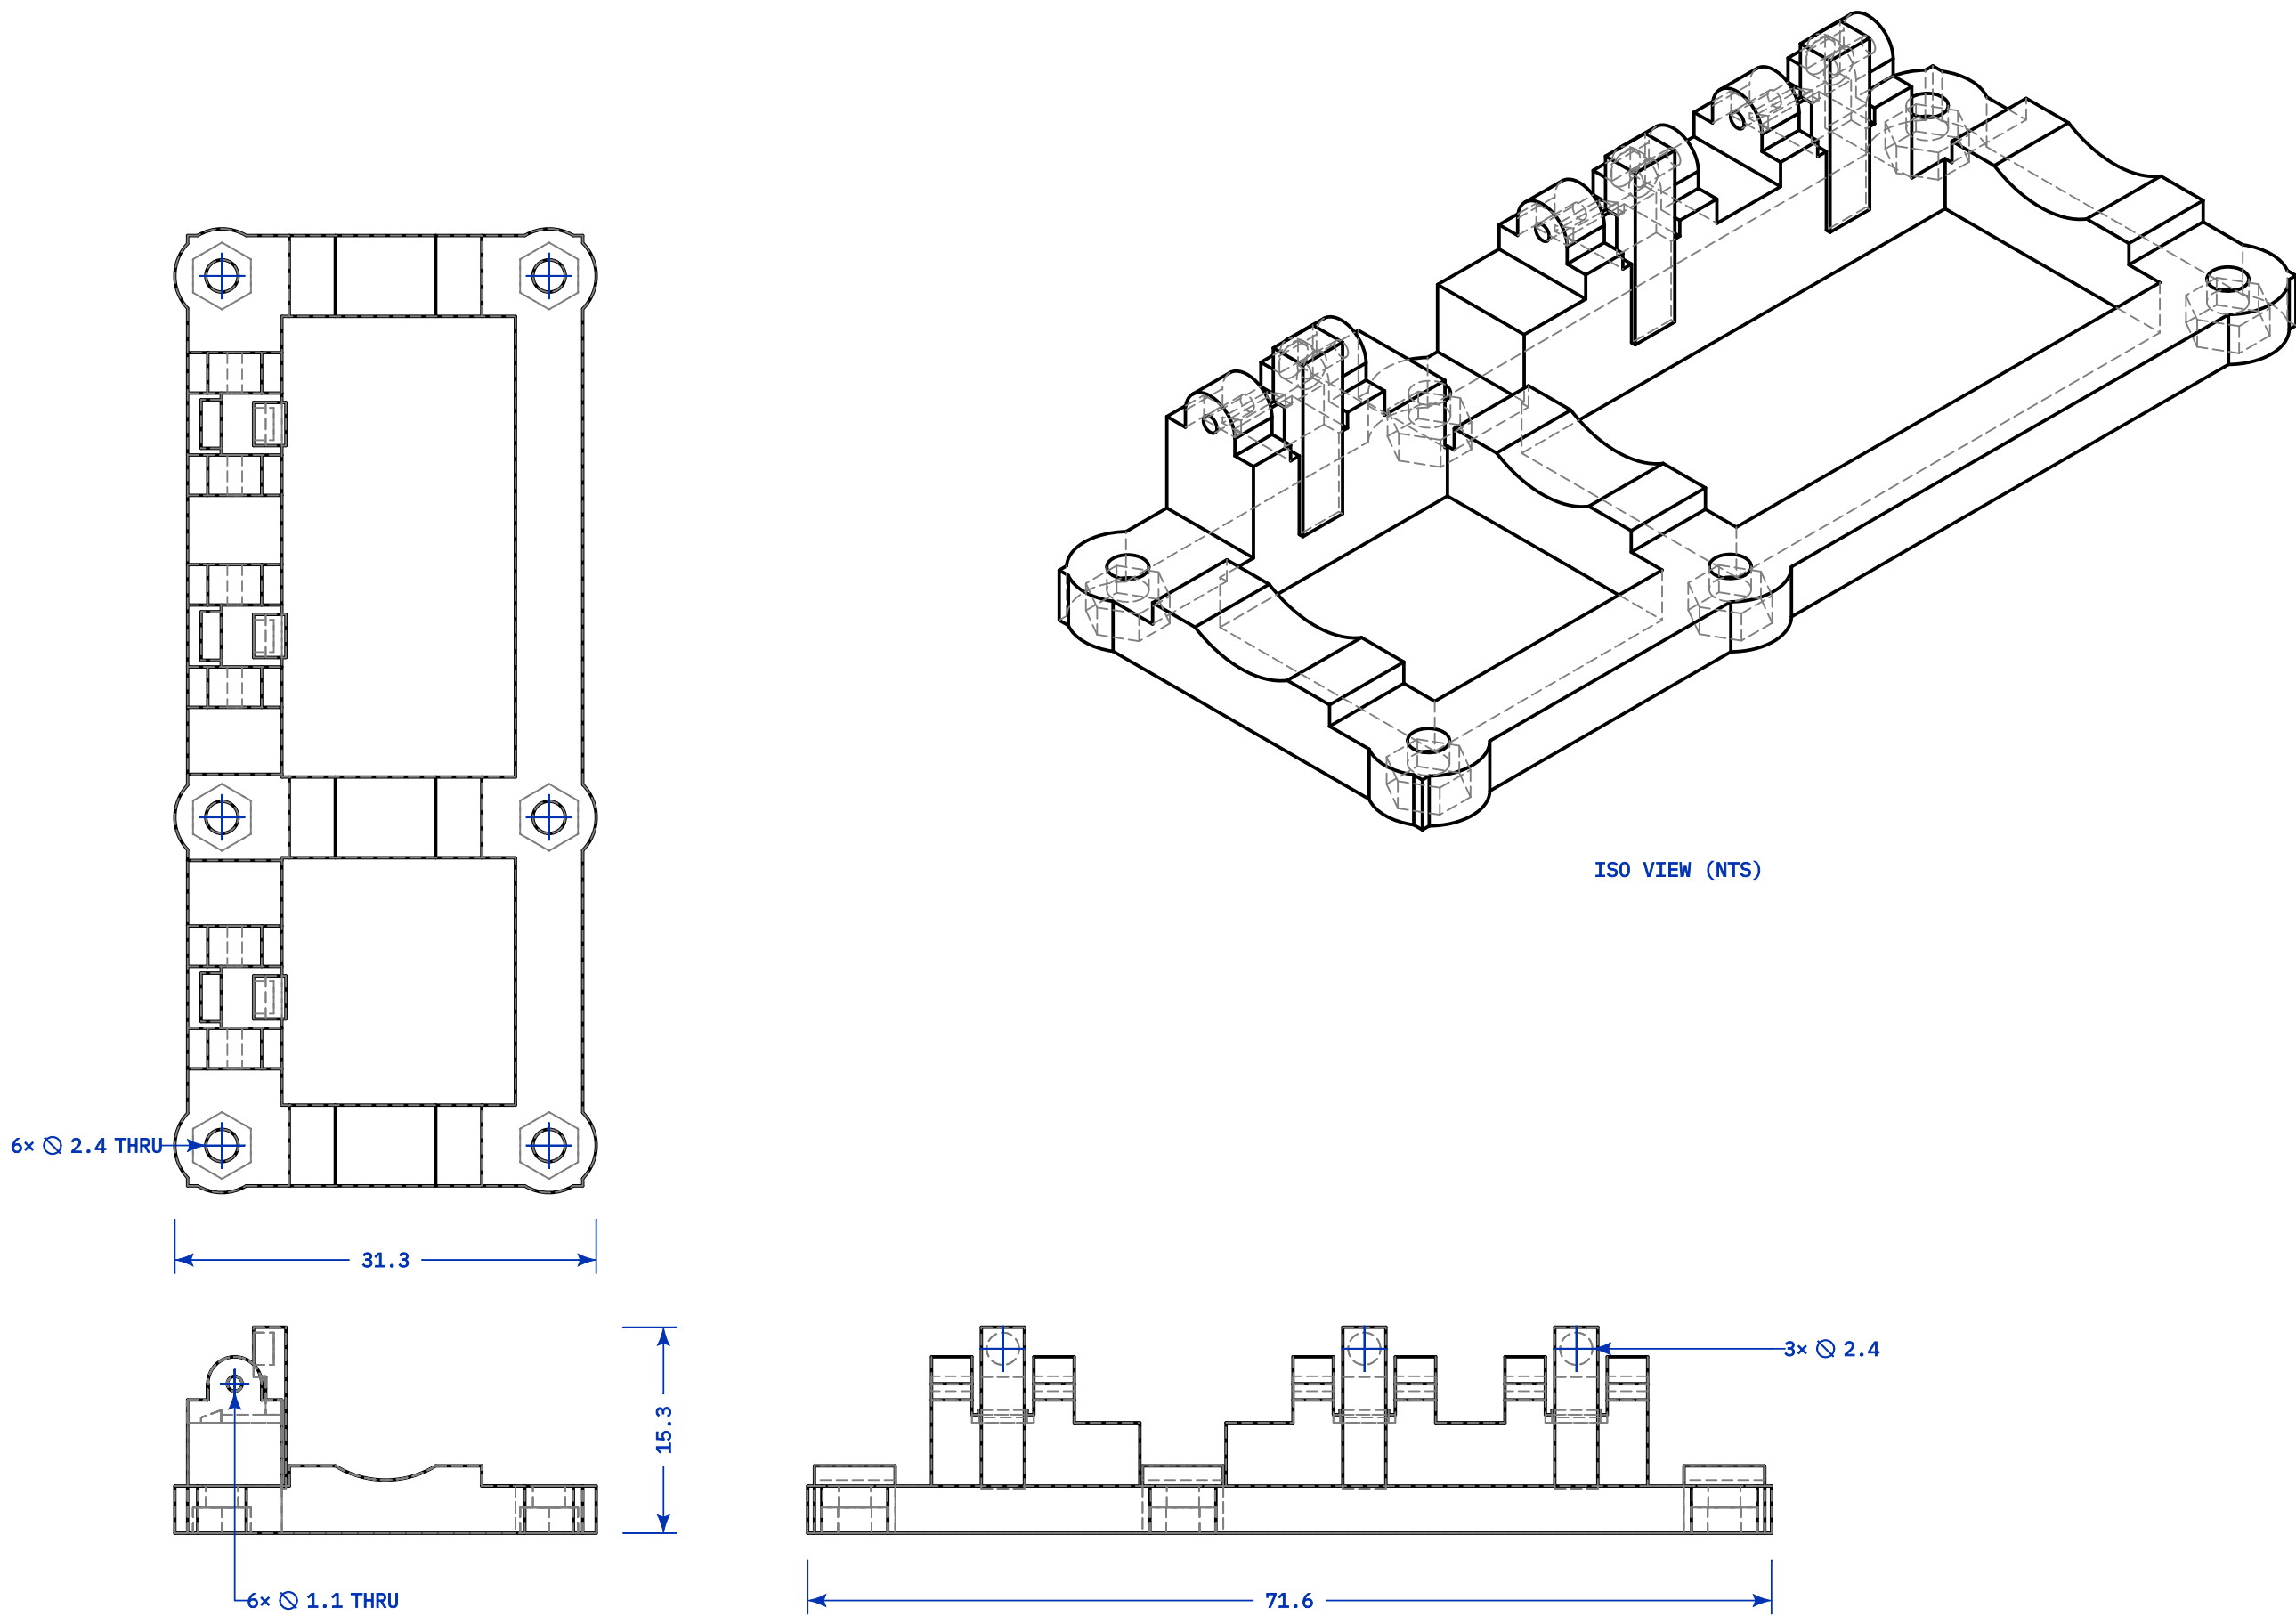

TITLE	FRAME / FEATURE SCHEDULE	DWG NO.	WK-TI-001-2	SCALE	2:1	MAT.	Ti / TBD	REV	P1
GEN. TOL.	DRAFT / SEE NOTES	DRAWN BY	PZFREO / draftwright						