Enrico Caruso 14
Muxless/UMA Schematics Document
Sandy Bridge
Intel PCH
2011-04-07
REV : A00

```
DY :      None Installed
UMA:      UMA ONLY installed
PSL:      KBC795 PSL circuit for 10mW solution installed.
10mW:     External circuit for 10mW solution installed.
DIS:      MUXLESS solution installed.
Surge:    For GO Rural config stuff.
GIGA:     For GIGA LAN config stuff.
HDMI:     For HDMI config stuff.
DIS_CRT:  Pure DIS install
```

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Cover Page		
Size: A3	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 1 of 105	

Block Diagram (Discrete/UMA co-lay)

##OnMainBoard

Project code: 91.4IU01.001
PCB P/N : 48.4IU16.0SC
Revision : 10315-SC

VRAM gDDR3 900NHz
1GB (128Mx16x4)
512MB (64Mx16x4)
88,89,90,91

gDDR3 900MHz

Seymou-XT S3
83.84,85,86,87

PCIe x 8
(Discrete only)

Intel CPU
Sandy Bridge
4,5,6,7,8,9,10

DDRIII 1066/1333 Channel A
DDRIII 1066/1333 Channel B

DDRIII Slot 0 1066/1333 15
DDRIII Slot 1 1066/1333 14

FDIx4x2
DMIx4 1GB/s

Intel PCH
Cougar Point
14 USB 2.0/1.1 ports
ETHERNET (10/100/1000Mb)
High Definition Audio
SATA ports (6)
PCIE ports (8)
LPC I/F
ACPI 1.1
17,18,19,20,21,22,23,24,25

PCIE x 1
10/100 /1000 LOM
Realtek RTL8111E (Giga LAN)
Realtek RTL8105E (10M/100M) 31
RJ45 CONN 59

PCIE x 1
802.11a/b/g
Mini-Card WLAN+BT3.0 64

PCIE
100MHz
2.5Gbps

CRT 50
LCD 49
HDMI 51

CRT
LVDS
HDMI

USB 2.0 x 1
CAMERA 49

USB 2.0
480Mbps

USB 2.0 x 1
M/B USB x1 (Left) 61

USB 2.0 x 2
I/O board USB x2 (Right) 82

SD/MMC/MS/ MS Pro 74
CardReader Realtek RTS5138 32
USB2.0

LPC Bus
33MHz

KBC
NUVOTON NPCE795BA0DX 27

Audio board
Internal Analog MIC 58
HP1 82
MIC IN
2CH SPEAKER 58

Azalia CODEC
IDT 92HD87 29
AZALIA
24MHz

PS/2
PS/2

Touch PAD 69
Int. KB 69

Thermal ENE P2800 28
ENE P2793 Fan 28

SATA
SATA 3Gbps
SPI

HDD 56
ODD 56
Flash ROM 4MB 60

SYSTEM DC/DC APL5916 48	
INPUTS	OUTPUTS
DCBATOUT	0D85V_S0

CPU DC/DC VT1316+1314 42~44	
INPUTS	OUTPUTS
DCBATOUT	VCC_CORE

SYSTEM DC/DC TPS51218 45	
INPUTS	OUTPUTS
DCBATOUT	1D05V_VTT

SYSTEM DC/DC TPS51125 41	
INPUTS	OUTPUTS
DCBATOUT	5V_AUX_S5 3D3V_AUX_S5 5V_S5 3D3V_S5 15V_S5

SYSTEM DC/DC TPS51216R 46	
INPUTS	OUTPUTS
DCBATOUT	1D5V_S3 0D75V_S0 DDR_VREF_S3

GFX DC/DC VT1316+1317 44	
INPUTS	OUTPUTS
DCBATOUT	VCC_GFXCORE

VGA RT8208B 92	
INPUTS	OUTPUTS
DCBATOUT	VGA_CORE

TI CHARGER BQ24707 40	
INPUTS	OUTPUTS
+DC_IN_S5 +PBATT	DCBATOUT

SYSTEM DC/DC APW7153B 47	
INPUTS	OUTPUTS
3D3V_S5	1D8V_S0

SYSTEM DC/DC G9731 93	
INPUTS	OUTPUTS
1D5V_S3 3D3V_S0	1V_VGA_S0 1D8V_VGA_S0
Switches	
INPUTS	OUTPUTS
1D5V_S3 5V_S5 3D3V_S5	1D5V_S0 5V_S0 3D3V_S0

PCB LAYER

L1:Top L4:Signal
L2:GND L5:VCC
L3:Signal L6:Bottom

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Block Diagram
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011 Sheet 2 of 105

PCH Strapping

Huron River Schematic Checklist Rev.0_7

Name	Schematics Notes
SPKR	**Reboot option at power-up** **Default Mode:** Internal weak Pull-down. **No Reboot Mode with TCO Disabled:** Connect to Vcc3_3 with 8.2-k - 10-k weak pull-up resistor.
INIT3_3V#	Weak internal pull-up. Leave as "No Connect".
GNT3#/GPIO55 GNT2#/GPIO53 GNT1#/GPIO51	GNT[3:0]# functionality is not available on Mobile. Mobile: Used as GPIO only Pull-up resistors are not required on these signals. If pull-ups are used, they should be tied to the Vcc3_3power rail.
SPI_MOSI	**Enable Danbury:** Connect to Vcc3_3 with 8.2-k? weak pull-up resistor. **Disable Danbury:** Left floating, no pull-down required.
NV_ALE	**Enable Danbury:** Connect to +NVRAM_VCCQ with 8.2-kohm weak pull-up resistor [CRB has it pulled up with 1-kohm no-stuff resistor] **Disable Danbury:** Leave floating (internal pull-down)
NC_CLE	DMI termination voltage. Weak internal pull-up. Do not pull low.
HAD_DOCK_EN# /GPIO[33]	Low (0) - Flash Descriptor Security will be overridden. Also, when this signals is sampled on the rising edge of PWROK then it will also disable Intel ME and its features. High (1) - Security measure defined in the Flash Descriptor will be enabled. Platform design should provide appropriate pull-up or pull-down depending on the desired settings. If a jumper option is used to tie this signal to GND as required by the functional strap, the signal should be pulled low through a weak pull-down in order to avoid asserting HDA_DOCK_EN# inadvertently. Note: CRB recommends 1-kohm pull-down for FD Override. There is an internal pull-up of 20 kohm for DA_DOCK_EN# which is only enabled at boot/reset for strapping functions.
HDA_SDO	Weak internal pull-down. Do not pull high. Sampled at rising edge of RSMRST#.
HDA_SYNC	Weak internal pull-down. Do not pull high. Sampled at rising edge of RSMRST#.
GPIO15	Low (1) - Intel ME Crypto Transport Layer Security (TLS) cipher suite with no confidentiality High (1) - Intel ME Crypto Transport Layer Security (TLS) cipher suite with confidentiality Note : This is an un-muxed signal. This signal has a weak internal pull-down of 20 kohm which is enabled when PWROK is low. Sampled at rising edge of RSMRST#. CRB has a 1-kohm pull-up on this signal to +3.3VA rail.
GPIO8	GPIO8 on PCH is the Integrated Clock Enable strap and is required to be pulled-down using a 1k +/- 5% resistor. When this signal is sampled high at the rising edge of RSMRST#, Integrated Clocking is enabled, When sampled low, Buffer Through Mode is enabled.
GPIO27	**Default = Do not connect (floating)** High(1) = Enables the internal VccVRM to have a clean supply for analog rails. No need to use on-board filter circuit. Low (0) = Disables the VccVRM. Need to use on-board filter circuits for analog rails.

Processor Strapping

Huron River Schematic Checklist Rev.0_7

Pin Name	Strap Description	Configuration (Default value for each bit is 1 unless specified otherwise)	Default Value
CFG[2]	**PCI-Express Static Lane Reversal**	**1:** Normal Operation. **0:** Lane Numbers Reversed 15 -> 0, 14 -> 1, ...	1
CFG[4]		**1:** Disabled - No Physical Display Port attached to Embedded DisplayPort. **0:** Enabled - An external Display Port device is connectd to the EMBEDDED display Port	0
CFG[6:5]	**PCI-Express Port Bifurcation Straps**	11 : x16 - Device 1 functions 1 and 2 disabled 10 : x8, x8 - Device 1 function 1 enabled ; function 2 disabled 01 : Reserved - (Device 1 function 1 disabled ; function 2 enabled) 00 : x8, x4, x4 - Device 1 functions 1 and 2 enabled	11
CFG[7]	**PEG DEFER TRAINING**	**1:** PEG Train immediately following xxRESETB de assertion **0:** PEG Wait for BIOS for training	1

POWER PLANE	VOLTAGE	Voltage Rails ACTIVE IN	DESCRIPTION
5V_S0 3D3V_S0 1D8V_S0 1D5V_S0 1D05V_VTT 0D85V_S0 0D75V_S0 VCC_CORE VCC_GFXCORE 1D8V_VGA_S0 3D3V_VGA_S0 1V_VGA_S0	5V 3.3V 1.8V 1.5V 1.05V 0.95 - 0.85V 0.75V 0.35V to 1.5V 0.4 to 1.25V 1.8V 3.3V 1V	S0	CPU Core Rail Graphics Core Rail
5V_USBX_S3 1D5V_S3 DDR_VREF_S3	5V 1.5V 0.75V	S3	
BT+ DCBATOUT 5V_S5 5V_AUX_S5 3D3V_S5 3D3V_AUX_S5	6V-14.1V 6V-14.1V 5V 5V 3.3V 3.3V	All S states	AC Brick Mode only
3D3V_LAN_S5	3.3V	WOL_EN	Legacy WOL
3D3V_AUX_KBC	3.3V	DSW, Sx	ON for supporting Deep Sleep states
3D3V_AUX_S5	3.3V	G3, Sx	Powered by Li Coin Cell in G3 and +V3ALW in Sx

SATA Table

SATA	
Pair	**Device**
0	HDD1
1	N/A
2	N/A
3	N/A
4	ODD
5	N/A

USB Table

Pair	Device
0	X
1	USB Ext. port 2 (MB)
2	X
3	X
4	X
5	CARD READER
6	X
7	X
8	USB Ext. port 3
9	USB Ext. port 1
10	X
11	Mini Card1 (WLAN+BT)
12	CAMERA
13	X

SMBus ADDRESSES

I² C / SMBus Addresses Device	Ref Des	HURON RIVER ORB Address	Hex	Bus
EC SMBus 1 Battery CHARGER				BAT_SCL/BAT_SDA BAT_SCL/BAT_SDA BAT_SCL/BAT_SDA
EC SMBus 2 PCH eDP				SML1_CLK/SML1_DATA SML1_CLK/SML1_DATA SML1_CLK/SML1_DATA
PCH SMBus SO-DIMMA (SPD) SO-DIMMB (SPD) Digital Pot G-Sensor MINI				PCH_SMBDATA/PCH_SMBCLK PCH_SMBDATA/PCH_SMBCLK PCH_SMBDATA/PCH_SMBCLK PCH_SMBDATA/PCH_SMBCLK PCH_SMBDATA/PCH_SMBCLK PCH_SMBDATA/PCH_SMBCLK

PCIE Routing

LANE1	X
LANE2	LAN
LANE3	X
LANE4	Wireless
LANE5	X
LANE6	X
LANE7	X
LANE8	X

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Table of Content

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 3 of 105

SSID = CPU

Signal Routing Guideline:
PEG_ICOMPO keep W/S=12/15 mils and routing length less than 500 mils.
PEG_ICOMPI & PEG_RCOMPO keep W/S=4/15 mils and routing length less than 500 mils.

Note:
Intel DMI supports both Lane Reversal and polarity inversion but only at PCH side. This is enabled via a soft strap.

Note:
Intel FDI supports both Lane Reversal and polarity inversion but only at PCH side. This is enabled via a soft strap.

Note:
Lane reversal does not apply to FDI sideband signals.

Signal Routing Guideline:
EDP_ICOMPO keep W/S=12/15 mils and routing length less than 500 mils.
EDP_COMPIO keep W/S=4/15 mils and routing length less than 500 mils.

NOTE.
Processor strap CFG[4] should be pulled low to enable Embedded DisplayPort.

Stuff to disable internal graphics function for power saving.

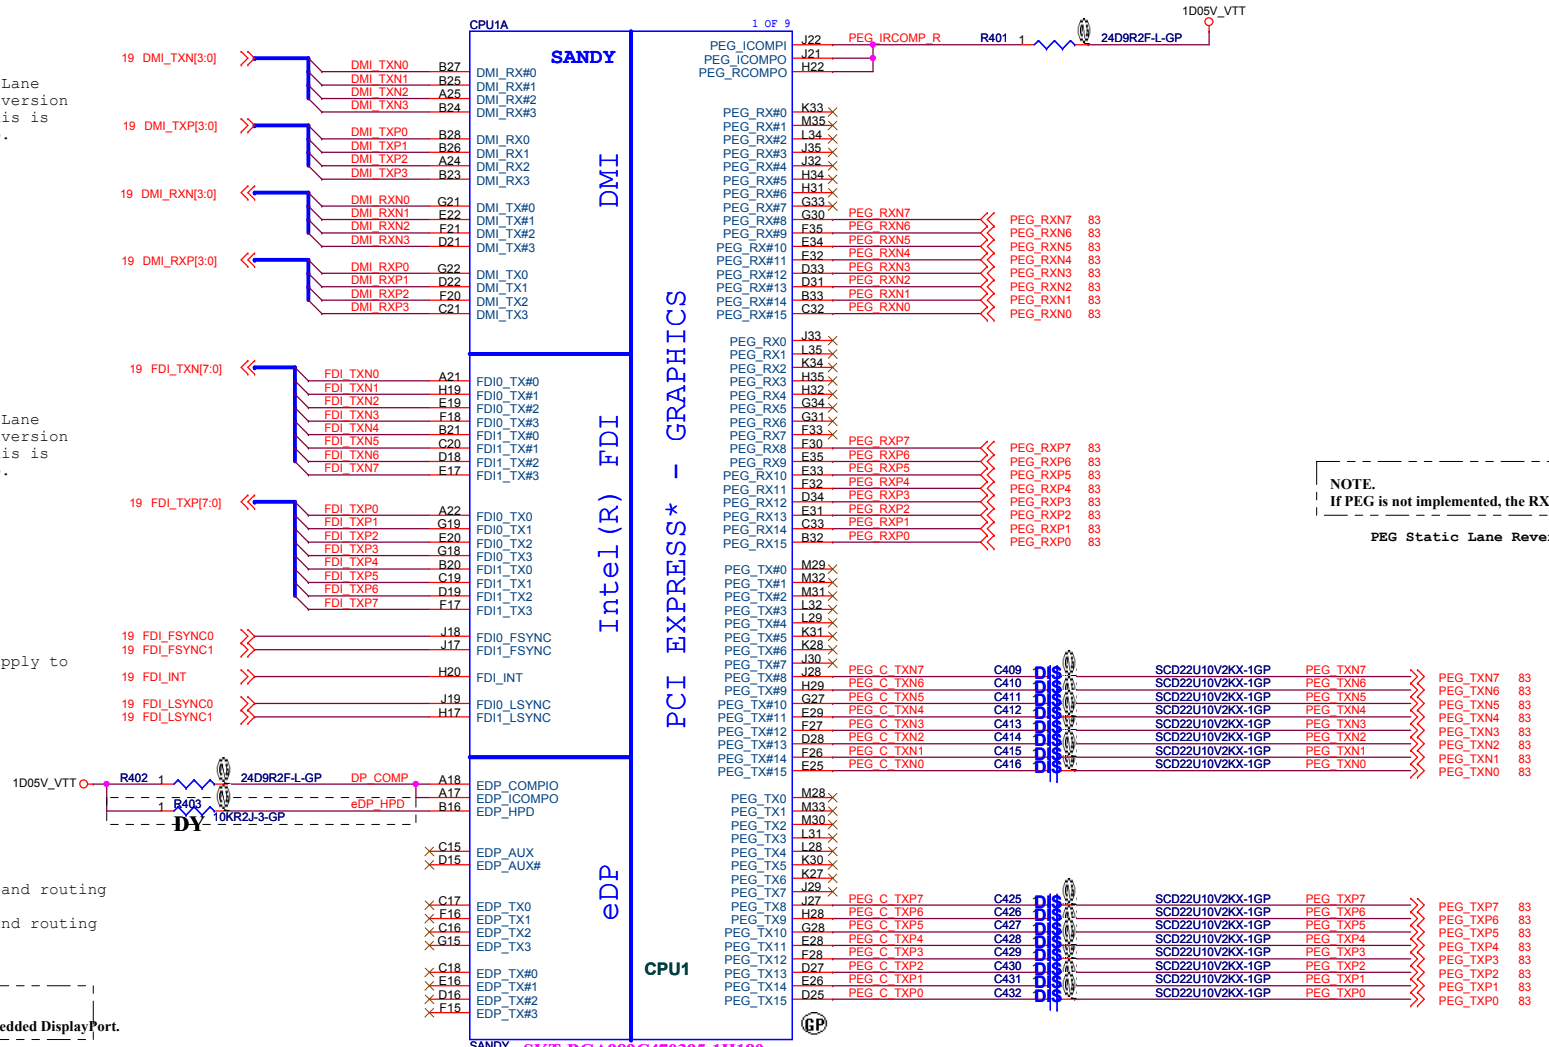

SANDY SKT-BGA989C470395-1H180
62.10055.421
2nd = 62.10040.771

NOTE:
Select a Fast FET similar to 2N7002E whose rise/ fall time is less than 6 ns. If HPD on eDP interface is disabled, connect it to CPU VCCIO via a 10-k pull-Up resistor on the motherboard.

NOTE.
If PEG is not implemented, the RX&TX pairs can be left as No Connect

PEG Static Lane Reversal

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: **CPU (PCIE/DMI/FDI)**

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 4 of 105

SSID = CPU

Disabling Guidelines:
If motherboard only supports external graphics:
Connect DPLL_REF_SSCLK on Processor to GND through 1K +/- 5% resistor.
Connect DPLL_REF_SSCLK# on Processor to VCCP through 1K +/- 5% resistorpower (~15 mW) may be wasted.

CPU1B — 2 OF 9 — SANDY

MISC: SNB_IVB#, SKTOCC#
THERMAL: CATERR#, PECI, PROCHOT#, THERMTRIP#
PWR MANAGEMENT: PM_SYNC, UNCOREPWRGOOD, SM_DRAMPWROK, RESET#
CLOCKS: BCLK, BCLK#, DPLL_REF_SSCLK, DPLL_REF_SSCLK#
DDR3 MISC: SM_DRAMRST#, SM_RCOMP0, SM_RCOMP1, SM_RCOMP2
JTAG & BPM: PRDY#, PREQ#, TCK, TMS, TRST#, TDI, TDO, DBR#, BPM#0–BPM#7

CPU1
SANDY SKT-BGA989C470395-1H180
62.10055.421
2nd = 62.10040.771

1D05V_VTT
R501 62R2J-GP
H_PROCHOT#
C502 SC47P50V2JN-3GP
CRB : 47pf
CEKLT:43pf

TPAD14-GP TP501 — SKTOCC# R — AN34
TPAD14-GP TP502 — H_CATERR# — AL33
22,27 H_PECI — AN33
27,40,42 H_PROCHOT# — R513 56R2J-4-GP — H_PROCHOT# R — AL32
22,36,85 H_THERMTRIP# — AN32
18 H_SNB_IVB# — C26

Connect EC to PROCHOT# through inverting OD buffer.

CLK_EXP_P 20
CLK_EXP_N 20
RN502 SRN1KJ-7-GP
1D05V_VTT
X01-0210 MergeR512 R514

R502 4K99R2F-L-GP — SM_DRAMRST# 37

SM_RCOMP_0 R506 140R2F-GP
SM_RCOMP_1 R507 25D5R2F-GP
SM_RCOMP_2 R508 200R2F-L-GP

Signal Routing Guideline:
SM_RCOMP keep routing length less than 500 mils.

11/16 remove TP for layout space

TP511 TPAD14-GP
TP512 TPAD14-GP

XDP_TCLK
XDP_TMS
XDP_TRST#
XDP_TDI
XDP_TDO
XDP_DBRESET#
XDP_BPM0 … XDP_BPM7 — TP503 … TP510 TPAD14-GP

19 H_PM_SYNC — AM34
22,36 H_CPUPWRGD — R504 0R0402-PAD — CPUPWRGD_R — AP33
R503 10KR2J-3-GP
C504 SCD1U10V2KX-5GP
19,37 PM_DRAM_PWRGD — R505 0R2J-2-GP — VDDPWRGOOD — V8
37 VDDPWRGOOD
DY

X01-0127 Add C504 for noise couple.

18,27,31,65,71,83 PLT_RST# — R510 1K5R2F-2-GP — BUF_CPU_RST# — AR33
R509 750R2F-GP
DY C501 SC220P50V2KX-3GP

12/6 swap net for layout

1D05V_VTT
RN501 SRN51J-1-GP
XDP_TDI
XDP_TMS
XDP_TDO
XDP_TCLK
XDP_TRST# R511 51R2J-2-GP

3D3V_S0
19 XDP_DBRESET# — XDP_DBRESET# — R516 10KR2J-3-GP

Buffered reset to CPU

1D05V_VTT
3D3V_S0
DY R518 75R2J-1-GP
DY C503 SCD1U10V2KX-5GP
U501 74VHC1G09DFT2G-GP
IN B, VCC, IN A, GND, OUT Y
18,27,31,65,71,83 PLT_RST#
BUFO_CPU_RST#
DY R517 43R2J-GP
BUF_CPU_RST#
DY R515 0R2J-2-GP
73.01G09.AAH

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CPU (THERMAL/CLOCK/PM)
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 5 of 105

SSID = CPU

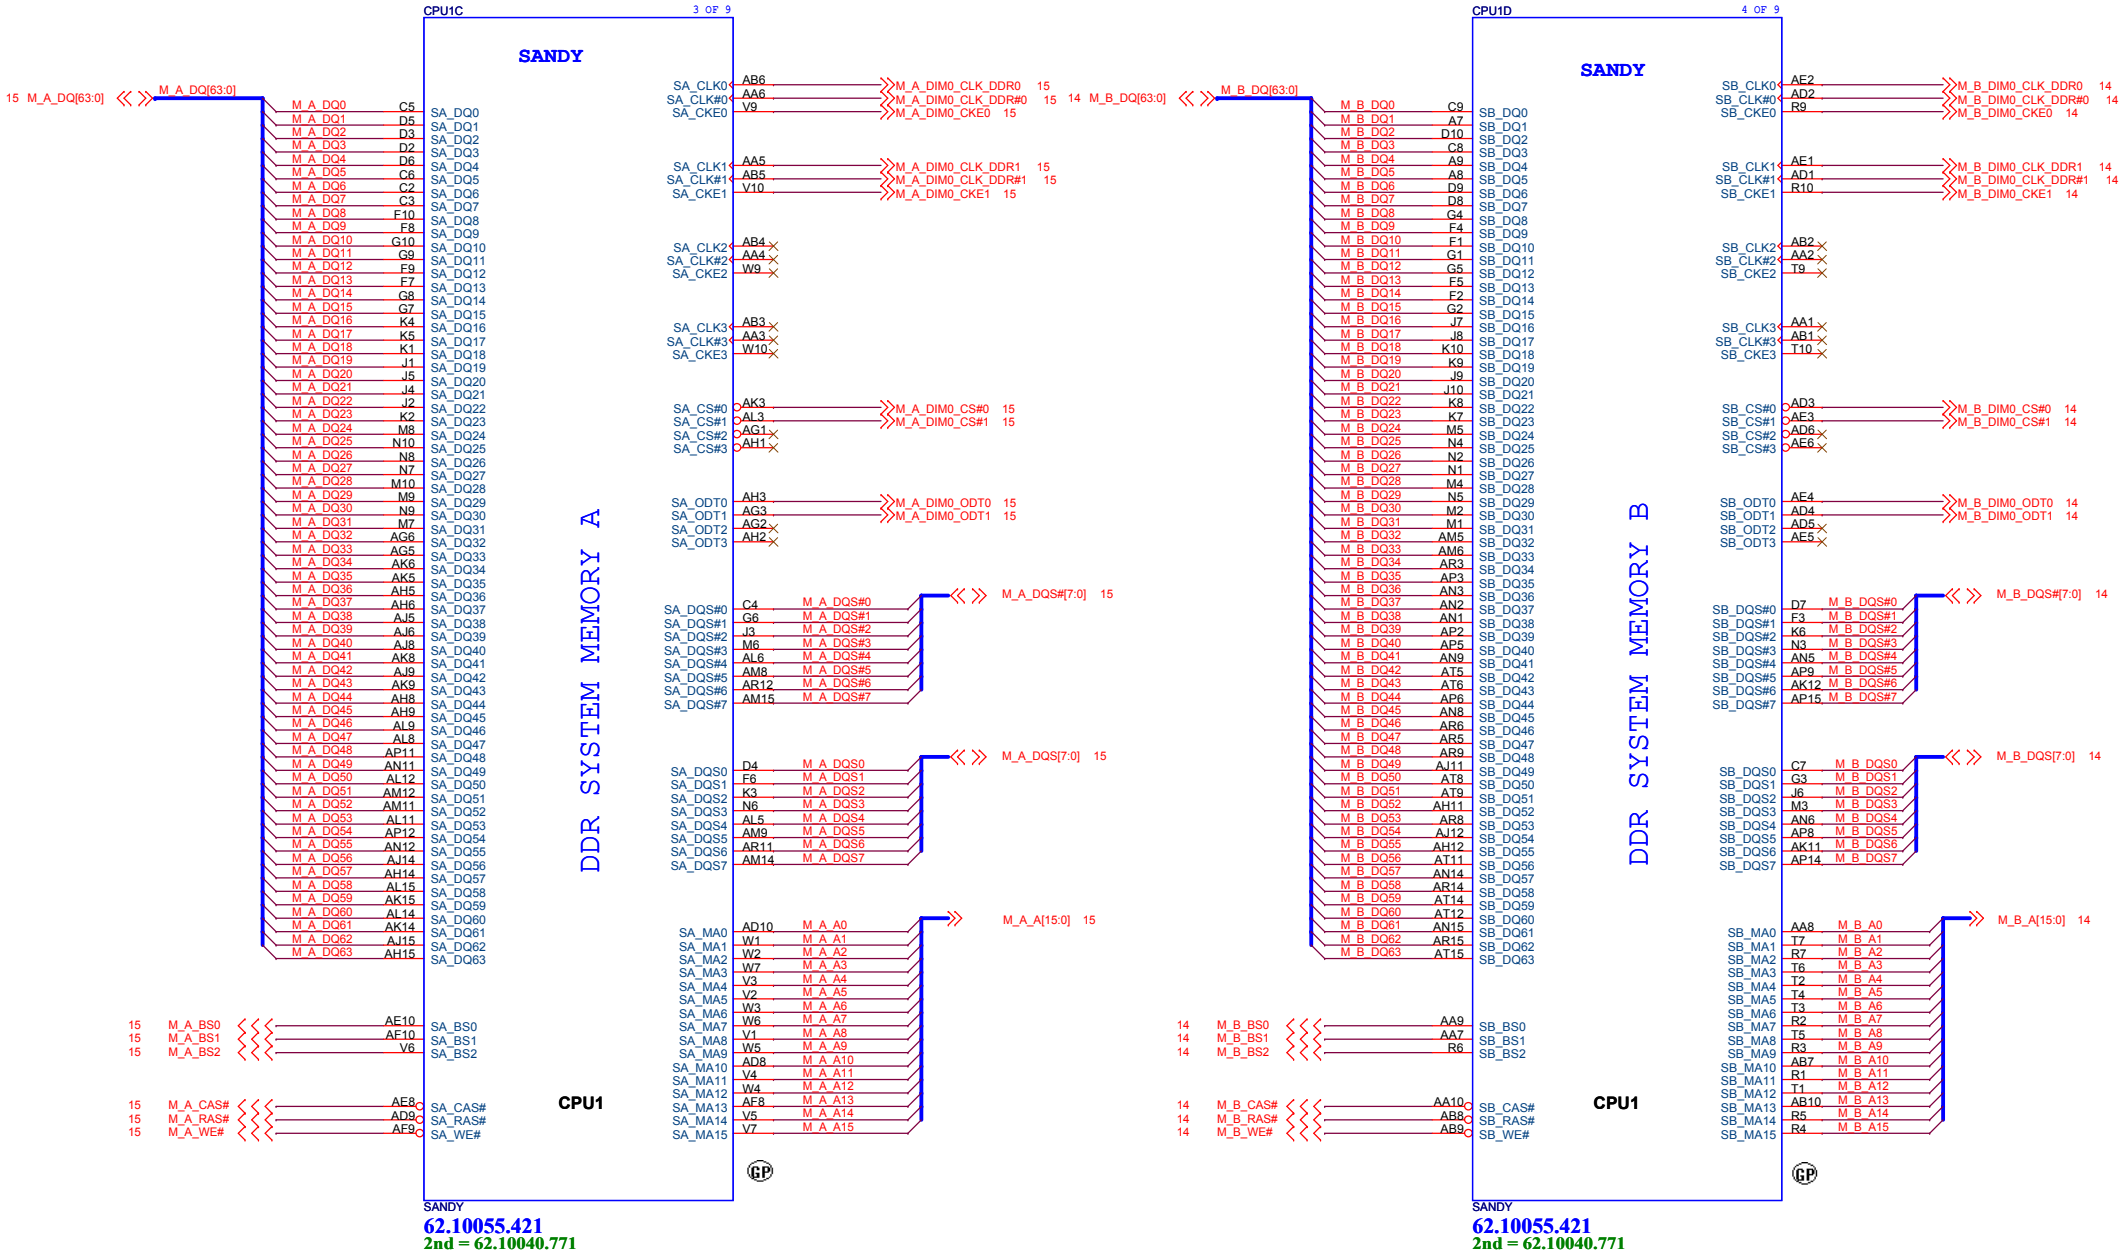

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: ***CPU (DDR)***

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 6 of 105

SSID = CPU

11/17 remove TP715

CPU1E 5 OF 9

SANDY

RESERVED

CPU1

SANDY SKT-BGA989C470395-1H180

62.10055.421

2nd = 62.10040.771

M3 - Processor Generated SO-DIMM VREF_DQ

B4:VREF_DQ CHA

D1:VREF_DQ CHB

20 mils

M_VREF_DQ_DIMM0
M_VREF_DQ_DIMM1
M_VREF_CA_DIMM0
M_VREF_CA_DIMM1
M_VREF_DQ_DIMM0_C
M_VREF_DQ_DIMM1_C
R708 R709 R707 R706 R711 R712 R710
0R2J-2-GP
1KR2F-3-GP
H_VCCP_SEL

0702 Modify
TP713 TP714
TPAD14-GP

CFG2

R702 1KR2J-1-GP

PEG Static Lane Reversal

CFG2	1: Normal Operation; Lane # definition matches socket pin map definition 0:Lane Reversed

11/17 change R703 to 1K but dummy

CFG4

R703 1KR2F-3-GP

Display Port Presence Strap

CFG4	1: Disabled; No Physical Display Port attached to Embedded Display Port 0: Enabled; An external Display Port device is connected to the Embedded Display Port

CFG5 CFG6

R701 R704 1KR2J-1-GP

PCIE Port Bifurcation Straps

CFG[6:5]	11: x16 - Device 1 functions 1 and 2 disabled 10: x8, x8 - Device 1 function 1 enabled ; function 2 disabled 01: Reserved - (Device 1 function 1 disabled ; function 2 enabled) 00: x8,x4,x4 - Device 1 functions 1 and 2 enabled

CFG7

R705 1KR2J-1-GP

PEG DEFER TRAINING

CFG7	1: PEG Train immediately following xxRESETB de assertion 0: PEG Wait for BIOS for training

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CPU (RESERVED)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 7 of 105

SSID = CPU

POWER

Voltage Rail	Voltage	Iccmax
VCC_CORE(QC)	0.8~1.35	94A
VCC_CORE(DC)	0.8~1.35	53A
VCCIO	1.05	8.5A
VDDQ	1.5	10A
VCCSA	0.75~0.9	6A
VCCPLL	1.8	1.2A
VAXG	0~1.52	33A

PROCESSOR CORE POWER

53A

11/15 change Caps to 78.22610.51L

12/23 stuff the capacities

12/28 Yellow mark for OPI change

VCC Output Decoupling Recommendation:
4 x 470 uF at Bottom Socket Edge
8 x 22 uF at Top Socket Cavity
8 x 22 uF at Top Socket Edge
8 x 22 uF at Bottom Socket Cavity

11/4 add Caps to 28 location as vendor recommand.

X01-0127 Stuff C812, C822, C831, C834
for VCC core noise issue.

X01-0217 Stuff C801=22uF
change C817 to 22uF

CPU1F

SANDY

6 OF 9

PEG AND DDR

CORE SUPPLY

SVID

SENSE LINES

CPU1

VCCIO Output Decoupling Recommendation:
2 x 330 uF (3 x 330 uF for 2012 capable designs)
5 x 22 uF & 5 x 0805 no-stuff at Bottom
7 x 22 uF & 2 x 0805 no-stuff at Top

12/28 Yellow mark for OPI change

PROCESSOR VCCIO: 8.5A

12/23 stuff the capacities

No-stuff sites outside the socket may be removed.
No-stuff sites inside the socket cavity need to remain.

11/16 follow DN13 to meet schematic check list

These resistors need to close to power IC

11/17 change part refernce R807 to R805

VR_SVID_ALERT# R805 75R2J-1-GP

H_CPU_SVIDCLK R806 54D9R2F-L1-GP

H_CPU_SVIDDAT R804 130R2F-1-GP

VIDALERT# AJ29 H_CPU_SVIDALRT# R803 43R2J-GP

VIDSCLK AJ30 H_CPU_SVIDCLK

VIDSOUT AJ28 H_CPU_SVIDDAT

VCC_SENSE AJ35

VSS_SENSE AJ34

VCCIO_SENSE B10

VSSIO_SENSE A10

R801 100R2F-L1-GP-U

R802 100R2F-L1-GP-U

SANDY

62.10055.421

2nd = 62.10040.771

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CPU (VCC_CORE)

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 8 of 105

SSID = CPU

VAXG Output Decoupling Recommendation:
2 x 470 uF at Bottom Socket Edge
2 x 22 uF at Top Socket Cavity
4 x 22 uF at Top Socket Edge
2 x 22 uF at Bottom Socket Cavity
4 x 22 uF at Bottom Socket Edge

Voltage Rail	Voltage	Iccmax
VCC_CORE(QC)	0.8~1.35	94A
VCC_CORE(DC)	0.8~1.35	53A
VCCIO	1.05	8.5A
VDDQ	1.5	10A
VCCSA	0.75~0.9	6A
VCCPLL	1.8	1.2A
VAXG	0~1.52	33A

POWER

VCC_GFXCORE

PROCESSOR VAXG: 33A

CPU1G — SANDY — GRAPHICS — 7 OF 9

SENSE LINES
VAXG_SENSE AK35 → VCC_AXG_SENSE 42
VSSAXG_SENSE AK34 → VSS_AXG_SENSE 42

VCC_GFXCORE
R906 100R2F-L1-GP-U
VCC_AXG_SENSE
VSS_AXG_SENSE
R907 100R2F-L1-GP-U

Refer to the latest Huron River Mainstream PDG (Doc# 436735) for more details on S3 power reduction implementation.

+V_SM_VREF_CNT should have 10 mil trace width

VREF
SM_VREF AL1 → +V_SM_VREF_CNT → +V_SM_VREF_CNT 37

Routing Guideline:
Power from DDR_VREF_S3 and +V_SM_VREF_CNT should have 10 mils trace width.

DDR3 -1.5V RAILS

PROCESSOR VDDQ: 10A

1D5V_S0 — 1D5V_S3

VDDQ Output Decoupling Recommendation:
1 x 330 uF
6 x 10 uF

79.33719.20L
2nd = 77.C3371.13L

12/28 Yellow mark for OPI

SA RAIL

PROCESSOR VCCSA: 6A

0D85V_S0

VCCSA Output Decoupling Recommendation:
1 x 330 uF
2 x 10 uF at Bottom Socket Cavity
1 x 10 uF at Bottom Socket Edge

11/16 Follow Annie team's schematic by power solution

R910 10R2J-2-GP — 0D85V_S0

R910 close to pin H23.

MISC

VCCSA_SENSE H23 → VCCSA_SENSE
FC_C22 C22, C24 → H_FC_C22, VCCSA_SEL → VCCSA_SEL 48
VCCSA_VID1

RN901 SRN1KJ-7-GP

11/ 17 dummy RN901

1.8V RAIL

PROCESSOR VCCPLL: 1.2A

1D8V_S0

VCCPLL Output Decoupling Recommendation:
1 x 330 uF
2 x 1 uF
1 x 10 uF

CPU1 — SANDY

62.10055.421
2nd = 62.10040.771

Disabling Guidelines for External Graphics Designs:
Can connect to GND if motherboard only supports external graphics and if GFX VR is not stuffed.
Can be left floating (Gfx VR keeps VAXG rail from floating) if the VR is stuffed

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CPU (VCC_GFXCORE)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 9 of 105

SSID = CPU

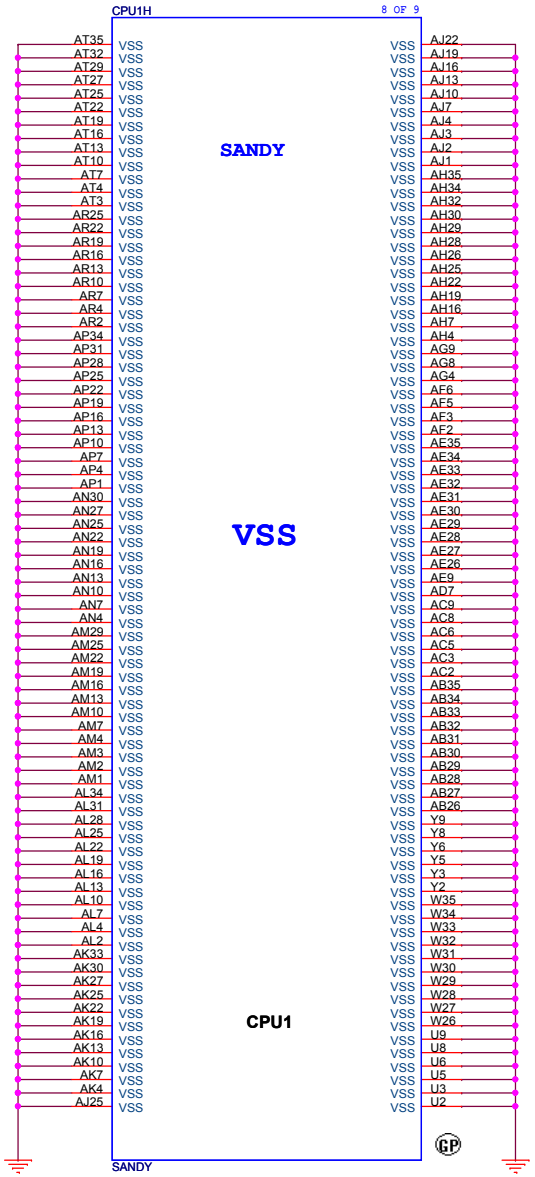

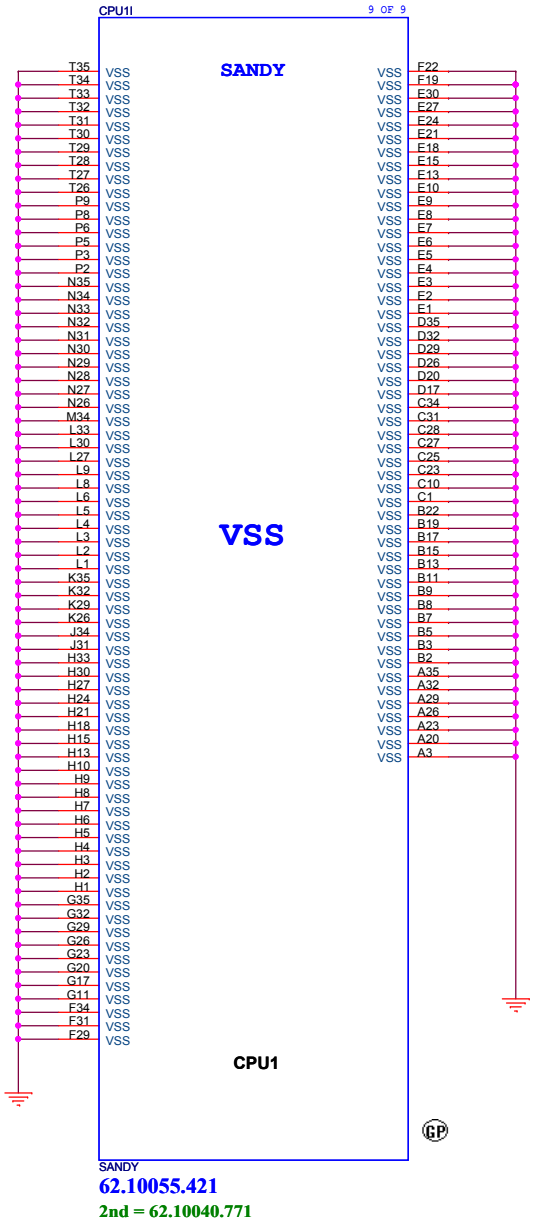

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CPU (VSS)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 10 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: XDP

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 11 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 12 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 13 of 105

SSID = MEMORY

DM2

DDR_VREF_S3
R1405 0R0402-PAD
M_VREF_CA_DIMM1
C1423 SC1U10V2KX-5GP
C1425 DY SC2D2U10V3KX-1GP
C1424 SC1U10V2KX-5GP

DDR_VREF_S3
R1404 0R0402-PAD
M_VREF_DQ_DIMM1
C1411 SC1U10V2KX-5GP
C1412 DY SC2D2U10V3KX-1GP
C1413 SC1U10V2KX-5GP

X02-0303 change 0R to short pad

0D75V_S0
Place these caps close to VTT1 and VTT2.
C1419 SC1U6D3V2KX-GP
C1420 SC1U6D3V2KX-GP
C1421 SC1U6D3V2KX-GP
C1422 DY SC1U6D3V2KX-GP
C1418 DY SC10U6D3V5KX-1GP

M_B_A[15:0] 6
M_B_BS2 6
M_B_BS0 6
M_B_BS1 6
M_B_DQ[63:0] 6

M_B_A0 98 A0
M_B_A1 97 A1
M_B_A2 96 A2
M_B_A3 95 A3
M_B_A4 92 A4
M_B_A5 91 A5
M_B_A6 90 A6
M_B_A7 86 A7
M_B_A8 89 A8
M_B_A9 85 A9
M_B_A10 107 A10/AP
M_B_A11 84 A11
M_B_A12 83 A12
M_B_A13 119 A13
M_B_A14 80 A14
M_B_A15 78 A15
79 A16/BA2
109 BA0
108 BA1

M_B_DQ0 5 DQ0
M_B_DQ1 7 DQ1
M_B_DQ2 15 DQ2
M_B_DQ3 17 DQ3
M_B_DQ4 4 DQ4
M_B_DQ5 6 DQ5
M_B_DQ6 16 DQ6
M_B_DQ7 18 DQ7
M_B_DQ8 21 DQ8
M_B_DQ9 23 DQ9
M_B_DQ10 33 DQ10
M_B_DQ11 35 DQ11
M_B_DQ12 22 DQ12
M_B_DQ13 24 DQ13
M_B_DQ14 34 DQ14
M_B_DQ15 36 DQ15
M_B_DQ16 39 DQ16
M_B_DQ17 41 DQ17
M_B_DQ18 51 DQ18
M_B_DQ19 53 DQ19
M_B_DQ20 40 DQ20
M_B_DQ21 42 DQ21
M_B_DQ22 50 DQ22
M_B_DQ23 52 DQ23
M_B_DQ24 57 DQ24
M_B_DQ25 59 DQ25
M_B_DQ26 67 DQ26
M_B_DQ27 69 DQ27
M_B_DQ28 56 DQ28
M_B_DQ29 58 DQ29
M_B_DQ30 68 DQ30
M_B_DQ31 70 DQ31
M_B_DQ32 129 DQ32
M_B_DQ33 131 DQ33
M_B_DQ34 141 DQ34
M_B_DQ35 143 DQ35
M_B_DQ36 130 DQ36
M_B_DQ37 132 DQ37
M_B_DQ38 140 DQ38
M_B_DQ39 142 DQ39
M_B_DQ40 147 DQ40
M_B_DQ41 149 DQ41
M_B_DQ42 157 DQ42
M_B_DQ43 159 DQ43
M_B_DQ44 146 DQ44
M_B_DQ45 148 DQ45
M_B_DQ46 158 DQ46
M_B_DQ47 160 DQ47
M_B_DQ48 163 DQ48
M_B_DQ49 165 DQ49
M_B_DQ50 175 DQ50
M_B_DQ51 177 DQ51
M_B_DQ52 164 DQ52
M_B_DQ53 166 DQ53
M_B_DQ54 174 DQ54
M_B_DQ55 176 DQ55
M_B_DQ56 181 DQ56
M_B_DQ57 183 DQ57
M_B_DQ58 191 DQ58
M_B_DQ59 193 DQ59
M_B_DQ60 180 DQ60
M_B_DQ61 182 DQ61
M_B_DQ62 192 DQ62
M_B_DQ63 194 DQ63

M_B_DQS#0 10 DQS0#
M_B_DQS#1 27 DQS1#
M_B_DQS#2 45 DQS2#
M_B_DQS#3 62 DQS3#
M_B_DQS#4 135 DQS4#
M_B_DQS#5 152 DQS5#
M_B_DQS#6 169 DQS6#
M_B_DQS#7 186 DQS7#

M_B_DQS0 12 DQS0
M_B_DQS1 29 DQS1
M_B_DQS2 47 DQS2
M_B_DQS3 64 DQS3
M_B_DQS4 137 DQS4
M_B_DQS5 154 DQS5
M_B_DQS6 171 DQS6
M_B_DQS7 188 DQS7

M_B_DQS#[7:0] 6
M_B_DQS[7:0] 6

6 M_B_DIM0_ODT0 116 ODT0
6 M_B_DIM0_ODT1 120 ODT1

M_VREF_CA_DIMM1 126 VREF_CA
M_VREF_DQ_DIMM1 1 VREF_DQ

15,37 DDR3_DRAMRST# 30 RESET#

0D75V_S0 203 VTT1
204 VTT2

NP1 NP2

RAS# 110 M_B_RAS# 6
WE# 113 M_B_WE# 6
CAS# 115 M_B_CAS# 6

CS0# 114 M_B_DIM0_CS#0 6
CS1# 121 M_B_DIM0_CS#1 6

CKE0 73 M_B_DIM0_CKE0 6
CKE1 74 M_B_DIM0_CKE1 6

CK0 101 M_B_DIM0_CLK_DDR0 6
CK0# 103 M_B_DIM0_CLK_DDR#0 6

CK1 102 M_B_DIM0_CLK_DDR1 6
CK1# 104 M_B_DIM0_CLK_DDR#1 6

DM0 11
DM1 28
DM2 46
DM3 63
DM4 136
DM5 153
DM6 170
DM7 187

SDA 200 PCH_SMBDATA 15,20,65
SCL 202 PCH_SMBCLK 15,20,65

EVENT# 198 TS#_DIMM0_1 15

VDDSPD 199

SA0 197 SA0_DIM1
SA1 201 SA1_DIM1

NC#1 77
NC#2 122
NC#/TEST 125

VDD1 75
VDD2 76
VDD3 81
VDD4 82
VDD5 87
VDD6 88
VDD7 93
VDD8 94
VDD9 99
VDD10 100
VDD11 105
VDD12 106
VDD13 111
VDD14 112
VDD15 117
VDD16 118
VDD17 123
VDD18 124

VSS 2 3 8 9 13 14 19 20 25 26 31 32 37 38 43 44 48 49 54 55 60 61 65 66 71 72 127 128 133 134 138 139 144 145 150 151 155 156 161 162 167 168 172 173 178 179 184 185 189 190 195 196 205 206

1D5V_S3

3D3V_S0
R1402 10KR2J-3-GP
SA1_DIM1
SA0_DIM1
R1401 10KR2J-3-GP

SWAP SA0_DM1 and SA1_DIM1 each other for DM2 can't boot up issue(only DN15/DQ15)

11/ 17 Change SMbus adress note

Note:
If SA0 DIM0 = 0, SA1_DIM0 = 0
SO-DIMMA SPD Address is 0xA0
SO-DIMMA TS Address is 0x30

If SA0 DIM0 = 0, SA1_DIM0 = 1
SO-DIMMA SPD Address is 0xA4
SO-DIMMA TS Address is 0x34

C1401 SC1D1U10V2KX-5GP
C1402 DY SC2D2U10V3KX-1GP

Thermal EVENT
3D3V_S0
TS#_DIMM0_1 R1403 10KR2J-3-GP

SODIMM A DECOUPLING
1D5V_S3
TC1401 DY ST330U2VDM4-GP
C1403 DY SC10U6D3V5KX-1GP
C1404 SC10U6D3V5KX-1GP
C1405 DY SC10U10V5ZY-1GP
C1406 SC10U6D3V5KX-1GP
C1407 DY SC10U6D3V5KX-1GP
C1408 DY SC10U10V5ZY-1GP
C1409 DY SC10U6D3V5KX-1GP
C1410 DY SC10U6D3V5KX-1GP

Layout Note:
Place these Caps near SO-DIMMA.
C1414 SC1U6D3V2KX-GP
C1415 SC1D1U10V2KX-5GP
C1416 SC1D1U10V2KX-5GP
C1417 SC1U6D3V2KX-GP

12/28 Yellow mark for OPI change

12/3 Change DM2 to 62.10024.E21
12/9 Change DM2 to 62.10017.K01
12/21 Change DM2 to 62.10017.P61
12/22 Change DM2 to 62.10024.E21

H =5.2mm

DDR3-204P-135-GP
62.10024.E21

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: DDR3-SODIMM2
Size: Custom
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 14 of 105

SSID = MEMORY

11/ 17 Change SMbus adress note

Note:
SO-DIMMB SPD Address is 0xA0
SO-DIMMB TS Address is 0x30

SO-DIMMB is placed farther from the Processor than SO-DIMMA

DM1

M_A_A[15:0] 6

M_A_A0 98
M_A_A1 97
M_A_A2 96
M_A_A3 95
M_A_A4 92
M_A_A5 91
M_A_A6 90
M_A_A7 86
M_A_A8 89
M_A_A9 85
M_A_A10 107
M_A_A11 84
M_A_A12 83
M_A_A13 119
M_A_A14 80
M_A_A15 78

6 M_A_BS2 79
6 M_A_BS0 109
6 M_A_BS1 108
6 M_A_DQ[63:0]

M_A_DQ0 5
M_A_DQ1 7
M_A_DQ2 15
M_A_DQ3 17
M_A_DQ4 4
M_A_DQ5 6
M_A_DQ6 16
M_A_DQ7 18
M_A_DQ8 21
M_A_DQ9 23
M_A_DQ10 33
M_A_DQ11 35
M_A_DQ12 22
M_A_DQ13 24
M_A_DQ14 34
M_A_DQ15 36
M_A_DQ16 39
M_A_DQ17 41
M_A_DQ18 51
M_A_DQ19 53
M_A_DQ20 40
M_A_DQ21 42
M_A_DQ22 50
M_A_DQ23 52
M_A_DQ24 57
M_A_DQ25 59
M_A_DQ26 67
M_A_DQ27 69
M_A_DQ28 56
M_A_DQ29 58
M_A_DQ30 68
M_A_DQ31 70
M_A_DQ32 129
M_A_DQ33 131
M_A_DQ34 141
M_A_DQ35 143
M_A_DQ36 130
M_A_DQ37 132
M_A_DQ38 140
M_A_DQ39 142
M_A_DQ40 147
M_A_DQ41 149
M_A_DQ42 157
M_A_DQ43 159
M_A_DQ44 146
M_A_DQ45 148
M_A_DQ46 158
M_A_DQ47 160
M_A_DQ48 163
M_A_DQ49 165
M_A_DQ50 175
M_A_DQ51 177
M_A_DQ52 164
M_A_DQ53 166
M_A_DQ54 174
M_A_DQ55 176
M_A_DQ56 181
M_A_DQ57 183
M_A_DQ58 191
M_A_DQ59 193
M_A_DQ60 180
M_A_DQ61 182
M_A_DQ62 192
M_A_DQ63 194

M_A_DQS#0 10
M_A_DQS#1 27
M_A_DQS#2 45
M_A_DQS#3 62
M_A_DQS#4 135
M_A_DQS#5 152
M_A_DQS#6 169
M_A_DQS#7 186

M_A_DQS0 12
M_A_DQS1 29
M_A_DQS2 47
M_A_DQS3 64
M_A_DQS4 137
M_A_DQS5 154
M_A_DQS6 171
M_A_DQS7 188

6 M_A_DIM0_ODT0 116
6 M_A_DIM0_ODT1 120

M_VREF_CA_DIMM0 126
M_VREF_DQ_DIMM0 1

14,37 DDR3_DRAMRST# 30

0D75V_S0 203 204

NP1 NP2

RAS# 110 — M_A_RAS# 6
WE# 113 — M_A_WE# 6
CAS# 115 — M_A_CAS# 6

CS0# 114 — M_A_DIM0_CS#0 6
CS1# 121 — M_A_DIM0_CS#1 6

CKE0 73 — M_A_DIM0_CKE0 6
CKE1 74 — M_A_DIM0_CKE1 6

CK0 101 — M_A_DIM0_CLK_DDR0 6
CK0# 103 — M_A_DIM0_CLK_DDR#0 6

CK1 102 — M_A_DIM0_CLK_DDR1 6
CK1# 104 — M_A_DIM0_CLK_DDR#1 6

M_A_DQS#[7:0] 6
M_A_DQS[7:0] 6

DM0 11
DM1 28
DM2 46
DM3 63
DM4 136
DM5 153
DM6 170
DM7 187

SDA 200 — PCH_SMBDATA 14,20,65
SCL 202 — PCH_SMBCLK 14,20,65

EVENT# 198 — TS#_DIMM0_1 14

VDDSPD 199

SA0 197 — SA0_DIM0
SA1 201 — SA1_DIM0

NC#1 77
NC#2 122
NC#/TEST 125

VDD1 75
VDD2 76
VDD3 81
VDD4 82
VDD5 87
VDD6 88
VDD7 93
VDD8 94
VDD9 99
VDD10 100
VDD11 105
VDD12 106
VDD13 111
VDD14 112
VDD15 117
VDD16 118
VDD17 123
VDD18 124

VSS 2 3 8 9 13 14 19 20 25 26 31 32 37 38 43 44 48 49 54 55 60 61 65 66 71 72 127 128 133 134 138 139 144 145 150 151 155 156 161 162 167 168 172 173 178 179 184 185 189 190 195 196 205 206

DDR3-204P-128-GP
62.10024.D51

H =9.2mm

SA1_DIM0
SA0_DIM0

R1502 10KR2J-3-GP
R1501 10KR2J-3-GP

3D3V_S0

C1501 SCD1U10V2KX-5GP
C1502 SC2D2U10V3KX-1GP DY

1D5V_S3

DDR_VREF_S3

R1504 0R0402-PAD
M_VREF_CA_DIMM0
C1523 SCD1U10V2KX-5GP
C1524 SC2D2U10V3KX-1GP DY
C1522 SCD1U10V2KX-5GP

R1503 0R0402-PAD
M_VREF_DQ_DIMM0
C1515 SCD1U10V2KX-5GP
C1516 SC2D2U10V3KX-1GP DY
C1517 SCD1U10V2KX-5GP

X02-0303 change 0R to short pad

Place these caps close to VTT1 and VTT2.

0D75V_S0
C1518 SC1U6D3V2KX-GP DY
C1519 SC1U6D3V2KX-GP
C1520 SC1U6D3V2KX-GP DY
C1521 SC1U6D3V2KX-GP

SODIMM B DECOUPLING

12/28 Yellow mark for OPI change

1D5V_S3
C1503 SC10U10V5ZY-1GP DY
C1504 SC10U10V5ZY-1GP DY
C1505 SC10U6D3V5KX-1GP
C1506 SC10U6D3V5KX-1GP
C1507 SC10U6D3V5KX-1GP
C1508 SC10U10V5ZY-1GP DY
C1509 SC10U6D3V5KX-1GP
C1510 SC10U6D3V5KX-1GP DY

C1511 SC1U6D3V2KX-GP
C1512 SCD1U10V2KX-5GP
C1513
C1514 SCD1U10V2KX-5GP

Layout Note:
Place these Caps near SO-DIMMB.

12/7 Change DM1 to 62.10024.D51
12/9 Change DM1 to 62.10017.K11
12/17 Change DM1 to 62.10017.N11
12/21 Change DM1 to 62.10017.Q41
12/22 Change DM1 to 62.10024.D91
12/22 Change DM1 to 62.10024.D51

Note:
The symbol DM1 is change value and PN only.

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: DDR3-SODIMM1
Size: Custom
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 15 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 16 of 105

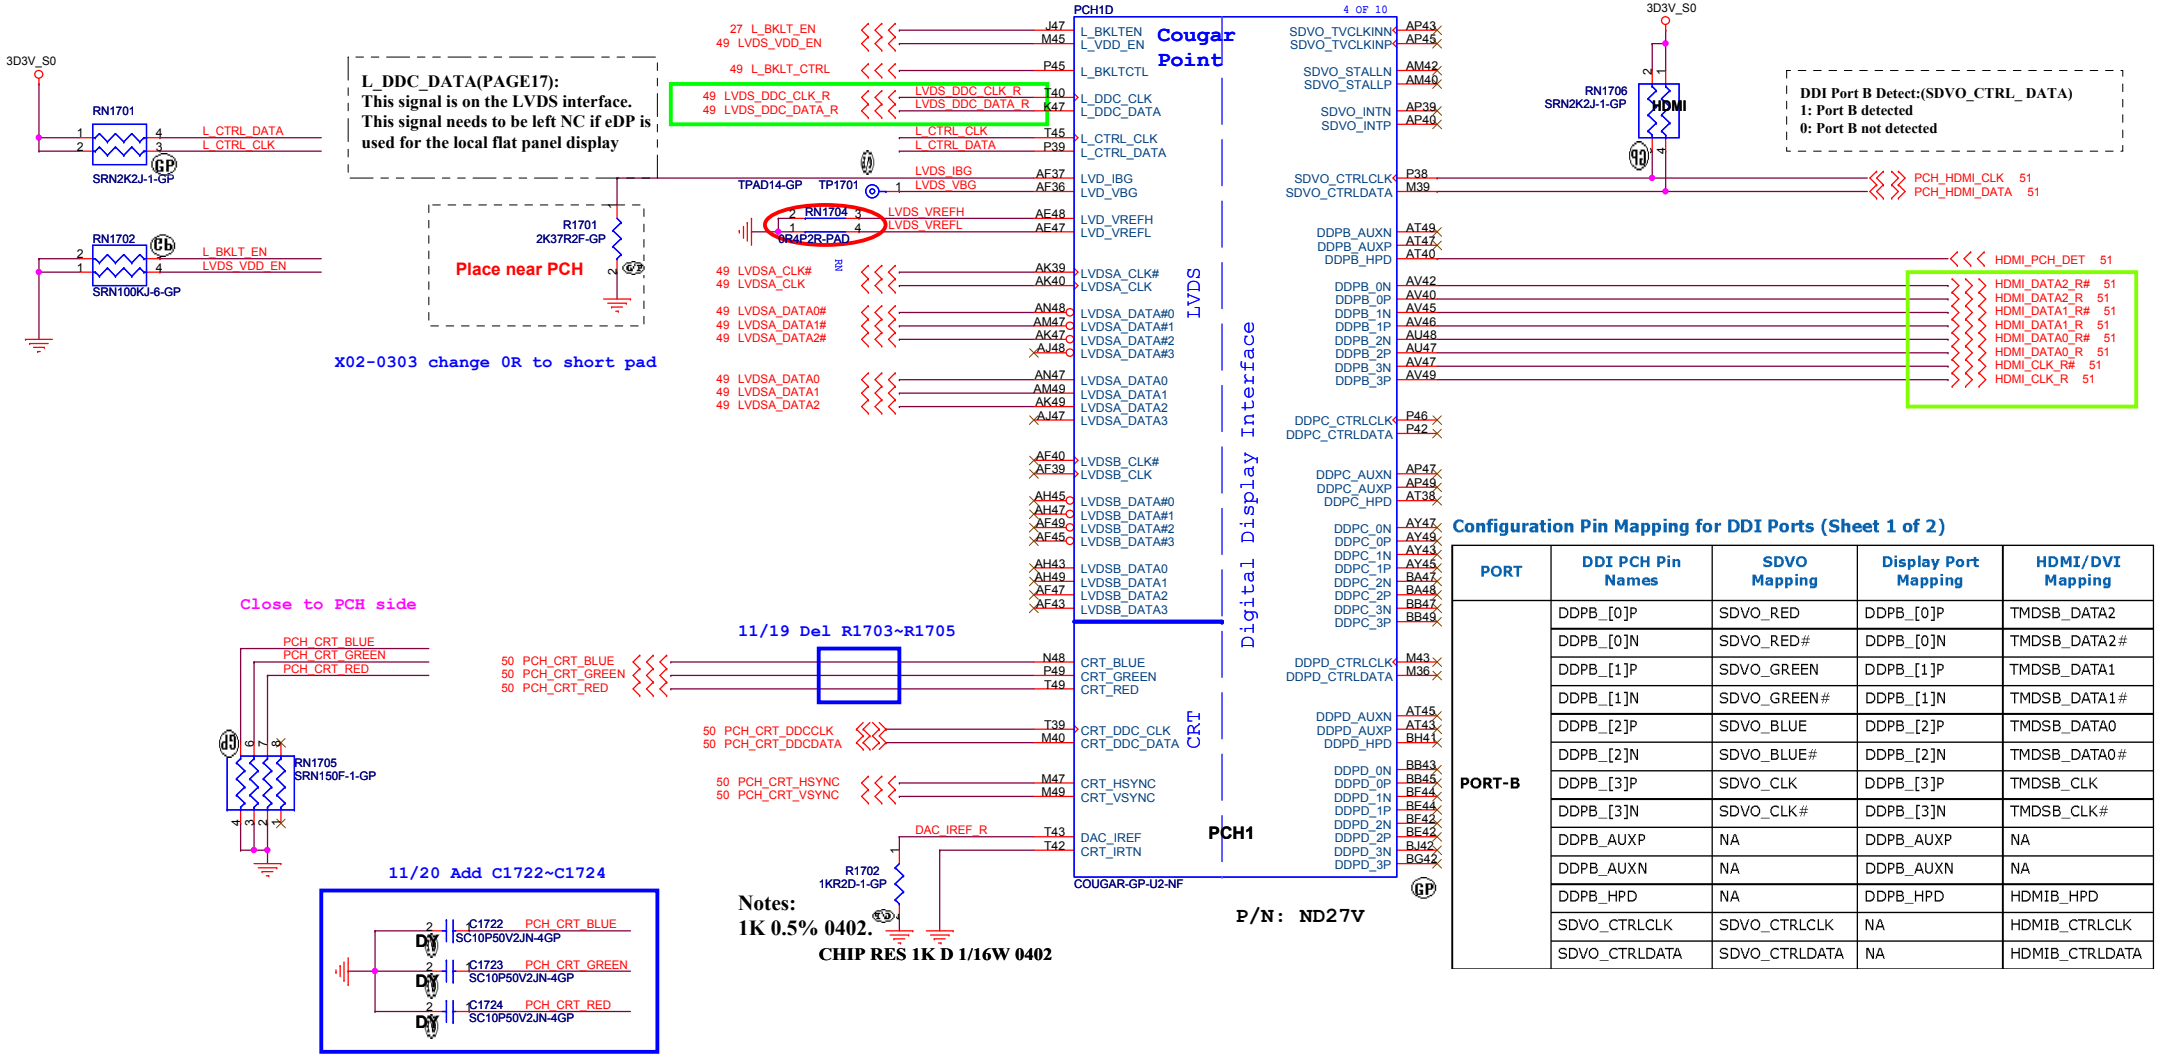

Configuration Pin Mapping for DDI Ports (Sheet 1 of 2)

PORT	DDI PCH Pin Names	SDVO Mapping	Display Port Mapping	HDMI/DVI Mapping
PORT-B	DDPB_[0]P	SDVO_RED	DDPB_[0]P	TMDSB_DATA2
	DDPB_[0]N	SDVO_RED#	DDPB_[0]N	TMDSB_DATA2#
	DDPB_[1]P	SDVO_GREEN	DDPB_[1]P	TMDSB_DATA1
	DDPB_[1]N	SDVO_GREEN#	DDPB_[1]N	TMDSB_DATA1#
	DDPB_[2]P	SDVO_BLUE	DDPB_[2]P	TMDSB_DATA0
	DDPB_[2]N	SDVO_BLUE#	DDPB_[2]N	TMDSB_DATA0#
	DDPB_[3]P	SDVO_CLK	DDPB_[3]P	TMDSB_CLK
	DDPB_[3]N	SDVO_CLK#	DDPB_[3]N	TMDSB_CLK#
	DDPB_AUXP	NA	DDPB_AUXP	NA
	DDPB_AUXN	NA	DDPB_AUXN	NA
	DDPB_HPD	NA	DDPB_HPD	HDMIB_HPD
	SDVO_CTRLCLK	SDVO_CTRLCLK	NA	HDMIB_CTRLCLK
	SDVO_CTRLDATA	SDVO_CTRLDATA	NA	HDMIB_CTRLDATA

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (LVDS/CRT/DDI)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 17 of 105

SSID = PCH

12/2 Net swap for layout

RN1801
INT_PIRQB# 1
INT_PIRQD# 2
INT_PIRQC# 3
INT_PIRQF# 4
5
10 INT_PIRQE#
9 INT_PIRQA#
8 INT_PIRQH#
7 INT_PIRQG#
6
3D3V_S0
3D3V_S0
SRN8K2J-2-GP-U

R1801 DY 1 4K7R2J-2-GP PCI_GNT3#

A16 swap override Strap/Top-Block Swap Override jumper	
PCI_GNT#3	Low = A16 swap override/Top-Block Swap Override enabled High = Default

R1802 DY 1 1KR2J-1-GP BBS_BIT1
R1803 DY 1 1KR2J-1-GP BBS_BIT0 BBS_BIT0 21

BOOT BIOS Strap		
GNT1#/GPIO51	SATA1GP/GPIO19	BOOT BIOS Location
0	0	LPC
0	1	Reserved
1	0	Reserved
1	1	SPI (Default)

RN1803
DGPU_HOLD_RST# 1
DGPU_PWR_EN# 2
4
3
SRN10KJ-5-GP

PCH1E
5 OF 10
Cougar Point
RSVD
NVRAM
PCI
USB
PCH1
COUGAR-GP-U2-NF

TP1 TP2 TP3 TP4 TP5 TP6 TP7 TP8 TP9 TP10 TP11 TP12 TP13 TP14 TP15 TP16 TP17 TP18 TP19 TP20
TP21 TP22 TP23 TP24
TP25 TP26 TP27 TP28 TP29 TP30 TP31 TP32 TP33 TP34 TP35 TP36 TP37 TP38 TP39 TP40

RSVD AY7 AV7 AU3 BG4 AT10 BC8 AU2 AT4 AT3 AT1 AY3 AT5 AV3 AV1 BB1 BA3 BB5 BB3 BB7 BE8 BD4 BF6
RSVD AV5 NV_ALE
DF_TVS AY1 NV_CLE
RSVD AV10 NV_RCOMP 1 TP1803 TPAD14-GP
RSVD AT8 AY5 BA2 AT12 BF3

USB Ext. port 1 (HS)
External debug port use on Huron river platform

USBP0N C24
USBP0P A24
USBP1N C25 USB_PN1 61
USBP1P B25 USB_PP1 61
USBP2N C26
USBP2P A26
USBP3N K28
USBP3P H28
USBP4N E28
USBP4P D28
USBP5N C28 USB_PN5 32
USBP5P A28 USB_PP5 32
USBP6N C29
USBP6P B29
USBP7N N28
USBP7P M28
USBP8N L30 USB_PN8 82
USBP8P K30 USB_PP8 82
USBP9N G30 USB_PN9 82
USBP9P E30 USB_PP9 82
USBP10N C30
USBP10P A30
USBP11N L32 USB_PN11 65
USBP11P K32 USB_PP11 65
USBP12N G32 USB_PN12 49
USBP12P E32 USB_PP12 49
USBP13N C32
USBP13P A32

USBRBIAS# C33 USB_RBIAS 1 R1811 22D6R2F-L1-GP
USBRBIAS B33

OC0#/GPIO59 A14 USB_OC#0_1 61
OC1#/GPIO40 K20 USB_OC#2_3
OC2#/GPIO41 B17 USB_OC#4_5
OC3#/GPIO42 C16 USB_OC#6_7
OC4#/GPIO43 L16 USB_OC#8_9 61
OC5#/GPIO9 A16 USB_OC#10_11
OC6#/GPIO10 D14 USB_OC#12_13
OC7#/GPIO14 C14 PCH_GPIO14

OC[3:0]# for Device 29 (Ports 0-7)
OC[7:4]# for Device 26 (Ports 8-13)

3D3V_S0
R1814 8K2R2J-3-GP
INT_PIRQA# K40 PIRQA#
INT_PIRQB# K38 PIRQB#
INT_PIRQC# H38 PIRQC#
INT_PIRQD# G38 PIRQD#
83 DGPU_HOLD_RST# TPAD14-GP TP1807 DGPU_SELECT# C46 REQ1#/GPIO50
93 DGPU_PWR_EN# DGPU_PWR_EN# C44 REQ2#/GPIO52
E40 REQ3#/GPIO54
TPAD14-GP TP1806 PCH_GPIO53 BBS_BIT1 D47 GNT1#/GPIO51
TPAD14-GP TP1801 PCI_GNT3# E42 GNT2#/GPIO53
F46 GNT3#/GPIO55
56 SATA_ODD_DA# R1813 0R0402-PAD 2 INT_PIRQE# G42 PIRQE#/GPIO2
INT_PIRQF# G40 PIRQF#/GPIO3
INT_PIRQG# C42 PIRQG#/GPIO4
INT_PIRQH# D44 PIRQH#/GPIO5
TPAD14-GP TP1802 PCI_PME# K10 PME#
PCI_PLTRST# C6 PLTRST#

X02-0311 dummy R1804

71 CLK_PCI_LPC R1804 DY 22R2J-2-GP CLK_PCI_LPC_R H49 CLKOUT_PCI0
20 CLK_PCI_FB R1805 22R2J-2-GP CLK_PCI_FB_R H43 CLKOUT_PCI1
27 CLK_PCI_KBC R1806 22R2J-2-GP CLK_PCI_KBC_R J48 CLKOUT_PCI2
K42 CLKOUT_PCI3
H40 CLKOUT_PCI4

EC1802 DY SC4D7P50V2CN-1GP
EC1801 DY SC33P50V2JN-3GP
EC1803 DY SC33P50V2JN-3GP

KBC CLK EMI

X02-0303 change 0R to short pad

5,27,31,65,71,83 PLT_RST# R1807 0R0402-PAD 2 PCI_PLTRST#
R1816 DY 100KR2J-1-GP
C1801 DY SC220P50V2KX-3GP

12/1 Swap net for layout
11/11 change to RN1802 to meet schematic check result.

RN1802
PCH_GPIO14 1
USB_OC#6_7 2
USB_OC#10_11 3
USB_OC#4_5 4
5
3D3V_S5
10 3D3V_S5
9 USB_OC#0_1
8 USB_OC#12_13
7 USB_OC#8_9
6 USB_OC#2_3
SRN8K2J-2-GP-U

1D8V_S0
R1808 2K2R2J-2-GP
R1809 1KR2J-1-GP
NV_CLE 1
H_SNB_IVB# 5

DMI & FDI Termination Voltage	
NV_CLE	Set to Vss when LOW Set to Vcc when HIGH

1D8V_S0
R1810 1KR2J-1-GP DY
NV_ALE

Danbury Technology:
Disabled when Low.
Enable when High.

USB Table

Pair	Device
0	X
1	USB Ext. port 2 (MB)
2	X
3	X
4	X
5	CARD READER
6	X
7	X
8	USB Ext. port 3
9	USB Ext. port 1
10	X
11	Mini Card1 (WLAN+BT)
12	CAMERA
13	X

USB 2.0 Overcurrent Pin Default Usage

Pin	Default Port Mapping	Pin	Default Port Mapping
OC0#	Port 0, Port 1	OC4#	Port 8, Port 9
OC1#	Port 2, Port 3	OC5#	Port 10, Port 11
OC2#	Port 4, Port 5	OC6#	Port 12, Port 13
OC3#	Port 6, Port 7	OC7#	Not Used

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (PCI/USB/NVRAM)
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 18 of 105

SSID = PCH

Signal Routing Guideline:
DMI_ZCOMP keep W=4 mils and routing length less than 500 mils.
DMI_IRCOMP keep W=4 mils and routing length less than 500 mils.

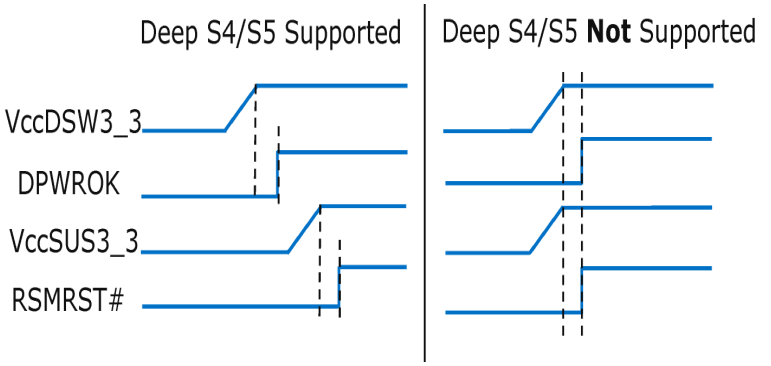

For platforms not supporting Deep S4/S5
1.VccSUS3_3 and VccDSW3_3 will rise at the same time (connected on board)
2.DPWROK and RSMRST# will rise at the same time (connected on board)
3.SLP_SUS# and SUSACK# are left as "no connect"
4.SUSWARN# used as SUSPWRDNACK/GPIO30

PCH1C — Cougar Point — 3 OF 10

DMI_RXN[3:0] → DMI_RXN0 BC24, DMI_RXN1 BE20, DMI_RXN2 BG18, DMI_RXN3 BG20 → DMI0RXN, DMI1RXN, DMI2RXN, DMI3RXN
DMI_RXP[3:0] → DMI_RXP0 BE24, DMI_RXP1 BC20, DMI_RXP2 BJ18, DMI_RXP3 BJ20 → DMI0RXP, DMI1RXP, DMI2RXP, DMI3RXP
DMI_TXN[3:0] → DMI_TXN0 AW24, DMI_TXN1 AW20, DMI_TXN2 BB18, DMI_TXN3 AV18 → DMI0TXN, DMI1TXN, DMI2TXN, DMI3TXN
DMI_TXP[3:0] → DMI_TXP0 AY24, DMI_TXP1 AY20, DMI_TXP2 AY18, DMI_TXP3 AU18 → DMI0TXP, DMI1TXP, DMI2TXP, DMI3TXP

FDI_TXN[7:0] ← FDI_RXN0 BJ14, FDI_RXN1 AY14, FDI_RXN2 BE14, FDI_RXN3 BH13, FDI_RXN4 BC12, FDI_RXN5 BJ12, FDI_RXN6 BG10, FDI_RXN7 BG9
FDI_TXP[7:0] ← FDI_RXP0 BG14, FDI_RXP1 BB14, FDI_RXP2 BF14, FDI_RXP3 BG13, FDI_RXP4 BE12, FDI_RXP5 BG12, FDI_RXP6 BJ10, FDI_RXP7 BH9

1D05V_VTT
R1901 1 — 49D9R2F-GP — DMI_COMP_R — BJ24 DMI_ZCOMP
R1902 1 — 750R2F-GP — RBIAS_CPY — BG25 DMI_IRCOMP, BH21 DMI2RBIAS

FDI_INT AW16 → FDI_INT 4
FDI_FSYNC0 AV12 → FDI_FSYNC0 4
FDI_FSYNC1 BC10 → FDI_FSYNC1 4
FDI_LSYNC0 AV14 → FDI_LSYNC0 4
FDI_LSYNC1 BB10 → FDI_LSYNC1 4

DMI, FDI

System Power Management

DSWVRMEN A18 ← DSWODVREN
DPWROK E22 ← PCH_DPWROK — R1910 0R0402-PAD — PM_RSMRST# — R1911 DY 10KR2J-3-GP — RTC_AUX_S5
WAKE# B9 → PCH_WAKE# 27
CLKRUN#/GPIO32 N3 → PM_CLKRUN# 27
SUS_STAT#/GPIO61 G8 → PM_SUS_STAT# → TP1901 TPAD14-GP
SUSCLK/GPIO62 N14 → SUS_CLK — R1913 0R0402-PAD → PCH_SUSCLK_KBC 27
SLP_S5#/GPIO63 D10 → PM_SLP_S5# → TP1902 TPAD14-GP
SLP_S4# H4 → PM_SLP_S4# 27,46
SLP_S3# F4 → PM_SLP_S3# 27,36,37,47
SLP_A# G10 → PM_SLP_A# → TP1903 TPAD14-GP
SLP_SUS# G16 → PM_SLP_SUS# → TP1904 TPAD14-GP
PMSYNCH AP14 → H_PM_SYNC → H_PM_SYNC 5
SLP_LAN#/GPIO29 K14 → PM_SLP_LAN# → TP1905 TPAD14-GP

SUSACK# C12 ← SUS_PWR_ACK — R1903 0R0402-PAD — SUSACK#
SYS_RESET# K3 ← XDP_DBRESET# 5 — R1925 0R0402-PAD — SYS_RESET#; R1905 DY 10KR2J-3-GP 3D3V_S0
SYS_PWROK P12 ← SYS_PWROK 36 — R1923 DY 0R2J-2-GP
PWROK L22 ← S0_PWR_GOOD 27,36 — R1924 0R0402-PAD — PWROK
APWROK L10 ← RUNPWROK 45,46,47 — R1907 DY 0R2J-2-GP — MEPWROK — R1906 0R0402-PAD
DRAMPWROK B13 ← PM_DRAM_PWRGD 5,37
RSMRST# C21 ← PM_RSMRST#
SUSWARN#/SUSPWRDNACK/GPIO30 K16 ← SUS_PWR_ACK 27
PWRBTN# E20 ← PM_PWRBTN# 27
ACPRESENT/GPIO31 H20 ← AC_PRESENT 27
BATLOW#/GPIO72 E10 ← BATLOW#
RI# A10 ← PM_RI#

PCH1
COUGAR-GP-U2-NF
GP

R1926 10KR2J-3-GP — SYS_PWROK
R1904 100KR2J-1-GP — PWROK

X02-0303 change 0R to short pad

S0_PWR_GOOD after PM_SLP_S3# delay 200 ms

P/N: ND27V

PM_RSMRST# — R1912 0R0402-PAD — RSMRST#_KBC 27

DSWODVREN - On Die DSW VR Enable	
HIGH	Enabled (DEFAULT)
LOW	Disabled

RTC_AUX_S5
R1917 1 — 330KR2J-L1-GP
DSWODVREN — R1918 1 DY 330KR2J-L1-GP

3D3V_S0
PM_CLKRUN# — R1919 1 — 8K2R2J-3-GP

3D3V_S5
RN1901 SRN10KJ-6-GP
8 BATLOW#
7 PCH_WAKE#
6 PM_RI#
5 SUS_PWR_ACK

12/2 Swap net for layout

R1909 10KR2J-3-GP — AC_PRESENT
R1922 DY 10KR2J-3-GP — PM_PWRBTN#
R1920 DY 10KR2J-3-GP — PM_SLP_LAN#
R1908 10KR2J-3-GP — PM_RSMRST#

PCIE_WAKE#
CRB : 1K
CEKLT: 10K

PCH_SUSCLK_KBC — EC1901 DY SC4D7P50V2CN-1GP

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (DM I/FDI/PM)
Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00
Date: Wednesday, April 13, 2011 | Sheet 19 of 105

SSID = PCH

CLK_PCH_48M
EC2001
DY
SC4D7P50V2CN-1GP

PCH1B
2 OF 10
Cougar Point
W-WAN
LAN
Card Reader
WLAN
USB3.0
Intel GBE LAN
Dock
NEW CARD
PCI-E*
SMBUS
Controller Link
CLOCKS
FLEX CLOCKS
COUGAR-GP-U2-NF

31 PCIE_RXN2
31 PCIE_RXP2
31 PCIE_TXN2
31 PCIE_TXP2
C2001 SCD1U10V2KX-5GP PCIE_TXN2_C
C2002 SCD1U10V2KX-5GP PCIE_TXP2_C

65 PCIE_RXN4
65 PCIE_RXP4
65 PCIE_TXN4
65 PCIE_TXP4
C2005 SCD1U10V2KX-5GP PCIE_TXN4_C
C2006 SCD1U10V2KX-5GP PCIE_TXP4_C

12/2 Swap net for layout
RN2001
PCIE_CLK_REQ0#
PCIE_CLK_LAN_REQ#
PCIE_CLK_REQ5#
3D3V_S5
PEG_B_CLKRQ#
PCIE_CLK_REQ4#
CLK_PCIE_REQ7#
EC_SWI#
SRN10KJ-L3-GP

SMBALERT#/GPIO11 E12 EC_SWI# >>> EC_SWI# 27
SMBCLK H14 SMB_CLK
SMBDATA C9 SMB_DATA
SML0ALERT#/GPIO60 A12 DRAMRST_CNTRL_PCH >>> DRAMRST_CNTRL_PCH 37
SML0CLK C8 SML0_CLK
SML0DATA G12 SML0_DATA
SML1ALERT#/PCHHOT#/GPIO74 C13 PCH_GPIO74
SML1CLK/GPIO58 E14 SML1_CLK <<> SML1_CLK 27,85
SML1DATA/GPIO75 M16 SML1_DATA <<> SML1_DATA 27,85

CL_CLK1 M7 CL_CLK TP2001 TPAD14-GP
CL_DATA1 T11 CL_DATA TP2002 TPAD14-GP
CL_RST1# P10 CL_RST# TP2003 TPAD14-GP

3D3V_S5
UMA
R2004 10KR2J-3-GP
PEG_CLKREQ# R
DIS
R2005 10KR2J-3-GP

SMB_CLK
SMB_DATA
SML0_DATA
SML0_CLK
SML1_CLK
SML1_DATA
PCIE_CLK_REQ6#
PCH_GPIO74
DRAMRST_CNTRL_PCH
RN2003 SRN2K2J-1-GP
RN2004 SRN2K2J-1-GP
RN2005 SRN2K2J-1-GP
RN2006 SRN10KJ-5-GP
R2009 1KR2J-1-GP

3D3V_S0
RN2007 SRN2K2J-1-GP
2nd = 84.DM601.03F
84.2N702.A3F
2N7002KDW-GP
SMB_DATA
SMB_CLK
Q2001
PCH_SMBDATA 14,15,65
PCH_SMBCLK 14,15,65

CRB : 1K
CEKLT: 10K

PEG_A_CLKRQ#/GPIO47 M10 PEG_CLKREQ# R
R2003 0R2J-2-GP
PEG_CLKREQ# 85
12/6 swap net for layout
RN2016 0R4P2R-PAD
CLKOUT_PEG_A_N AB37 CLKOUT_PEG_A_N
CLKOUT_PEG_A_P AB38 CLKOUT_PEG_A_P
CLK_PCIE_VGA# 83
CLK_PCIE_VGA 83

CLKOUT_DMI_N AV22 CLKOUT_DMI_N
CLKOUT_DMI_P AU22 CLKOUT_DMI_P
RN2010 0R4P2R-PAD
CLK_EXP_N 5
CLK_EXP_P 5

CLKOUT_DP_N AM12
CLKOUT_DP_P AM13

CLKIN_DMI_N BF18 CLK_BUF_EXP_N
CLKIN_DMI_P BE18 CLK_BUF_EXP_P

CLKIN_GND1_N BJ30 CLK_BUF_CPYCLK_N
CLKIN_GND1_P BG30 CLK_BUF_CPYCLK_P
RN2008 SRN10KJ-5-GP

CLKIN_DOT_96N G24 CLK_BUF_DOT96_N
CLKIN_DOT_96P E24 CLK_BUF_DOT96_P
PL 10K FOR Integrated CLOCK GEN mode.

CLKIN_SATA_N AK7 CLK_BUF_CKSSCD_N
CLKIN_SATA_P AK5 CLK_BUF_CKSSCD_P
RN2020 SRN10KJ-5-GP
CLK_BUF_DOT96_N
CLK_BUF_DOT96_P

REFCLK14IN K45 CLK_BUF_REF14
RN2021 SRN10KJ-5-GP
CLK_BUF_CKSSCD_N
CLK_BUF_CKSSCD_P

CLKIN_PCILOOPBACK H45 CLK_PCI_FB <<< CLK_PCI_FB 18
12/6 swap net for layout

XTAL25_IN V47 XTAL25_IN
XTAL25_OUT V49 XTAL25_OUT
RN2019 SRN10KJ-5-GP
CLK_BUF_EXP_N
CLK_BUF_EXP_P

XCLK_RCOMP Y47 XCLK_RCOMP
R2007 90D9R2F-1-GP
+VCCDIFFCLKN
CLK_BUF_REF14 R2008 10KR2J-3-GP

CLKOUTFLEX0/GPIO64 K43 JTAG_TCK
R2001 22R2J-2-GP
JTAG_TCK_VGA 83,85
CLKOUTFLEX1/GPIO65 F47 CLK_48_USB30
R2016 22R2J-2-GP
CLK_PCH_48M 32
CLKOUTFLEX2/GPIO66 H47 CLK_27M_VGA_R
TP2007 TPAD14-GP
CLKOUTFLEX3/GPIO67 K49 DGPU_PRSNT#

11/18 Del VGA 27M and change to TP2007

WWAN CLK
PCIE_CLK_REQ0# J2 PCIECLKRQ0#/GPIO73
CLKOUT_PCIE0N Y40
CLKOUT_PCIE0P Y39

WLAN CLK
65 CLK_PCIE_WLAN#
65 CLK_PCIE_WLAN
RN2012 0R4P2R-PAD
CLK_PCH_SRC1_N AB49 CLKOUT_PCIE1N
CLK_PCH_SRC1_P AB47 CLKOUT_PCIE1P
65 CLK_PCIE_WLAN_REQ# M1 PCIECLKRQ1#/GPIO18

LAN CLK
12/6 swap net for layout
PCIE_CLK_REQ2# V10 PCIECLKRQ2#/GPIO20
31 CLK_PCIE_LAN#
31 CLK_PCIE_LAN
RN2014 0R4P2R-PAD
CLK_PCH_SRC3_N Y37 CLKOUT_PCIE3N
CLK_PCH_SRC3_P Y36 CLKOUT_PCIE3P
31 PCIE_CLK_LAN_REQ# A8 PCIECLKRQ3#/GPIO25
A00-0413 SWAP RN2014 net for layout

USB3.0 CLK
CLKOUT_PCIE4N Y43
CLKOUT_PCIE4P Y45
PCIE_CLK_REQ4# L12 PCIECLKRQ4#/GPIO26

CLKOUT_PCIE5N V45
CLKOUT_PCIE5P V46
PCIE_CLK_REQ5# L14 PCIECLKRQ5#/GPIO44

CLKOUT_PEG_B_N AB42
CLKOUT_PEG_B_P AB40
PEG_B_CLKRQ# E6 PEG_B_CLKRQ#/GPIO56

CLKOUT_PCIE6N V40
CLKOUT_PCIE6P V42
PCIE_CLK_REQ6# T13 PCIECLKRQ6#/GPIO45

NEWCARD CLK
CLKOUT_PCIE7N V38
CLKOUT_PCIE7P V37
CLK_PCIE_REQ7# K12 PCIECLKRQ7#/GPIO46
TPAD14-GP TP2005 ITPXDP_N AK14 CLKOUT_ITPXDP_N
TPAD14-GP TP2006 ITPXDP_P AK13 CLKOUT_ITPXDP_P

PCH1
P/N: ND27V

3D3V_S0
RN2018 SRN10KJ-5-GP
PCIE_CLK_REQ2#
CLK_PCIE_WLAN_REQ#
PCIECLKRQ1# and PCIECLKRQ2#
Support S0 power only

11/1 Add EC2002~EC2007 for EMI request
CLK_PCIE_WLAN# SC22P50V2JN-4GP DY EC2002
CLK_PCIE_WLAN SC22P50V2JN-4GP DY EC2003
CLK_PCIE_LAN SC22P50V2JN-4GP DY EC2004
CLK_PCIE_LAN# SC22P50V2JN-4GP DY EC2005
JTAG_TCK_VGA SC22P50V2JN-4GP DY EC2007

Prioritize 27/14/24/48/25-MHz FLEX on FLEX1 and FLEX3
Do not configure 27/14/24/48/25-MHz FLEX clock on FLEX0 and FLEX2
if more than 2 PCI clocks + PCI loopback are routed.

XTAL25_IN
XTAL25_OUT
C2008 SC15P50V2JN-2-GP
X2001 XTAL-25MHZ-155-GP
R2006 1M1R2J-GP
C2007 SC15P50V2JN-2-GP

11/29 change X2001 to 82.30020.D41
X01-0217 change C2008 , C2007 to 15pF

3D3V_S0 3D3V_S0
R2012 R2013
UMA
UMA_DISCRETE#
UMA: 1 1
DIS :0 1
SG(PX) : 0 0
Optimus(Muxless) : 1 0
UMA_DIS#
DGPU_PRSNT#
UMA_DIS# 22
R2010 R2011
DY DIS

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (PCI-E/SMBUS/CLOCK/CL)
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 20 of 105

SSID = PCH

X01-0210 Merge R2115 R2116

X01-0208 Add RN2101, R2127 for LPC EA result
X01-0210 change RN2101 to RN2104 RN2105

INTVRMEN- Integrated SUS 1.05V VRM Enable
High - Enable internal VRs
Low - Enable external VRs

RTC_AUX_S5

RN2106 SRN20KJ-1-GP

C2103 SC1U6D3V2KX-GP

C2104 SC1U6D3V2KX-GP

G2101 CAP-OPEN

RTC_X1 — R2101 10MR2J-L-GP — RTC_X2

X2101 X-32D768KHZ-67-GP

C2101 SC15P50V2JN-2-GP

C2102 SC15P50V2JN-2-GP

82.30001.A81

2nd = 82.30001.691

3rd = 82.30001.861

29 HDA_CODEC_SDOUT — 33R2J-2-GP — R2123 HDA_SDOUT

29 HDA_CODEC_RST#
29 HDA_CODEC_BITCLK
RN2102 SRN33J-5-GP
HDA_RST#
HDA_BITCLK

R2104 1M1R2J-GP — SRTC_RST#

SM_INTRUDER#

RTC_AUX_S5 — R2105 330KR2F-L-GP — PCH_INTVRMEN

HDA_BITCLK
HDA_SYNC
29 HDA_SPKR
HDA_RST#
29 HDA_SDIN0

Notes:
ME_UNLOCK (HDA_SDO) connect to EC.
Make sure EC drive this pin "low" all the time.

27 ME_UNLOCK — R2107 1KR2J-1-GP — HDA_SDOUT

TPAD14-GP TP2105 — PCH_GPIO33

TPAD14-GP TP2101 — PCH_JTAG_TCK_BUF
TPAD14-GP TP2102 — PCH_JTAG_TMS
TPAD14-GP TP2103 — PCH_JTAG_TDI
TPAD14-GP TP2104 — PCH_JTAG_TDO

27,60 SPI_CLK_R — R2108 33R2J-2-GP — PCH_SPI_CLK
27,60 SPI_CS0#_R — R2109 33R2J-2-GP — PCH_SPI_CS0#
PCH_SPI_CS1#
27,60 SPI_SI_R — R2110 33R2J-2-GP — PCH_SPI_SI
27,60 SPI_SO_R — ER2111 0R0402-PAD — PCH_SPI_SO

11/1 Add R2111 for EMI request

11/ 17 change R2111 from 33ohm to 0ohm and change to ER2111

PCH1A — 1 OF 10 — Cougar Point — PCH1 — COUGAR-GP-U2-NF

RTC: RTCX1 A20, RTCX2 C20, RTCRST# D20, SRTCRST# G22, INTRUDER# K22, INTVRMEN C17

LPC: FWH0/LAD0 C38, FWH1/LAD1 A38, FWH2/LAD2 B37, FWH3/LAD3 C37, FWH4/LFRAME# D36, LDRQ0# E36, LDRQ1#/GPIO23 K36, SERIRQ V5

IHDA: HDA_BCLK N34, HDA_SYNC L34, SPKR T10, HDA_RST# K34, HDA_SDIN0 E34, HDA_SDIN1 G34, HDA_SDIN2 C34, HDA_SDIN3 A34, HDA_SDO A36, HDA_DOCK_EN#/GPIO33 C36, HDA_DOCK_RST#/GPIO13 N32

JTAG: JTAG_TCK J3, JTAG_TMS H7, JTAG_TDI K5, JTAG_TDO H1

SPI: SPI_CLK T3, SPI_CS0# Y14, SPI_CS1# T1, SPI_MOSI V4, SPI_MISO U3

SATA 6G: SATA0RXN AM3, SATA0RXP AM1, SATA0TXN AP7, SATA0TXP AP5, SATA1RXN AM10, SATA1RXP AM8, SATA1TXN AP11, SATA1TXP AP10

SATA: SATA2RXN AD7, SATA2RXP AD5, SATA2TXN AH5, SATA2TXP AH4, SATA3RXN AB8, SATA3RXP AB10, SATA3TXN AF3, SATA3TXP AF1, SATA4RXN Y7, SATA4RXP Y5, SATA4TXN AD3, SATA4TXP AD1, SATA5RXN Y3, SATA5RXP Y1, SATA5TXN AB3, SATA5TXP AB1, SATAICOMPO Y11, SATAICOMPI Y10, SATA3RCOMPO AB12, SATA3COMPI AB13, SATA3RBIAS AH1, SATALED# P3, SATA0GP/GPIO21 V14, SATA1GP/GPIO19 P1

LPC_AD[0..3] — RN2104 SRN33J-5-GP-U — LPC_AD0, LPC_AD1, LPC_AD2, LPC_AD3
RN2105 SRN33J-5-GP-U
LPC_FRAME# — R2127 33R2J-2-GP
KB_DET# 69
INT_SERIRQ 27

HDD1
SATA_TXN0_C SCD01U16V2KX-3GP — C2114
SATA_TXP0_C SCD01U16V2KX-3GP — C2113
SATA_RXN0 56, SATA_RXP0 56, SATA_TXN0 56, SATA_TXP0 56

ODD
SATA_TXN4_C — C2111 SCD01U16V2KX-3GP
SATA_TXP4_C — C2112 SCD01U16V2KX-3GP
SATA_RXN4 56, SATA_RXP4 56, SATA_TXN4 56, SATA_TXP4 56

1D05V_VTT
SATA_COMP — R2112 37D4R2F-GP
SATA3_COMP — R2113 49D9R2F-GP
RBIAS_SATA3 — R2114 750R2F-GP

SATA_LED# 68
SATA_DET#0
BBS_BIT0 — BBS_BIT0 18

P/N: ND27V

Flash Descriptor Security Overide	
HDA_SDOUT	Low = Default High = Enable

+3VS_+1.5VS_HDA_IO — R2102 1KR2J-1-GP — HDA_SDOUT

NO REBOOT STRAP

No Reboot Strap	
HDA_SPKR	Low = Default High = No Reboot

3D3V_S0 — R2106 1KR2J-1-GP — HDA_SPKR

+3VS_+1.5VS_HDA_IO — R2103 1KR2J-1-GP — HDA_SYNC

This signal has a weak internal pull down.
On Die PLL VR is supplied by 1.5V when sampled high, 1.8 V when sampled low.
Needs to be pulled High for Huron River platform.
co-operate with R2310

PLL ODVR VOLTAGE	
HDA_SYNC	Low = 1.8V (Default) High = 1.5V

HDA_SYNC: This strap is sampled on rising edge of RSMRST# and is used to sample 1.5V VccVRM supply mode. 1K external pull-up resistor is required on this signal on the board. Signal may have leakage paths via powered off devices (Audio Codec) and hence contend with the external pull-up. A blocking FET is recommended in such a case to isolate HDA_SYNC from the Audio Codec device until after the Strap sampling is complete.

11/2 Merge R2122 into Q2101

RUN_ENABLE — Q2101 2N7002K-2-GP
29 HDA_CODEC_SYNC — R2117 100KR2J-1-GP — HDA_CODEC_SYNC
HDA_SYNC_R — R2124 33R2J-2-GP — HDA_SYNC
R2122 33R2J-2-GP DY
84.2N702.J31
2ND = 84.2N702.031

HDA_CODEC_BITCLK — EC2102 SC4D7P50V2CN-1GP DY
HDA_CODEC_SDOUT — EC2103 SC4D7P50V2CN-1GP DY
SPI_CS0#_R — EC2101 SC4D7P50V2CN-1GP DY

3D3V_S0 — RN2103 SRN10KJ-GP
INT_SERIRQ
SATA_DET#0
22 S_GPIO — R2125 10KR2J-3-GP
22 PSW_CLR# — R2126 10KR2J-3-GP

12/6 Separate RN2103 to R2125 and R2126

11/11Remove RN2104 and FP_DET#

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (SPI/RTC/LPC/SATA/IHDA)

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 21 of 105

SSID = PCH

Note:
For PCH debug with XDP, need to DUMMY R2218

PCH1F — 6 OF 10 — Cougar Point — COUGAR-GP-U2-NF

GPIO: BMBUSY#/GPIO0 (T7), TACH1/GPIO1 (A42), TACH2/GPIO6 (H36), TACH3/GPIO7 (E38), GPIO8 (C10), LAN_PHY_PWR_CTRL/GPIO12 (C4), GPIO15 (G2), SATA4GP/GPIO16 (U2), TACH0/GPIO17 (D40), SCLOCK/GPIO22 (T5), GPIO24/MEM_LED (E8), GPIO27 (E16), GPIO28 (P8), STP_PCI#/GPIO34 (K1), GPIO35 (K4), SATA2GP/GPIO36 (V8), SATA3GP/GPIO37 (M5), SLOAD/GPIO38 (N2), SDATAOUT0/GPIO39 (M3), SDATAOUT1/GPIO48 (V13), SATA5GP/GPIO49 (V3), GPIO57 (D6)

CPU/MISC: TACH4/GPIO68 (C40), TACH5/GPIO69 (B41), TACH6/GPIO70 (C41), TACH7/GPIO71 (A40), A20GATE (P4), PECI (AU16), RCIN# (P5), PROCPWRGD (AY11), THRMTRIP# (AY10), INIT3_3V# (T14), TS_VSS1 (AH8), TS_VSS2 (AK11), TS_VSS3 (AH10), TS_VSS4 (AK10), NC_1 (P37)

NCTF: NCTF_VSS#A4, NCTF_VSS#A44, NCTF_VSS#A45, NCTF_VSS#A46, NCTF_VSS#A5, NCTF_VSS#A6, NCTF_VSS#B3, NCTF_VSS#B47, NCTF_VSS#BD1, NCTF_VSS#BD49, NCTF_VSS#BE1, NCTF_VSS#BE49, NCTF_VSS#BF1, NCTF_VSS#BF49, NCTF_VSS#BG2, NCTF_VSS#BG48, NCTF_VSS#BH3, NCTF_VSS#BH47, NCTF_VSS#BJ4, NCTF_VSS#BJ44, NCTF_VSS#BJ45, NCTF_VSS#BJ46, NCTF_VSS#BJ5, NCTF_VSS#BJ6, NCTF_VSS#C2, NCTF_VSS#C48, NCTF_VSS#D1, NCTF_VSS#D49, NCTF_VSS#E1, NCTF_VSS#E49, NCTF_VSS#F1, NCTF_VSS#F49

NCTF TEST PIN: A4,A44,A45,A46,A5,A6,B3,B47,BD1,BD49,BE1,BE49,BF1,BF49,BG2,BG48,BH3,BH47,BJ4,BJ44,BJ45,BJ46,BJ5,BJ6,C2,C48,D1,D49,E1,E49,F1,F49

PCH1

P/N: ND27V

3D3V_S0 — R2202 100KR2J-1-GP — SATA_ODD_PRSNT#

3D3V_S0 — RN2203 SRN10KJ-5-GP — H_A20GATE, H_RCIN#

GPIO27 has a weak[20K] internal pull up.
To enable on-die PLL Voltage regurator, should not place external pull down.

11/11 Remove R2220 for GPIO48 set to GPO

X02-0303 change 0R to short pad

S_GPIO — R2218 100R2J-2-GP — PCH_GPIO0

EC_SMI#, EC_SCI#, DGPU_HPD_INTR#, ICC_EN#, RTC_SENSE#, PCH_GPIO15, DGPU_PWROK, PCH_GPIO22, PCH_GPIO24, PCH_GPIO27, PLL_ODVR_EN, PSW_CLR#, PCH_GPIO35, DMI_OVRVLTG, FDI_OVRVLTG, MFG_MODE, GFX_CRB_DET, PCH_GPIO48, PCH_TEMP_ALERT#, PCH_NCTF_1, PCH_NCTF_2, PCH_NCTF_3, PCH_NCTF_4

TPAD14-GP TP2219, TP2210, TP2212, TP2203, TP2213, TP22, TP2214, TP2206, TP2207, TP2208, TP2209

SATA_ODD_PWRGT 56, UMA_DIS# 20, PCH_GPIO70 — TP2204 TPAD14-GP, PCH_GPIO71 — TP2205 TPAD14-GP

H_A20GATE 27, H_PECI R — R2203 0R2J-2-GP (DY) — H_PECI 5,27, H_RCIN# 27, H_CPUPWRGD 5,36, PCH_THERMTRIP_R — R2204 390R2J-1-GP — H_THERMTRIP# 5,36,85, INIT3_3V# — TP2201 TPAD14-GP

TS Signal Disable Guideline:
TS_VSS1, TS_VSS2, TS_VSS3 and TS_VSS4 should not float on the motherboard. They should be tied to GND directly.

TS_VSS — R2219 0R0402-PAD

G2201 GAP-OPEN

3D3V_S0 — PCH_TEMP_ALERT# R2222 10KR2J-3-GP; MFG_MODE R2223 10KR2J-3-GP; RN2201 SRN10KJ-6-GP: DGPU_HPD_INTR#, EC_SCI#, EC_SMI#

11/11Remove DBC_EN
X01-0211 swap DGPU_HPD_INTR#, EC_SMI# for layout.

12/1 Add R2224 pull high — R2224 10KR2J-3-GP — RTC_SENSE#

11/15 Remove Rn2204

3D3V_S5 — R2201 1KR2J-1-GP (DY) — PCH_GPIO15

11/ 17 Dummy R2201 because GPIO15 internal PH

3D3V_S0 — R2207 10KR2J-3-GP (DY) — FDI_OVRVLTG; R2208 10KR2J-3-GP

FDI TERMINATION VOLTAGE OVERRIDE	
GPIO37 (FDI_OVRVLTG)	LOW - Tx, Rx terminated to same voltage (DC Coupling Model DEFAULT)

3D3V_S0 — R2209 10KR2J-3-GP (DY) — DMI_OVRVLTG; R2210 10KR2J-3-GP

DMI TERMINATION VOLTAGE OVERRIDE	
GPIO36 (DMI_OVRVLTG)	LOW - Tx, Rx terminated to same voltage (DC Coupling Model DEFAULT)

Integrated Clock Enable functionality is achieved via soft-strap. The default is integrated clock enable.

Integrated Clock Chip Enable	
ICC_EN#	HIGH (R2211 DY)- DISABLED [DEFAULT]
	LOW (R2211)- ENABLED

ICC_EN# — R2211 1KR2J-1-GP

GPIO8 has a weak[20K] internal pull up.
Integrated Clock Enable functionality is achieved via soft-strap. The default is integrated clock enable.

PLL ON DIE VR ENABLE
NOTE:This signal has a weak internal pull-up 20K ENABLED -- HIGH (R2212 UNSTUFFED) DEFAULT DISABLED -- LOW (R2212 STUFFED)

PLL_ODVR_EN — DY — R2212 1KR2J-1-GP

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (GPIO/CPU)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 22 of 105

SSID = PCH 6A

11/ 17 Add R2301 but dummy it
and change L2301 source to 3D3V_DAC_S0

POWER

Cougar Point

PCH1G 7 OF 10

1.3A(Total current of VCCCORE)

11/18 change capacity to 0603 package

2.925A(Total current of VCCIO)

12/28 Yellow mark for OPI change

0.266A (Totally VCC3_3 current)

0.159A(Totally current of VCCVRM)

0.042A (Totally current of VCCDMI)

VCCVRM(Internal PLL and VRMs):
A.1.5V for Mobile
B.1.8 V for Desktop

11/2 change
R2304, R2305 to 0ohm

X02-0303
change 0R to short pad

11/18 change capacity to 0603 package

X02-0303
change 0R to short pad

68.00214.051
2nd = 68.00206.041
3rd = 68.00335.081

Voltage Rail	Voltage	Iccmax
V_PROC_IO	1.05	0.001
V5REF	5	0.001
V5REF_Sus	5	0.001
Vcc3_3	3.3	0.266
VccADAC3	3.3	0.001
VccADPLLA	1.05	0.08
VccADPLLB	1.05	0.08
VccCore	1.05	1.3
VccDMI	1.1	0.042
VccIO3	1.05	2.925
VccASW	1.05	1.01
VccSPI	3.3	0.02
VccDSW3_3	3.3	0.002
VccDFTERM	1.8	0.19
VccRTC	3.3	6u
VccSus3_3	3.3	0.097
VccSusHDA	3.3	0.01
VccVRM	1.5	0.16
VccClkDMI	1.05	0.02
VccSSC	1.05	0.095
VccDIFFCLKN	1.05	0.055
VccALVDS	3.3	0.001
VccTX_LVDS3	1.8	0.06

Refer to NPCE795 shared SPI flash architecture

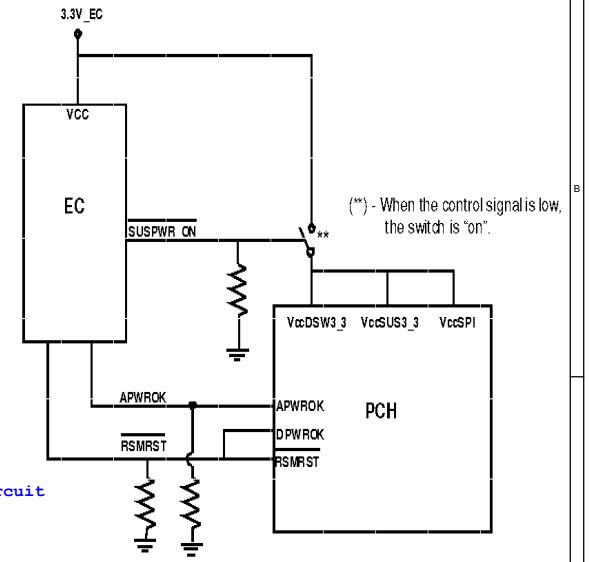

11/3 Add LDO for CRT DAC power

11/ 17change U2301 Vout power rail and stuff the circuit

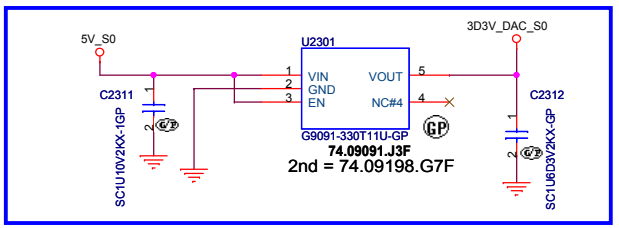

P/N: ND27V

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (POWER1)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 23 of 105

SSID = PCH

POWER

PCH1J

Cougar Point

10 OF 10

USB

Clock and Miscellaneous

PCI/GPIO/LPC

SATA

MISC

CPU

PCH1

RTC

HDA

COUGAR-GP-U2-NF

P/N: ND27V

11/18 change capacity to 0603 package

12/28 Yellow mark for OPI change

11/ 17 Change R2406 from close gap to 0ohm

X02-0303 change 0R to short pad

11/ 17 Change R2409 from close gap to 0ohm

Voltage Rail	Voltage	Iccmax
V_PROC_IO	1.05	0.001
V5REF	5	0.001
V5REF_Sus	5	0.001
Vcc3_3	3.3	0.266
VccADAC3	3.3	0.001
VccADPLLA	1.05	0.08
VccADPLLB	1.05	0.08
VccCore	1.05	1.3
VccDMI	1.1	0.042
VccIO3	1.05	2.925
VccASW	1.05	1.01
VccSPI	3.3	0.02
VccDSW3_3	3.3	0.002
VccDFTERM	1.8	0.19
VccRTC	3.3	6u
VccSus3_3	3.3	0.097
VccSusHDA	3.3	0.01
VccVRM	1.5	0.16
VccClkDMI	1.05	0.02
VccSSC	1.05	0.095
VccDIFFCLKN	1.05	0.055
VccALVDS	3.3	0.001
VccTX_LVDS3	1.8	0.06

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: PCH (POWER2)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 24 of 105

SSID = PCH

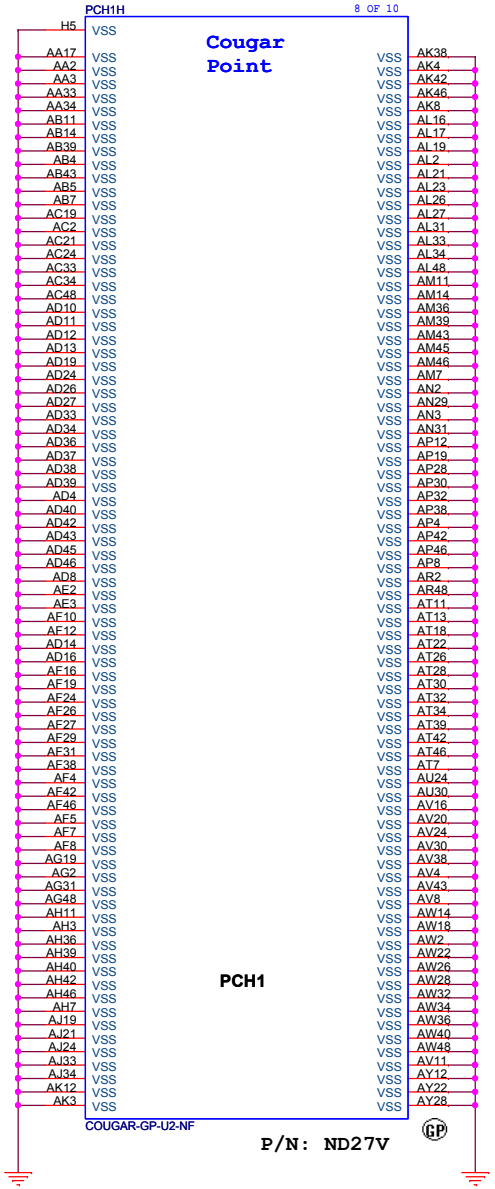

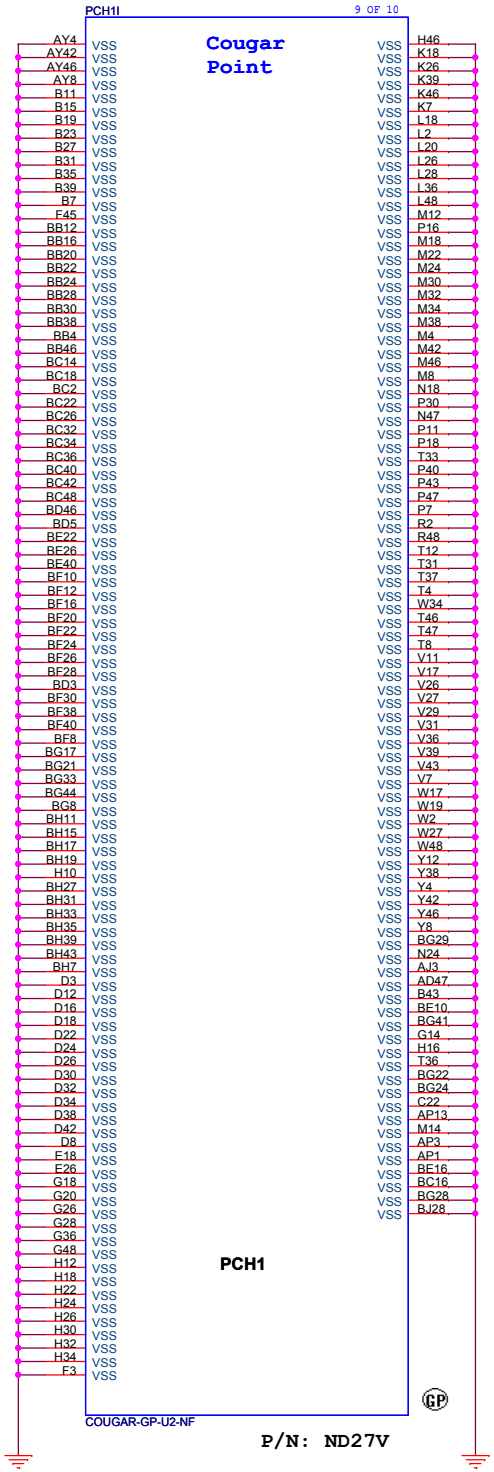

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: ***PCH (VSS)***

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 25 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 26 of 105

SSID = KBC

11/ 17 change R2702 from close gap to 0ohm
X02-0303 change 0R to short pad

11/17 change R2724 to meet X00 PCB ver
X01-0210 change R2724 to meet X01 PCB ver
X02-0314 change R2724 to meet X02 PCB ver

Reserved 0.1uF on all of ADC input pins
base on NUVOTON feedback list.(C2717~C2721)

A00-0413 change R2724 to 47K for PCB ver

PCB VERSION A/D(PIN98)	PULL-LOW RESISTOR	PULL-HIGH RESISTOR	VOLTAGE
X00	100.0K	10.0K	3.0V
X01	100.0K	20.0K	2.75V
X02	100.0K	33.0K	2.48V
A00	100.0K	47.0K	2.24V
Reserved	100.0K	64.9K	2.0V
Reserved	100.0K	76.8	1.87V
Reserved	100.0K	100.0K	1.65V
Reserved	100.0K	143.0K	1.358V
Reserved	100.0K	174.0K	1.204V
Reserved	100.0K	215.0K	1.048V

MODEL_ID

MODEL_ID_DET(GPIO07)	PULL-LOW RESISTOR	PULL-HIGH RESISTOR	VOLTAGE
Reserved	100.0K	10.0K(64.10025.6DL)	3.0V
Reserved	100.0K	20.0K(64.20025.6DL)	2.75V
DVI5_UMA with HDMI	100.0K	33.0K	2.48V
DVI5_UMA without HDMI	100.0K	47.0K(64.47025.6DL)	2.24V
DVI4_UMA with HDMI	100.0K	64.9K(64.64925.6DL)	2.0V
DVI4_UMA without HDMI	100.0K	76.8K(64.76825.6DL)	1.87V
DVI4_DIS(512M) with HDMI	100.0K	100.0K(64.10035.6DL)	1.65V
DVI4_DIS(512M) without HDMI	100.0K	143.0K(64.14335.L0L)	1.358V
DVI4_DIS(1G) with HDMI	100.0K	174.0K(74.17435.6DL)	1.204V
DVI4_DIS(1G) without HDMI	100.0K	215.0K(64.21535.6DL)	1.048V

11/16 Add R2728 R2729 for SERIES_ID

11/22 add RTC_AUX_S5 to KBC_GPIO72

X01-0127 Del R2757 to follow standard 10mw circuit

11/1 Add R2777, C2777 for EMI

11/ 17 add R2774 pull high for LID_CLOSE#

Very close to EC

NOTES:
The NPCE795P GPIO/PWM outputs that are connected to LEDs have high drive buffers (20mA) and can be connected directly to the LEDs.

11/2 Add MODEL_ID_DET pin for Vostro & Inspron select

Notes:
The total SPI interface signal between EC and PCH can't not exceed 6500mil. The mismatch between SPI signal must be within 500mil

11/19 add TP2701 for KBC_GPIO10

Follow DQ15 change PCIE_RST# to AD_IA_HW2

<------ TP

<------ BATTERY / CHARGER

<------PCH / eDP

11/22 change WLAN LED control to KBC

X02-0309 change 0R to short pad

NOTE:
Locate resistors R2736,R2719 and R2722 close to the NPCE795P.

NOTE:
Connect GND and AGND planes via either 0R resistor or one point layout connection.

11/16 Add R2776 for aviod kbc code error

11/ 17 DY D2705 to meet DN13 result

12/10 Add R2762 and dummy R2732, Q2702

EC_GPIO47 High Active

PSL SOLUTION

10mW SOLUTION

11/ 17 DY R2734 and stuff R2756 to keep KBC data

VBACKUP

PSL_IN1

PSL_OUT

12/22 swap net for layout

12/6 swap net for layout

EC GPIO standard PH/PL

NOTES:
Please make sure there's no pull-down resistor on USB_PWR_EN#,AC_PRESENT,E51_TXD.

ROSA Multi GPIO setting

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: KBC Nuvoton NPCE795

Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 27 of 105

SSID = Thermal

Thermal sensor P2800

Option 1: OTZ=95°C → ADJ=3.3V

Option 2: OTZ=85°C → ADJ=Floating

Option 3: OTZ=90°C → ADJ=GND

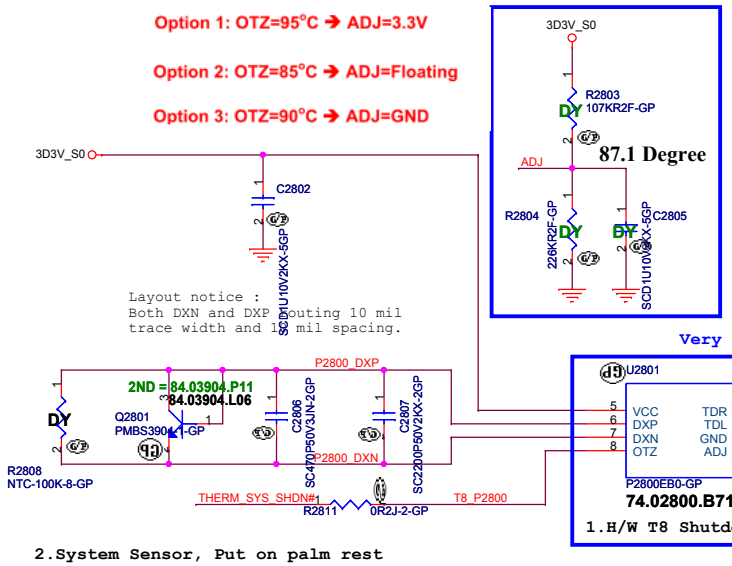

2.System Sensor, Put on palm rest

12/14 dummy R2803, R2804 and C2805

Very Close to CPU1

	Pin-1	Definition
P2793A	/FON	Low(<0.4V): VOUT =Vin and the fan is fully-on High(>1.6V): VOUT=1.6*VSET This pin is internal Pull-High with ~500K ohm
P2793B	EN	Low (<0.4): IC is shutdown. High(>1.6V): VOUT=1.6*VSET This pin is internal Pull-High with ~500K ohm

Fan controller P2793

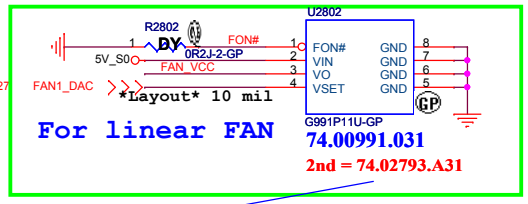

Very close to CPU1

12/15 Remove 3rd source

11/4 Vendor recommand

X01-0209 dummy U2805 circuit

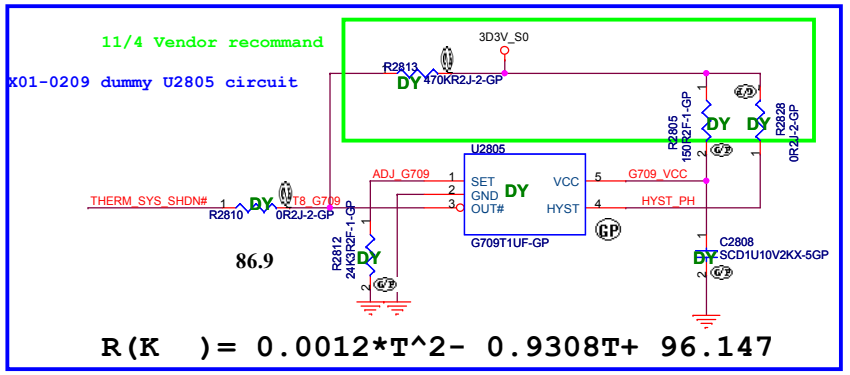

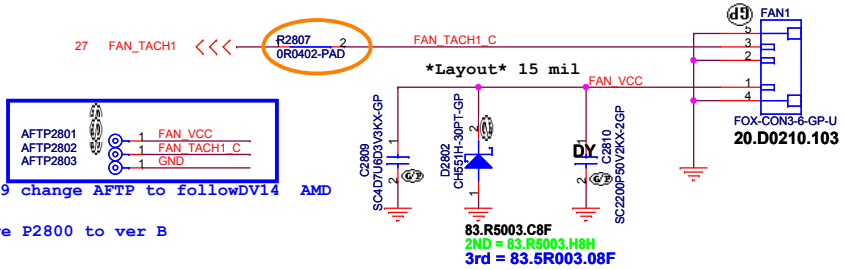

X02-0309 change AFTP to followDV14 AMD

12/13 change P2800 to ver B

VGA Thermal sensor P2800

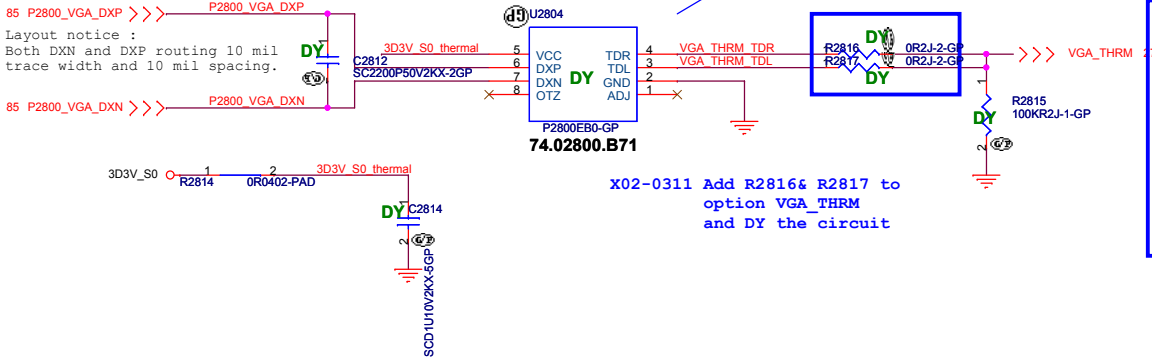

X02-0311 Add R2816& R2817 to option VGA_THRM and DY the circuit

11/18 remove R2817, R2818, C2816 and NC U2804 OTZ pin

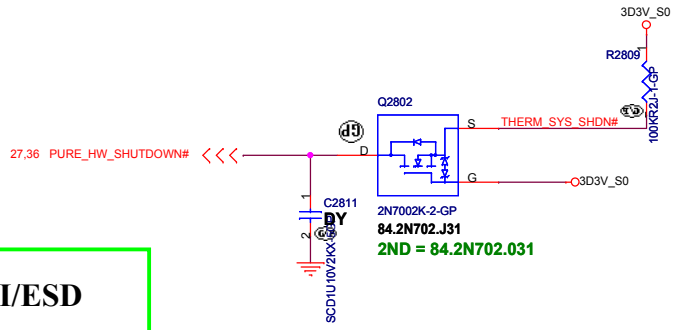

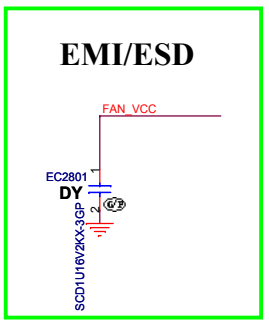

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Thermal P2800/Fan Controllor P2793

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 28 of 105

SSID = AUDIO

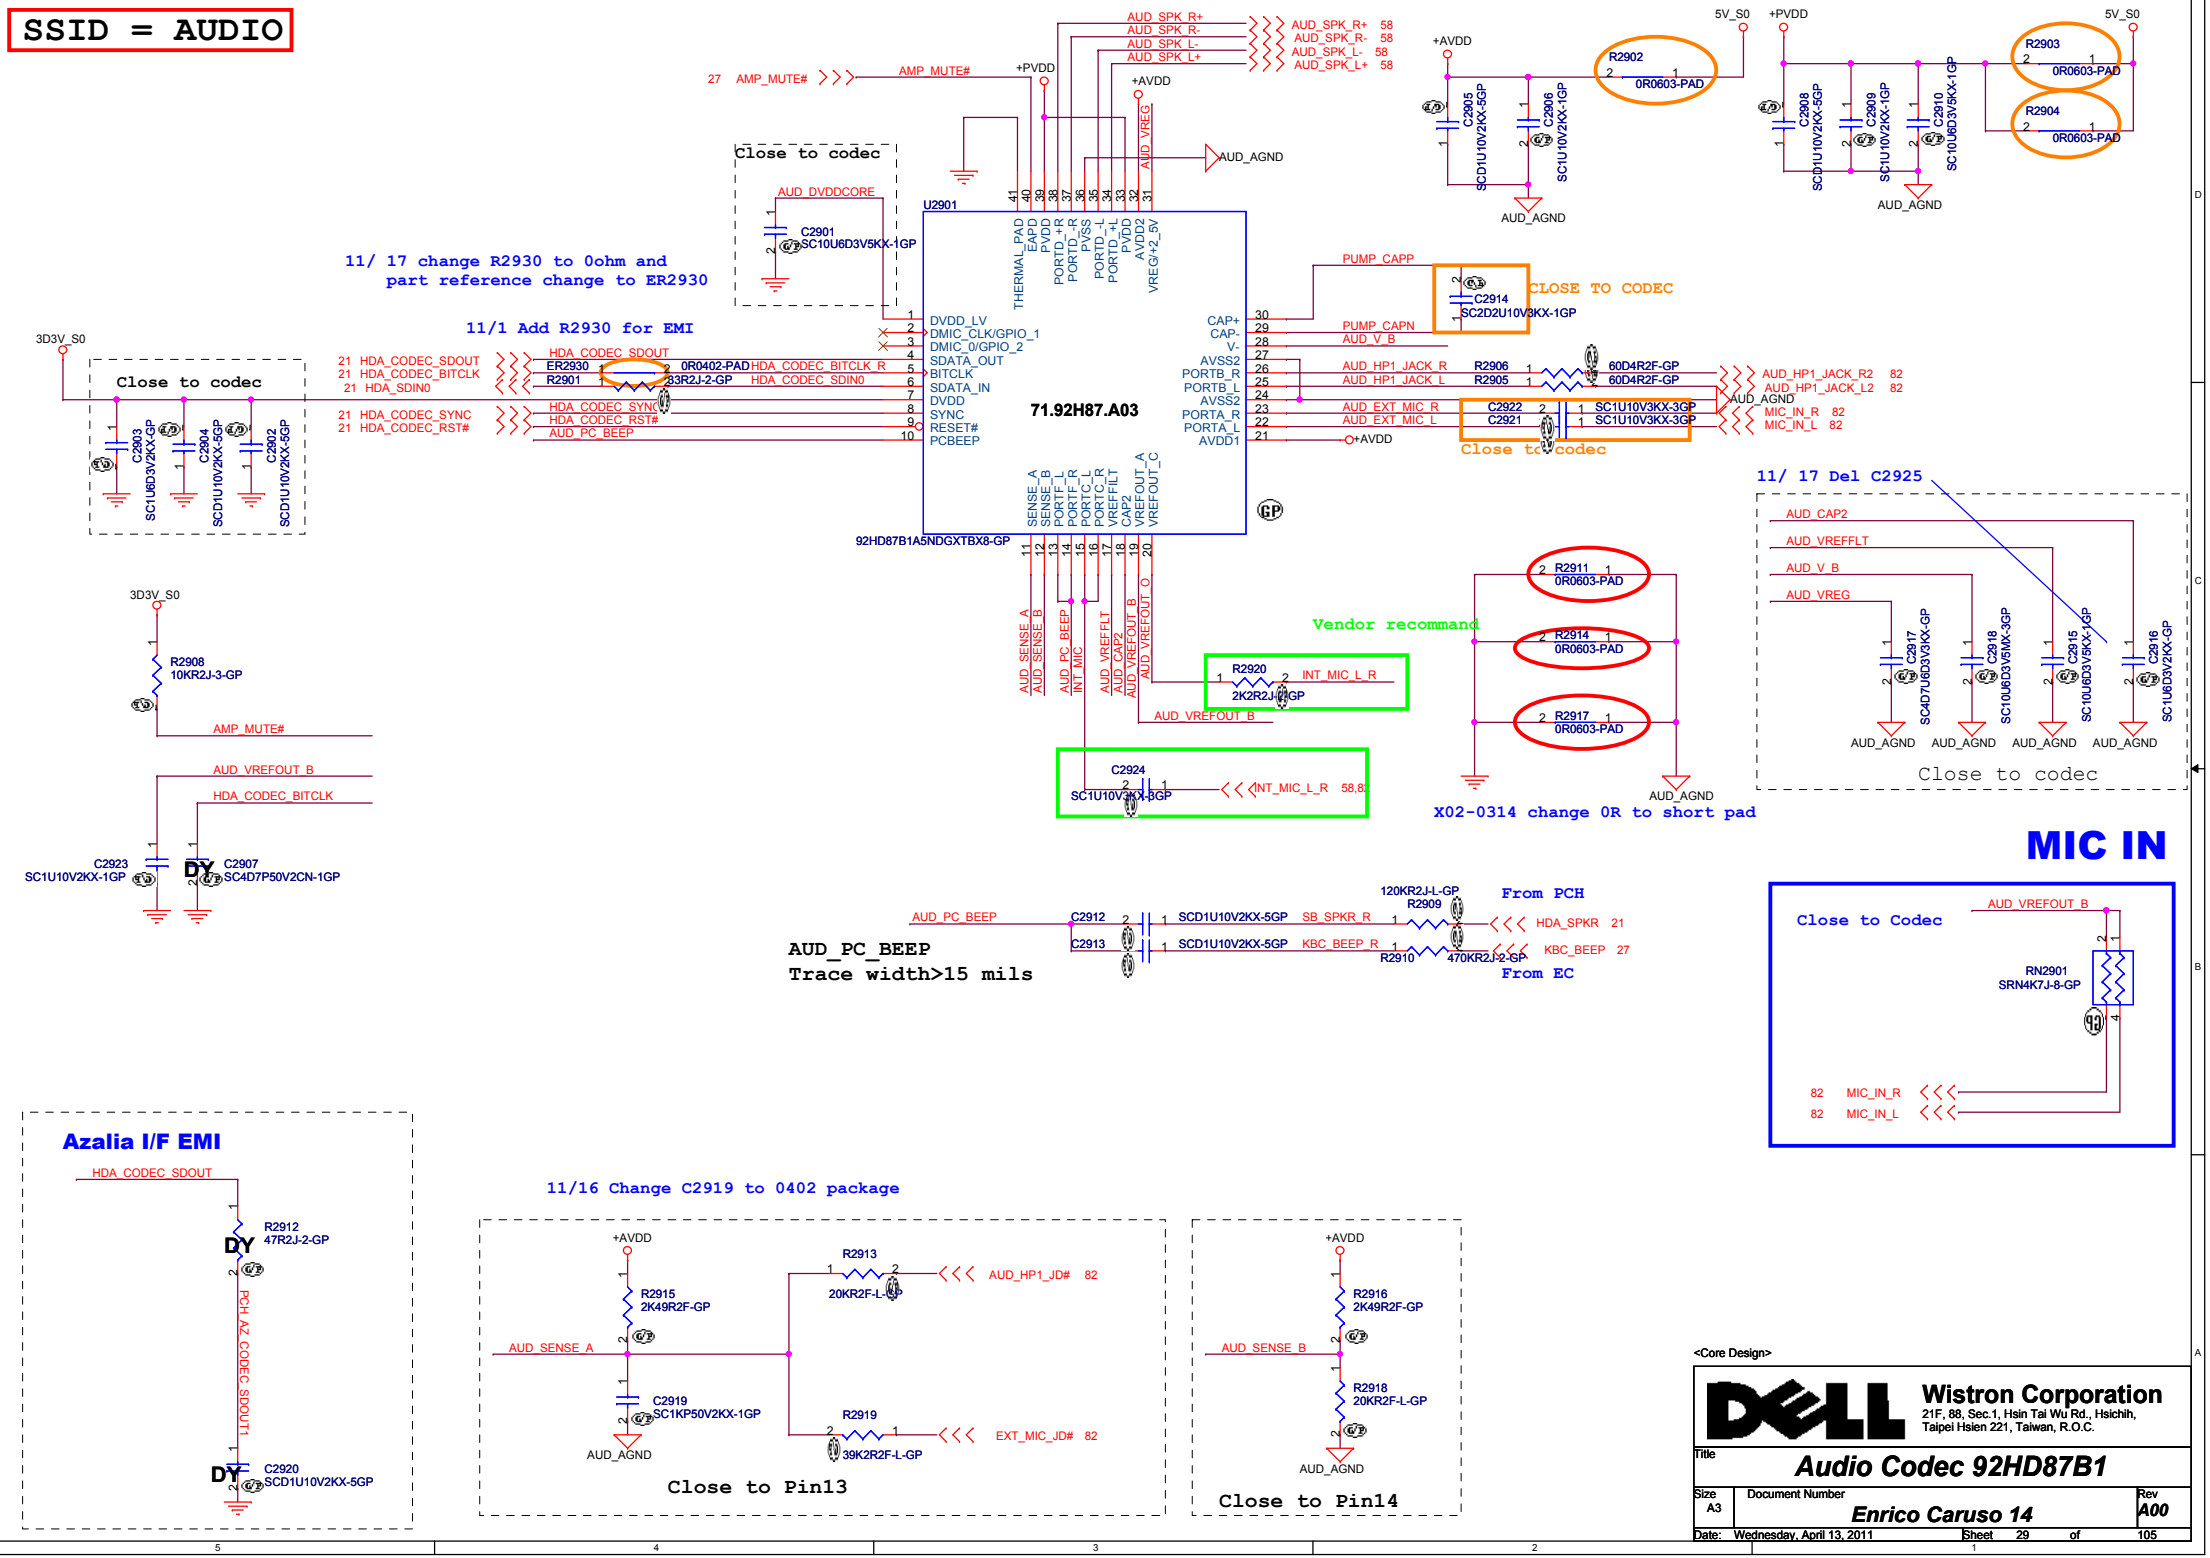

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: **Audio Codec 92HD87B1**

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 29 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 30 of 105

LAN CHIP

11/18 change L3101 to slime type

60 mils

L3101 IND-4D7UH-192-GP

LANOUP_1.05S

CTRL10A_R

R3117 0R0603-PAD

R3115 0R0603-PAD

EVDD10

DVDD10

C3106 SC1U10V3ZY-6GP

C3120 SCD1U16V2ZY-2GP

C3115 SC4D7U6D3V3KX-GP

X5R

C3113 C3109 C3114 C3117 C3112 C3123 C3116 SCD1U16V2ZY-2GP

GIGA

40 mils

3D3V_LAN_S5

C3118 C3121 C3119 SCD1U16V2ZY-2GP

AVDD33_REG

R3104 0R0603-PAD

C3101 SC4D7U6D3V3KX-GP

C3111 SCD1U16V2ZY-2GP

X5R

X02-0303 change 0R to short pad

3D3V_LAN_S5

RN3103 SRN10KJ-5-GP

Q3104_B

Q3104 PMBS3904-1-GP

LAN_RST#

PLT_RST# 5,16,27,65,71,83

R3130 DY 0R2J-2-GP

X02-0311 add circuit to provent leakage.

X02-0314 SWAP net

3D3V_S0

3D3V_LAN_S5

R3119 DY 0R3J-0-U-GP

R3120 DY 0R3J-0-U-GP

3D3V_S5

PA102FMG-GP-U Q3103

main: 84.00102.031

2nd: 84.03403.031

C3130 SCD1U10V2KX-4GP

R3121 10KR2J-3-GP

C3122 SC1U6D3V2KX-GP

R3118 20KR2F-L-GP

PM_LAN_ENABLE_R

DY C3125 SC1U10V2KX-1GP

C3129 SCD1U10V2KX-5GP

C3126 SCD1U10V2KX-4GP

GIGA

C3128 SCD1U10V2KX-5GP

11/19 add R3131 for KBC code test

R3131 0R2J-2-GP DY

Q3102

27 PM_LAN_ENABLE

LAN_ENABLE_R_C

2N7002K-2-GP

A00-0320

Change R3118 for LOM power sequence

X01-0211 add C3122 for soft-sart

3D3V_LAN_S5

R3113 2K49R2F-GP

LAN_RSET

DVDD10

U3101

GND

LANXOUT

LANXIN

GPO

AVDD33 AVDD33 RSET AVDD10 CKXTAL2 CKXTAL1 AVDD33 DVDD10 LED0 DVDD33 GPO/SMBALERT LED1/EESK

LAN_MDI0P LAN_MDI0N LAN_MDI1P LAN_MDI1N LAN_MDI2P LAN_MDI2N LAN_MDI3P LAN_MDI3N

MDIP0 MDIN0 AVDD10 MDIP1 MDIN1 AVDD10 MDIP2 MDIN2 AVDD10 MDIP3 MDIN3 AVDD33

LAN

REGOUT VDDREG VDDREG ENSWREG EEDI/SDA LED3/EEDO EECS/SCL DVDD10 LANWAKE# DVDD33 ISOLATE# PERST#

LANOUP_1.05S

ENSWREG

EEDI/SDA

LAN_EECS

DVDD10

PCIE_WAKE# 27

ISOLATE#

R3107 10KR2J-3-GP

R3110 1KR2J-1-GP

R3109 15KR2F-GP

LAN_RST#

RTL8111E-VB-GR-GP

DVDD10 SMBCLK SMBDATA CLKREQ# HSIP HSIN REFCLK_P REFCLK_N EVDD10 HSOP HSON GND

TPAD14-GP TP3101

SMBDATA_LAN

CLK_LAN_REQ#_R

PCIE_TXP2

PCIE_TXN2

CLK_PCIE_LAN

CLK_PCIE_LAN#

EVDD10

PCIE_RXP2_C

PCIE_RXN2_C

C3131 SCD1U10V2KX-5GP

11/29 change X3101 to 82.30020.D41

X01-0217 change C3102, C3103 to 15pF

R3116 10KR2J-3-GP GIGA SMBDATA_LAN

3D3V_LAN_S5

R3103 1KR2J-1-GP GPO

R3114 10KR2J-3-GP EEDI/SDA

11/2 change LAN_REQ# circuit to prevent leakage.

X02-0302 Dummy PCIE_CLK_LAN_REQ# circuit

3D3V_LAN_S5

R3101 10KR2J-3-GP DY

CLK_LAN_REQ#_R

R3102 10KR2J-3-GP DY

Q3101_B

Q3101 PMBS3904-1-GP

R3108 DY 0R2J-2-GP

PCIE_CLK_LAN_REQ# 20

R3123 10KR2J-3-GP DY

For Switch Regulator enable

3D3V_LAN_S5

R3105 0R0402-PAD

R3106 0R2J-2-GP DY

AVDD33_REG

3D3V_S0

PCIE_WAKE# 10KR2J-3-GP DY R3122

3D3V_LAN_S5

LANXOUT

C3102 SC15P50V2JN-2-GP

X3101 XTAL-25MHZ-155-GP

82.30020.D41

LANXIN

C3103 SC15P50V2JN-2-GP

C3105 SCD1U10V2KX-5GP

C3104 SCD1U10V2KX-5GP

PCIE_RXP2_C PCIE_RXN2_C

PCIE_TXP2 PCIE_TXN2

PCIE_RXP2 20 PCIE_RXN2 20

PCIE_TXP2 20 PCIE_TXN2 20

CLK_PCIE_LAN 20 CLK_PCIE_LAN# 20

X01-0127 change Q3101 base power rail for leakage issue.

DN15ATI Whistler

Wistron Corporation

21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih, Taipei Hsien 221, Taiwan, R.O.C.

Title: Reserved

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 31 of 105

SSID = SDIO

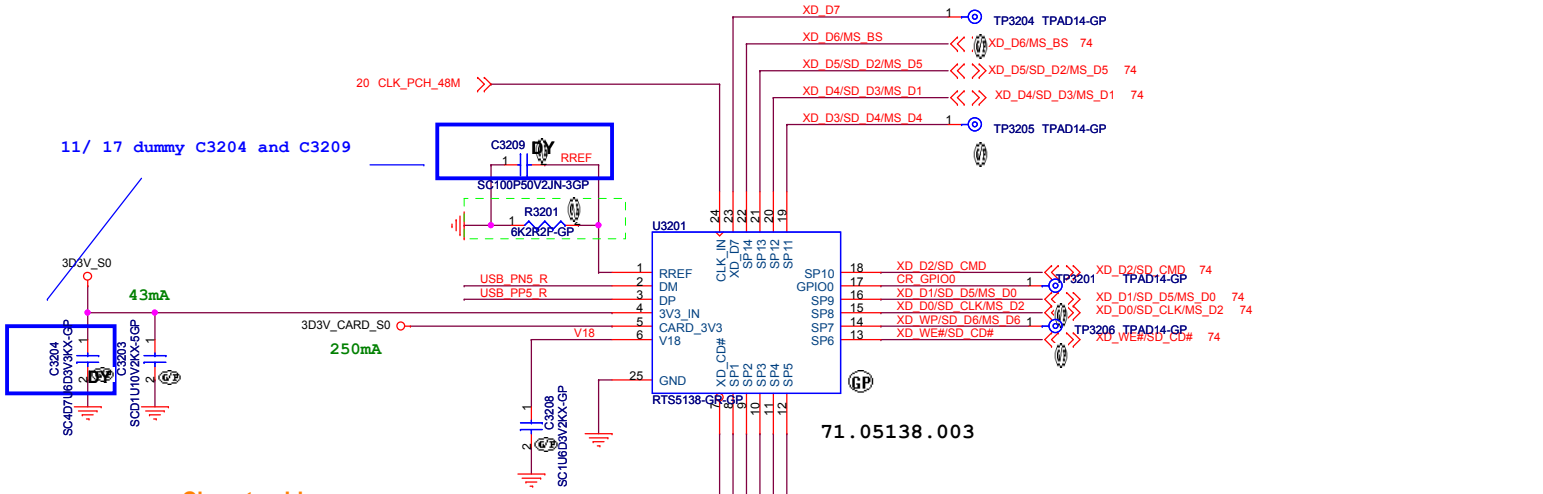

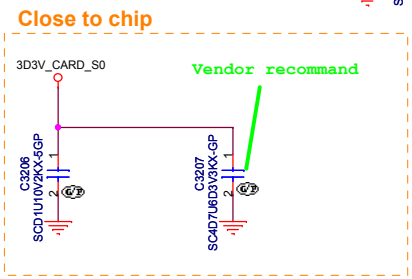

11/1 Add R3210, C3210 for EMI

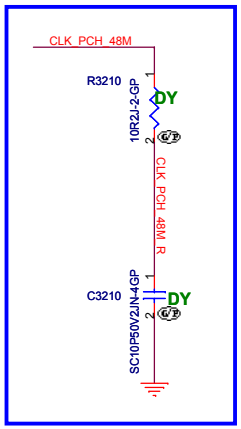

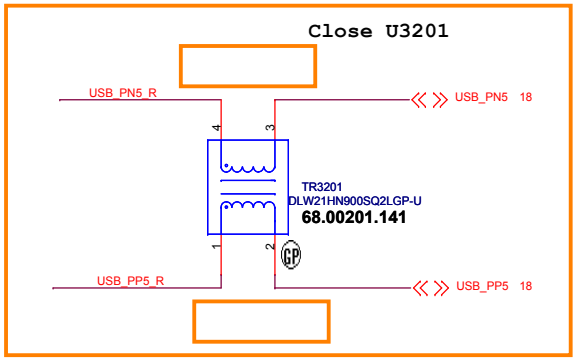

X02-0311 stuff TR3201 and change symbol to 68.00201.141

A00-0324 change TR6102 to TR3201

A00-0406 remove R3206, R3207 PAD

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Card Reader-RTS5138

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 32 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 33 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 34 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 35 of 105

SSID = Reset.Suspend

20101206 X02:
Add Q3603 for RTC power sequence.

27,42 IMVP_PWRGD → R3614 0R0402-PAD → SYS_PWROK

C3612 SCD01U50V2KX-1GP DY

PS_S3CNTRL → Q3603 2N7002K-2-GP

X02-0303 change 0R to short pad

12/16 Add Q3603 to meet RTC sequence as DN13

Power Sequence

19,27 S0_PWR_GOOD → D3602 BAS16-6-GP DY → SYS_PWROK 19

83.00016.K11
2ND = 83.00016.F11

1D05V_VTT → R3622 56R2J-4-GP → H_THERMTRIP# 5,22,85

5,22 H_CPUPWRGD → R3601 1KR2J-1-GP DY H_PWRGD_R → Q3601 CHT2222APT-GP

C3602 SCD01U50V2KX-1GP DY

2ND = 83.00016.F11
83.00016.K11
BAS16-6-GP

PURE_HW_SHUTDOWN# 27,28

41 3V_5V_EN → D3601 → S5_ENABLE 27

R3603 1KR2J-1-GP

R3602 200KR2J-L1-GP DY

ROSA Run Power

5V_S0

AO4468 MAX 9A
Rds(on) = 18.5mOhm
2nd = 84.08882.037

15V_S5 → R3604 100KR2J-1-GP

5V_S5 84.04468.037 AO4468-GP U3601 → 5V_S0

+5V_RUN Comsumption
Peak current 7.73A

3D3V_AUX_S5 → R3606 100KR2J-1-GP PS_S3CNTRL → PS_S3CNTRL 37

Q3602 2N7002KDW-GP
84.2N702.A3F
2nd = 84.DM601.03F

R3605 10KR2J-3-GP 5V_RUN_ENABLE

C3608 SCD01U50V2KX-1GP

C3603 SC10U10V5ZY-1GP

3D3V_S0

Rds(on) = 18.5mOhm
AO4468 MAX 11.6A
2nd = 84.08882.037

3D3V_S5 84.04468.037 AO4468-GP U3602 → 3D3V_S0

+3.3V_RUN Comsumption
Peak current 8.14A

19,27,37,47 PM_SLP_S3#

RUN_ENABLE

R3607 10KR2J-3-GP 3.3V_RUN_ENABLE

C3605 SCD01U50V2KX-1GP

C3604 SC10U6D3V5KX-1GP

1.5V_RUN for VGA Comsumption
Peak current 7.39A

+1.5V_RUN_CPU Comsumption
Peak current 3A

+1.5V_RUN for Mini-Card Comsumption
Peak current 1A

1D5V_S0

1D5V_S3 → TPCA8062-H-GP MAX 28A
Rds(on) = 4.1~5.4m OHM
U3606 POWERPAK-8P-GP → 1D5V_S0

MAX Current ? mA
Design Current ? mA
Total= 11.39A

R3630 10KR2J-3-GP 1.5V_RUN_ENABLE

C3610 SCD01U50V2KX-1GP

C3609 SC10U6D3V5KX-1GP

X02-0314 Change U3606 footprint.

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Power Plane Enable

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 36 of 105

Close to CPU
S3 Power Reduction Circuit Processor VREF_DQ Implementation

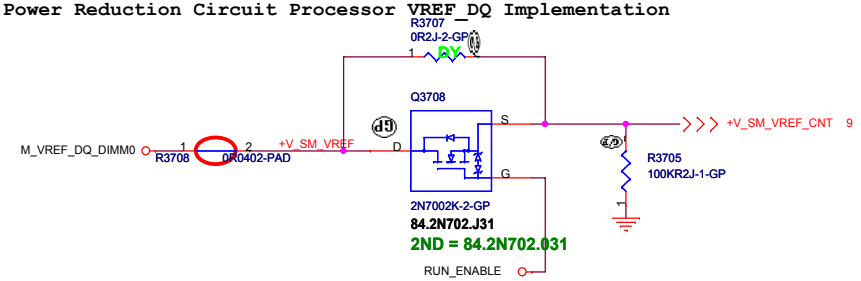

Close to DIMM
S3 Power Reduction Circuit SM_DRAMPWROK

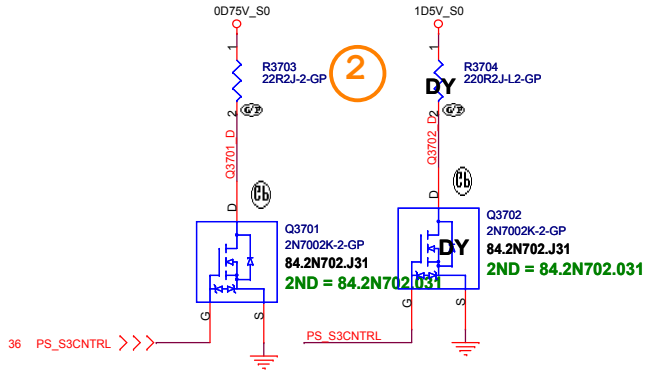

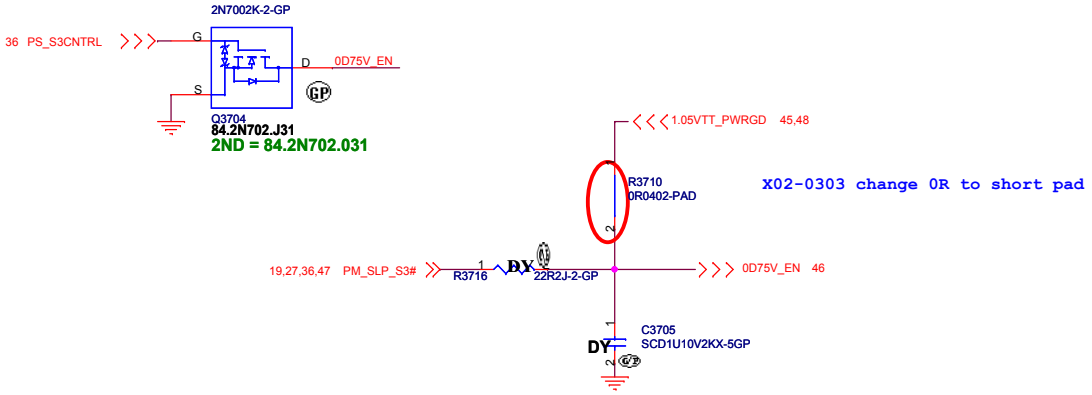

Close to CPU
S3 Power Reduction Circuit SM_DRAMPWROK

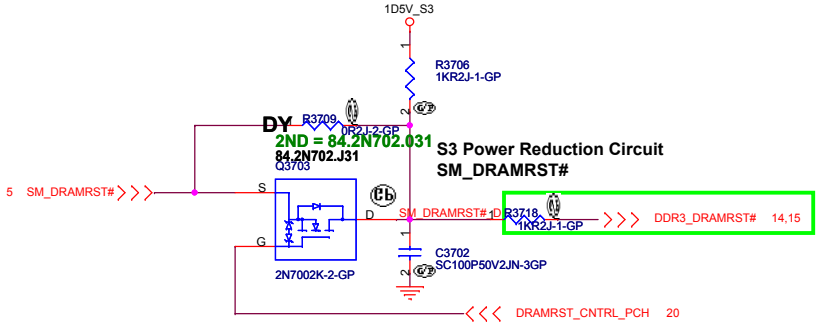



Close to CPU
S3 Power Reduction Circuit SM_DRAMPWROK

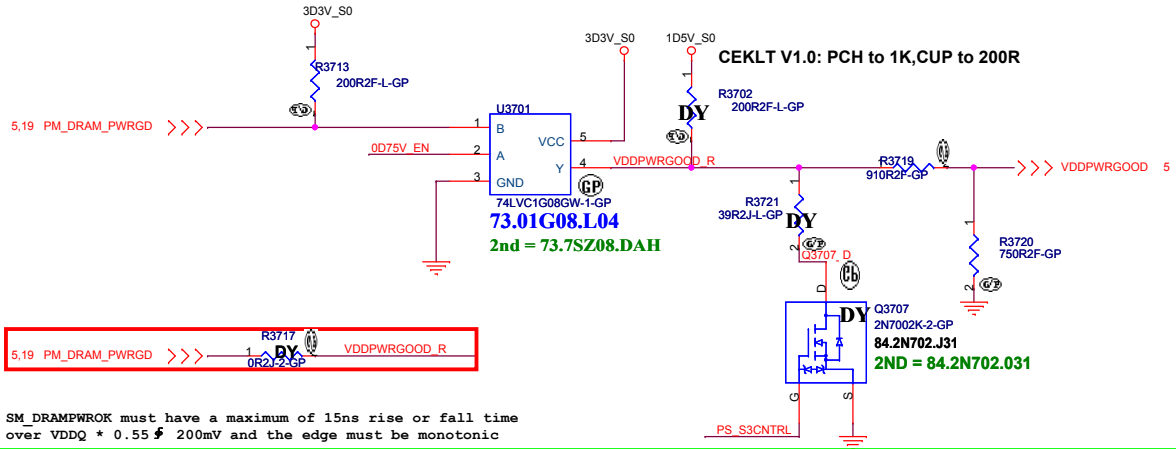

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: S3 Reduction Circuit

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 37 of 105

SSID = PWR.Support

DCin CONN

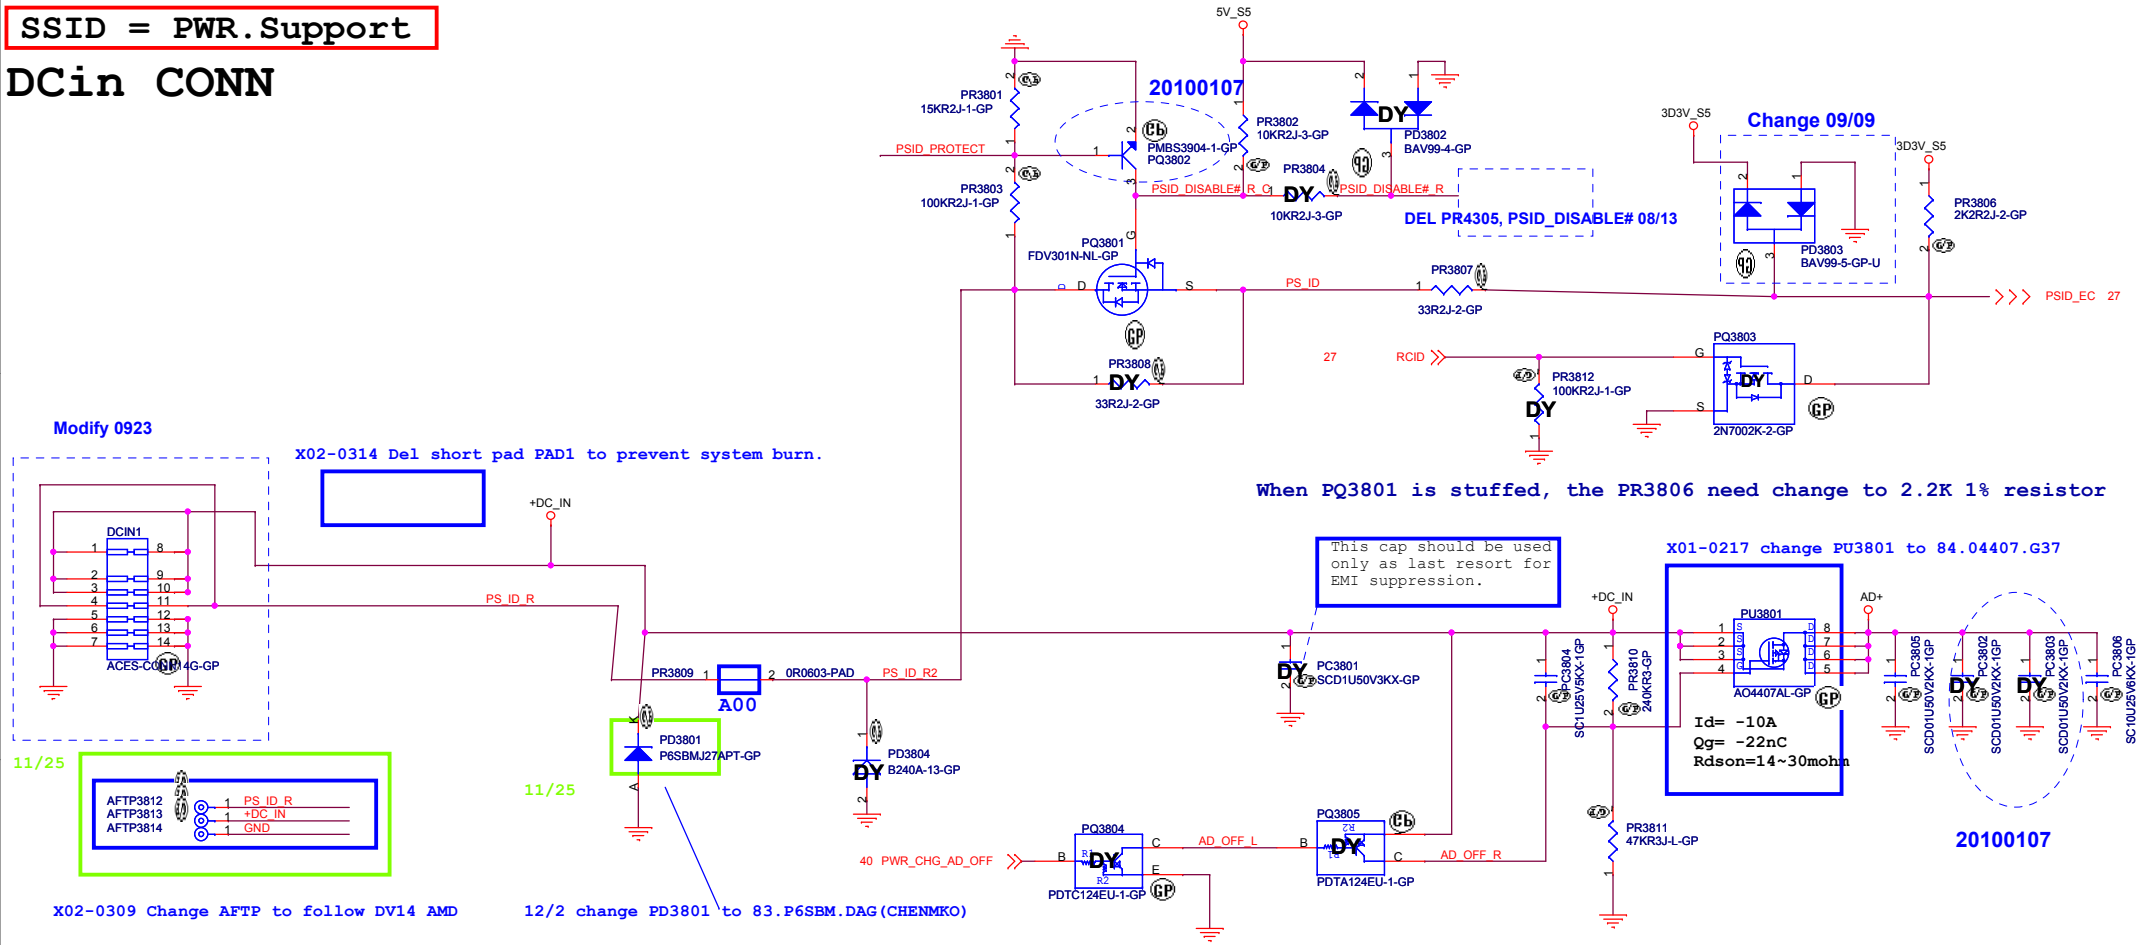

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: DCIN Jack		
Size: A3	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 38 of 105	

SSID = PWR.Support

Batt Connecter

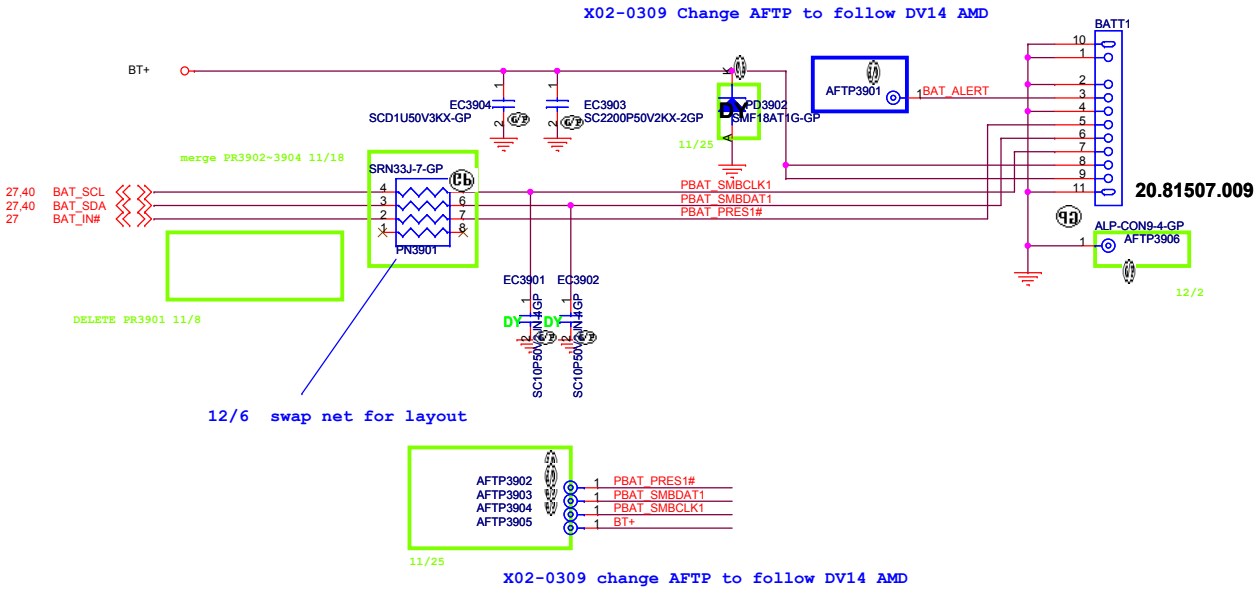

For actual location, need to be swap all pin

Placement: Close to Batt Connector

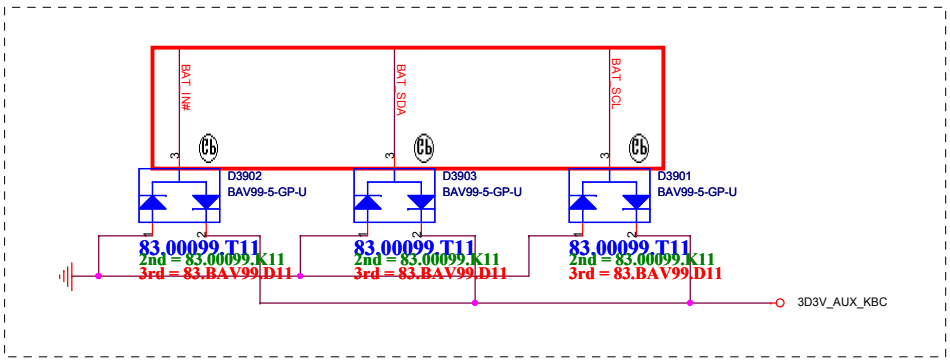

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: BATT CONN

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 39 of 105

SSID = Charger

X01-0217 change PU4002, PU4003 to 84.04407.G37

EE need pull high and net name

0802 Rename H_PROCHOT#

PU4002 AO4407AL-GP
Id= -10A
Qg= -22nC
Rdson=14~13mohm

PU4003 AO4407AL-GP
Id= -10A
Qg= -22nC
Rdson=14~13mohm

A00-0412 dummy PR4037

A00-0412 stuff PQ4005

A00-0412 Change PR4029 to 54.9K

A00-0412 Change PR4013 to 49.9K

A00-0412 stuff PR4030& PR4032

A00-0412 Change PR4027 to 19.6K

PQ4002 2N7002KDW-GP
84.2N702.A3F
2nd = 84.DM601.03F

PU4005 BQ24707ARGRR-GP

delete net name 11/10

delete net name 11/15

Charger Current=1.4~3.6A

X01-0217 change PU4001, PU4004 to 84.04496.037

Add net name 11/10

EE need check pull high

ROSA

Adapter Type	PR4023
65W	24K
90W	33.2K
130W	59K

11/15

11/29

BOM merge 12/15

PR4034 can dummy if you use external 10mW

X01-0127 DY PQ4007, PR4038, PR4039 for new version BQ24707

EC code only BQ24707

H_PROCHOT#	AD_IA_HW	AD_IA_HW2
65W	0	0
90W	1	0
130W	0	1

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CHARGER BQ24707

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 40 of 105

SSID = PWR.Plane.Regulator_3p3v5v

X01-0217 change PR4103 to 100K(F)

12/10 EE change for BOM merge

Design Current = 4.5A
7A<OCP< 8.4A

Design Current = 16A
25.1A<OCP< 29.3A

X02-0310 stuff PC4120

Close to VFB Pin (pin5)

Close to VFB Pin (pin2)

12/20 changePC4126 to 78.47520.51L

I/P cap: 10U 25V K0805 X5R/ 78.10622.51L
Inductor: 2.2U PCMC063T-2R2MN Cyntec 18mohm/20mohm Isat =10Arms 68.2R210.20B
O/P cap: 330U6.3V M6.3*5.7 15mOhm 3.16Arms Matsuki/77.53371.04L
H/S: SIS412DN / 24mohm/30mOhm@4.5Vgs/ 84.00412.037
L/S: SI7716ADN / 13.5mohm/16.5mOhm@4.5Vgs/ 84.07716.037

I/P cap:10U 25V K0805 X5R/ 78.10622.51L
Inductor: 1.50UH PCMC104T-1R5 Cyntec 3.8mohm/4.2mohm Isat =33Arms 68.1R510.10J
O/P cap: 220U 6.3V PSLV0J227M 25mOhm 2.236Arms NEC_TOKIN/77.C2271.00L
H/S,L/S: FDMS3604S / 7.5mohm/9.8mOhm@4.5Vgs, 2.6mohm/3.2mOhm@4.5Vgs/ 84.03604.037

SKIPSEL	VREG3 or VREG5	VREF(2V)	GND
Operating Mode	OOA Auto Skip	Auto Skip	PWM only

EN0	Open	820k to GND	GND
Operating Mode	enable both LDOs, VCLK on and ready to turn on switcher channels	enable both LDOs, VCLK off and ready to turn on switcher channels	disable all circuit

TPS51125:

TONSEL	CH1	CH2
GND	200kHz	265kHz
VREF	245kHz	305kHz
VREG3	300kHz	375kHz
VREG5	365kHz	460kHz

RT8205B:

TONSEL	CH1	CH2
GND	200kHz	250kHz
VREF	300kHz	375kHz
VREG3	365kHz	460kHz
VREG5	365kHz	460kHz

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: TPS51125_5V/3D3V

Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 41 of 105

SSID = CPU.Regulator

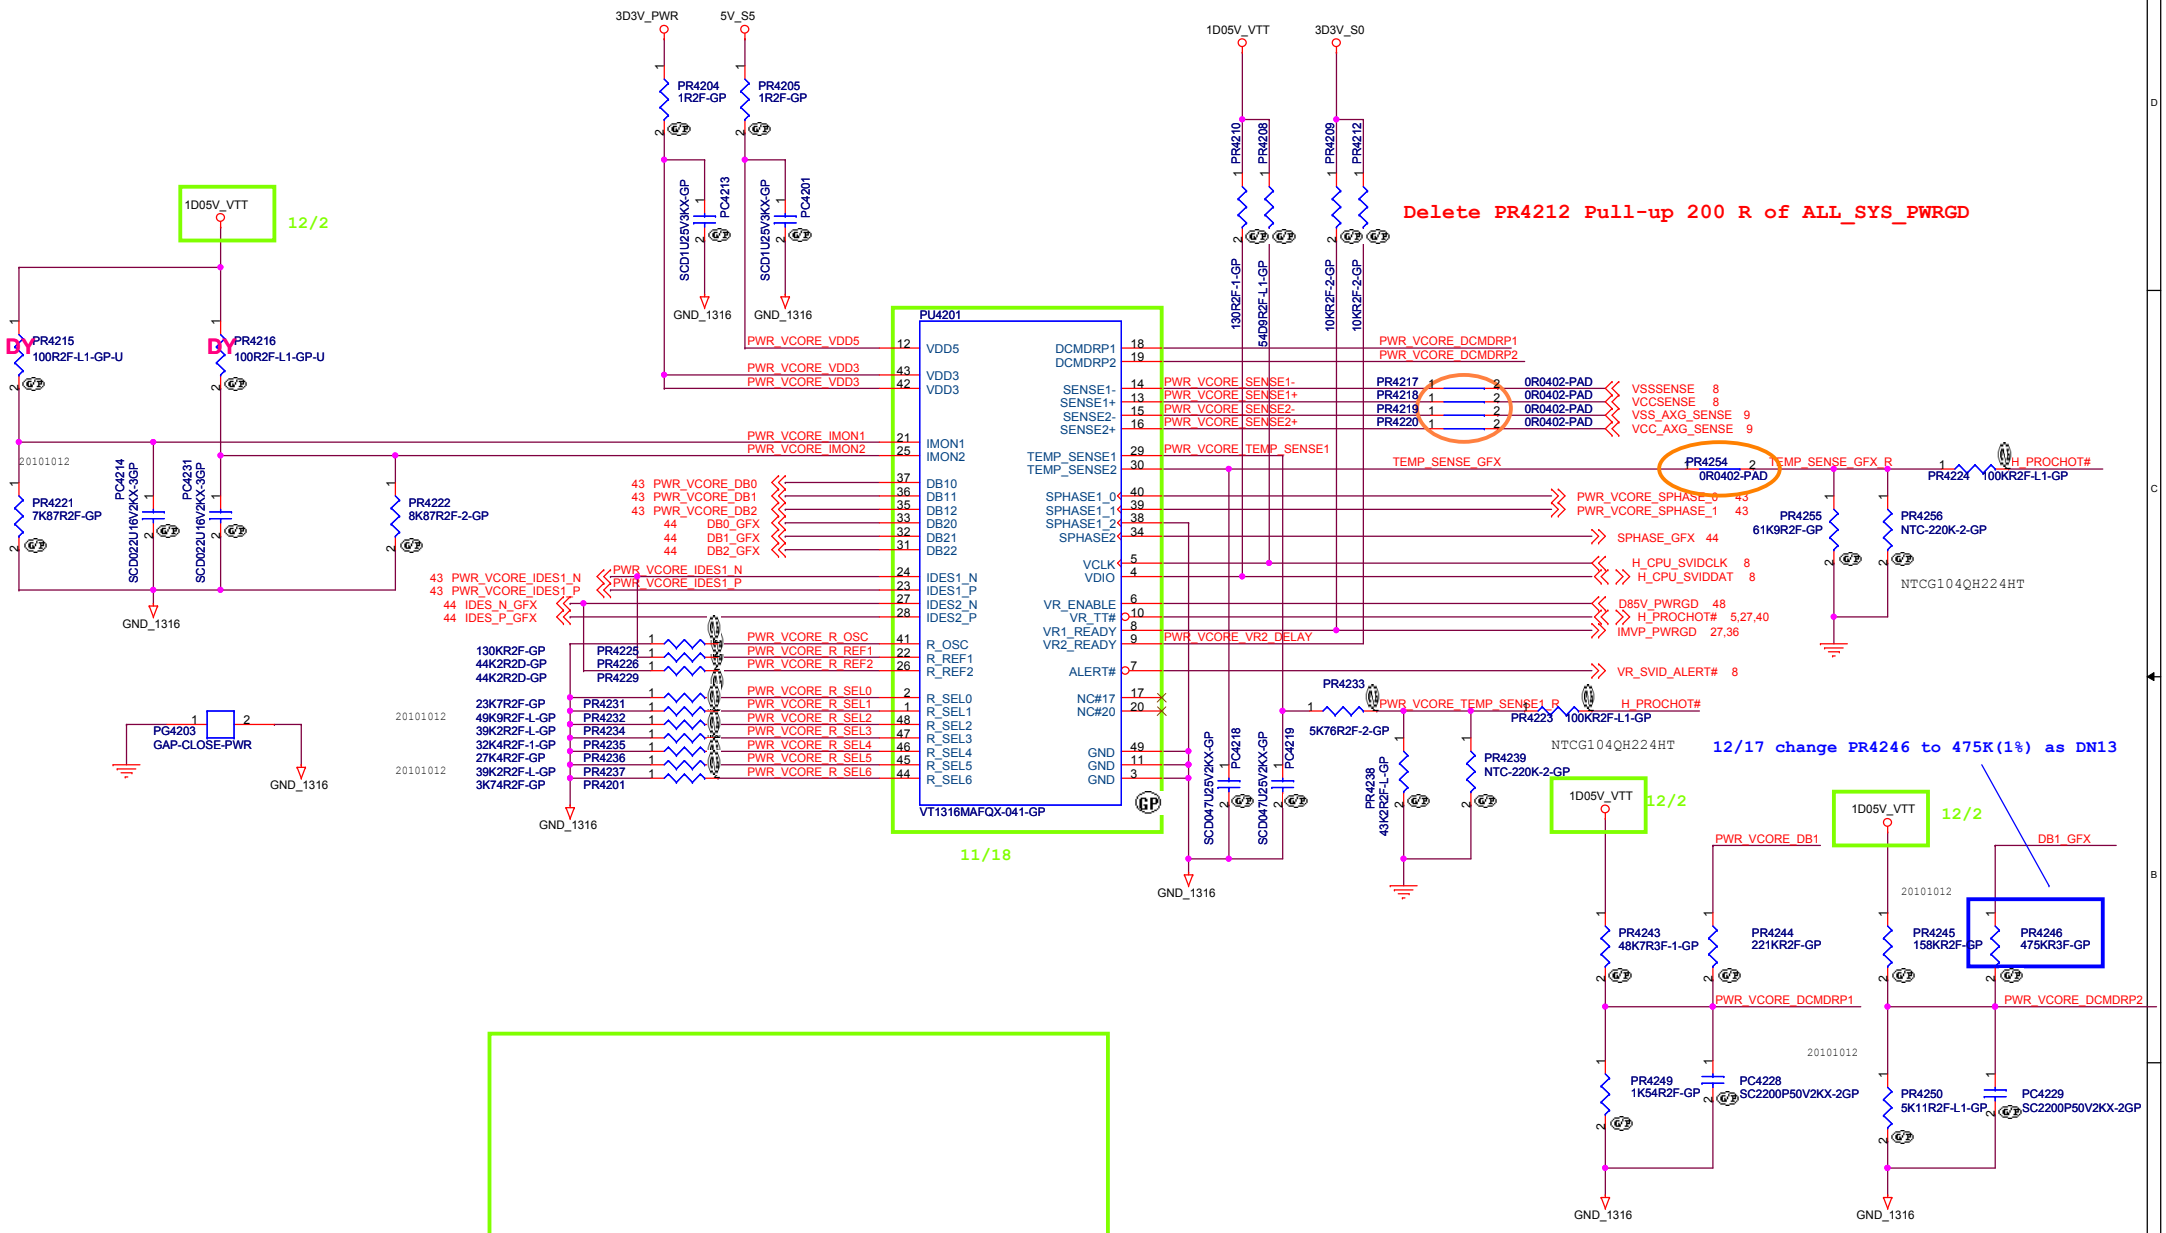

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: VT1316+1314_CPU_CORE(1/3)

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 42 of 105

X01-0217 change PR4202, PR4213, PR4230
PR4247 to 7.5K(F)

400mils or Copper Shape

2120mils or Copper Shape

400mils or Copper Shape

53A=2120mils or Copper Shape

12/29 change PL4201 to HF part

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: VT1316+1314_CPU_CORE(2/3)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 43 of 105

X01-0217 change PR4402& PR4406 to 4.12K(F)

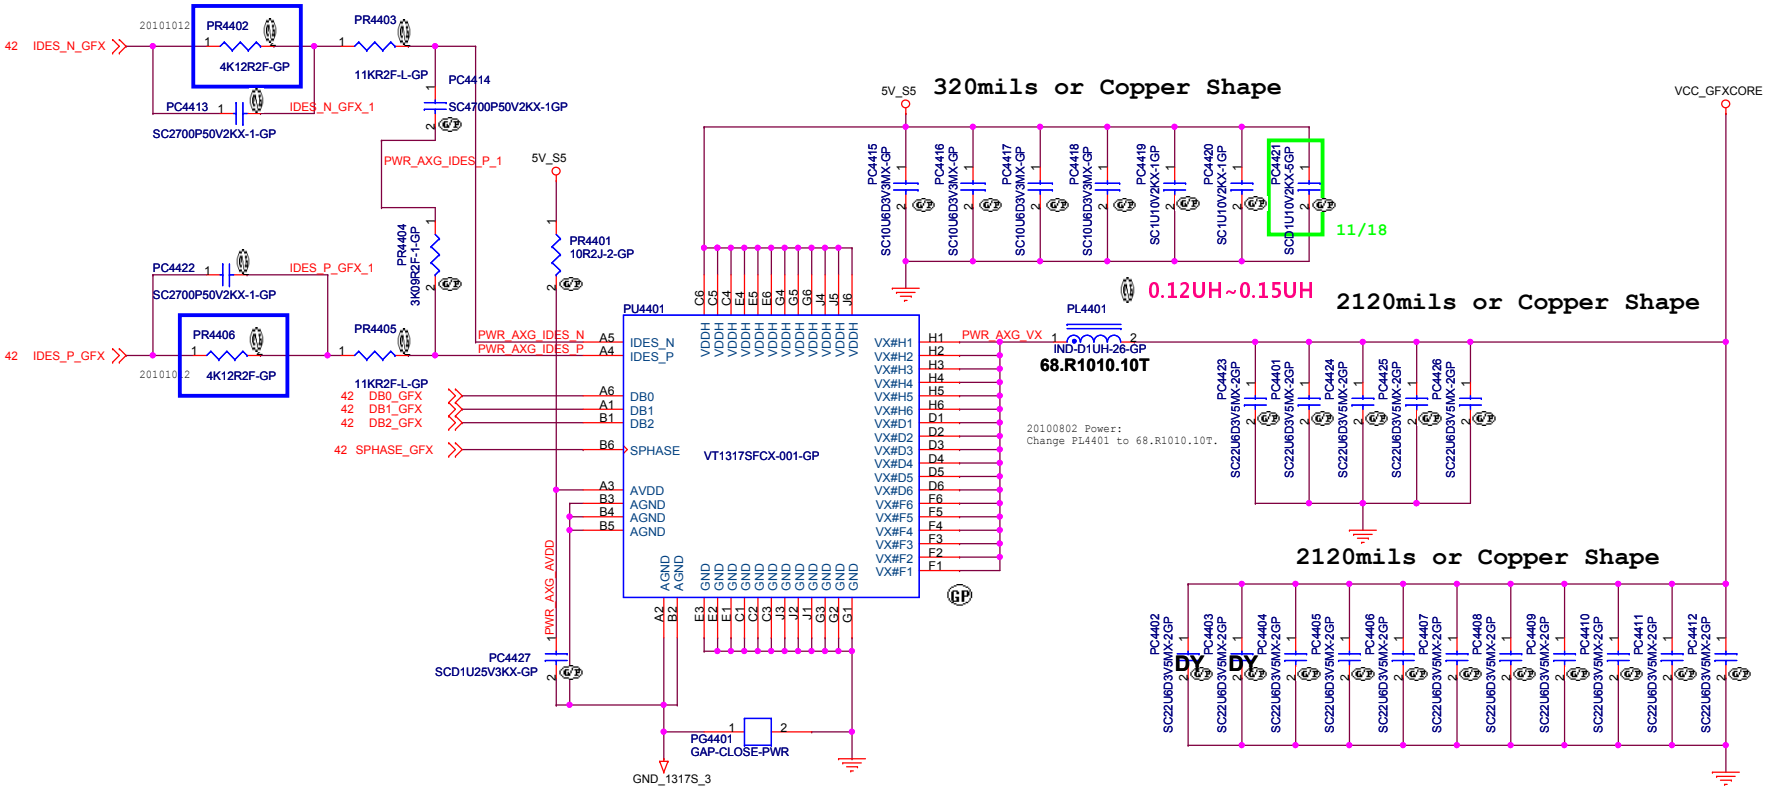

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: VT1316+1317_AXG_CORE(3/3)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 44 of 105

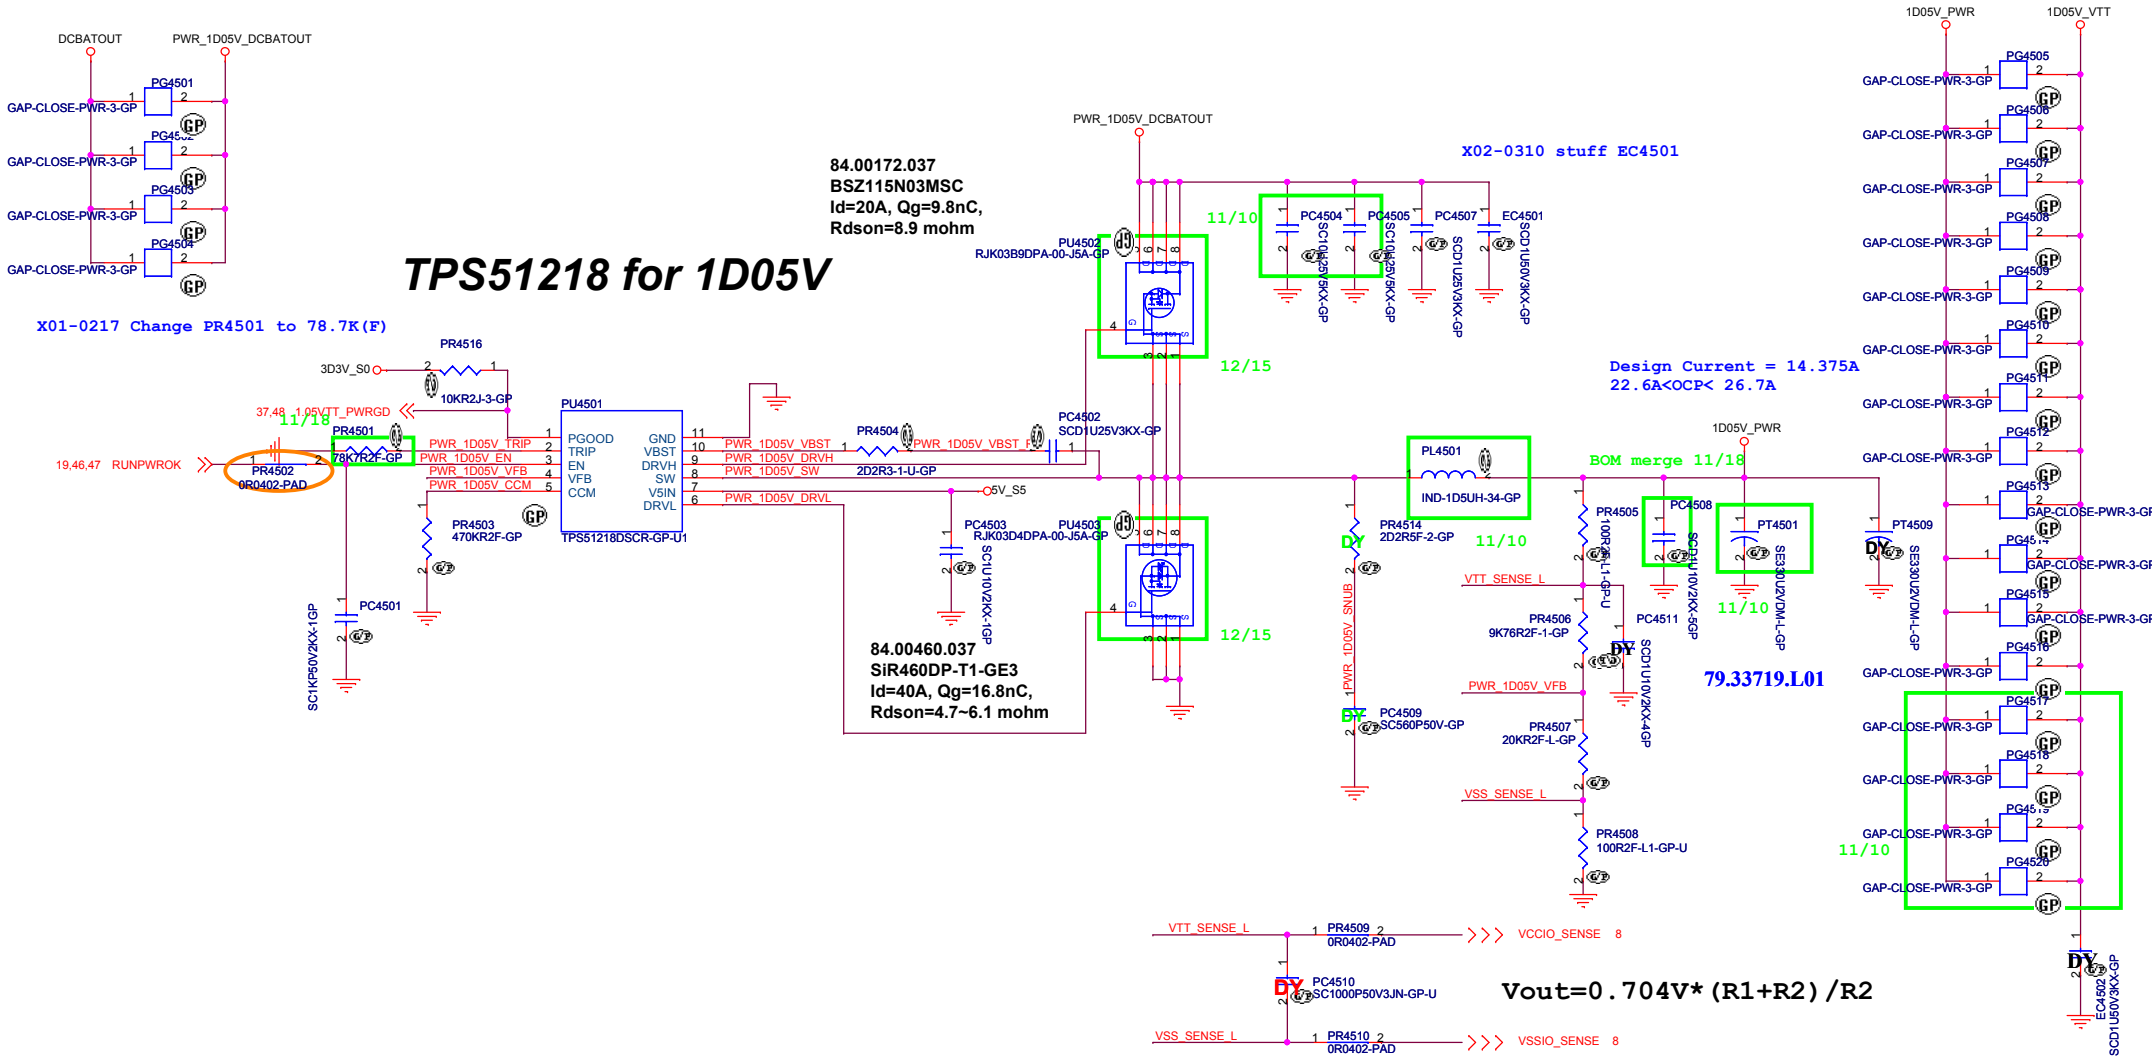

I/P cap: 10U 25V K0805 X5R/ 78.10622.51L
Inductor: 1.50UH PCMC104T Cyntec 3.8mohm/4.2mohm Isat =33Arms 68.1R510.10J
O/P cap: 330U2V EEFSX0D331ER 9mOhm 3Arms Panasonic/79.33719.L01
H/S: SIR172DP / 10.3mohm/12.4mOhm@4.5Vgs/ 84.00172.037
L/S: SiR460DP / 0.49mohm/0.61mOhm@4.5Vgs/ 84.00460.037

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: TPS51218_+1.05V_VTT
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 45 of 105

SSID = PWR.Plane.Regulator_1p5v0p75v

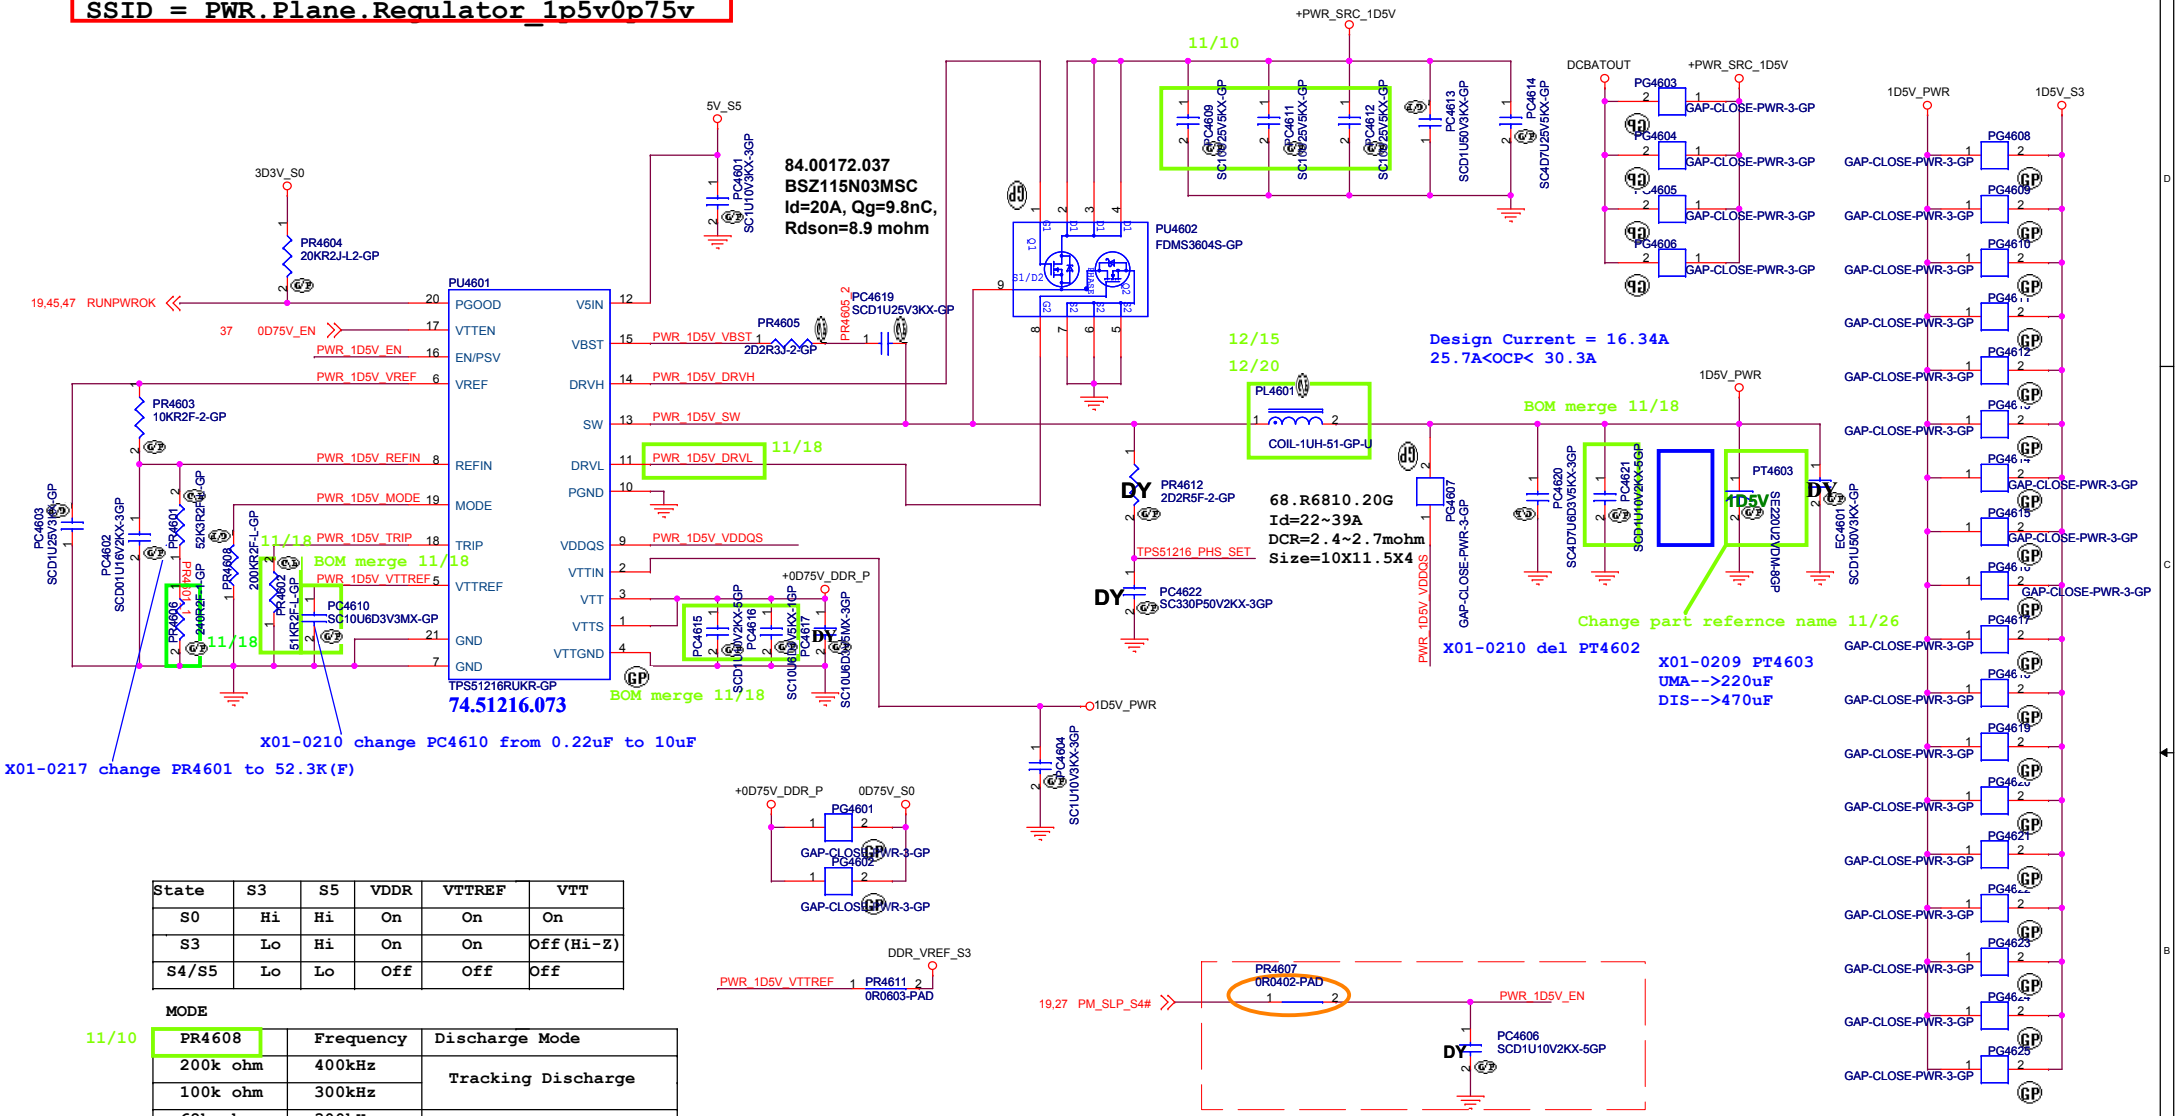

State	S3	S5	VDDR	VTTREF	VTT
S0	Hi	Hi	On	On	On
S3	Lo	Hi	On	On	Off(Hi-Z)
S4/S5	Lo	Lo	Off	Off	Off

MODE

11/10

PR4608	Frequency	Discharge Mode
200k ohm	400kHz	Tracking Discharge
100k ohm	300kHz	
68k ohm	300kHz	Non-tracking Discharge
47k ohm	400kHz	

I/P cap:10U 25V K0805 X5R/ 78.10622.51L
Inductor: 0.68UH PCMC104T-R68MN Cyntec 2.4mohm/2.7mohm Isat =39Arms 68.R6810.20G
O/P cap: 220U2V EEFCX0D221R 15mOhm 2.7Arm/Panasonic/79.22719.20L
H/S,L/S: FDMS3604S / 7.5mohm/9.8mOhm@4.5Vgs, 2.6mohm/3.2mOhm@4.5Vgs/ 84.03604.037

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: TPS51216_+1.5V_SUS

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 46 of 105

SSID = PWR.Plane.Regulator_1p8v

+1.8V_RUN
Design current = 1.015A

APW7153B for 1D8V_S0 DIS

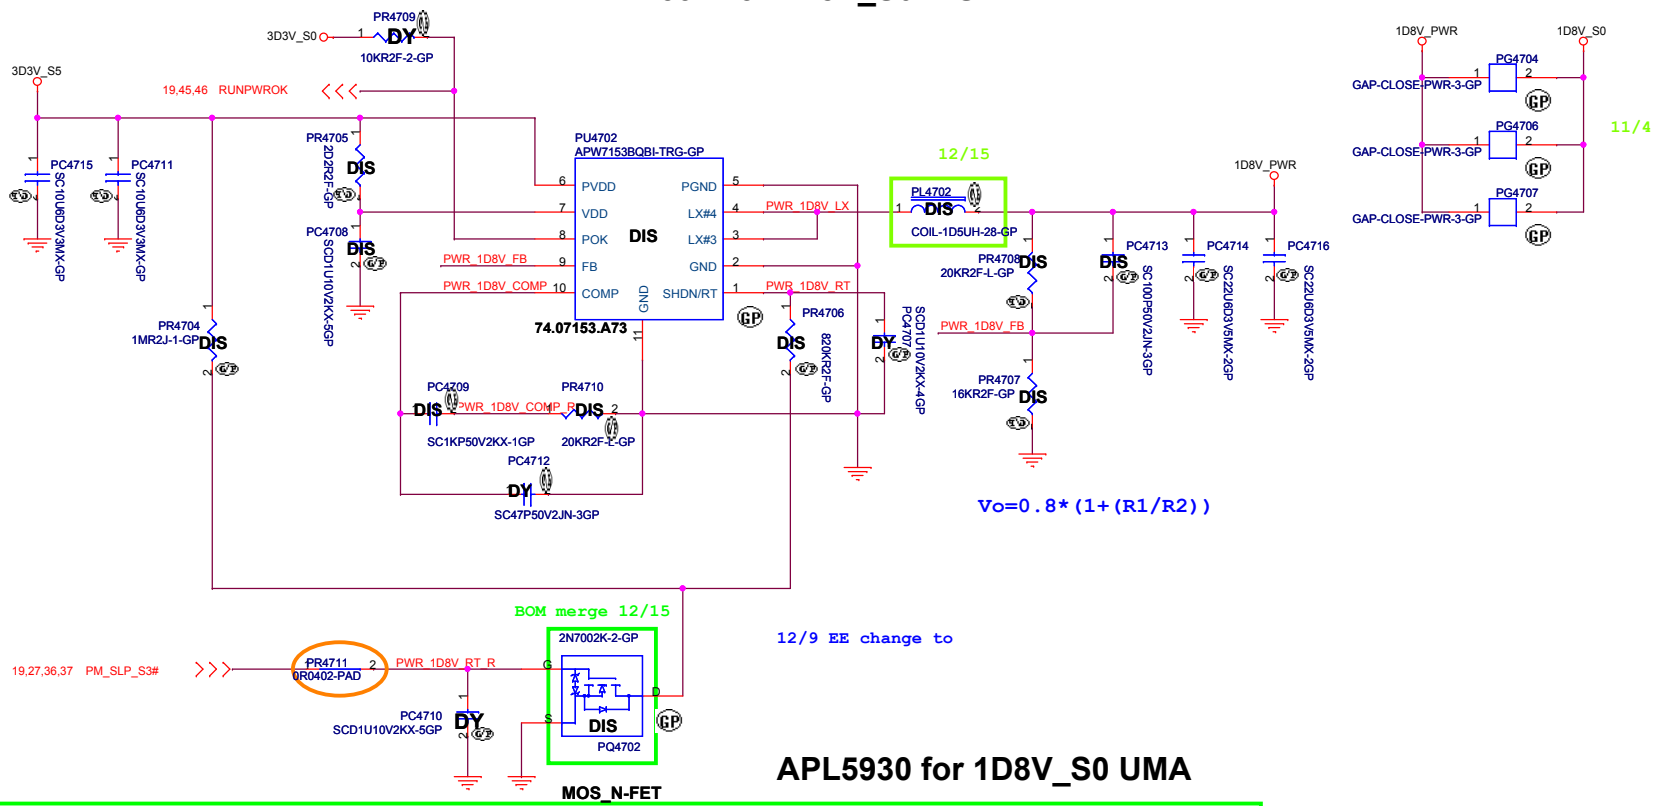

APL5930 for 1D8V_S0 UMA

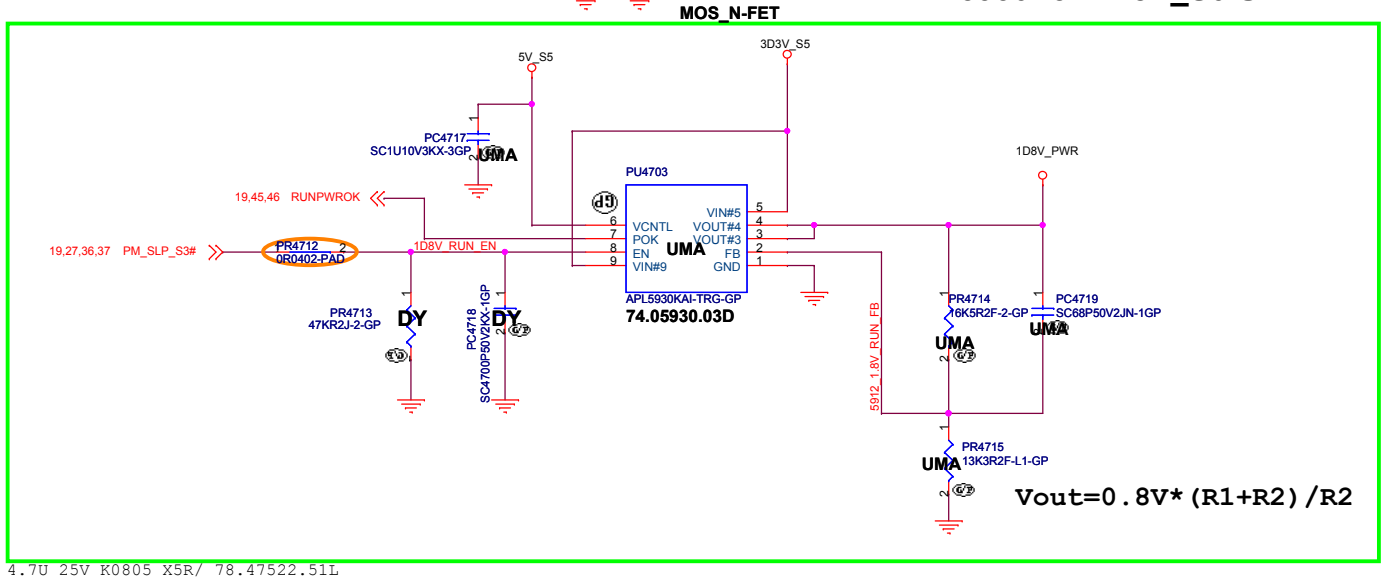

I/P cap: 4.7U 25V K0805 X5R/ 78.47522.51L
O/P cap: 22U 25V M0805 X5R/ 78.22610.51L
Inductor: 1.5U PCMC063T Cyntec 14mohm/15mohm Isat =18Arms 68.1R510.10K

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: APW7153B_ +1.8V_RUN
Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00
Date: Wednesday, April 13, 2011 | Sheet 47 of 105

APL5916 for VCCSA

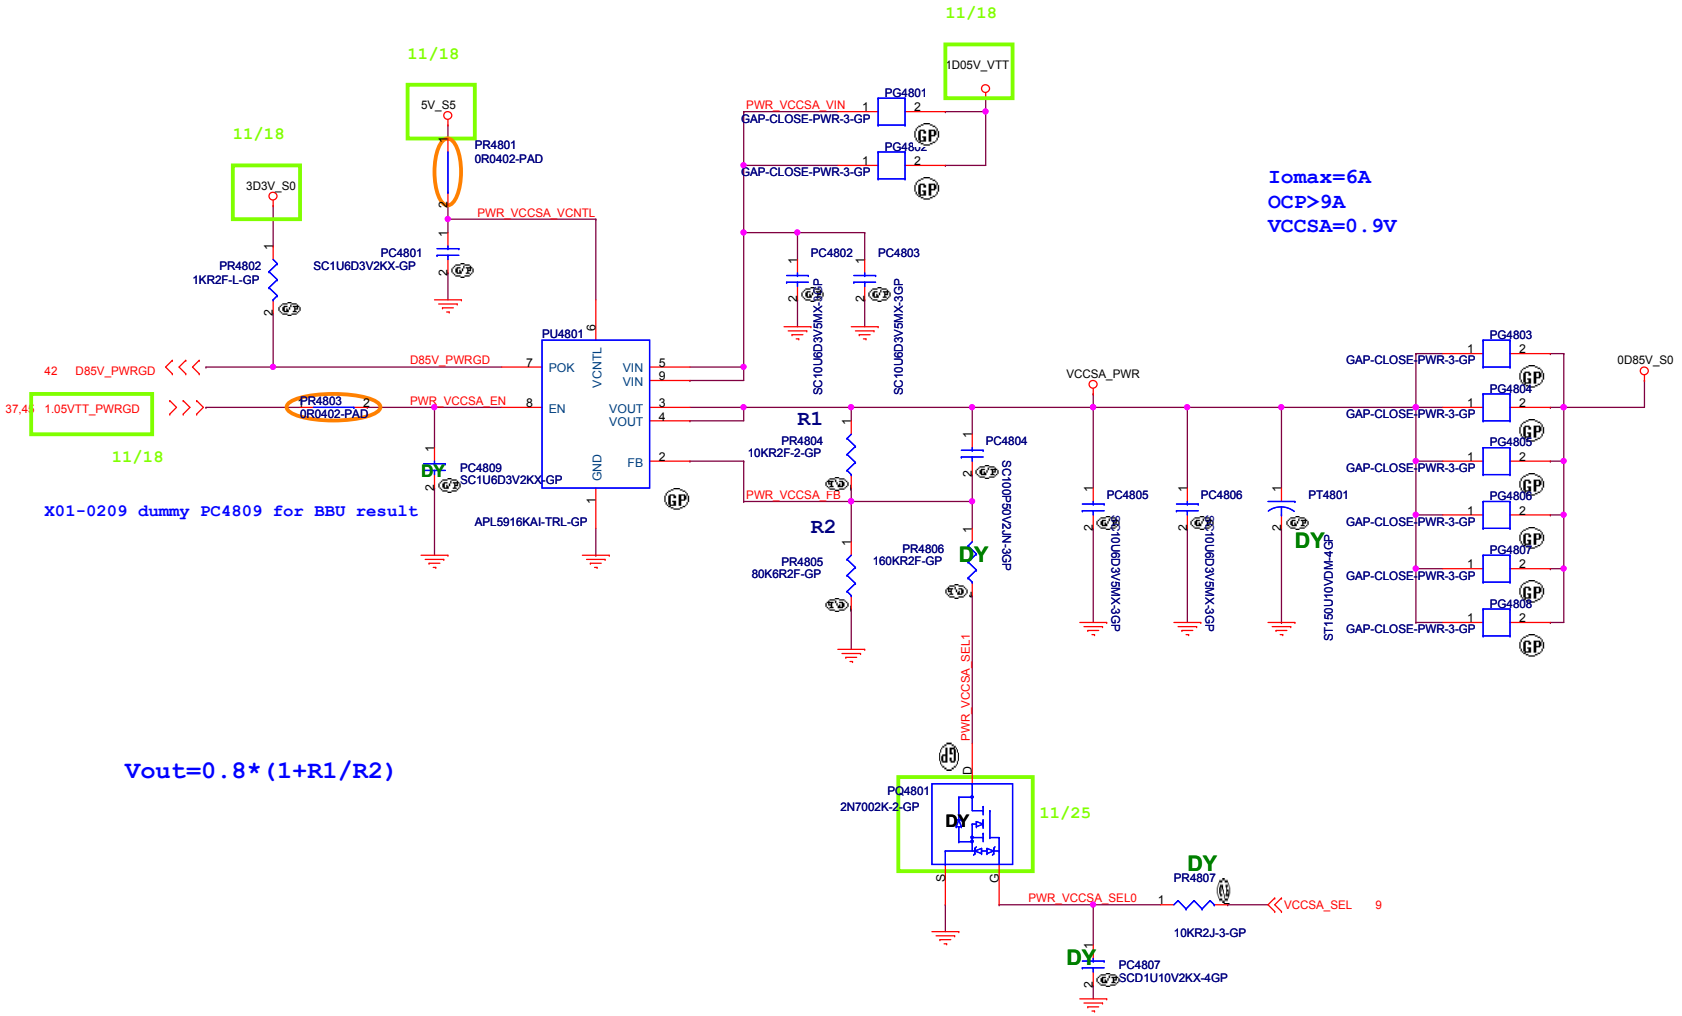

JV10-CS

緯創資通 Wistron Corporation 21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih, Taipei Hsien 221, Taiwan, R.O.C.		
Title: APL5916_VCCSA		
Size	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 48 of 105	

SSID = VIDEO

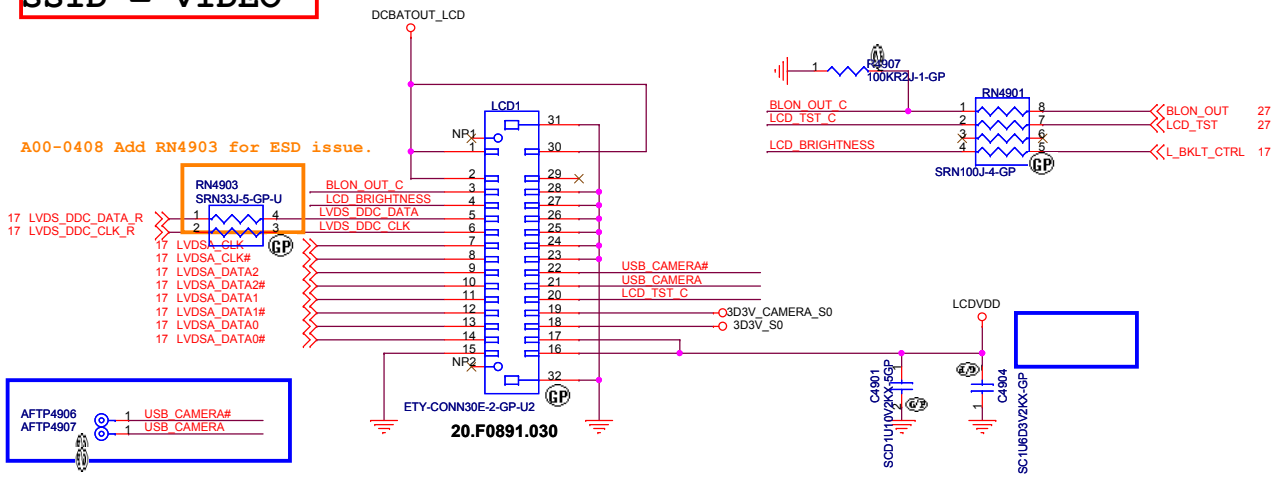

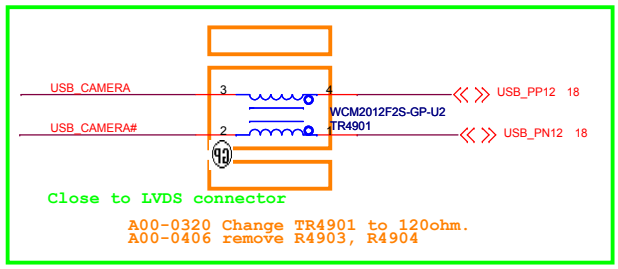

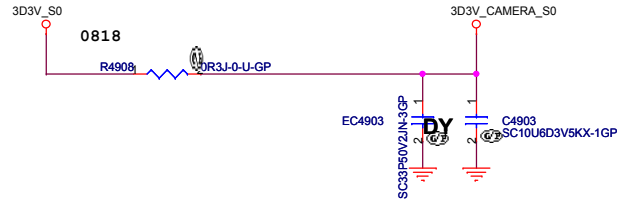

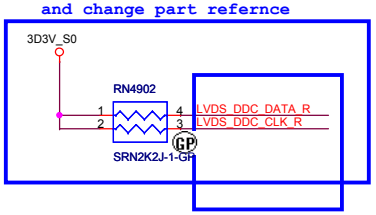

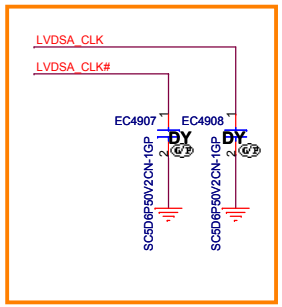

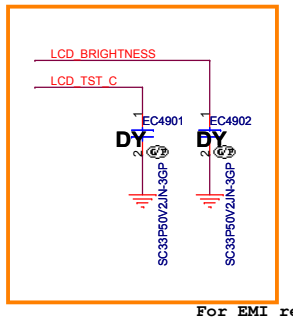

SSID = Inverter

INVERTER POWER

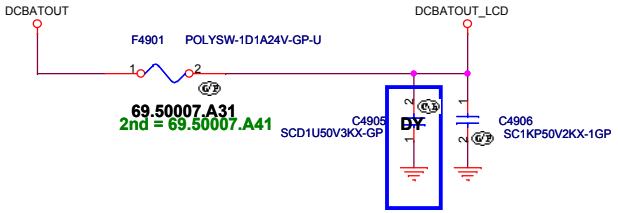

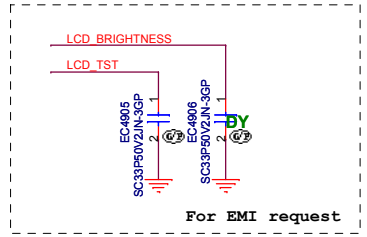

SSID = VIDEO

LCD POWER

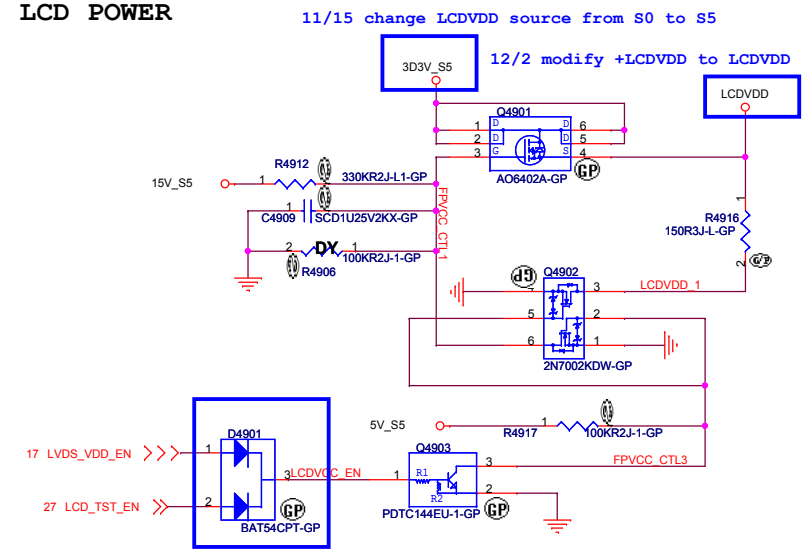

12/9 BOM merge

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: LCD Connector

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 49 of 105

SSID = VIDEO

11/ 17 Add RN5012 for SMbus pull high

X01: change RN5012 from 0R to 2.2KR

11/3 Add RN5010 for CRT SMBus

X02-0303 change 0R to short pad

11/29 change CRT1 to 20.20927.015

X02-0309 change AFTP to follow DV14 AMD

11/18 change Fuse for CRT and HDMI share

11/15 remove F5501 base on brazos result.

11/ 17 Remove R5001

5V Tolerance

Layout Note:

*Pi-filter & 150 Ohm pull-down resistors should be as close as to CRT CONN.

* RGB signal will hit 75 Ohm first, then pi-filter, finally CRT CONN.

Hsync & Vsync level shift

X00 9/23

X01-0208 change R5002, R5003 to 33R

CLOSE TO TRANSFORMER

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: CRT Connector

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 50 of 105

SSID = VIDEO

HDMI Level Shifter & CONNECTOR

HDMI CONN

R5101 0R0402-PAD: HDMI_CLK_R_C → HDMI_CLK_R_C_CON
R5102 0R0402-PAD: HDMI_CLK_R_C# → HDMI_CLK_R_C#_CON
RR5106 0R0402-PAD: HDMI_DATA1_R_C → HDMI_DATA1_R_C_CON
RR5105 0R0402-PAD: HDMI_DATA1_R_C# → HDMI_DATA1_R_C#_CON

A00-0407 remove TR5101, TR5102, TR5103, TR5104 PAD and remove 0R PAD.

RR5104 0R0402-PAD: HDMI_DATA0_R_C → HDMI_DATA0_R_C_CON
RR5103 0R0402-PAD: HDMI_DATA0_R_C# → HDMI_DATA0_R_C#_CON
RR5108 0R0402-PAD: HDMI_DATA2_R_C → HDMI_DATA2_R_C_CON
RR5107 0R0402-PAD: HDMI_DATA2_R_C# → HDMI_DATA2_R_C#_CON

HDMI_PLL_GND
Q5103 2N7002K-2-GP
84.2N702.J31
2ND = 84.2N702.031
5V_S0
R5123 0R2J-2-GP
R5113 100KR2J-1-GP
11/19 change net Q5103_G to 5V_S0

HDMI1 SKT-HDMI19P-63-GP-U
22.10296.171
HDMI_DATA2_R_C_CON
HDMI_DATA2_R_C#_CON
HDMI_DATA1_R_C_CON
HDMI_DATA1_R_C#_CON
HDMI_DATA0_R_C_CON
HDMI_DATA0_R_C#_CON
HDMI_CLK_R_C_CON
HDMI_CLK_R_C#_CON
DDC_CLK_HDMI
DDC_DATA_HDMI
HPD_HDMI_CON
11/18 change Fuse for CRT and HDMI share
5V_CRT_S0_R
C5102 SCD1U10V2KX-5GP
X02-0309
Del AFTP test point to follow DV14 AMD
3D3V_S0
12/9 BOM merge
12/23 BOM merge
Q5102 PMBS3904-1-GP
84.03904.L06
2ND = 84.03904.M11
HDMI_HPD_B
R5111 150KR2J-L1-GP
R5110 200KR2J-L1-GP
HDMI_HPD_E
R5125 0R0402-PAD
HDMI_PCH_DET 17
R5112 10KR2J-3-GP

HDMI DISCRETE/ UMA Co-lay

17 HDMI_CLK_R# C5103 SCD1U10V2KX-5GP → HDMI_CLK_R_C#
17 HDMI_CLK_R C5104 SCD1U10V2KX-5GP → HDMI_CLK_R_C
17 HDMI_DATA0_R# C5105 SCD1U10V2KX-5GP → HDMI_DATA0_R_C#
17 HDMI_DATA0_R C5106 SCD1U10V2KX-5GP → HDMI_DATA0_R_C
66.68136.08L=>680ohm for UMA
66.47136.A8L=>470ohm for GPU
17 HDMI_DATA1_R# C5110 SCD1U10V2KX-5GP → HDMI_DATA1_R_C#
17 HDMI_DATA1_R C5107 SCD1U10V2KX-5GP → HDMI_DATA1_R_C
17 HDMI_DATA2_R# C5108 SCD1U10V2KX-5GP → HDMI_DATA2_R_C#
17 HDMI_DATA2_R C5109 SCD1U10V2KX-5GP → HDMI_DATA2_R_C
RN5106 SRN680J-GP
RN5107 SRN680J-GP
HDMI_PLL_GND

5V_CRT_S0_R
12/1 Modify 5V_HDMI to 5V_CRT_S0_R
3D3V_S0
RN5101 SRN2K2J-1-GP
11/18 change RN5117 BOM control property to HDMI
17 PCH_HDMI_CLK
17 PCH_HDMI_DATA
RN5117 0R4P2R-PAD
X02-0303 change 0R to short pad
Q5104 2N7002KDW-GP
84.2N702.A3F
2nd = 84.DM601.03F
DDC_CLK_Q
DDC_DATA_Q
DDC_CLK_HDMI
DDC_DATA_HDMI

11/16 Del RN5112~5115 for no need to reserve for VGA

Routing Guidelines:
CTRLDATA must be routed longer than CTRLCLK within 1000 mils (25.4 mm).
The total delay on CTRLDATA should be longer than CTRLCLK.

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: HDMI Level Shifter/Connector
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 51 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 52 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: LVDS_Switch

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 53 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 54 of 105

SSID = User.Interface

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: ITP/Fan Connector

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 55 of 105

SSID = SATA

SATA HDD Connector

11/10 Change HDD1 CONN to 62.10065.031
12/22 Change HDD1 CONN to62.10065.H71

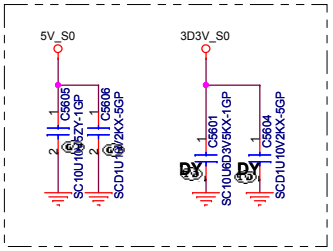

Close to HDD1

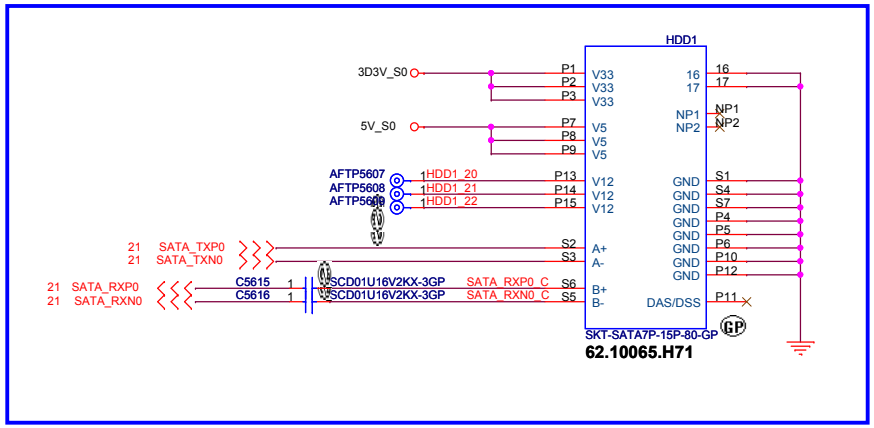

ODD Connector

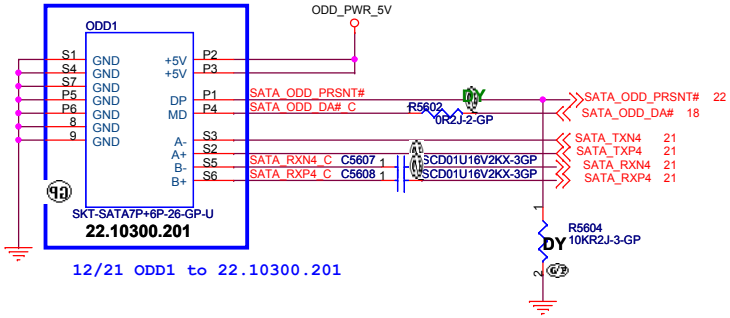

12/21 ODD1 to 22.10300.201

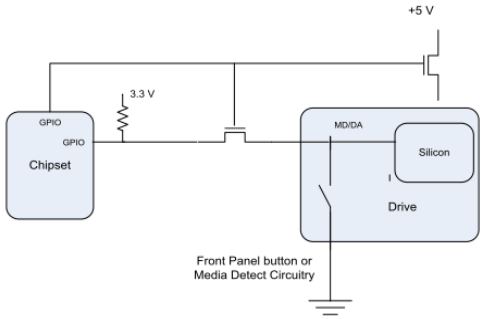

When the drive is powered on, the FET to the MD/DA pin drive is OFF.
When the drive is powered off, the FET to the MD/DA pin is ON

SATA Zero Power ODD

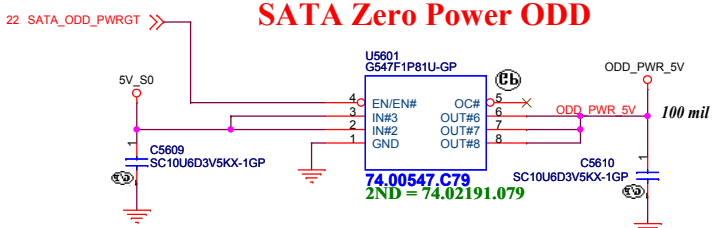

100 mil

Current limit
Active High
typ =>2A

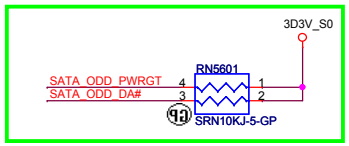

SUPPORT ZERO SATA ODD

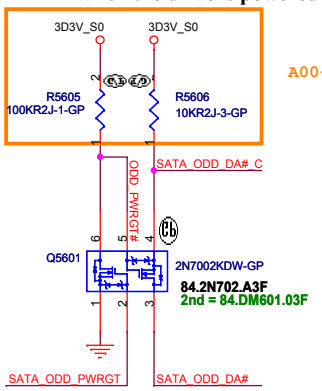

A00-0408 Add R5606 to pull high 3.3V_S0
Change pull high to 3.3V_S0

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: HDD/ODD

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 56 of 105

SSID = ESATA

(Blanking)

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: ESATA		
Size: A3	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 57 of 105	

SSID = AUDIO

Speaker Connector

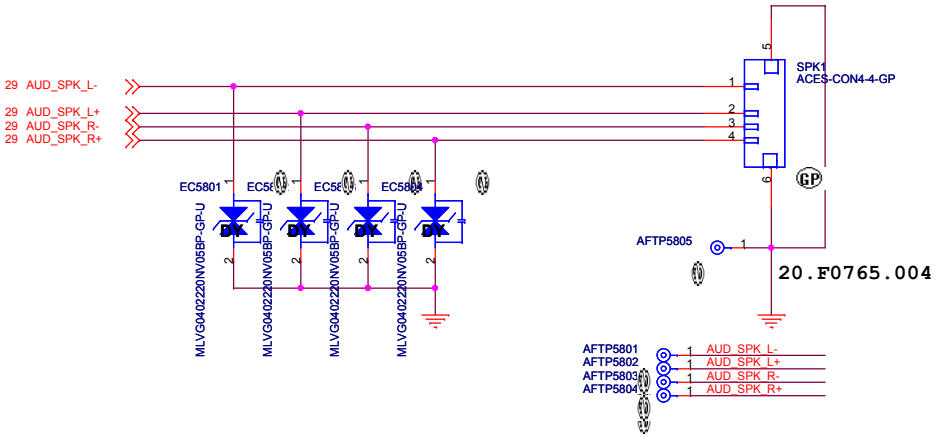

11/10 remove MIC1

11/26 reserve MIC2

12/7 change MIC2 to 20.F1050.002

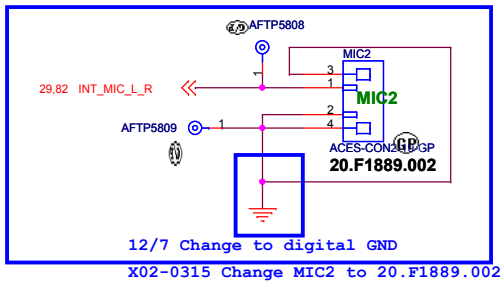

12/7 Change to digital GND

X02-0315 Change MIC2 to 20.F1889.002

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: SPEAKER CONN

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 58 of 105

SSID = LOM

LAN TransFormer

X01-0211 Add EMI solution for Surge

Giga Main: 68.IH601.301
Giga 2nd: 68.05009.30A

10/100 Main: 68.HH035.301
10/100 Main: 68.01284.30A

11/30 swap net

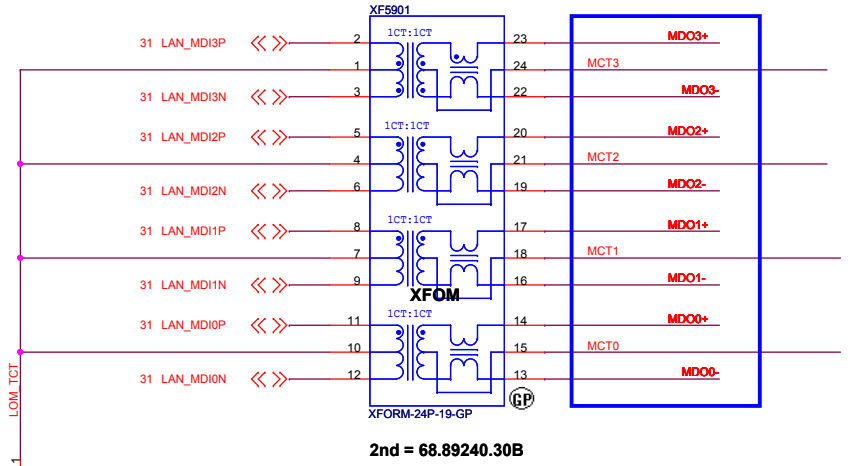

2nd = 68.89240.30B

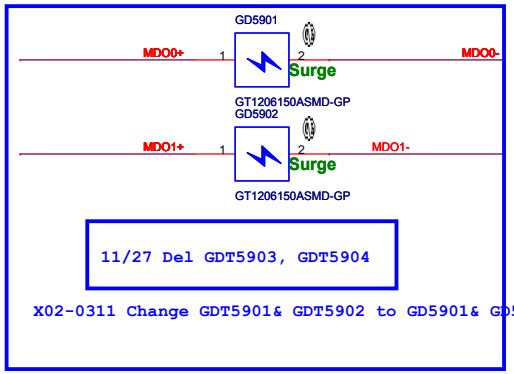

11/27 Del GDT5903, GDT5904

X02-0311 Change GDT5901& GDT5902 to GD5901& GD5902

0722 : change to gas tube

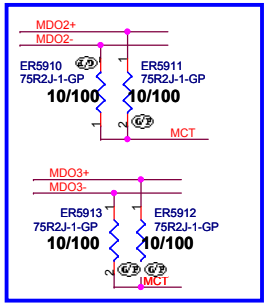

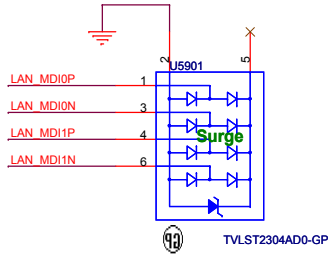

11/27 Del U5902

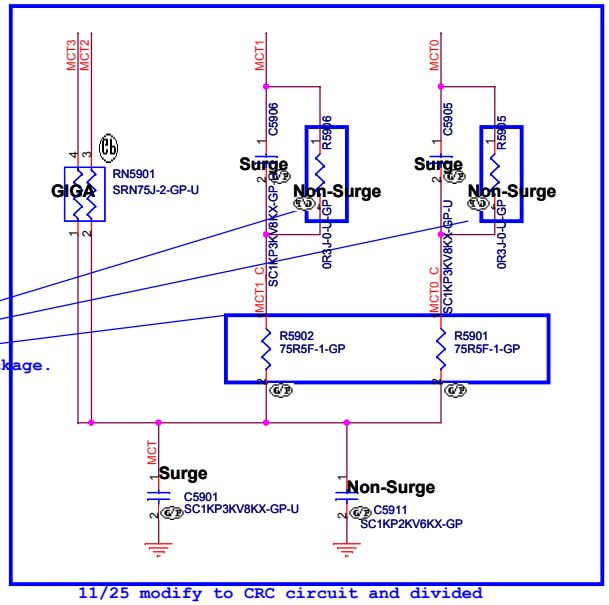

12/6 change resistor package.

11/25 modify to CRC circuit and divided resistor as EMI suggest
11/29 Change C5911 to 78.1022S.22L

RJ45

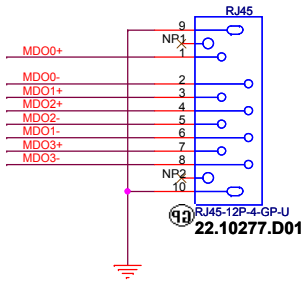

11/29 change RJ45 to 22.10277.D01

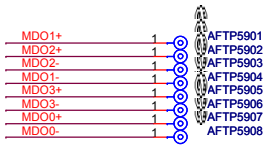

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: XFOM&RJ45

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 59 of 105

SSID = Flash.ROM

SPI FLASH ROM (4M byte) for PCH

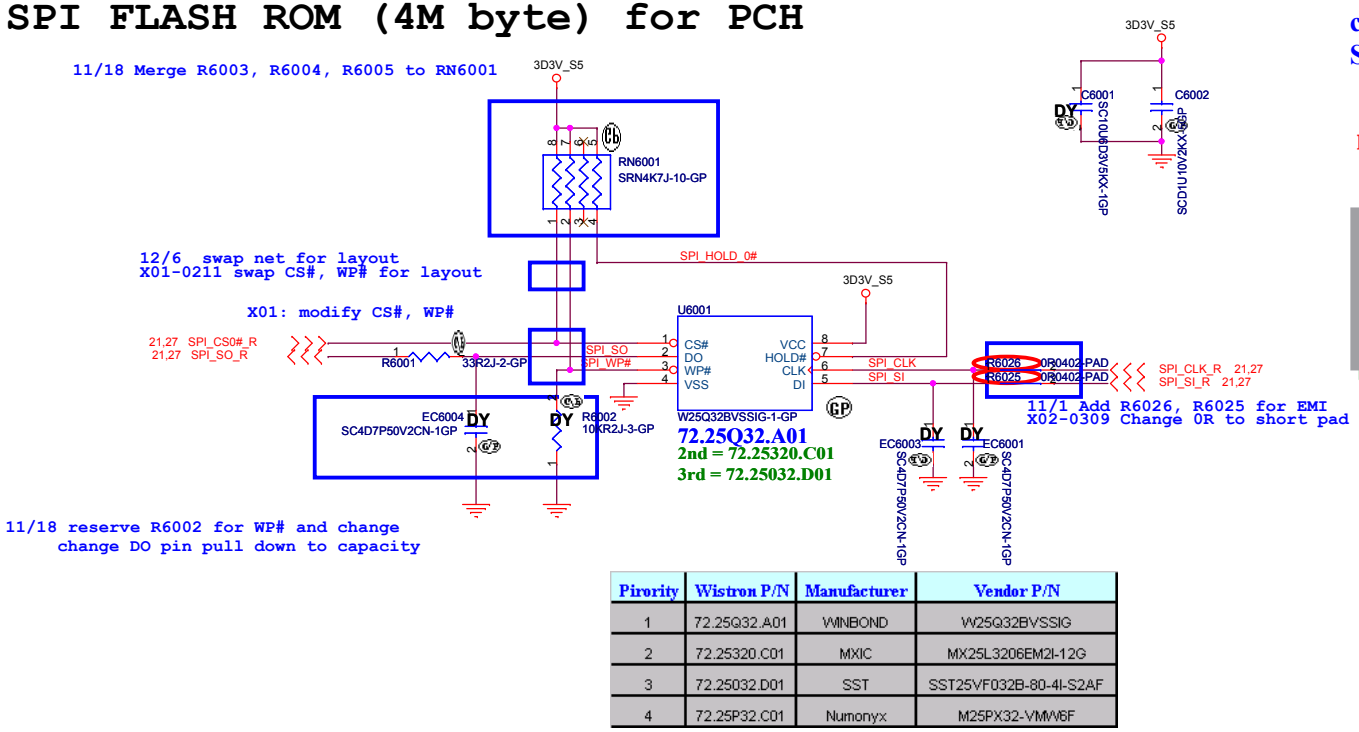

Pirority	Wistron P/N	Manufacturer	Vendor P/N
1	72.25Q32.A01	WINBOND	W25Q32BVSSIG
2	72.25320.C01	MXIC	MX25L3206EM2I-12G
3	72.25032.D01	SST	SST25VF032B-80-4I-S2AF
4	72.25P32.C01	Numonyx	M25PX32-VMW6F

Notes:
The total SPI interface signal between EC and PCH can't not exceed 6500mil. The mismatch between SPI signal must be within 500mil

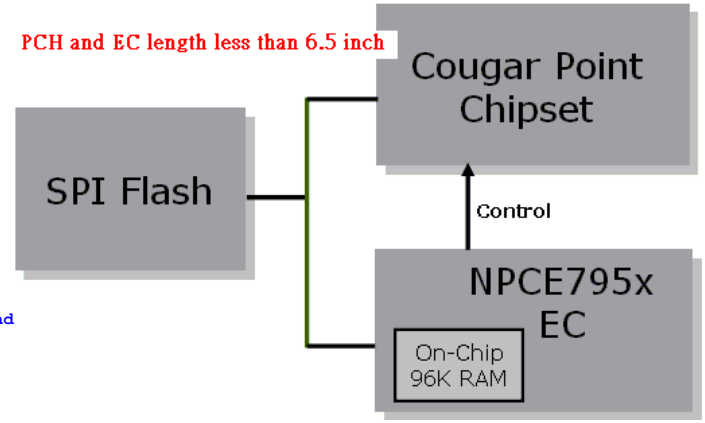

SSID = RBATT

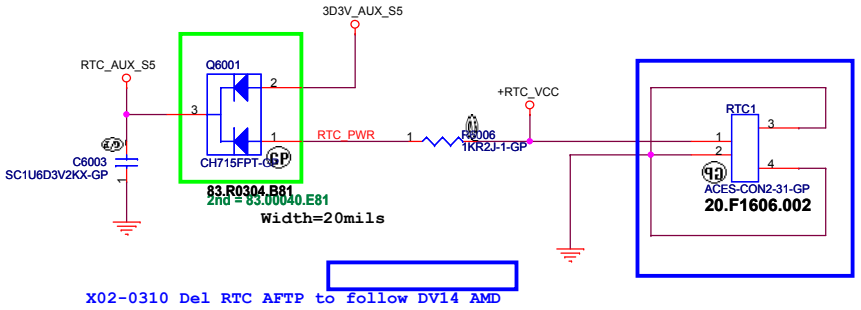

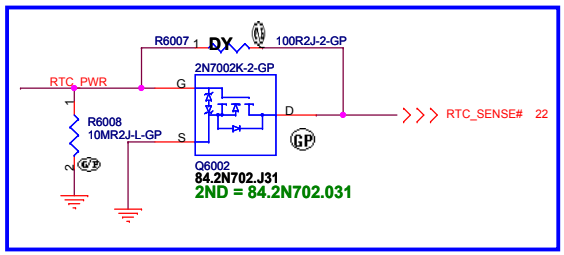

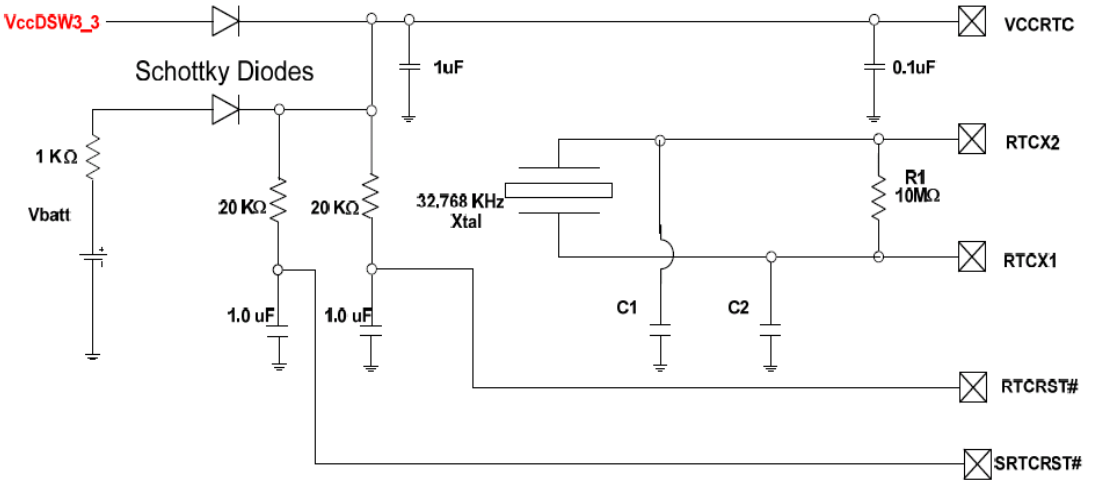

VccRTC is now connected to VccDSW3_3 through the Schottky diode instead of the 3.3V Sus well.

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Flash/RTC

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 60 of 105

SSID = USB

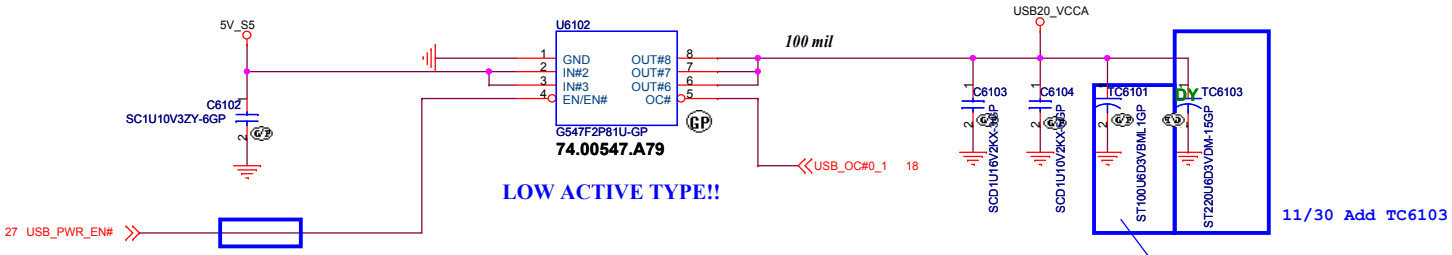

LOW ACTIVE TYPE!!

11/30 Add TC6103

12/22 change TC6101 to 100uF

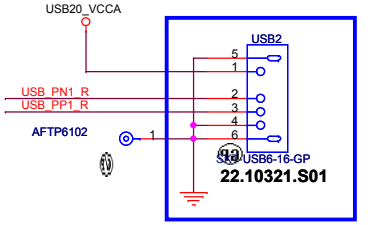

11/29 change USB2 to 22.10321.S01

11/18 remove R6101, R6104

11/10 Move USB power SW to Mainboard

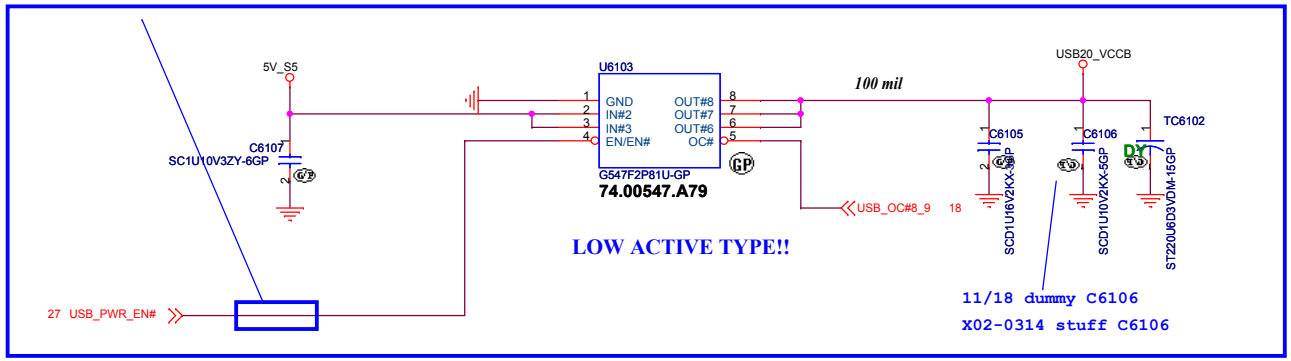

LOW ACTIVE TYPE!!

11/18 dummy C6106

X02-0314 stuff C6106



11/1 Stuff TR6101 for EMI

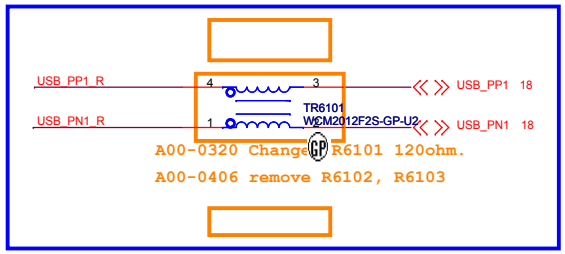

A00-0320 Change R6101 120ohm.

A00-0406 remove R6102, R6103

A00-0408 Swap TR6101 net for layout



DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: USB Power SW

Size	Document Number	Rev
	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 61 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 62 of 105

SSID = User.Interface

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Bluetooth

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 63 of 105

(Blanking)

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

RESERVED

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 64 of 105

SSID = Wireless

Mini Card Connector(802.11a/b/g)

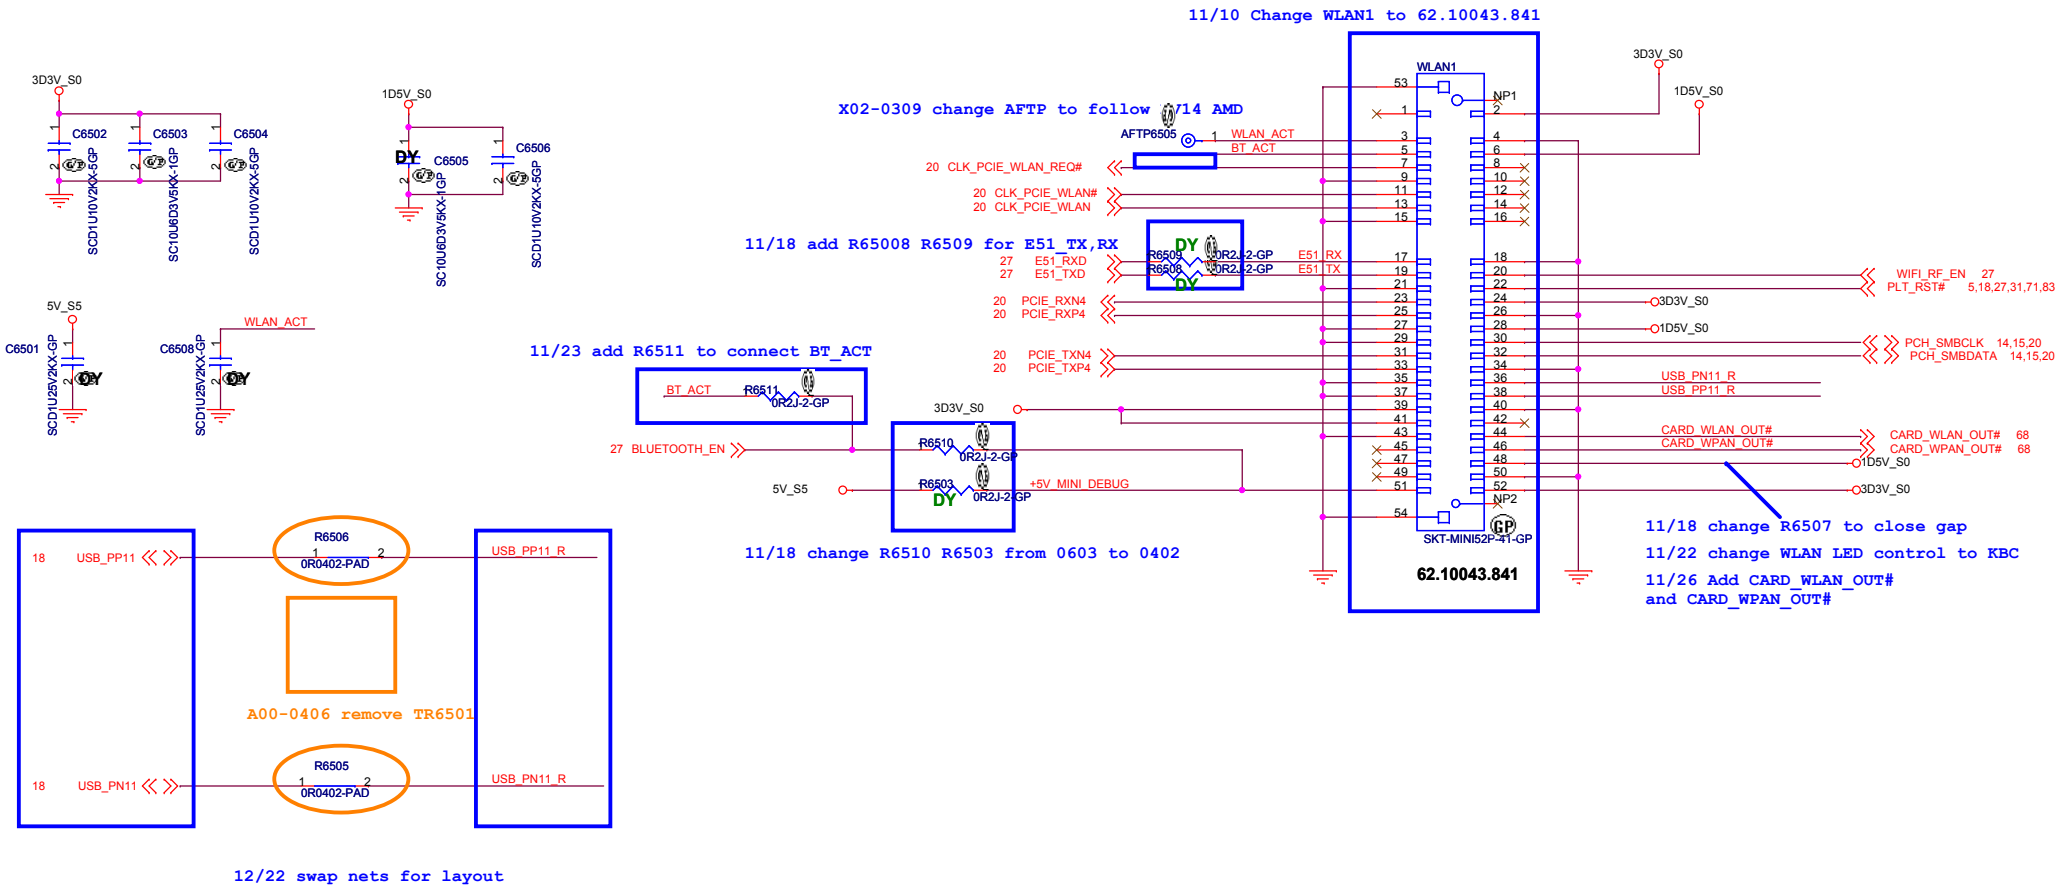

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: MINICARD(WLAN)/ITP CONN

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 65 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 66 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 67 of 105

SSID = User.Interface

FRONT POWER LED

27 PWRLED# → R6813 0R0402-PAD → PWRLED# C → Q6801 (PDTA143ET-GP) 84.00143.M11 → LED_PWR → R6806 330R2J-3-GP → FPOWER_LED_A → PLED1 LED-W-27-GP 83.01221.R70 → 5V_S5

11/26 reserve R6813 to aviod LED turn on when Q6801 install

R6811 0R0402-PAD

A00-0320 Change resistor for LED brightness

SATA HDD LED(White)

11/26 Add R6810 to avoid LED turn on

21 SATA_LED# → R6810 15KR2J-1-GP → SATALED# C → Q6805 (PDTA143ET-GP) 84.00143.M11 → SATA_LED_R → R6812 330R2J-3-GP → HDD_LED_A → HDLED1 LED-W-27-GP 83.01221.R70 → 5V_S0

Need change to LOW actived from KBC GPIO

EC6801 SC220P50V2KX-3GP DY — LED_PWR
EC6810 SC220P50V2KX-3GP DY — SATA_LED_R
EC6807 SC220P50V2KX-3GP DY — WHITE_LED_BAT#
EC6809 SC220P50V2KX-3GP DY — AMBER_LED_BAT#

11/18 add R6804 R6805 0ohm and dummy Q6807, Q6808

12/3 Change LED part reference to follow standard

Battery LED2(WHITE_LED)

X02-0303 change 0R to short pad

R6804 0R0402-PAD

27 BATT_WHITE_LED# → Q6807 (PDTC124EU-GP) 84.00124.H1K → WHITE_LED_BAT# → R6801 330R2J-3-GP → BAT_WHITE# → CHLED1 LED-OW-3-GP 83.00326.G70

WHITE

11/16 Del RN6801 to follow DV15 AMD

R6805 0R0402-PAD

27 CHG_AMBER_LED# → Q6808 (PDTC124EU-GP) 84.00124.H1K → AMBER_LED_BAT# → R6803 499R2F-2-GP → BAT_AMBER#

AMBER

Battery LED1(AMBER_LED)

A00-0413 change R6806, R6812, R6801, R6808 to 330ohm

Wireless LED

A00-0328 change R6814 to 10KR

11/26 change WLANLED control circuit

65 CARD_WLAN_OUT# → D6801 BAT54A-7-F-1-GP → WLAN_LED# → R6814 10KR2J-3-GP → WLANLED# C → Q6806 (PDTA143ET-GP) 84.00143.M11 → WLAN_LED_R → R6808 330R2J-3-GP → WLAN_LED → WLED1 LED-W-27-GP 83.01221.R70 → 5V_S0

65 CARD_WPAN_OUT#

27 KBC_WLAN_OUT# → R6807 0R2J-2-GP DY

11/26 remove R6835

WHITE

X02-0315 Change R6808 to 499K

11/26 if WLAN LED control by KBC. remove D6801 and short R6814, R6807

X01-0217 Change R6814 to 0R

EC6806 SCD1U25V2KX-GP DY

Place EC6806 near LED2

A00-0316 modify WLED1 circuit for brightness

Power button

27 KBC_PWRBTN# → R6802 100R2J-2-GP → AFTP6801 → KBC_PWRBTN# C → PWRBT1 ACES-CONN8G-GP 20.K0464.004 → AFTP6802

12/10 change PWRBT1 pin define

12/21 change PWRBT1 to 20.K0464.004

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: LED Bard/Power Button

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 68 of 105

SSID = KBC

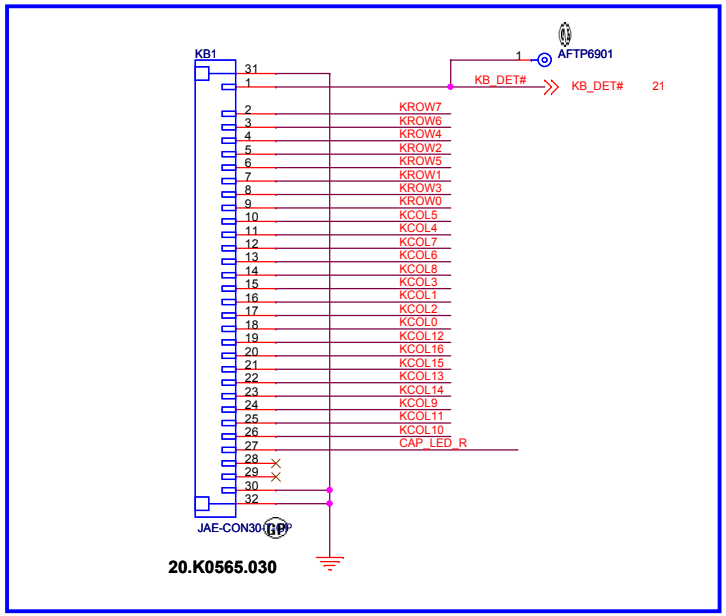

11/26 change KB1 to 20.K0597.030

12/8 Change KB1 to 20.K0565.030

X02-0309 change AFTP to follow DV14 AMD



12/8 Add Cap LED control circuit

CAP LED CONTROL

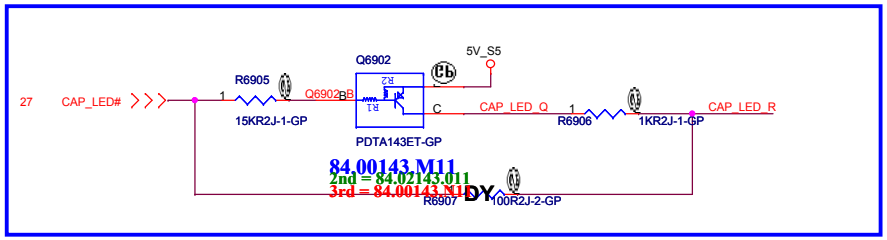

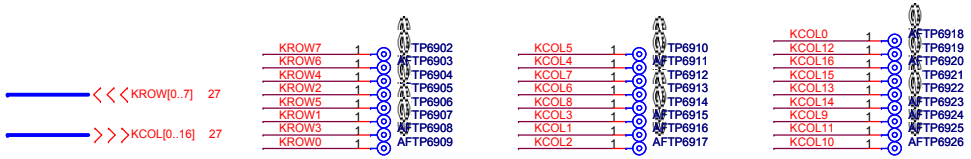

SSID = Touch.Pad

X01-0216 Modify pin define error

TouchPad Connector

12/6 swap net for layout

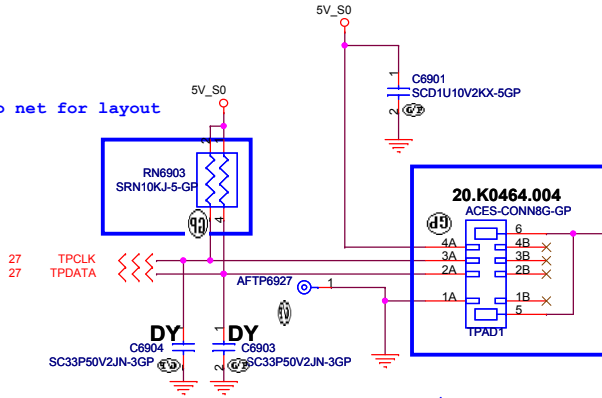

X01-0216 Modify pin define error



X01-0216 exchange C6903& C6904

11/23 change TPAD1 to 20.K0320.004

X01-0208 change TPAD1 to 20.K0464.004

X01-0216 Modify pin define error

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Key Board/Touch Pad

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 69 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Hall Sensor*

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 70 of 105

11/18 remove RN7102, R7107

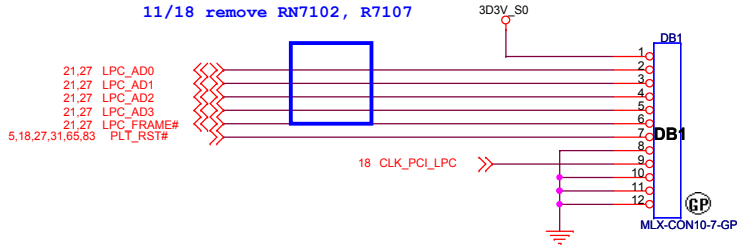

20.D0183.110



DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title	Debug connector	
Size: A3	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 71 of 105	

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 72 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 73 of 105

SSID = SDIO

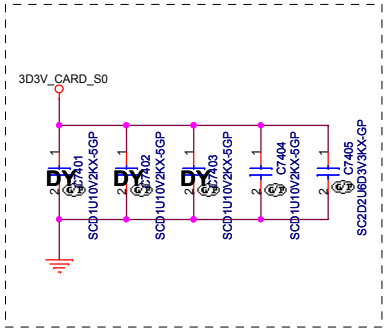

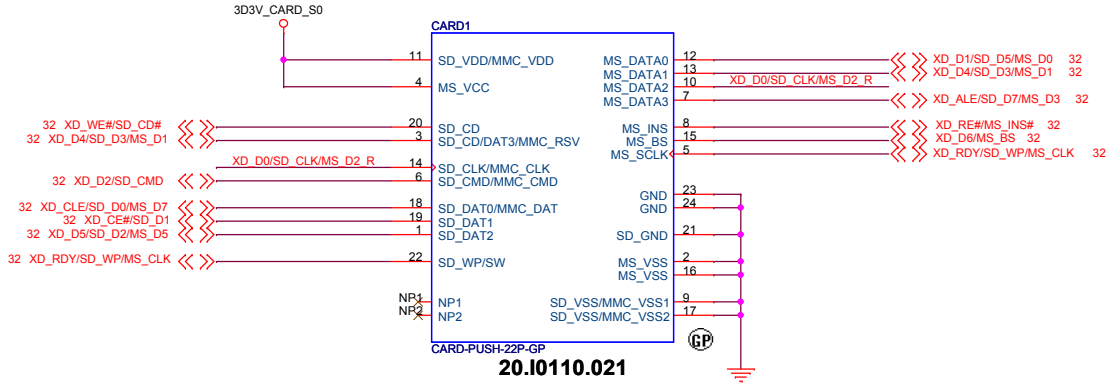

20.I0110.021

0810 Vendor Recommand

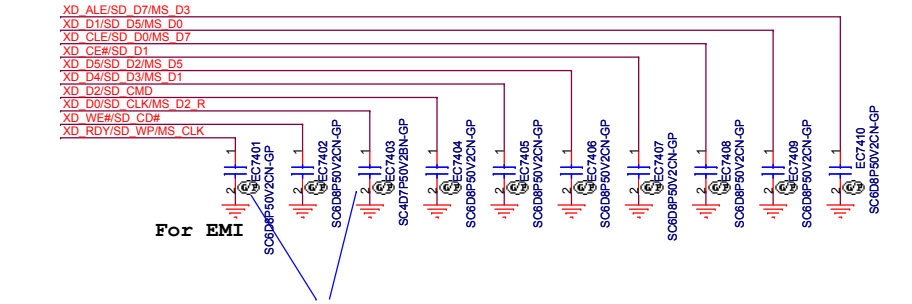

11/18 Dummy EC7401, EC7403

11/20 vendor recommand to reserve 5P

X01-0216 stuff EC7401~EC7410 for EMI



<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: SD/XD/MS/MMC Card CONN

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 74 of 105

SSID = ExpressCard

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Express Card

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 75 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title

Reserved

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 76 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 77 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 78 of 105

SSID = User.Interface

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Free Fall Sensor

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 79 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 80 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Reserved*

Size	Document Number	Rev
A3	*Enrico Caruso 14*	*A00*

Date: Wednesday, April 13, 2011 Sheet 81 of 105

11/1 Stuff TR8201, TR8202 for EMI

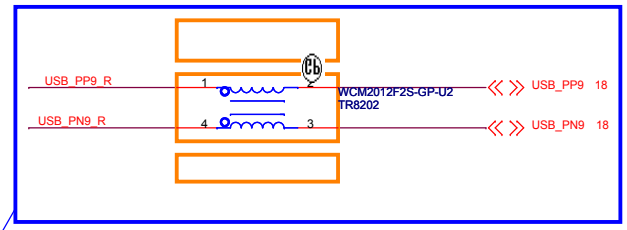

A00-0406 remove R8201, R8202, R8203, R8204 pad

A00-0320 Change TR8201, TR8202 to 120ohm.

A00-0408 Swap net for layout

12/6 swap net for layout

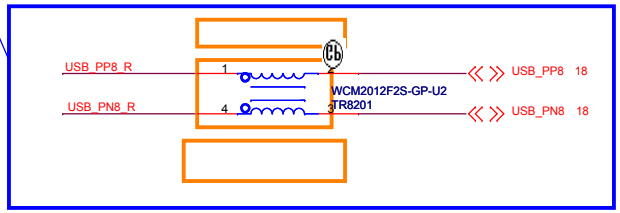

11/1 Add EC2901~EC2904 for EMI request

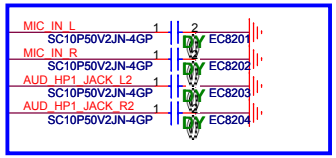

IOBD1 is for USB board

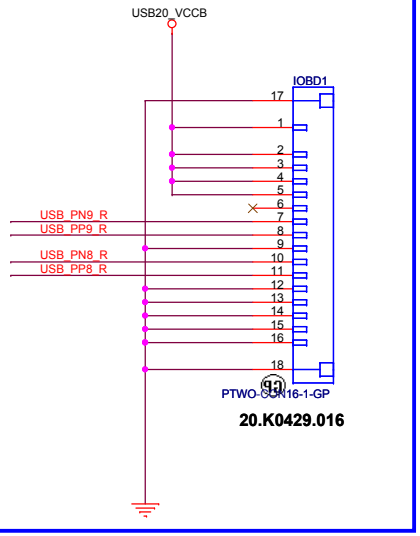

11/10 modify B2B CONN and pin define

X01-0214 add AFTP8201~8210

X02-0309 Del AFTP8201~8210

IOBD2 is for Audio board

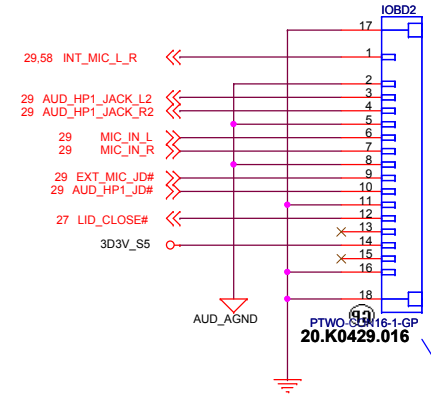

X02-0309 Del AFTP8201~8210

12/10 Change pin defien for audio board routing smooth.

12/14 Change IOBD2 to 20.K0429.016 and change pin define.

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: IO Board Connector

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 82 of 105

SSID = VIDEO

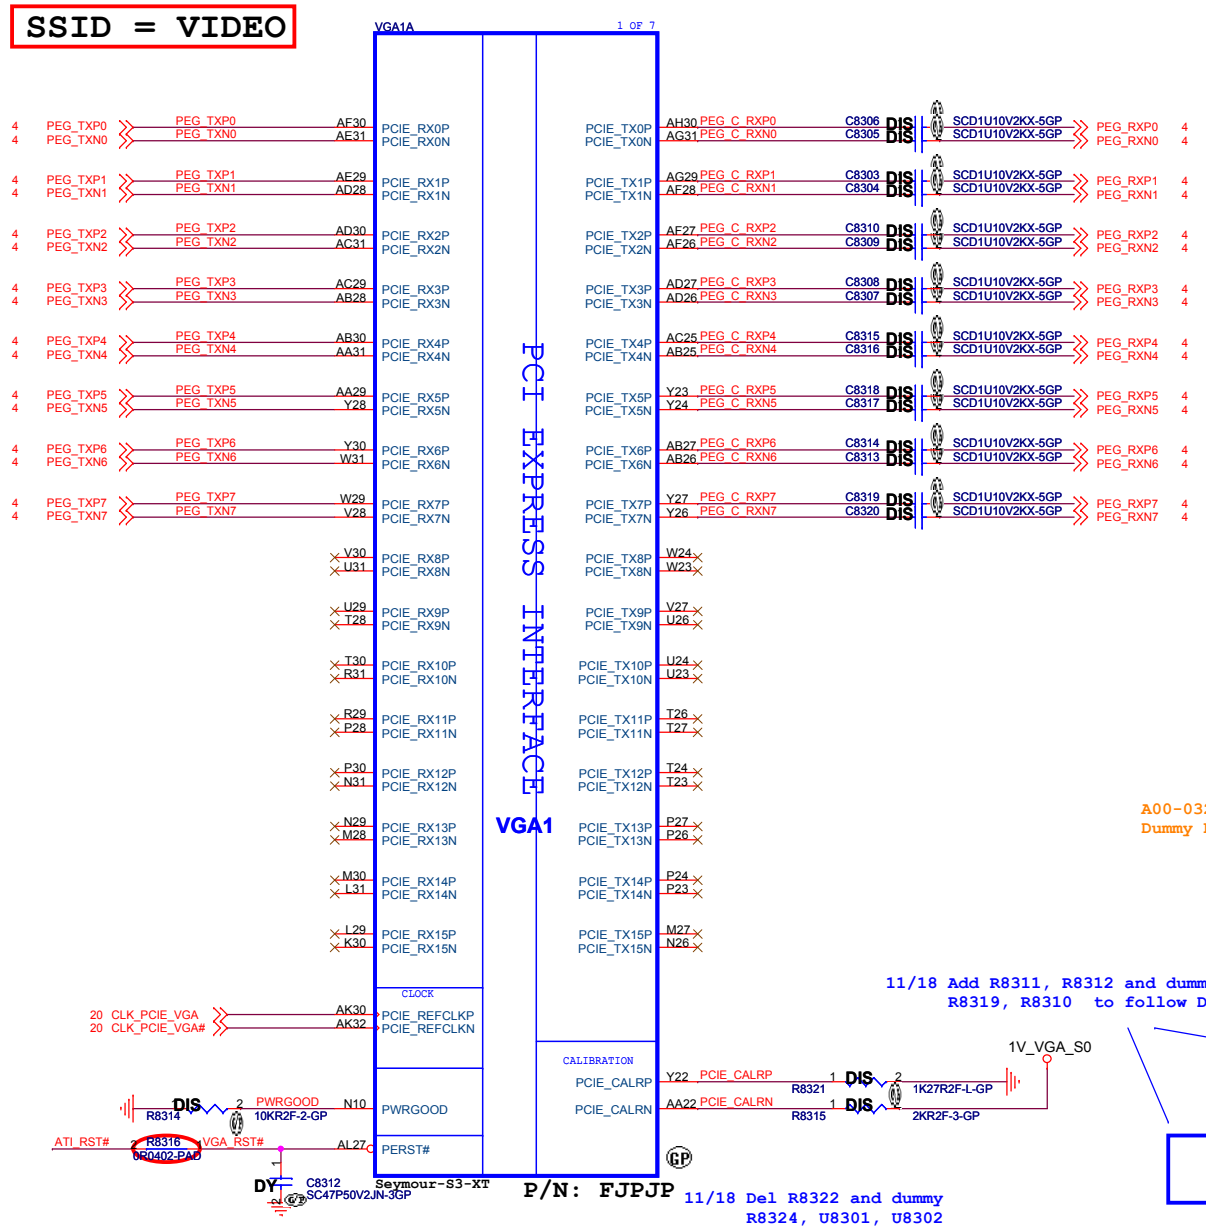

11/18 Add R8311, R8312 and dummy R8319, R8310 to follow DN13

11/18 Del R8322 and dummy R8324, U8301, U8302

CONFIGURATION STRAPS

ALLOW FOR PULLUP PADS FOR THESE STRAPS AND IF THESE GPIOS ARE USED, THEY MUST NOT CONFLICT DURING RESET

RECOMMENDED SETTINGS
0= DO NOT INSTALL RESISTOR
1 = INSTALL 3K RESISTOR
X = DESIGN DEPENDANT
NA = NOT APPLICABLE

STRAPS	PIN	DESCRIPTION OF DEFAULT SETTINGS	RECOMMEND	PLATFORM SETTING
TX_PWRS_ENB	GPIO0	Transmitter Power Savings Enable 0: 50% Tx output swing 1: Full Tx output swing	X	1
TX_DEEMPH_EN	GPIO1	PCIE TRANSMITTER DE-EMPHASIS ENABLED 0:Tx de-emphasis disabled 1:Tx de-emphasis enabled	X	1
BIF_GEN2_EN_A	GPIO2	0:Advertises the PCIe device as 2.5GT/s capable at power on. 1:Advertises the PCIe device as 5.0GT/s capable at power on.	0	0
GPIO5_AC_BATT	GPIO5	optional input allow the system to request a fast power reduction by setting GPIO5 to low.	?	0
GPIO8_ROMSO	GPIO8	RESERVED	0	0
VGA_DIS	GPIO9	0:VGA Controller capacity enabled 1:The device won't be recognized as the system's VGA controller	0	0
ROMIDCFG[2:0]	GPIO[13:11]	BIOS_ROM_EN=1, Config[2:0] defines the ROM type BIOS_ROM_EN=0, Config[2:0] defines the primary memory aperture size	X X X	0 0 1 (256MB)
GPIO21_BB_EN	GPIO21	RESERVED	0	0
BIOS_ROM_EN	GPIO_22_ROMCSB	0:Disable external BIOS ROM device 1:Enable external BIOS ROM device	X	0
VIP_DEVICE_STRAP_EN	V2SYNC	VIP Device Strap Enable indicates to the software driver that it sense whether or not a VIP device is connected on the VIP Host interface.	X	0
RSVD	H2SYNC	RESERVED	0	0
RSVD	GENERICC	RESERVED	0	0
AUD[1]	HSYNC	AUD[1:0]:11-Audio for both DisplayPort and HDMI	X	1
AUD[0]	VSYNC		X	1

2010/06/11

PIN STRAPS

A00-0322
Dummy R8302 for disable de-emphasis

2010/06/11 Need to check

3D3V_VGA_S0

85 TX_PWRS_ENB R8301 DIS 3KR2J-2-GP
85 TX_DEEMPH_EN R8302 DY 3KR2J-2-GP 2010/07/13 Stuff for 5.0GT/S
85 BIF_GEN2_EN_A R8303 DIS 10KR2J-3-GP
85 GPIO8_ROMSO R8304 DY 10KR2J-3-GP
85 VGA_DIS R8305 DY 10KR2J-3-GP
85 CONFIG0 R8306 DIS 10KR2J-3-GP
85 CONFIG1 R8307 DY 10KR2J-3-GP
85 CONFIG2 R8308 DY 10KR2J-3-GP
50,85 VGA_CRT_VSYNC R8309 DY 10KR2J-3-GP
50,85 VGA_CRT_HSYNC R8310 DY 10KR2J-3-GP
85 VSYNC_DAC2 R8311 DY 10KR2J-3-GP
85 HSYNC_DAC2 R8312 DY 10KR2J-3-GP
85 BIOS_ROM_EN R8313 DY 10KR2J-3-GP
85 GPIO5_AC_BATT R8318 DY 10KR2J-3-GP
85 GPIO21_BB_EN R8317 DY 10KR2J-3-GP

3D3V_VGA_S0

85 JTAG_TMS_VGA R8325 DY 10KR2J-3-GP
R8328 DY 10KR2J-3-GP
84 TESTEN R8327 DIS 5K11R2F-L1-GP
85 JTAG_TRST#_VGA R8326 DY 10KR2J-3-GP
20,85 JTAG_TCK_VGA R8329 DY 10KR2J-3-GP

JTAG SIGNAL OPTION

Signal	Normal mode	Debug mode	pilot run mode
TESTEN	"1"(PU)	"1"(PU)	"0"(PD)
JTAG_TRST#	"0"(PD)	"1"(PU)	NC
JTAG_TCK	CLK	"1"(PU)	NC
JTAG_TMS	"1"(PU)	"1"(PU)	NC

11/2 change to 1D5V_VGA_PWOK

85 1D5V_VGA_PWOK R8330 DY 0R2J-2-GP
93 1D8V_S0_VGA_PG R8324 DY 0R2J-2-GP
PLT_RST# R8323 DY 0R2J-2-GP ATI_RST#
1D8V_S0_VGA_PG_R C8311 DY SCD1U10V2KX-4GP
U8301 74LVC1G08GW-1-GP 73.01G08.L04 2ND =
3D3V_VGA_S0
U8301_Y
5,18,27,31,65,71 PLT_RST#

X02-0311 Change R8316, R8331 to short pad

18 DGPU_HOLD_RST# R8331 0R0402-PAD
U8302 74LVC1G08GW-1-GP 73.01G08.L04 2ND =
3D3V_VGA_S0
ATI_RST# ATI_RST# 85

PE_GPIO0	
dGPU mode	H
IGPU	L
IGPU with BACO	H

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU_PCIE/STRAPPING(1/5)
Size: A3 Document Number: Enrico Caruso 14 Rev: A00
Date: Wednesday, April 13, 2011 Sheet 83 of 105

SSID = VIDEO

PLACE MVREF DIVIDERS AND CAPS CLOSE TO ASIC

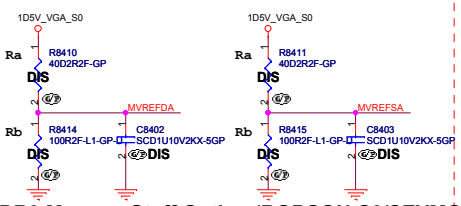

DDR3/GDDR3 Memory Stuff Option (ROBSON-S3/SEYMOUR-XT-S3)

	DDR5	DDR3
MVDDQ	1.5V	1.5V/1.8V
Ra	40.2R	40.2R
Rb	100R	100R

DPC_CALR (Park/Robson-S3):
Analog calibration.
Connect DPxx_CALR to GND through a 150- (1%)
resistor.

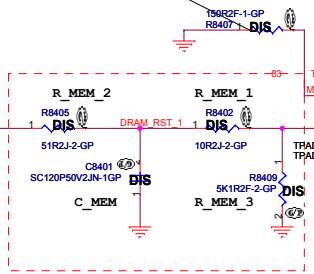

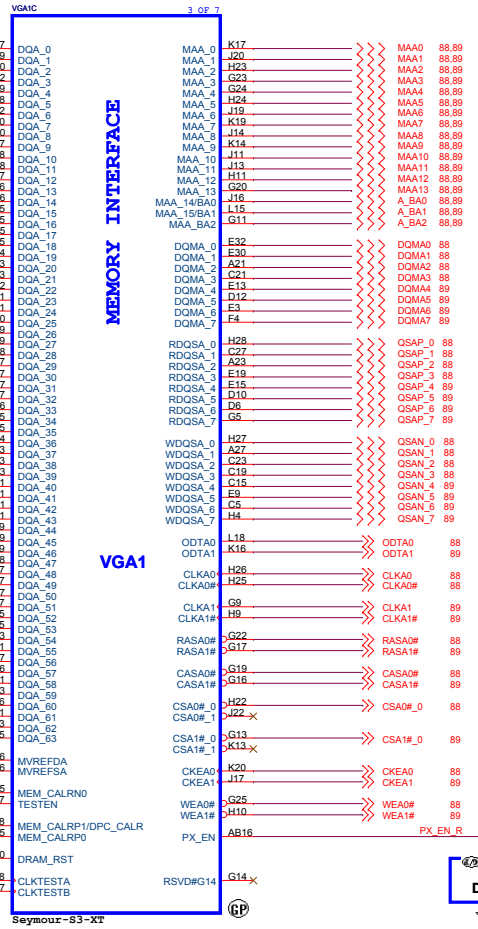

11/16 change part reference to R8441 and stuff

11/18 move R8441 before R8440

2010/07/06
Schematics check list:
A pull-down resistor is required.

P/N: FJPJP

88,89 MEM_RST

** This basic topology should be used for DRAM_RST for DDR3/GDDR3/GDDR5.These Capacitors and Resistor values are an example only. The Series R and || Cap values will depend on the DRAM load and will have to be calculated for different Memory ,DRAM Load and board to pass Reset Signal Spec.

Designator	For SEYMOUR	For Robson
R_MEM_1	10R	10R
R_MEM_2	50R	50R
R_MEM_3	5K	5K
C_MEM	120pF	120pF

Place all these components very close to GPU (Within 25mm) and keep all component close to each Other (within 5mm) except R_MEM_2

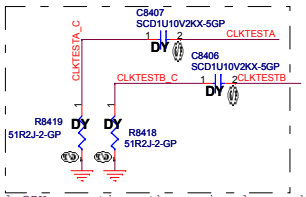

For normal GPU operation, these signals can be left floating (do not populate the capacitors and resistors).

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU Memory(2/5)

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 84 of 105

SSID = VIDEO

MEMORY ID Table

DVPDATA[3:0]	Description
0000	DDR3 SAMSUNG-K4W1G1646G-BC11(900MHz)64M*16
0001	DDR3 Hynix-H5TQ1G63DFR-11C (900MHz) 64M*16
0010	DDR3 SAMSUNG K4W2G1646C-HC11 (900MHz) 128M*16
0011	DDR3 Hynix-H5TQ2G63BFR-11C (900MHz) 128M*16

DVPDATA[0:3] Default:Pull down

For Seymour,
DPC_PVDD is DPC_VDD18 2010/06/11
DPC_PVSS and all DPC_VSSR are DP_VSSR

2010/07/15 Modify:
Q8501 change to dual 2n7002.
Add R8512,R8521,C8529 for Q8501 pin2 turn on timming control.

X01: dummy VGA thermal circuit based on DN15

11/18 Del C8529 to follow DN13

GPIO_6,GPIO_15_PWRCNTL_0,GPIO_16_SSIN,GPIO_20_PWRCNTL_1:
Voltage control signals for the core (VDDC and VDDCI).
At Reset, these signals will be inputs with weak internal pull-down resistors.
VBIOS can define all voltage control signals to be either 3.3-V or open drain outputs (all signals must be the same type). The output state (high/low) of these signals is programmable for each PowerPlay state.

12/17 dummy R8523 for panel interface unused.

2010/07/07
Change to RSVD based on DS v3.05

PLACE VREFG DIVIDER AND CAP CLOSE TO ASIC

11/18 Del 27M CLK circuit from PCH

2010/07/06
Schematics check list:
A 1~M ohm resistor must be connected between XTALIN and XTALOUT when a crystal is used.

0923 Modify for DV14 Config

MEM_ID Control

2010/06/11

2010/07/07 Remove TP8517,TP8518,TP8506,TP8519,TP8512

Vendor suggest to reserve test point 09/06

2010/07/07 Remove TP8517,TP8518,TP8506,TP8519,TP8512

12/20 NC R-,G-,B- on SSI and try to co-layout with Rosbson in PT stage

12/20 Add R8504 for Robson.

12/9 chnage R8501 to ROB

0820

0723 Add SMBUS

AUXP PD 100K
AUXN PD 100K
Draw on EDP circuit page

12/16 change R8507, R8505 and R8513 to ROB

Change to DY 9/20

Clock Input Configuraiton -GDDR3/DDR3
a) 27MHz crystal connected to XTALIN or XTALOUT or
b) 27MHz (1.8V) oscillator connected to XTALIN or
c) 27MHz (3.3V) oscillator connected to XO_IN (Park, Madison, and Broadway only)

11/2 Stuff X8501, R8502
C8524, C8525

11/29 change X8501 to 82.30034.641

LVDS Interface

P/N: FJPJP

P/N: FJPJP

Modified 9/1

Seymour-S3-XT

Seymour-S3-XT

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU_DP/LVDS/CRT/GPIO(3/5)
Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00
Date: Wednesday, April 13, 2011 | Sheet 85 of 105

SSID = VIDEO

12/28 Yellow mark for OPI change

POWER

VGA1

Seymour-S3-XT

P/N: FJPJP

12/6 remove tp8604, 8605

12/2 change property to EMI for BOM control

12/28 Yellow mark for OPI change

Close to VGA pin R21, U21

X01: add capacity for BIF_VDDC

2010/06/17_1

Rds(on) = 1ow
VGS=0.7~1.5V

AO4468 MAX 3.1A
Rds(on) = 101~155mOhm
VGS=+/-12V

2010/07/08

1D5V_VGA_PWOK

11/18 dummy 1D5V_VGA_PWOK circuit

11/2 change net name to 1D5V_VGA_PWOK

Change polarity , switch pin D and pin S. 9/6

X02-0302 Add R8605, R8609 PU 5V for lower Rdson

X01: modify to DGPU_PWROK

Non-BACO= HIGH
BACO = LOW

	PX_EN	8209A_EN/DEM_VGA	1D5V_VGA_PWOK_R	PX_EN#	PX_EN##
Non-BACO	0	1	1	0	1
BACO	1	0	0	1	0

PX_EN# = High, BIF_VDDC = 1V_VGA_S0
PX_EN## = High, BIF_VDDC = VGA_CORE

12/16 dummy U8605 and stuff R8601 to follow standard schematic.

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU_POWER(4/5)

Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 86 of 105

SSID = VIDEO

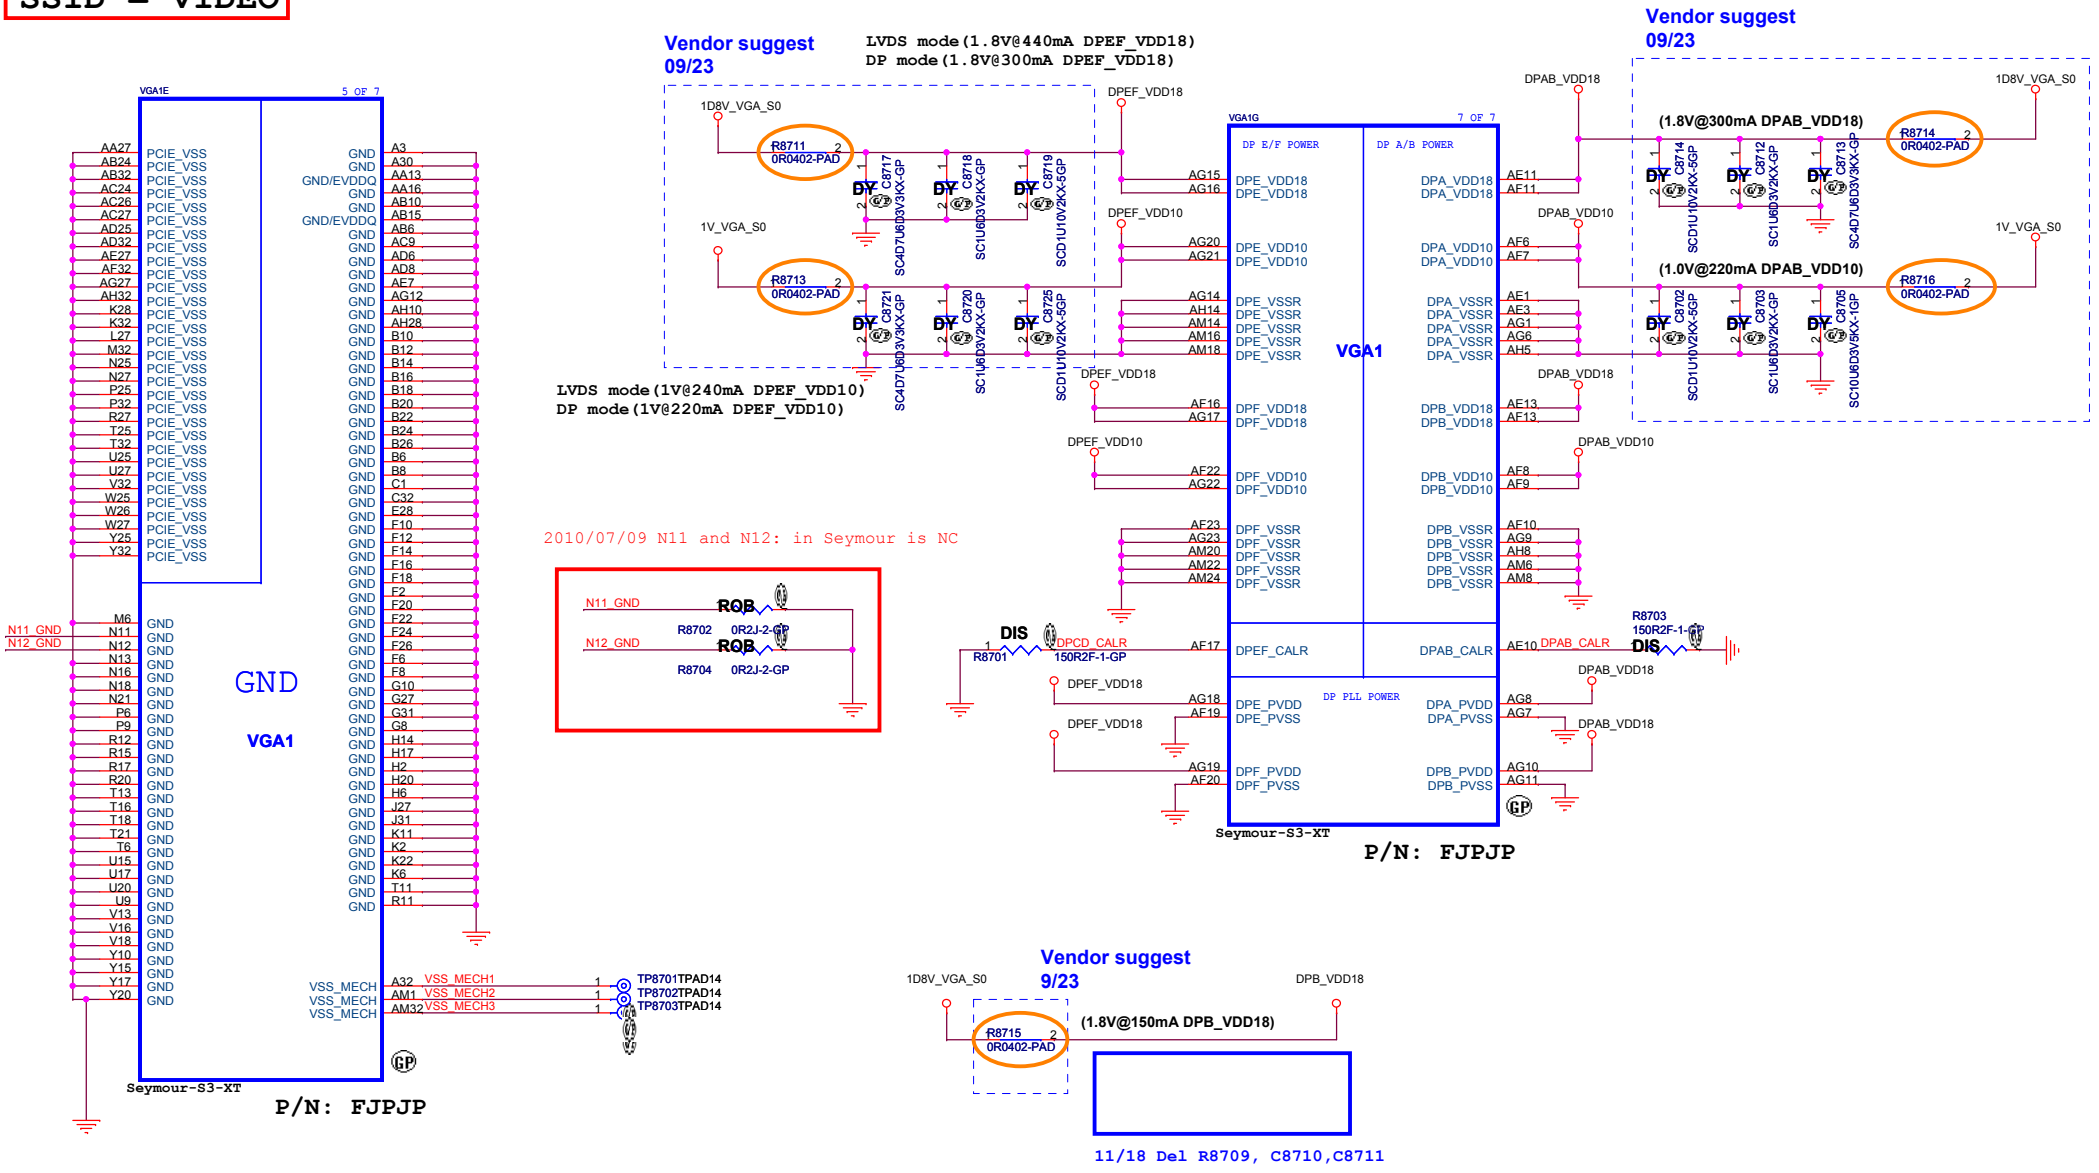

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU_DPPWR/GND(5/5)

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 87 of 105

SSID = VIDEO

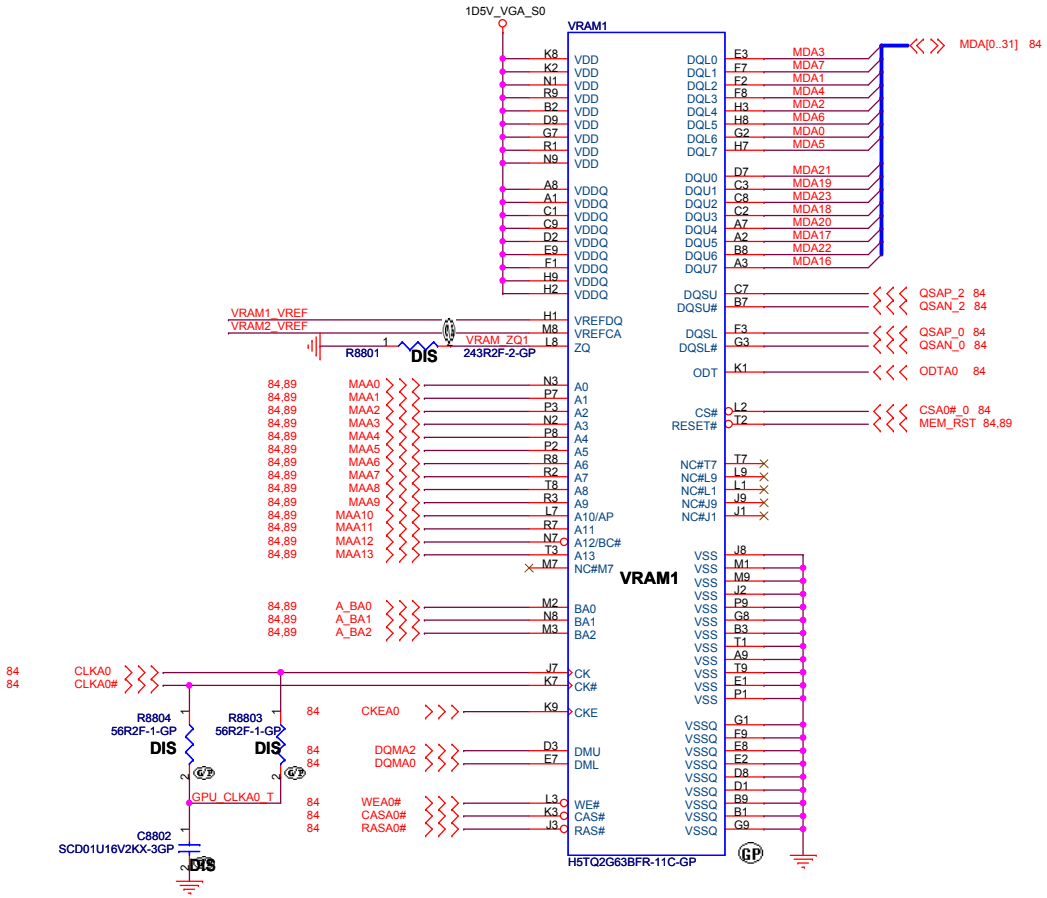

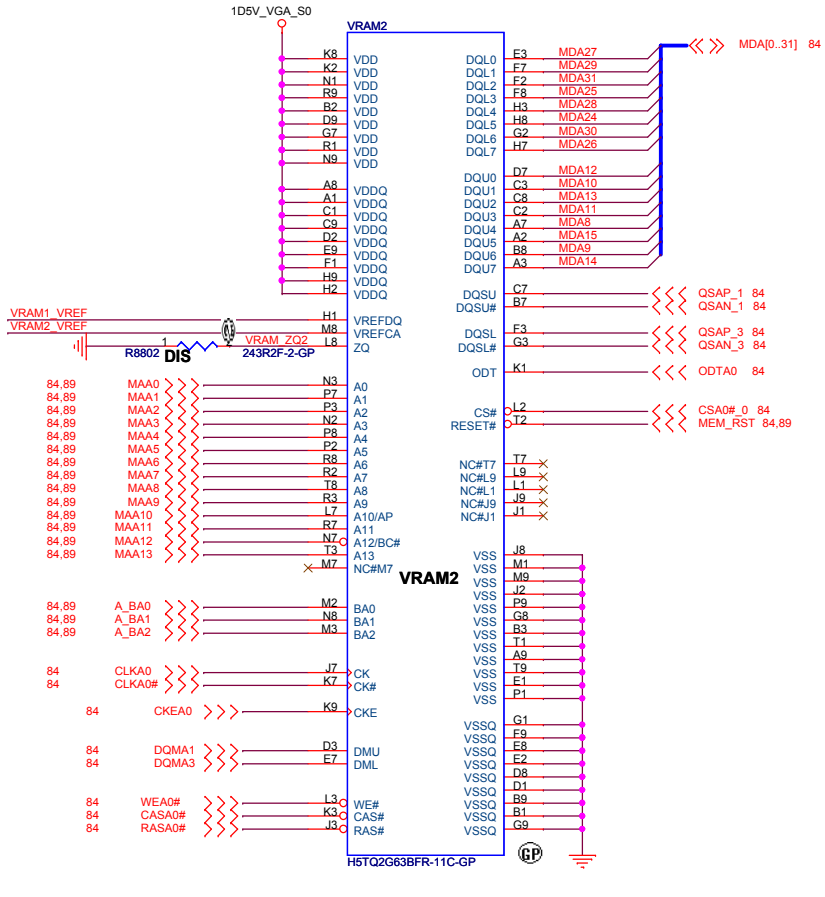

X01-0211 change VRAM symbol for layout (larger package)

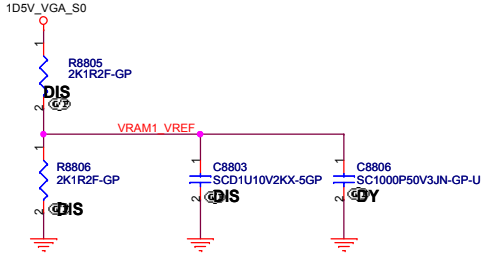

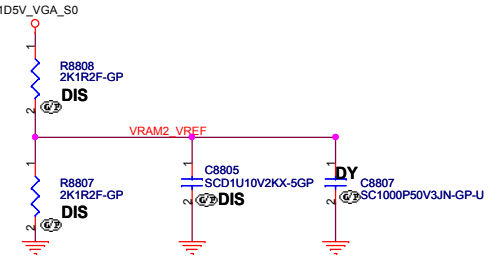

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU-VRAM1,2 (1/4)

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 88 of 105

SSID = VIDEO

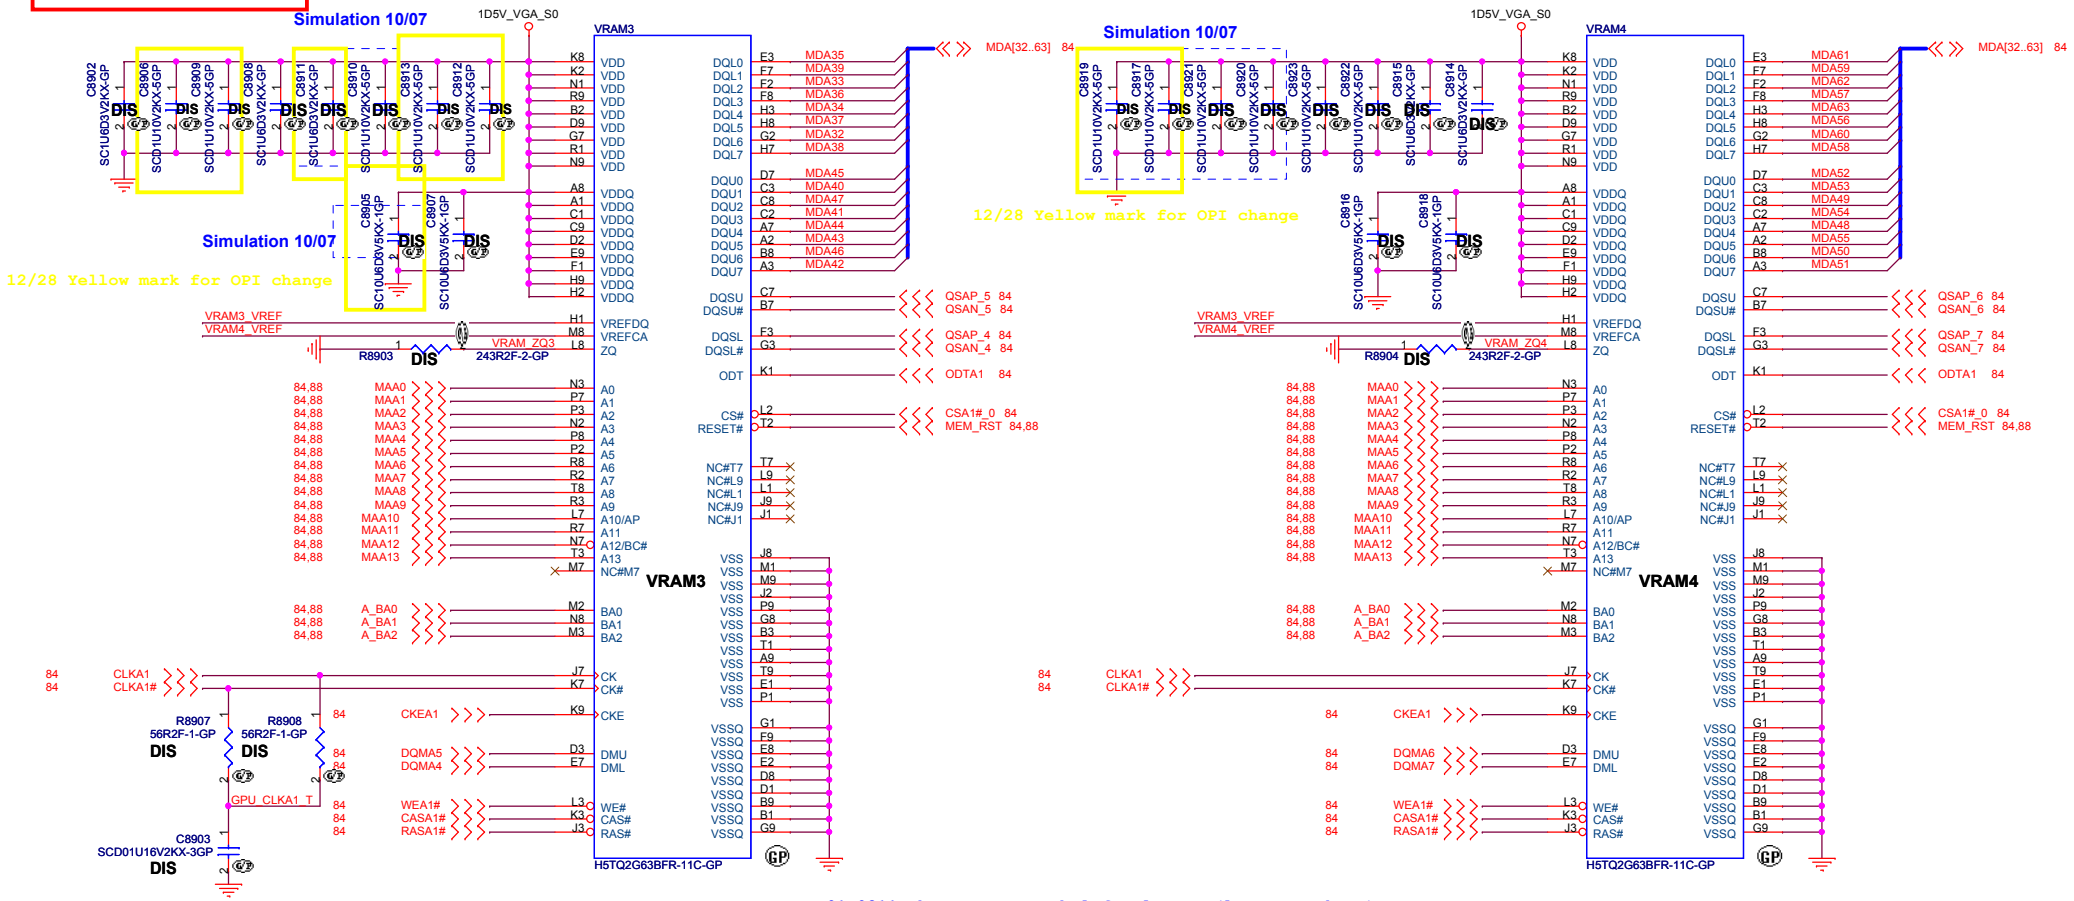

X01-0211 change VRAM symbol for layout (larger package)

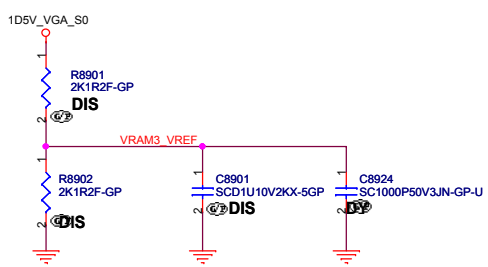

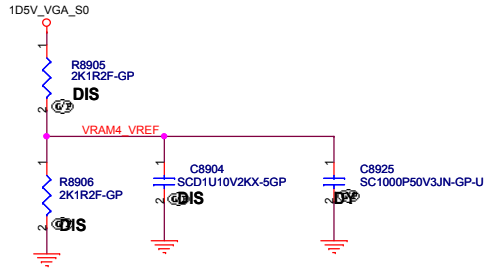

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: GPU-VRAM3,4 (2/4)

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 89 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *GPU-VRAM5,6 (3/4)*

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 90 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *GPU-VRAM7,8 (4/4)*

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 91 of 105

SSID = PWR.Plane.Regulator_VGACORE

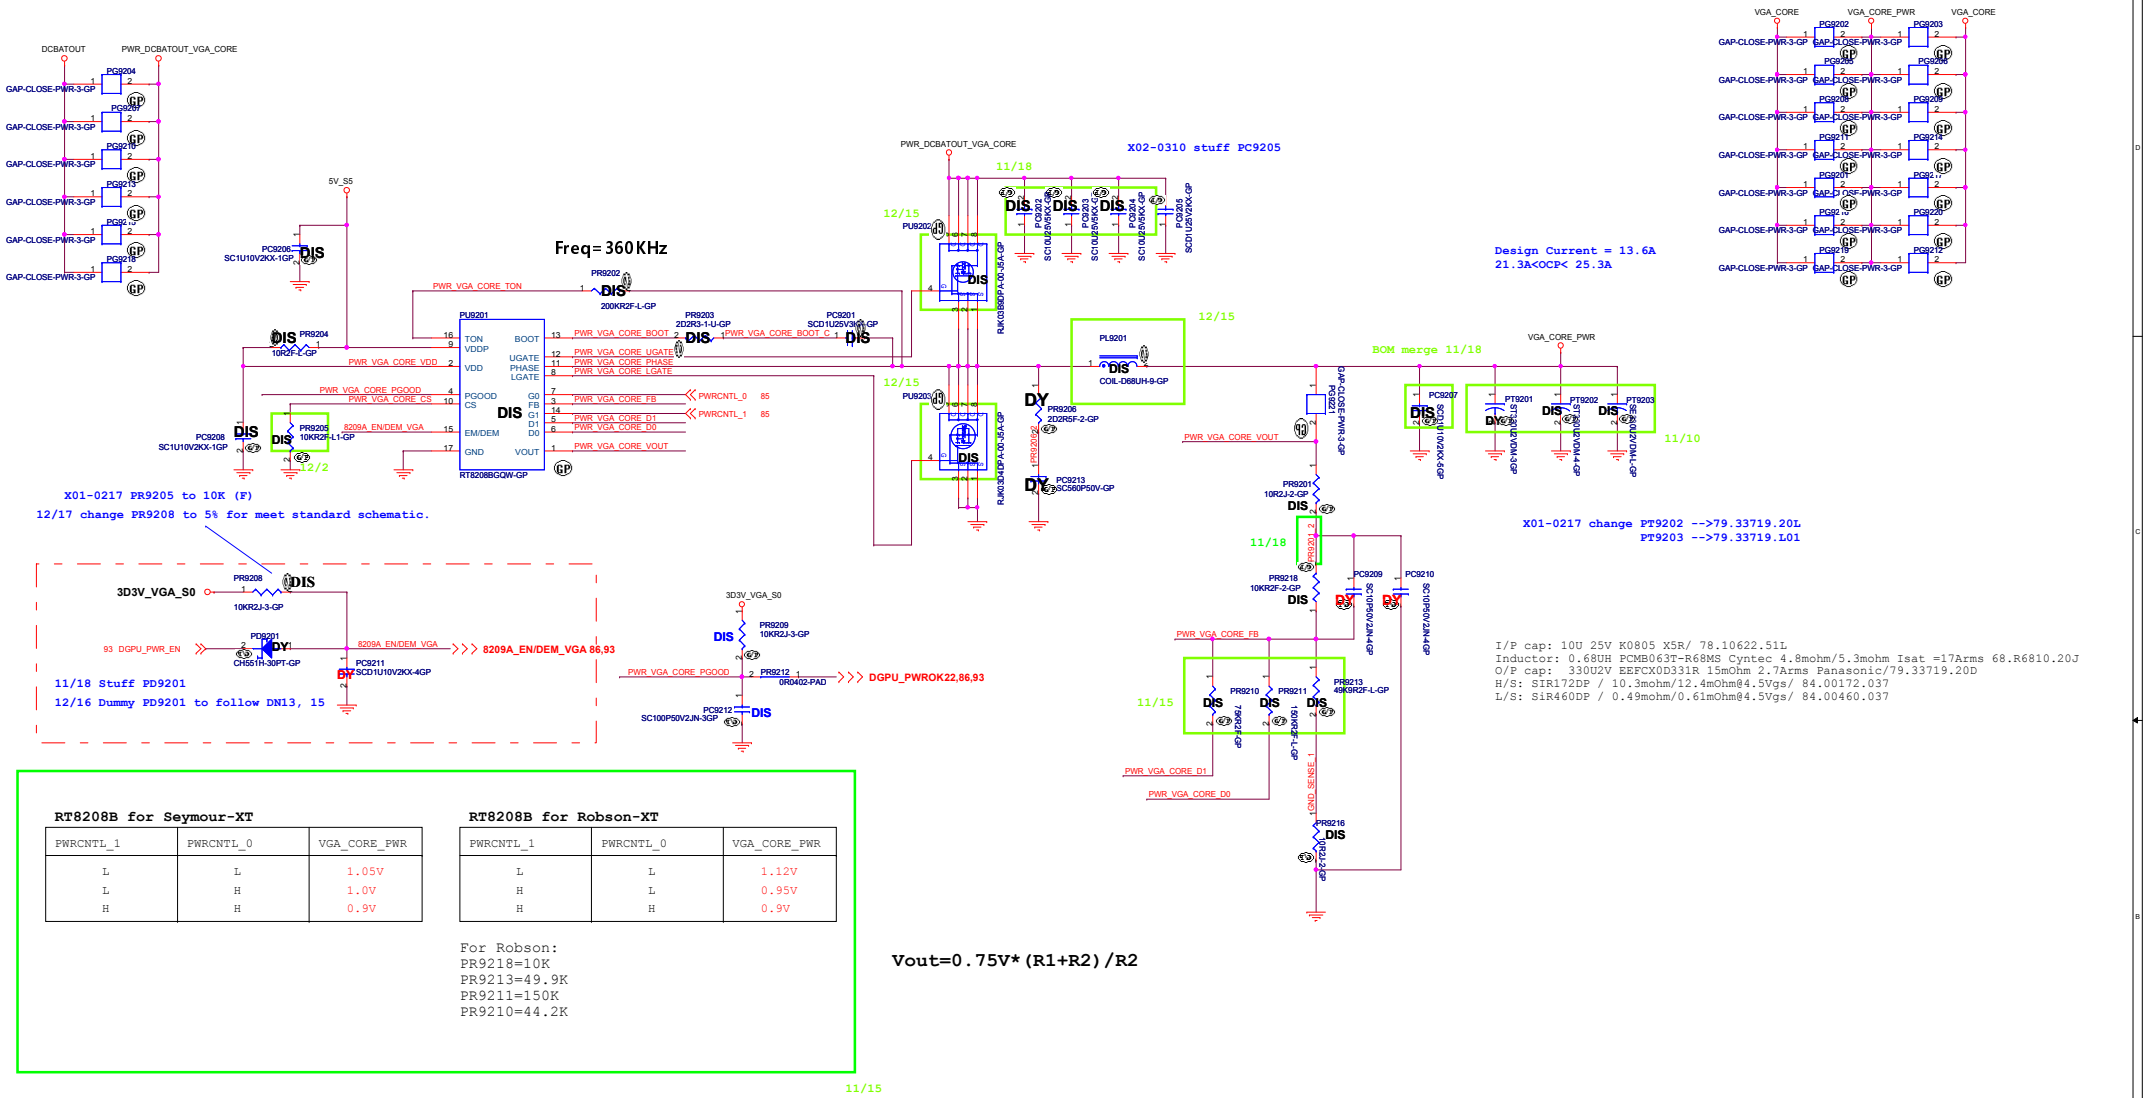

RT8208B for Seymour-XT

PWRCNTL_1	PWRCNTL_0	VGA_CORE_PWR
L	L	1.05V
L	H	1.0V
H	H	0.9V

RT8208B for Robson-XT

PWRCNTL_1	PWRCNTL_0	VGA_CORE_PWR
L	L	1.12V
H	L	0.95V
H	H	0.9V

For Robson:
PR9218=10K
PR9213=49.9K
PR9211=150K
PR9210=44.2K

11/15

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: RT8208B +VGA_CORE

Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 92 of 105

3D3V_S0 to 3D3V_VGA_S0 Transfer

Change DUMMY Reference Name to PX_BACO

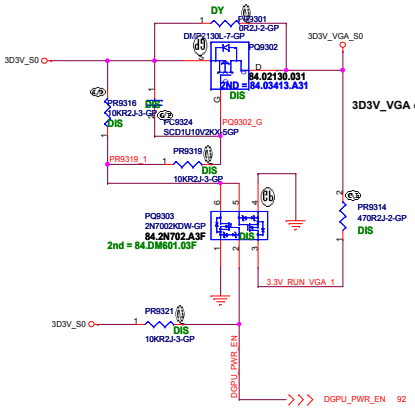

	DGPU_PWR_EN#
dGPU mode	L
IGPU	H
IGPU with BACO	L

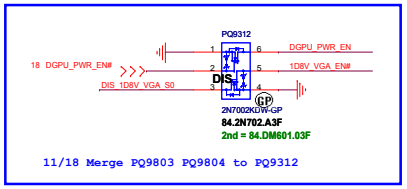

11/18 Merge PQ9803 PQ9804 to PQ9312

1D8V_VGA_S0

AO4468, SO-8
Id=??A, Qg=9~12nC
Rdson=17.4~22m ohm

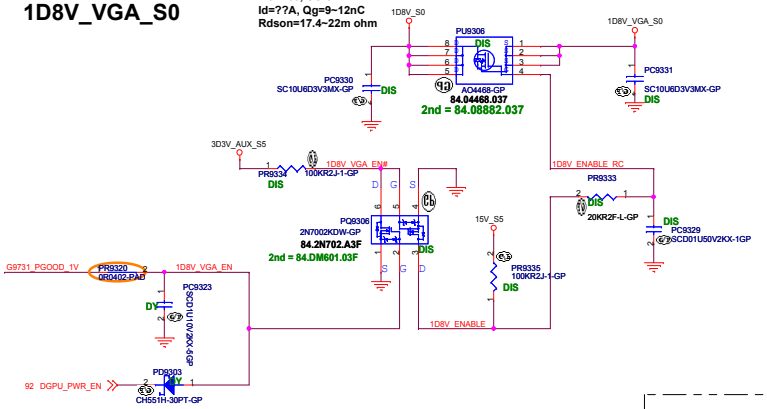

1D8V_VGA_S0_PG

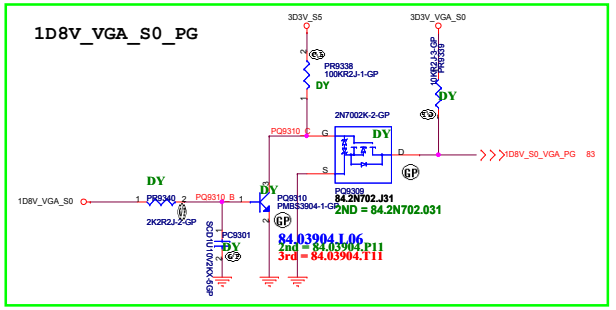

Discharge Circuit

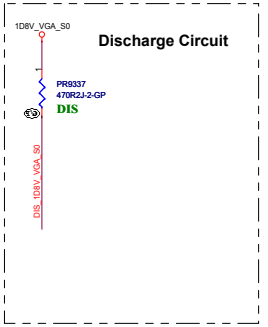

1D5V_VGA_S0

change low Rds(on) MOSFET

AO4468, SO-8
Id=?A, Qg=9~12nC
Rdson=17.4~22m ohm

1D5V_S3 to 1D5V_VGA_S0 trace need increase to avoid 1D5V_VGA_S0 DROP Voltage.

Park_Madison Does Not Support BACO, So follow Old Sequence
Seymour_Whistler_Robson Support BACO, So Change Sequence

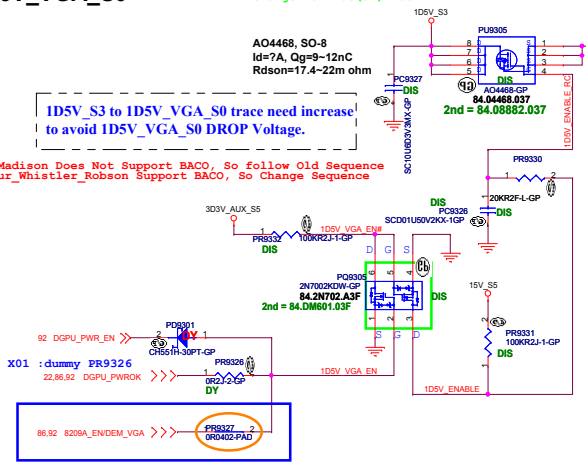

11/18 Add PR9327 for 8209A_EN/DEM_VGA turn on 1D5V_VGA_S0 power.

Discharge Circuit

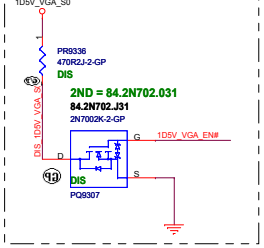

G9731 for 1V_VGA_S0

Park_Madison Does Not Support BACO, So follow Old Sequence
Seymour_Whistler_Robson Support BACO, So Change Sequence

3D3V_VGA_S0 should ramp-up before VGA_Core
VGA_Core should ramp-up before 1V_VGA_S0
1V_VGA_S0 should ramp up before 1D8V_VGA_S0

so 1V_VGA_S0 EN have to fine tune RC delay after VGA_Core

1V_VGA_S0
Design current = 2.445A

Vout=0.8V*(R1+R2)/R2= 1.0036V

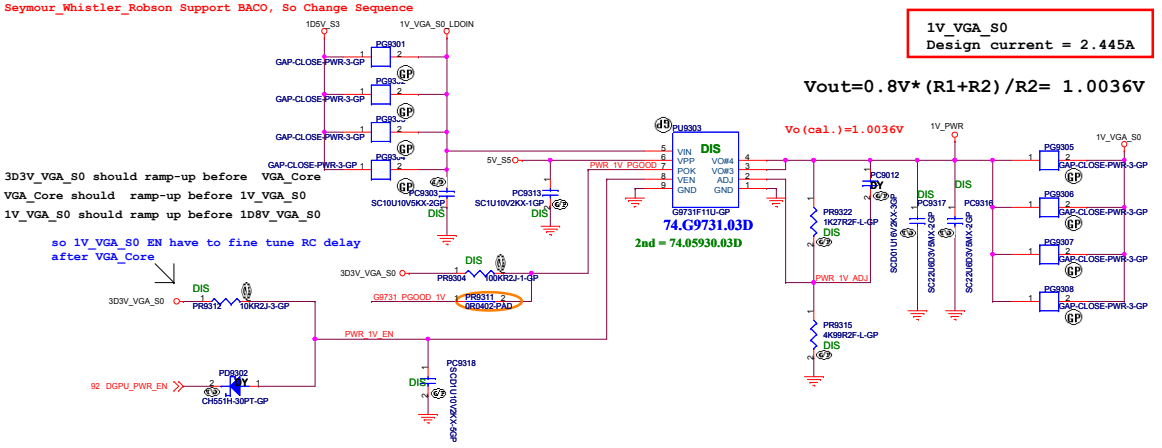

Discharge Circuit

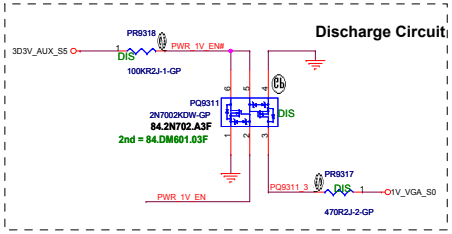

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title	DISCRETE VGA POWER	
Size: A2	Document Number: Enrico Caruso 14	Rev: A00
Date: Wednesday, April 13, 2011	Sheet 93 of 105	

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *LVDS_Switch*

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 94 of 105

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *CRT_Switch*

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 95 of 105

SSID = SDIO

(Blanking)

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: TOUCH PANEL

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 96 of 105

SSID = Mechanical

H1 HT85BE85R29-U-5-GP
H2 HOLE256R115-GP
H3 HT85BE85R29-U-5-GP
H4 HT85BE85R29-U-5-GP
H5 HT85BE85R29-U-5-GP
H6 HT85BE85R29-U-5-GP
H7 HT85B95X975R29-S-GP

X01-0208 stuff SPR1 and add SPR2

SPR1 SPRING-62-GP 34.39S07.003

A00-0406 dummy SPR2

SPR2 SPRING-58-GP 34.4B312.002

X02-0314 stuff SPR2

12/17 add SPR1 for EMI
12/21 change SPR1 to 34.4B312.002
12/22 change SPR1 to 34.39S07.003

X01-0211 change SPR2, SPR3 to 34.4B312.002
X01-0210 add SPR3

SPR3 SPRING-58-GP 34.4B312.002

SPR4 SPRING-13-GP-U 34.43E24.001
SPR5 SPRING-13-GP-U 34.43E24.001

X01-0211 add SPR4, SPR5

For CPU BRACKET

H8 HOLE197R166-1-GP
H9 HOLE197R166-1-GP
H10 HOLE197R166-1-GP

VGA Stand-Off

H11 STF237R117H83-1-GP DIS

PCH Stand-Off

H12 STF217R113H162-GP
H13 STF237R117H83-1-GP DY

A00-0412 dummy H12, H13 for remove PCH Heatsink
A00-0413 change H12 to 34.4HL17.001

12/2 Delete SPR1, SPR2

DCBATOUT

EC9701 SCD1U25V2KX-GP
EC9702 SCD1U25V2KX-GP
EC9703 SCD1U25V2KX-GP
EC9704 SCD1U25V2KX-GP
EC9705 SCD1U25V2KX-GP
EC9706 SCD1U25V2KX-GP
EC9707 SCD1U25V2KX-GP
EC9708 SCD1U25V2KX-GP
EC9709 SCD1U25V2KX-GP
DY EC9710 SCD1U25V2KX-GP
DY EC9711 SCD1U25V2KX-GP
DY EC9712 SCD1U25V2KX-GP
DY EC9713 SCD1U25V2KX-GP
EC9714 SCD1U25V2KX-GP
EC9715 SCD1U25V2KX-GP
EC9716 SCD1U25V2KX-GP
EC9717 SCD1U25V2KX-GP
EC9718 SCD1U25V2KX-GP
DY EC9719 SCD1U25V2KX-GP

5V_S5

X02-0314 stuff EC9722

DY EC9720 SCD1U25V2KX-GP
DY EC9721 SCD1U25V2KX-GP
DY EC9722 SCD1U25V2KX-GP
DY EC9723 SCD1U25V2KX-GP
DY EC9724 SCD1U25V2KX-GP
DY EC9725 SCD1U25V2KX-GP
DY EC9726 SCD1U25V2KX-GP

PWR_3D3V_DCBATOUT

EC9727 SCD1U25V2KX-GP

12/15 Stuff EC9727

3D3V_S5

DY EC9728 SCD1U25V2KX-GP

1D5V_S3

DY EC9729 SCD1U25V2KX-GP
DY EC9730 SCD1U25V2KX-GP
DY EC9731 SCD1U25V2KX-GP

VCC_GFXCORE

EC9732 SCD1U25V2KX-GP

VCC_CORE

EC9733 SCD1U25V2KX-GP
EC9734 SCD1U25V2KX-GP
EC9735 SCD1U25V2KX-GP
EC9736 SCD1U25V2KX-GP
EC9737 SCD1U25V2KX-GP

1D05V_VTT

EC9738 SCD1U25V2KX-GP
EC9739 SCD1U25V2KX-GP

5V_S5

EC9740 SCD1U25V2KX-GP

3D3V_S5

BT+

EC9741 SCD1U25V2KX-GP

12/17 Add EC9741

12/6 Add EMI capacities
12/20 change EMI caps to 0402 package

DY EC9742 SCD1U10V2KX-5GP
DY EC9743 SCD1U10V2KX-5GP
DY EC9744 SCD1U10V2KX-5GP
DY EC9745 SCD1U10V2KX-5GP
DY EC9746 SCD1U10V2KX-5GP

AUD_AGND

X01-0208 add EC9742~EC9746

<Core Design>

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: UNUSED PARTS/EMI Capacitors
Size: A3
Document Number: Enrico Caruso 14
Rev: A00
Date: Wednesday, April 13, 2011
Sheet 97 of 105

Huron River Platform Power Sequence

(AC mode)

red word: KBC GPIO

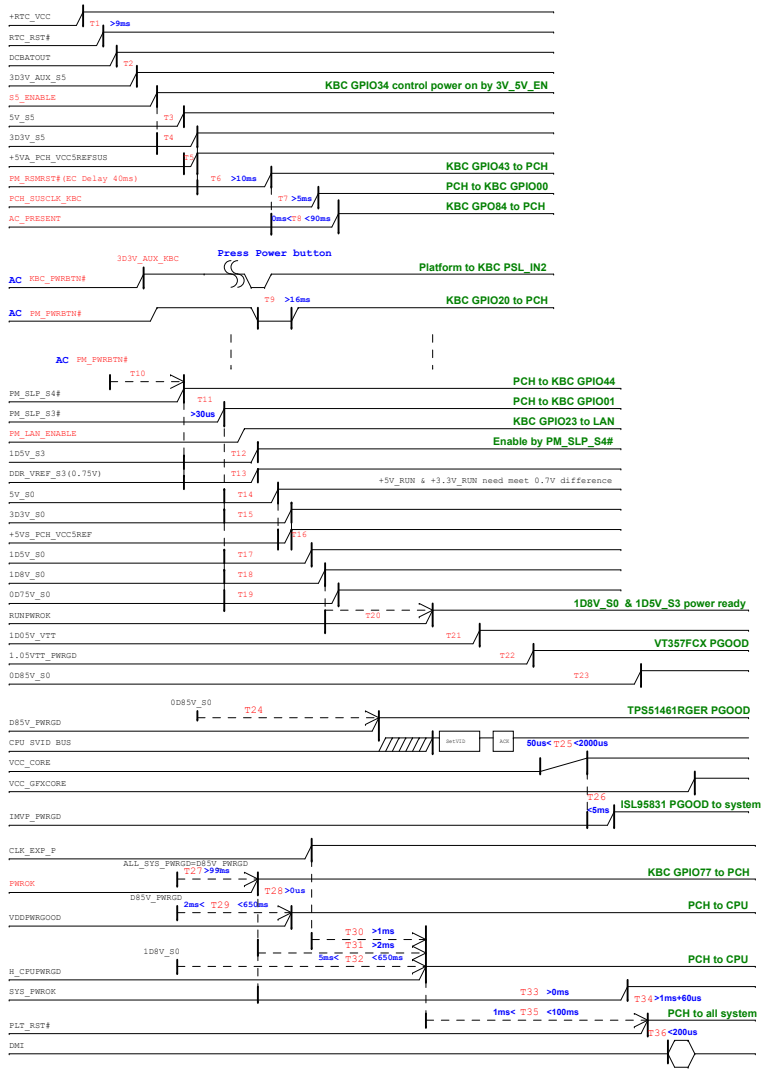

Within logic high level and disable if it is less than the logic low level.

VSREF_S0s must be powered up before Vccdmi0_1, or after Vccdmi0_3 within 0.7 V. Also, VSREF_S0s must power down after Vccdmi0_3, or before Vccdmi0_3 within 0.7 V.

Not floating.

Sense the power button status

This signal has an internal pull-up resistor and has an internal 16 ms de-bounce on the input.

VSREF_S0s must be powered up before Vccd_h, or after Vccd_h within 0.7 V. Also, VSREF_S0s must power down after Vccd_h, or before Vccd_h within 0.7 V.

This signal represents the Power Good for all the non-CORE and non-graphics power rails.

Robson XT Power-Up/Down Sequence

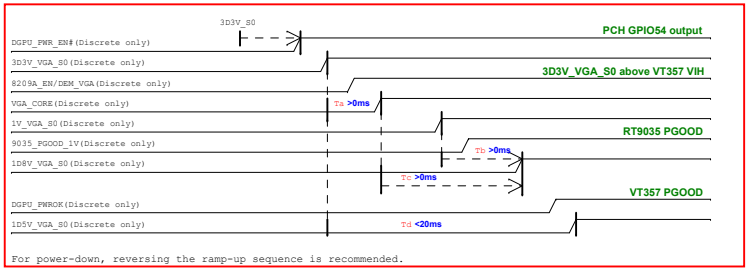

For power-down, reversing the ramp-up sequence is recommended.

(DC mode)

red word: KBC GPIO

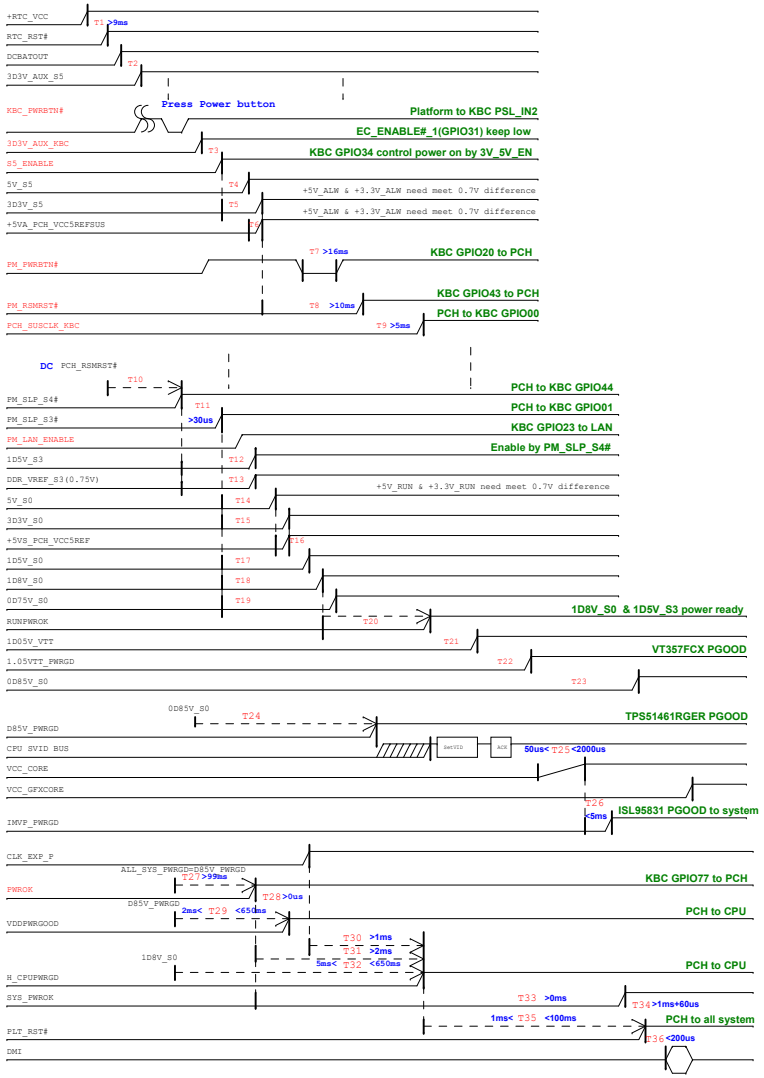

Sense the power button status

VSREF_S0s must be powered up before Vccd_h, or after Vccd_h within 0.7 V. Also, VSREF_S0s must power down after Vccd_h, or before Vccd_h within 0.7 V.

This signal represents the Power Good for all the non-CORE and non-graphics power rails.

<Core Design>

Wistron Corporation
21F, 88, Sec 1, Hsin Tai Wu Rd., Hsichih, Taipei Hsien 221, Taiwan, R.O.C.

Title: Power Sequence

Size	Document Number	Rev
A1	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 68 of 100

Wistron HURON RIVER POWER UP SEQUENCE DIAGRAM

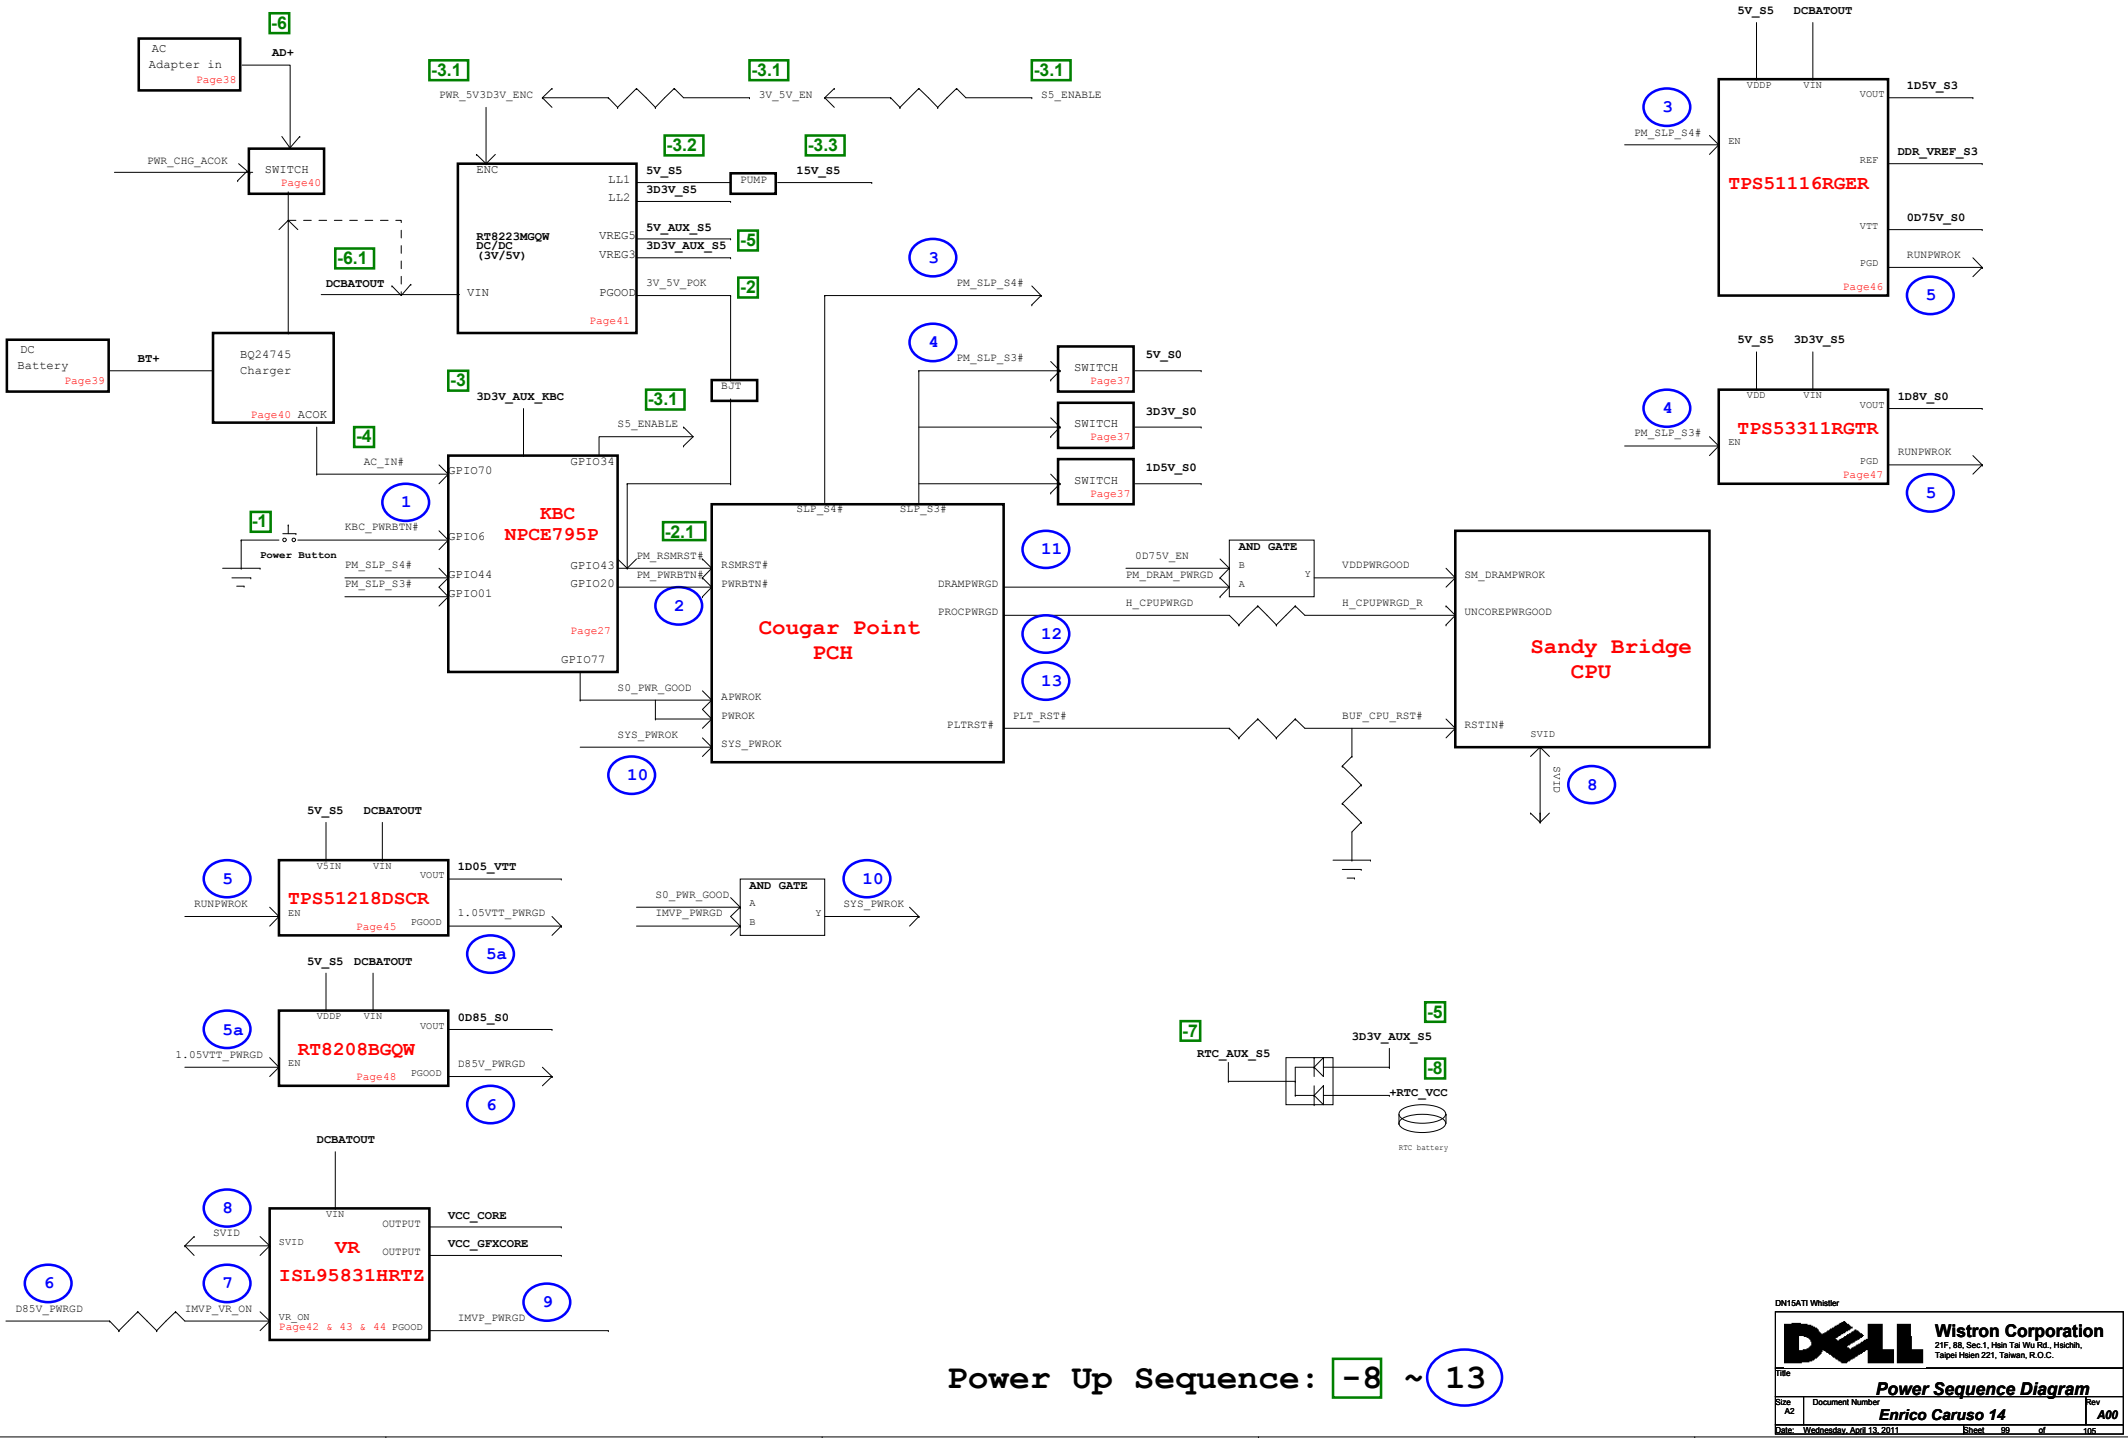

Power Up Sequence: -8 ~ 13

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Power Sequence Diagram

Size: A2 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 89 of 105

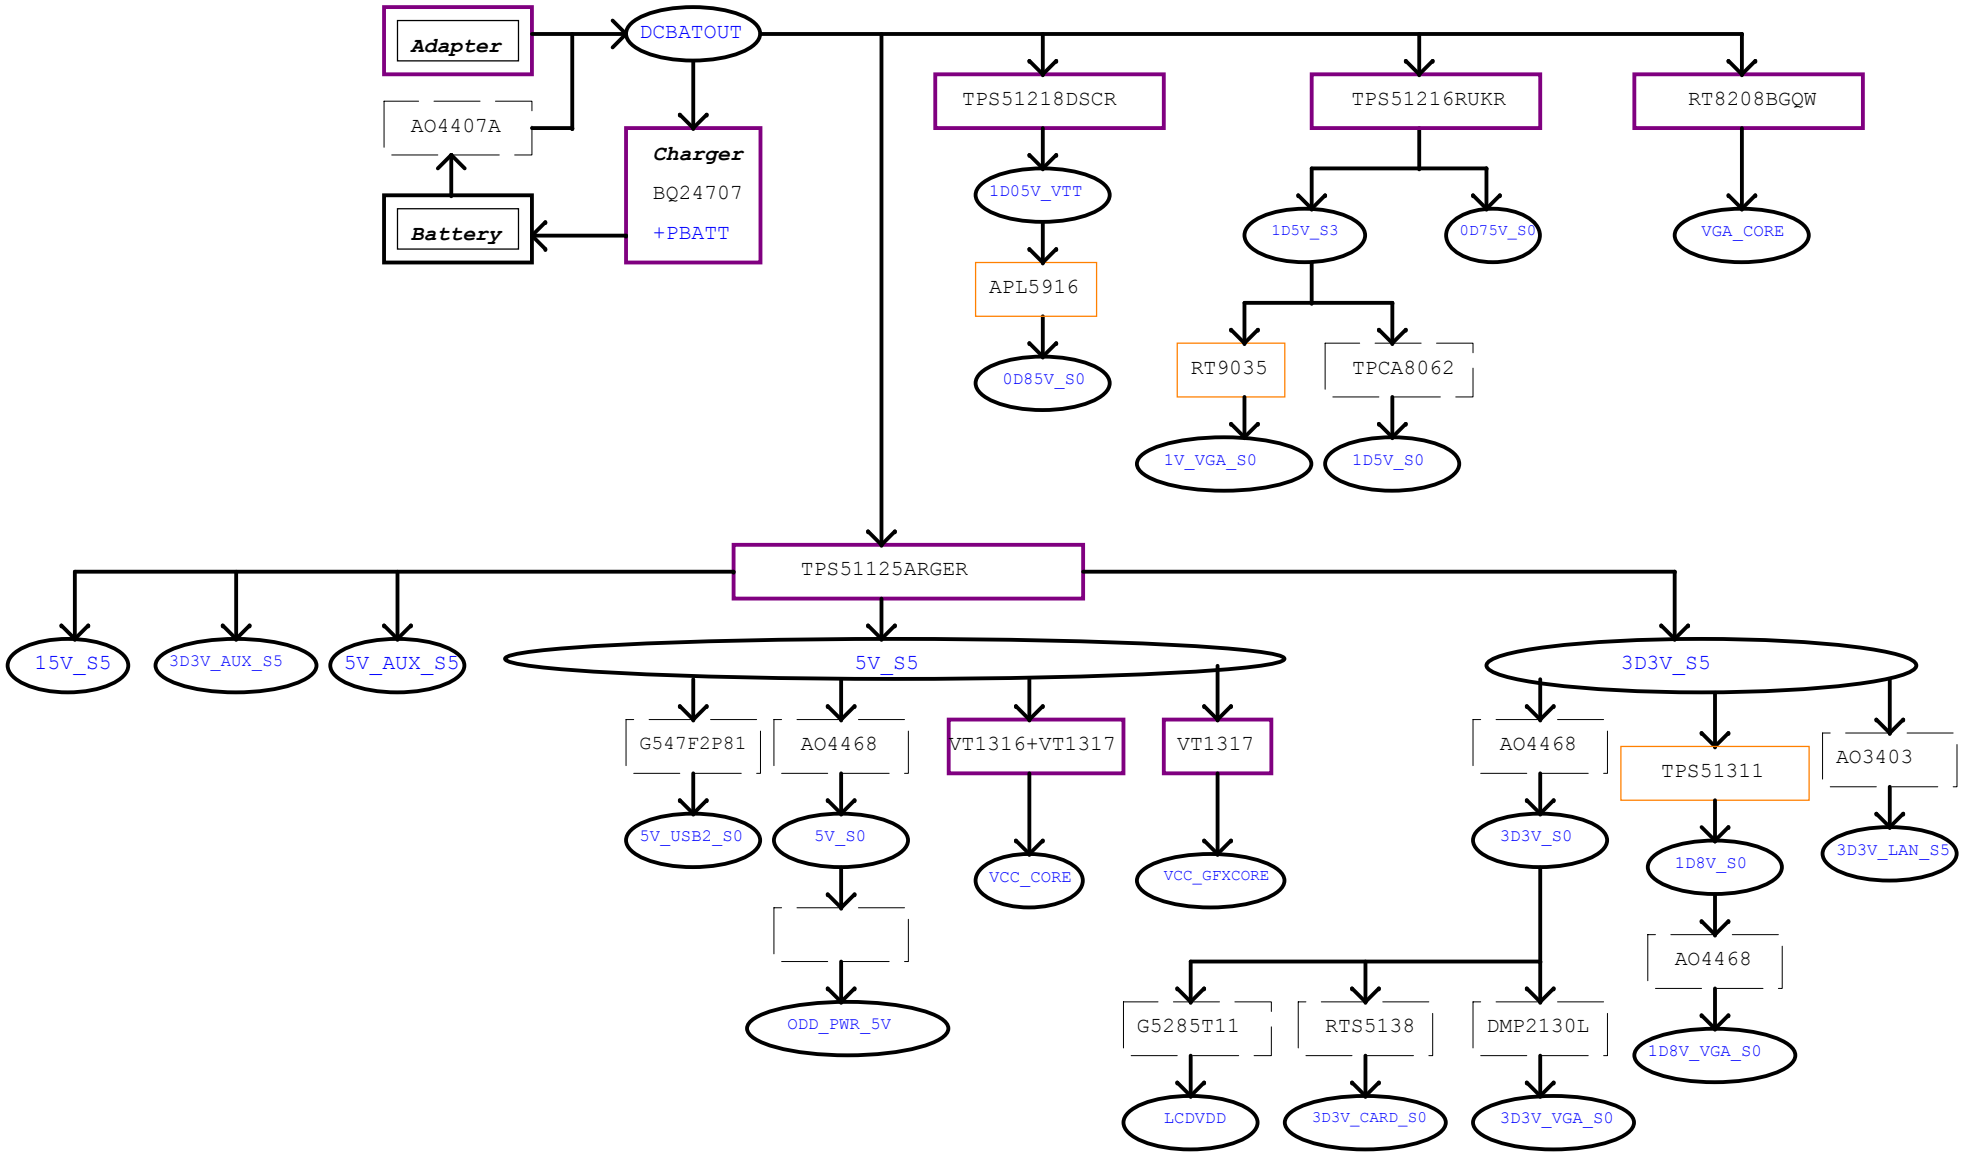

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Power Block Diagram

Size	Document Number	Rev
A3	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 100 of 105

PCH SMBus Block Diagram

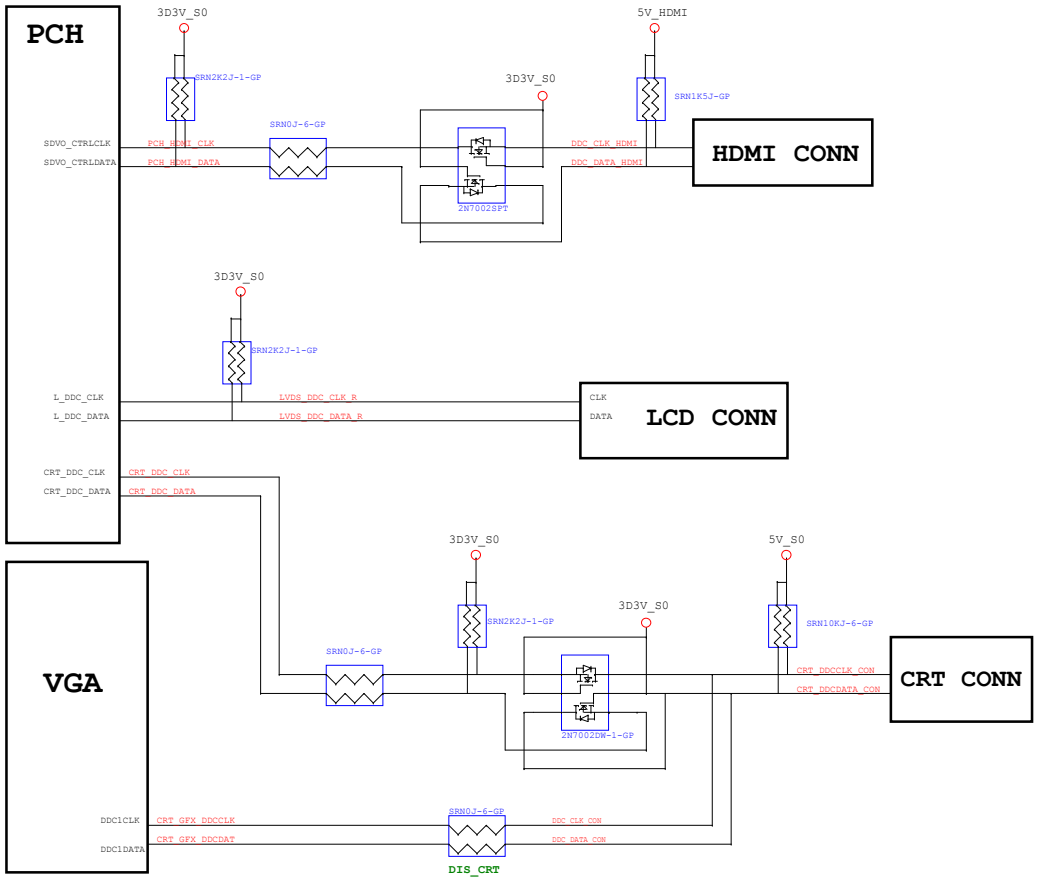

KBC SMBus Block Diagram

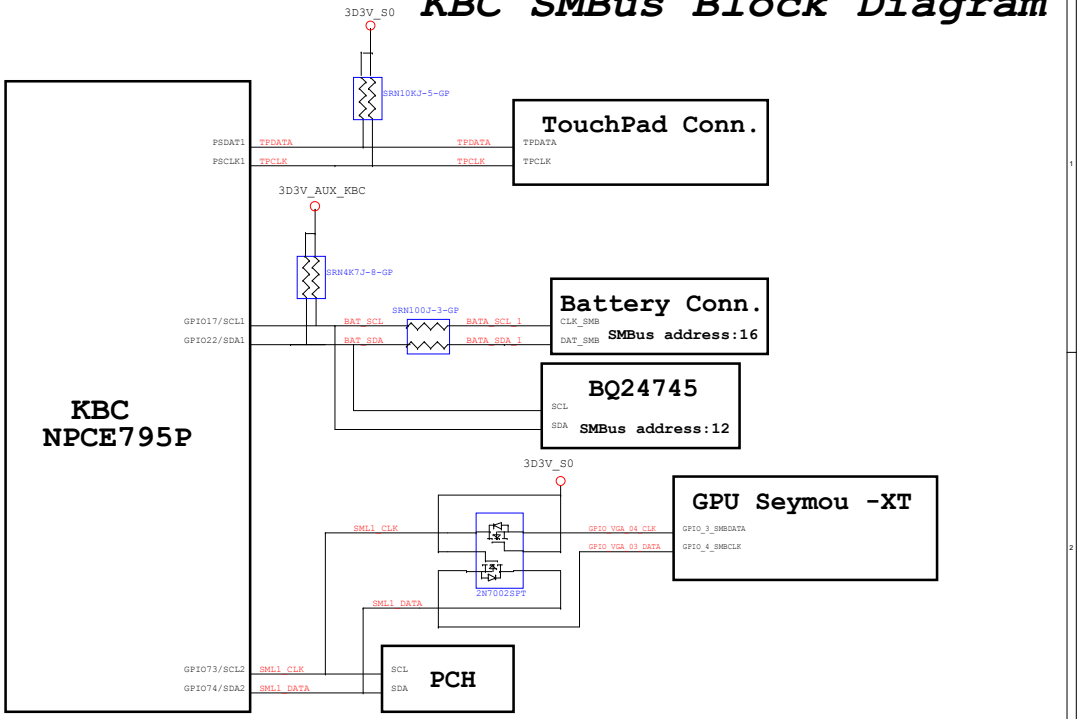

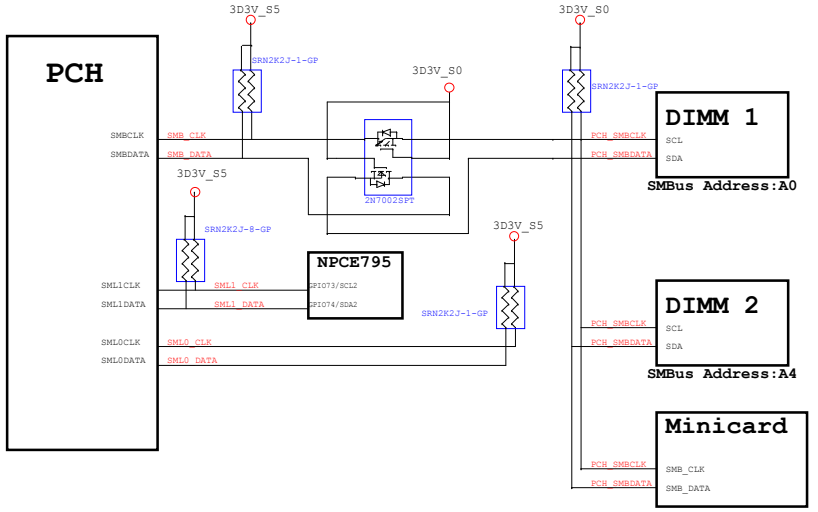

DIN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: SMBUS Block Diagram

Size	Document Number	Rev
A2	Enrico Caruso 14	A00

Date: Wednesday, April 13, 2011 Sheet 101 of 105

Thermal Block Diagram

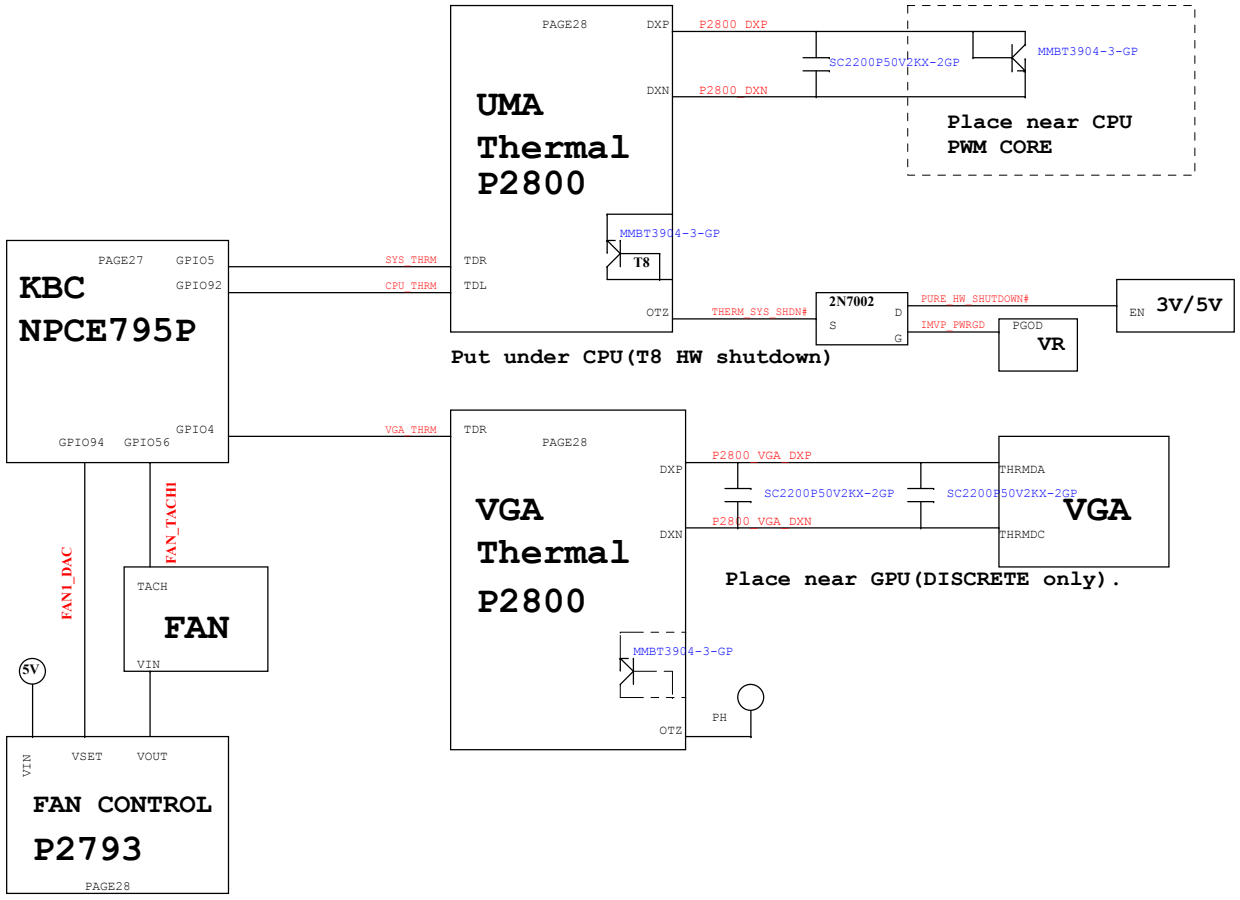

Audio Block Diagram

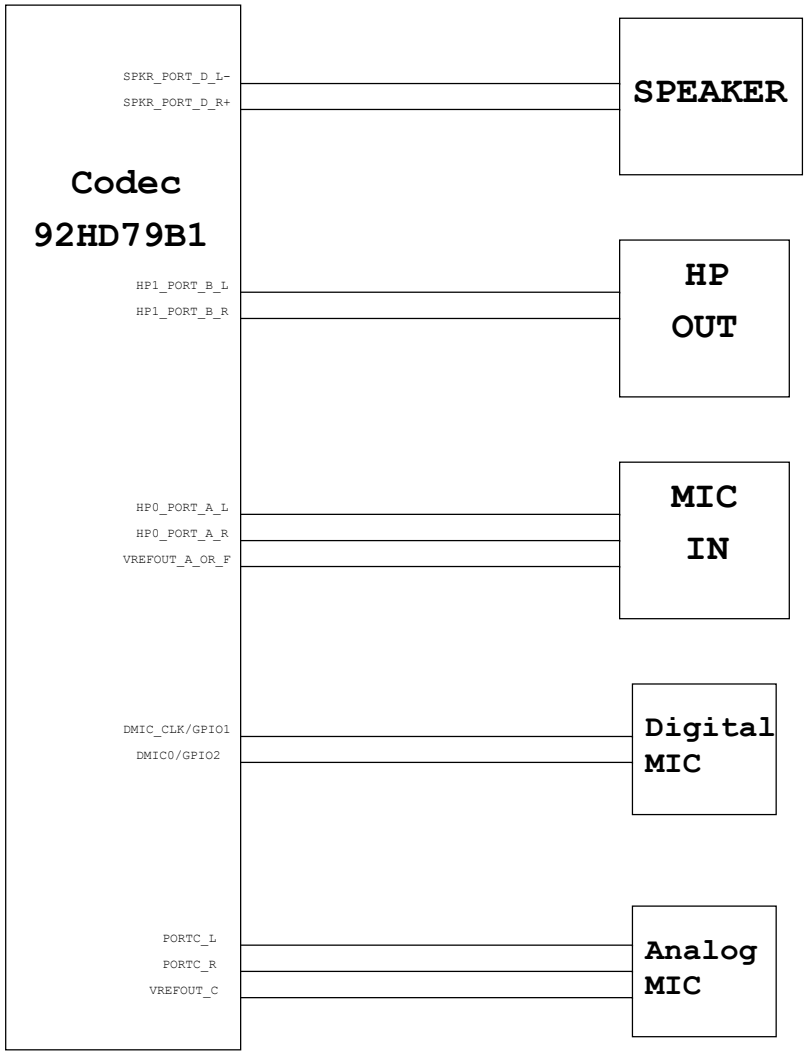

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Thermal/Audio Block Diagram

Size: Custom | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 102 of 105

DATA	PAGE	Change Description	Version
12/28	85	dummy VGA thermal circuit	X01
12/28	86	modify to DGPU_PWROK	X01
12/28	86	add capacity for BIF_VDDC	X01
12/28	93	dummy PR9326	X01
1/14	93	modify CS#, WP#	X01
1/27	5	Add C504 for noise couple.	X01
1/27	8	Stuff C812, C822, C831, C834 for VCC core noise issue.	X01
1/27	27	Del R2757 to follow standard 10mW circuit	X01
1/27	31	change Q3101 base power rail for leakage issue.	X01
1/27	40	X01-0127 DY PQ4007, PR4038, PR4039 for new version BQ24707	X01
2/8	21	Add RN2101, R2127 for LPC EA result	X01
2/8	27	Dummy R2769	X01
2/8	50	change R5002, R5003 to 33R	X01
2/8	69	TPAD1 to 20.K0464.004	X01
2/8	27	change R5002, R5003 to 33R	X01
2/8	97	add EC9742~EC9746	X01
2/8	97	stuff SPR1 and add SPR2	X01
2/9	28	dummy U2805 circuit	X01
2/9	46	PT4603 UMA-->220uF DIS-->470uF	X01
2/9	48	dummy PC4809 for BBU result.	X01
2/10	5	Merge R512 R514	X01
2/10	21	change RN2101 to RN2104 RN2105	X01
2/10	27	change R2724 to meet X01 PCB ver	X01
2/10	46	del PT4602	X01
2/10	46	change PC4610 from 0.22uF to 10uF	X01
2/10	97	add SPR3	X01
2/10	21	Merge R5115 R2116	X01
2/11	31	add C3122 for soft-sart	X01
2/11	59	Add EMI solution for Surge	X01
2/11	19,27	Change R1925, R1924, R1906, R1913, R2720, R2758, R2759, R2760 to short-pad	X01
2/14	82	add AFTP8201~8210	X01

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: *Change History*

Size: A3 | Document Number: *Enrico Caruso 14* | Rev: *A00*

Date: Wednesday, April 13, 2011 | Sheet 103 of 105

DATA	PAGE	Change Description	Version
0212	40	Change charger IC to new version	X01
0302	31	Dummy PCIE_CLK_LAN_REQ# circuit	X02
0302	86	Add R8605, R8609 PU 5V for lower Rdson	X02
0303	14,15,17,18 19,22,23,24 27,29,31,36 37,50,51,68	Change R1404, R1405,R1504, R1503,RN1704, R1807, R1903, R1910, R1912, R2214, R2304, R2305, R2306, R2307, R2404, R2405, R2406, R2409, R2702, R2735,R2762, R2756, R2911,R2914, R2917, R3104, R3115, R3117, R3614, R3710, RN5010, RN5117, R6811, R6813, R6804, R6805 0R to short pad	X02
0309	86	Change AFTP test point to follow DV14 AMD	X02
0310	41,45,92,97	Stuff PC4120, EC4501, PC9205, EC9708, EC9709, EC9714, EC9715, EC9716, EC9717, EC9718, EC9720, EC9724, EC9725, EC9740	X02
0311	28	Add R2816& R2817 to option VGA_THRM and DY the circuit	X02
0311	83	Change R8316, R8331 to short pad	X02
0311	59	Change GDT5901& GDT5902 to GD5901& GD5902	X02
0311	18	dummy R1804	X02
0311	31	add rest circuit to provent leakage.	X02
0311	32	Stuff TR3201 and change symbol to 68.00201.141	X02
0314	38	Del short pad PAD1 to prevent system burn.	X02
0314	97	Stuff SPR2	X02
0314	61,97	Stuff EC9722,C6106	X02
0314	36	Change U3606 footprint.	X02
0315	58	Change MIC2 to 20.F1889.002	X02
0315	88,89	Modify VRAM property PN and footprint	X02
0315	32,59	Modify part reference problem of ER5912& TR3201.	X02
0316	68	Modify WLED1 cirucit for brightness.	A00
0320	31	Change R3118 for LOM power sequence	A00
0320	49	Change TR4901 to 120ohm.	A00
0320	61	Change TR601 120ohm.	A00
0320	68	Change resistor for LED brightness	A00
0320	82	Change TR8201, TR8202 to 120ohm.	A00
0320	83	Dummy R8302 for disable de-emphasis	A00
0329	27	change R2735 to 10R and C2711 to 220p	A00
0329	68	Change R6814 to 10KR	A00
0406	97	Dummy SPR2	A00
0406	32, 49, 61, 65,82	Remove R3206, R3207, R4903, R4904, R6102, R6103, TR6501, R8201, R8202, R8203, R8204 PAD	A00

DN15ATI Whistler

Wistron Corporation
21F, 88, Sec.1, Hsin Tai Wu Rd., Hsichih,
Taipei Hsien 221, Taiwan, R.O.C.

Title: Change History

Size: A3 | Document Number: Enrico Caruso 14 | Rev: A00

Date: Wednesday, April 13, 2011 | Sheet 104 of 105

DATA	PAGE	Change Description	Version
0407	51	remove HDMI common mode choke PAD	A00
0408	49,61,82	Swap TR4901, TR6101, TR8201, TR8202 net for layout	A00
0408	49	Add RN4903 for ESD issue.	A00
0408	56	Add R5606 to pull high 3.3V_S0 and change R5605 pull high to 3.3V_S0	A00
0412	40	Change PR4027 to 19.6K Change PR4029 to 54.9K Change PR4013 to 49.9K	A00
0412	40	Dummy PR4037 and stuff PR4030, PR4032, PQ4005	A00
0412	97	dummy H12, H13 for remove PCH Heatsink	A00
0412	5,28,29,31 50,65,85 84,86,87	Change R504,R2807,R3105, R6505, R6506, R8601,R2902,R2903,R2904,R8440,R8517,R8711,R8713,R8714,R8715,R8716,RN2010,RN2012,RN2014,RN2016,,RN5007,RN5008 to short-PAD	A00
0412	21,29	Change ER2111,ER2930 to short-PAD	A00
0412	41,42,45 46,47,48 93	Change PR4121,PR4122,PR4125,PR4217,PR4218,PR4219,PR4220,PR4254,PR4502,PR4607,PR4801,PR4803,PR4711,PR9311,PR9320,PR9327,PR4712 to short-PAD	A00
0413	97	change H12 to 34.4HL17.001	A00
0413	27	change R2724 to 47K for PCB ver	
0413	68	change R6806, R6812, R6801, R6808 to 330ohm	
0413	41,,45,47 89,93	Change close-GAP to green cover-GAP	
0413	28	update P2800 thermal option.	
0413	20	SWAP RN2014 net for layout	

Title	<Title>	
Size A3	Document Number <Doc>	Rev A00
Date: Wednesday, April 13, 2011	Sheet 105 of 105	