





Ivy Bridge Processor (DDR3)




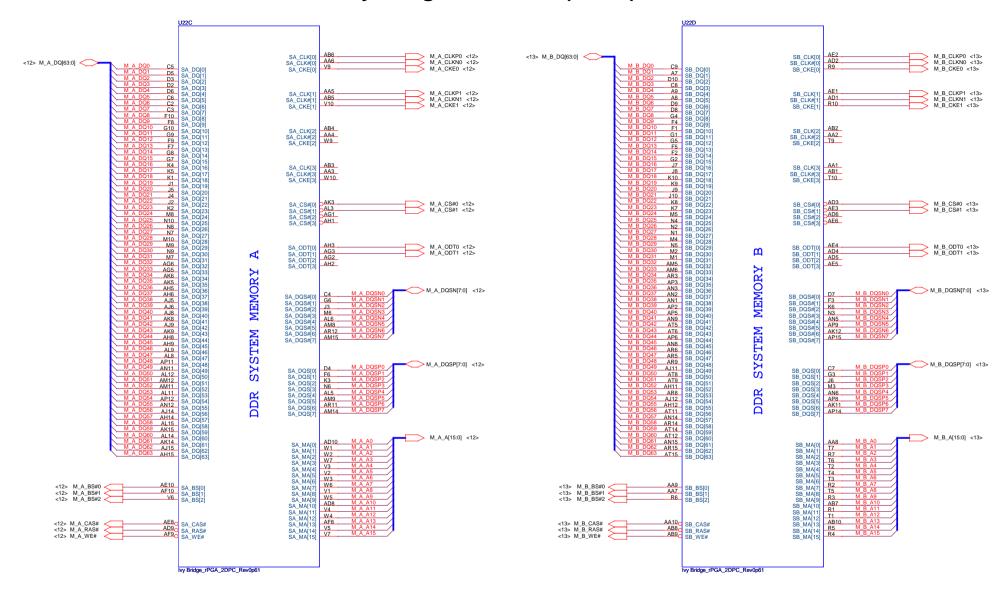


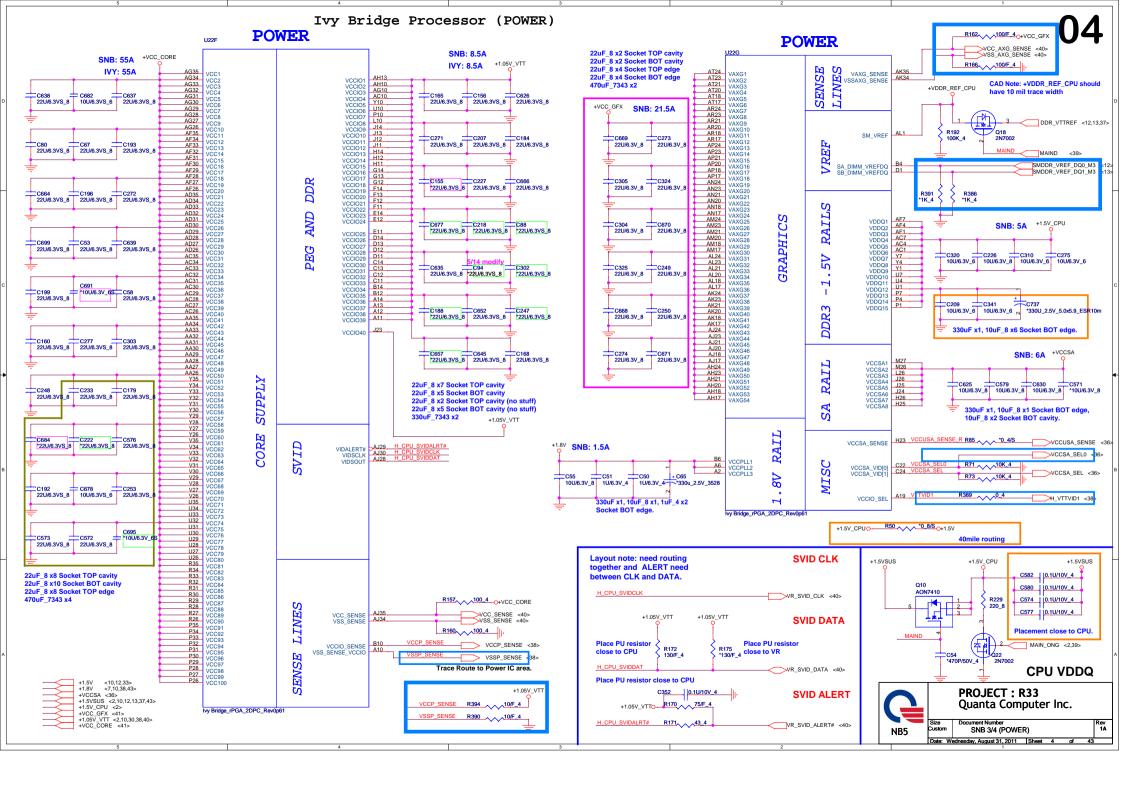


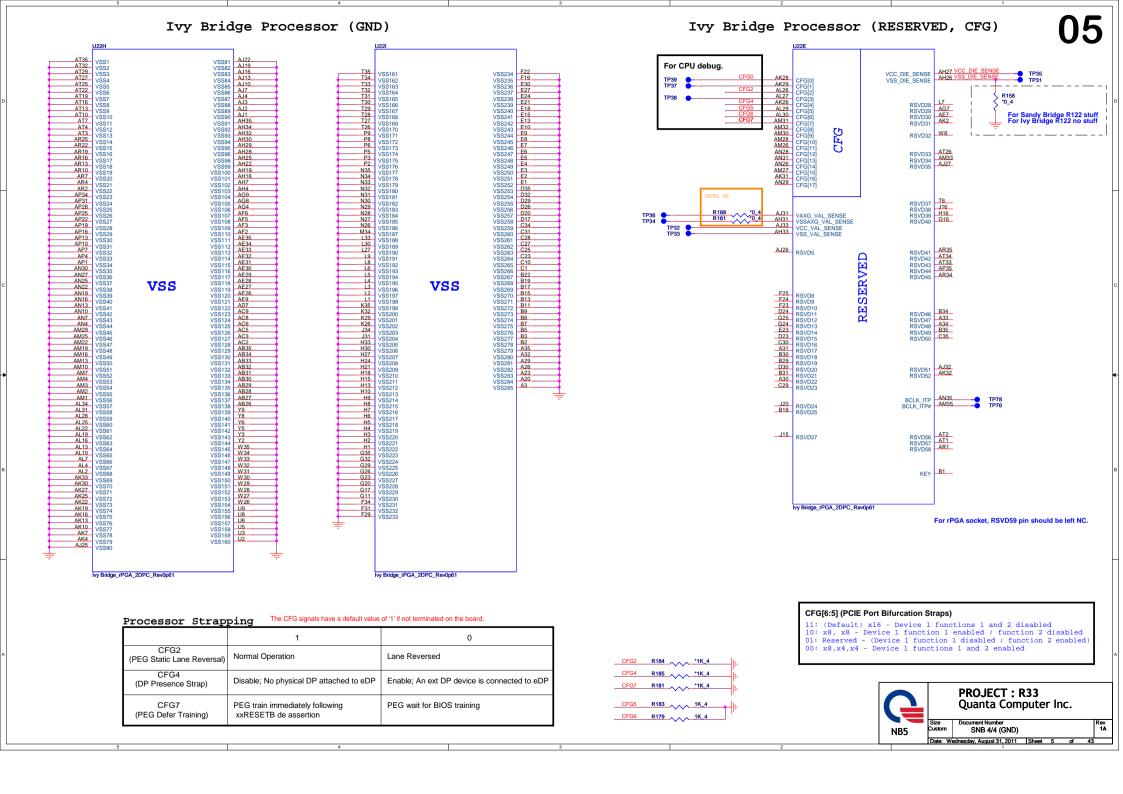


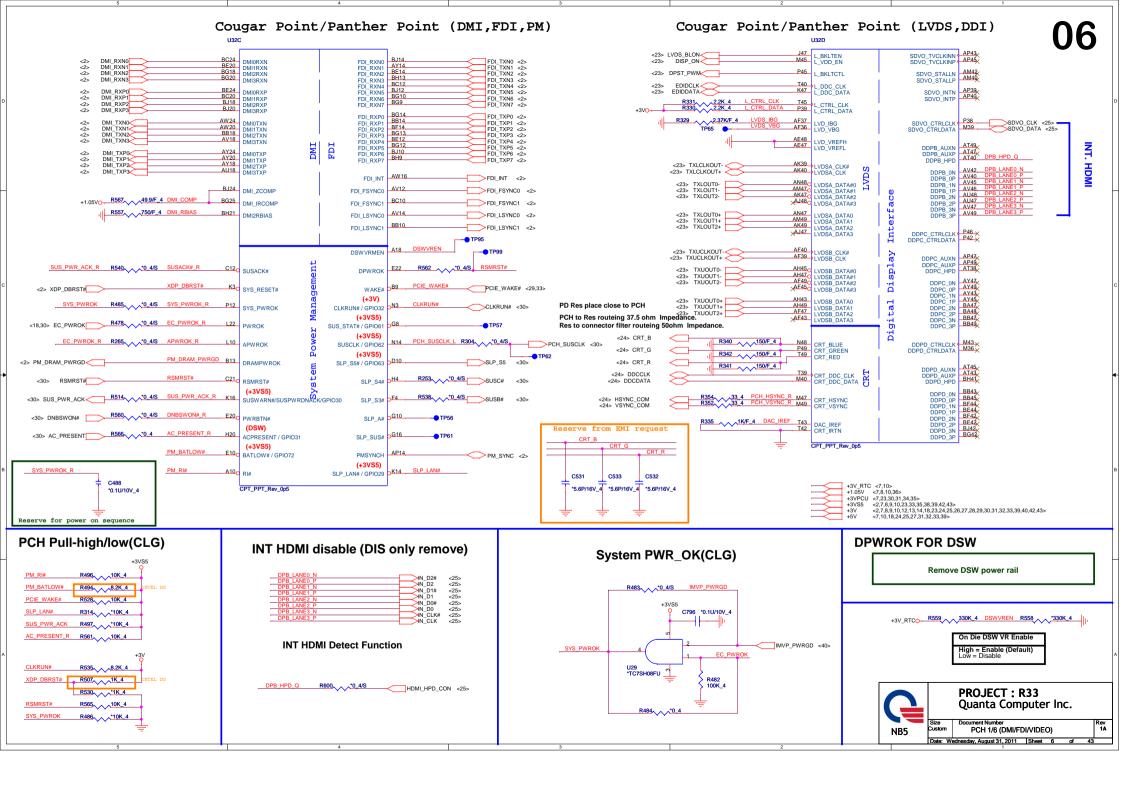


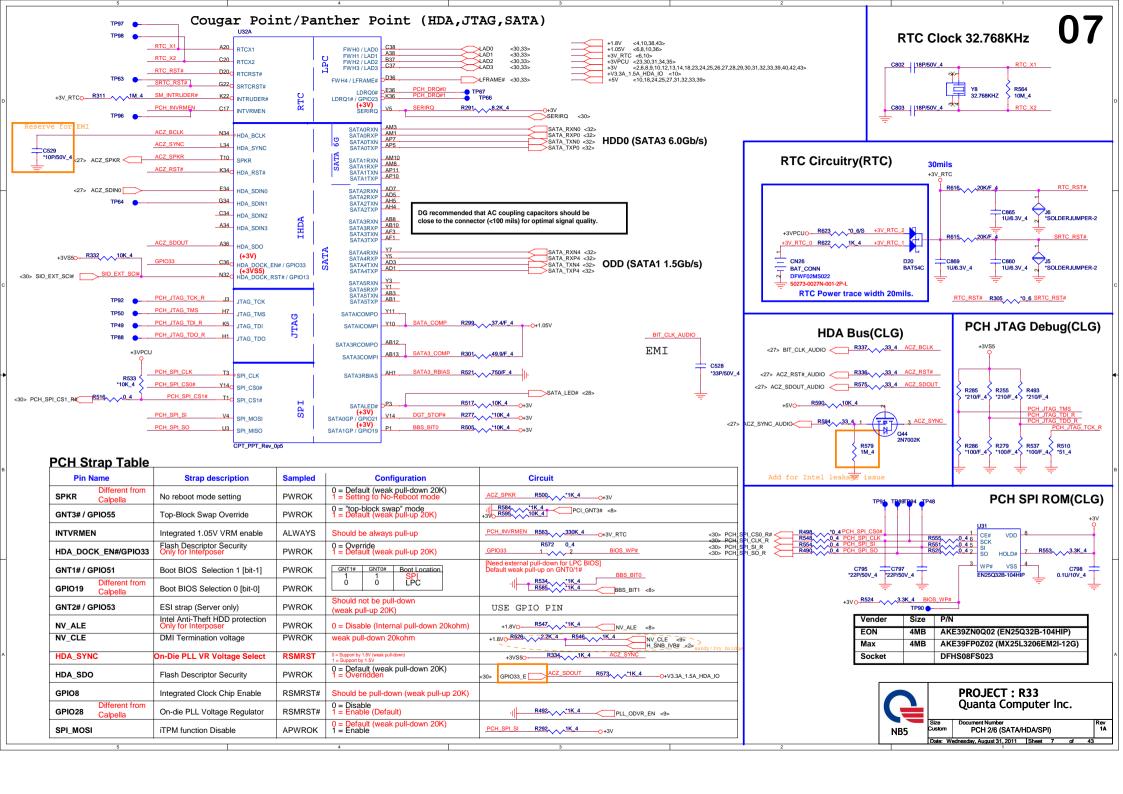


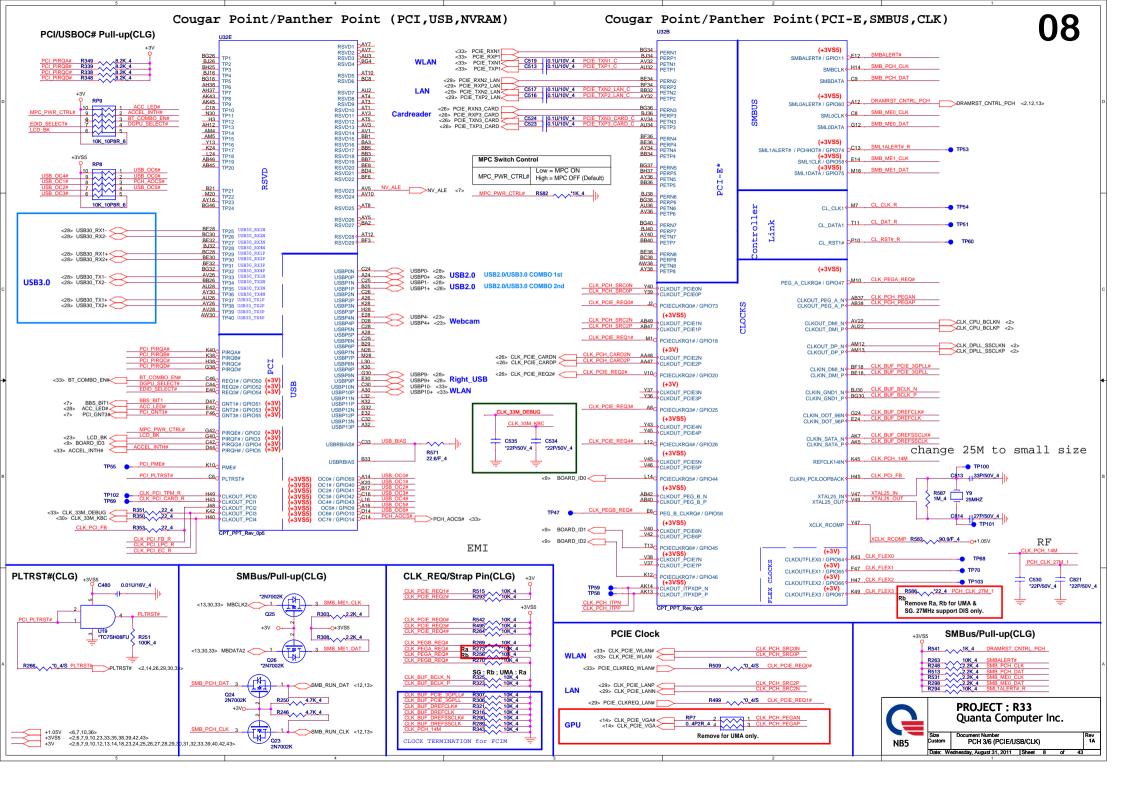


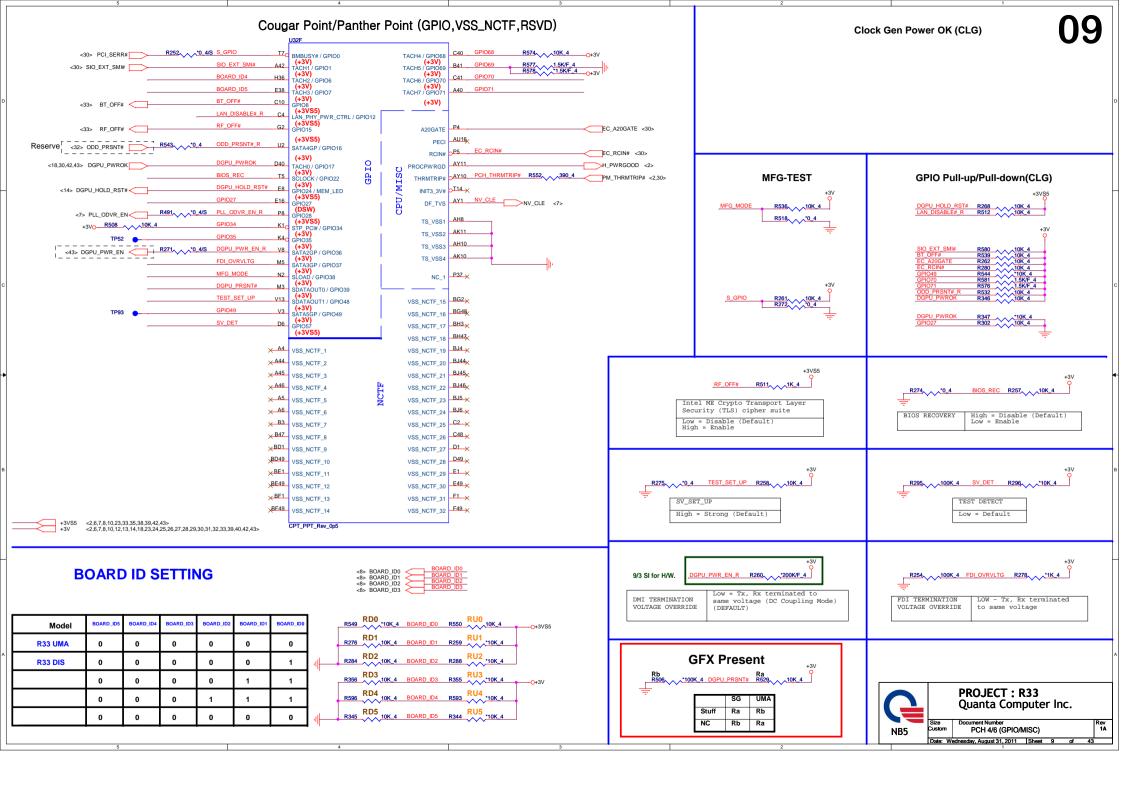


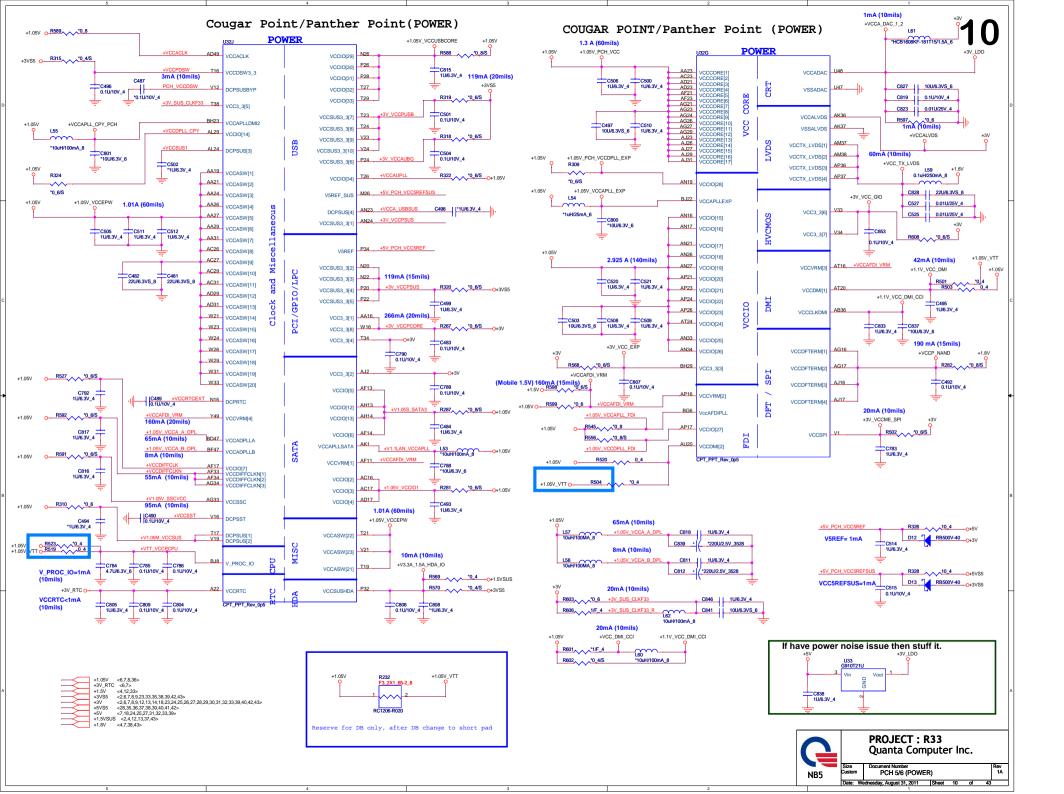


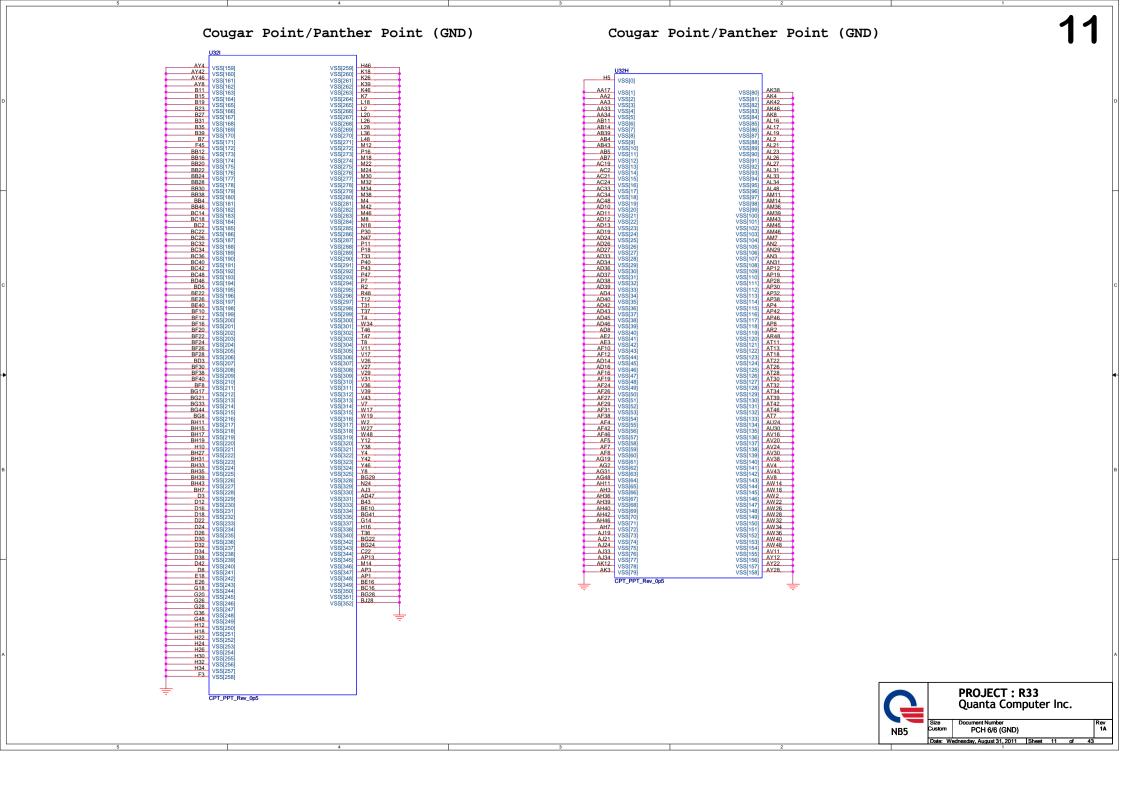


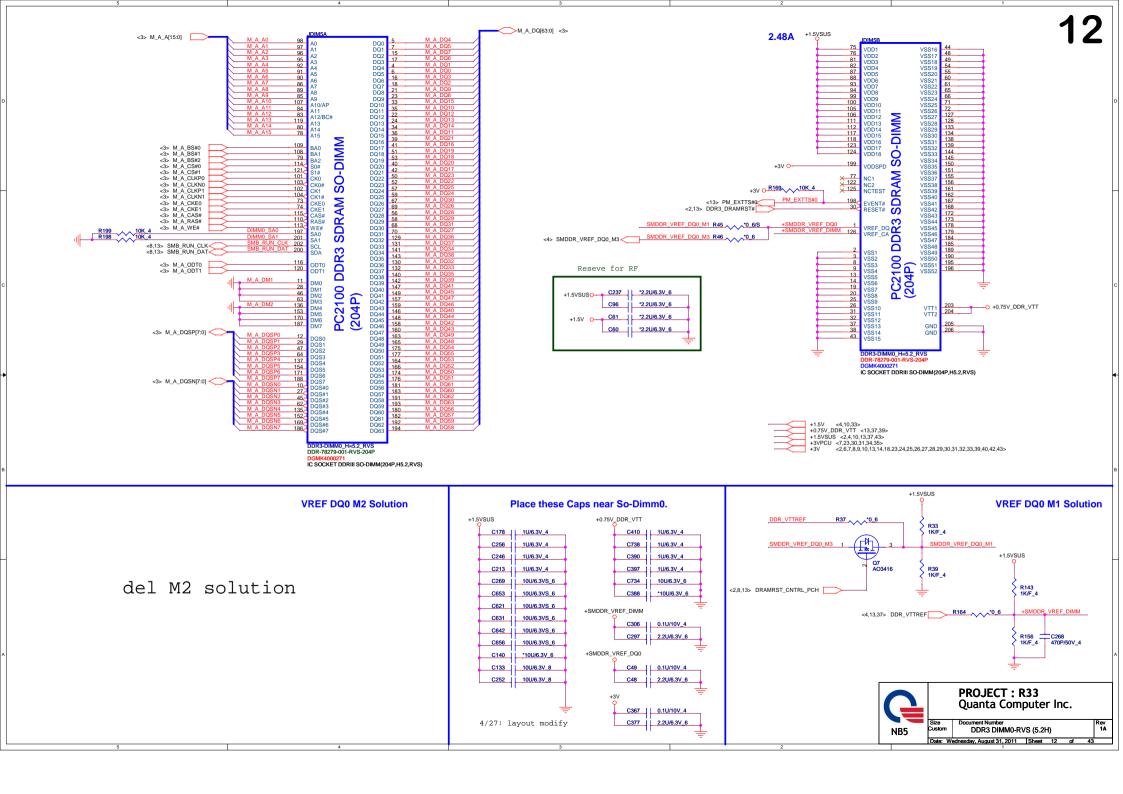


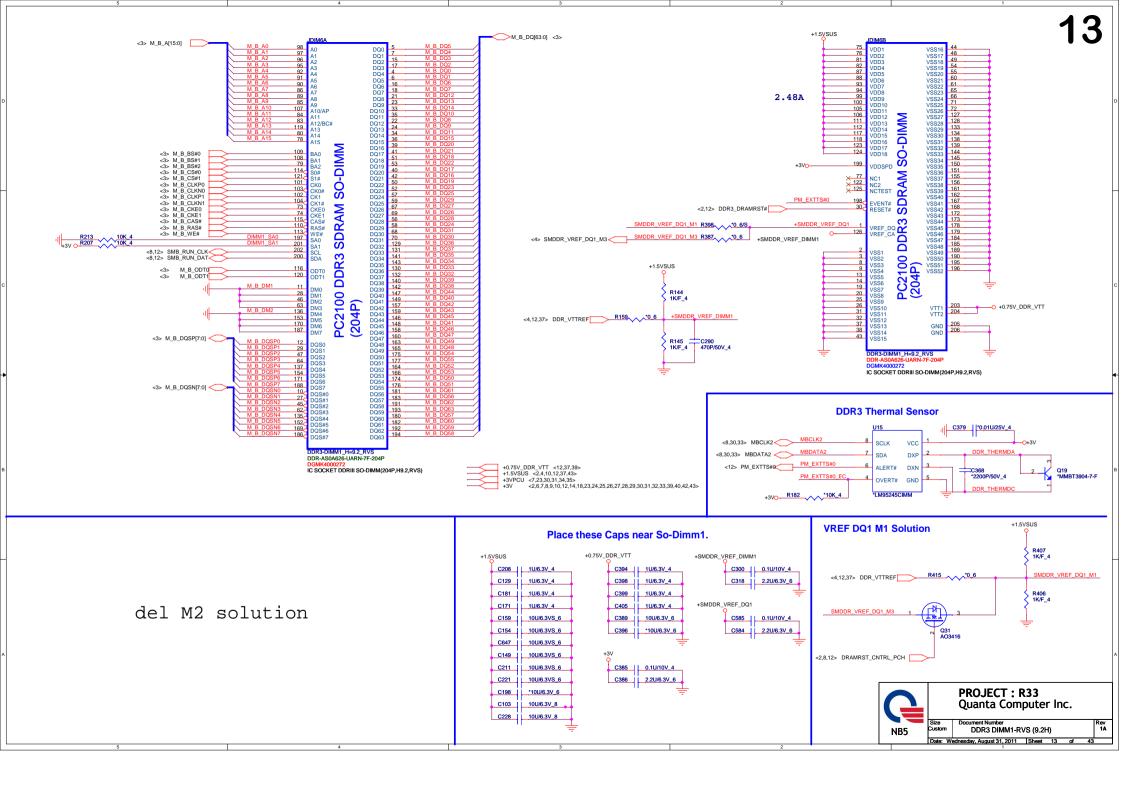

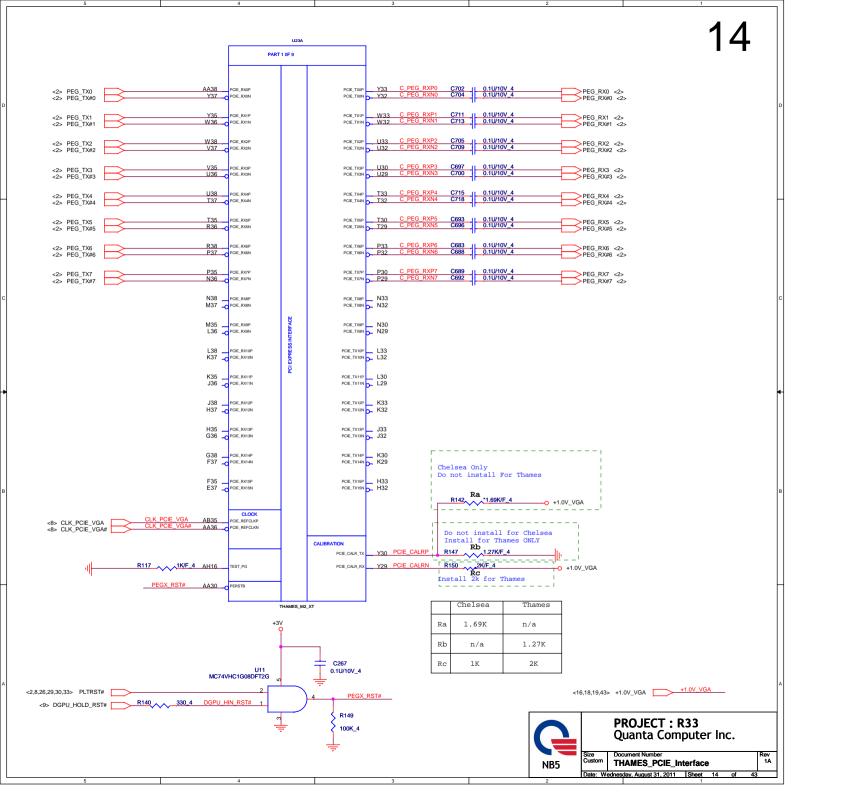

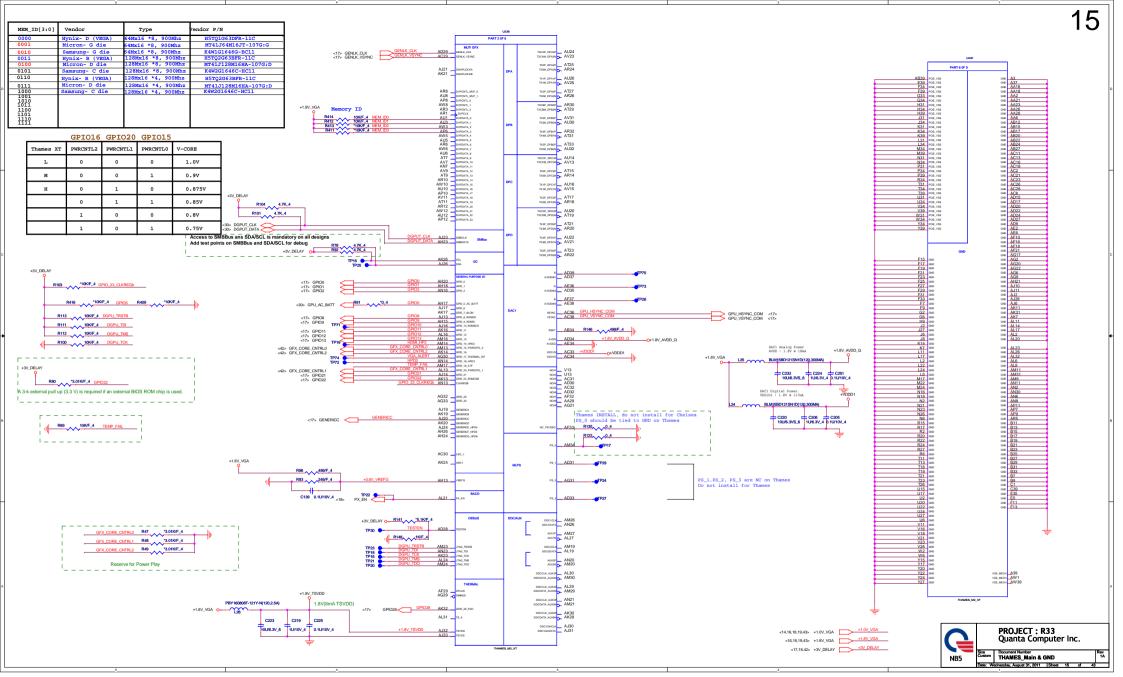

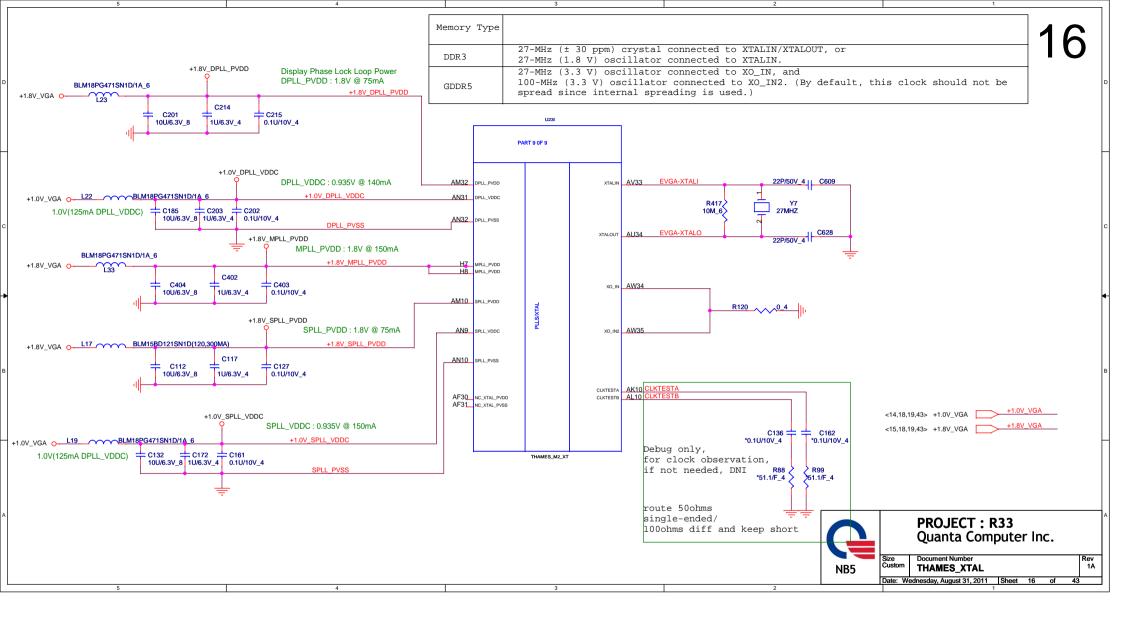


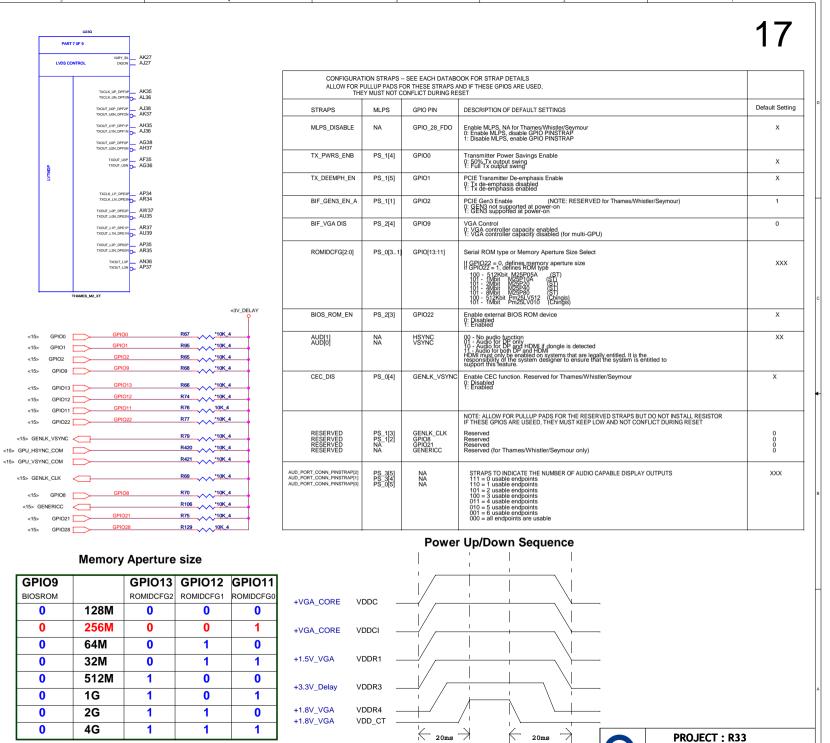



It is a shared pin strap with CONFIG[2:0] if BIOS_ROM_EN is set to 0.


Quanta Computer Inc.


THAMES_LVDS / STRAP

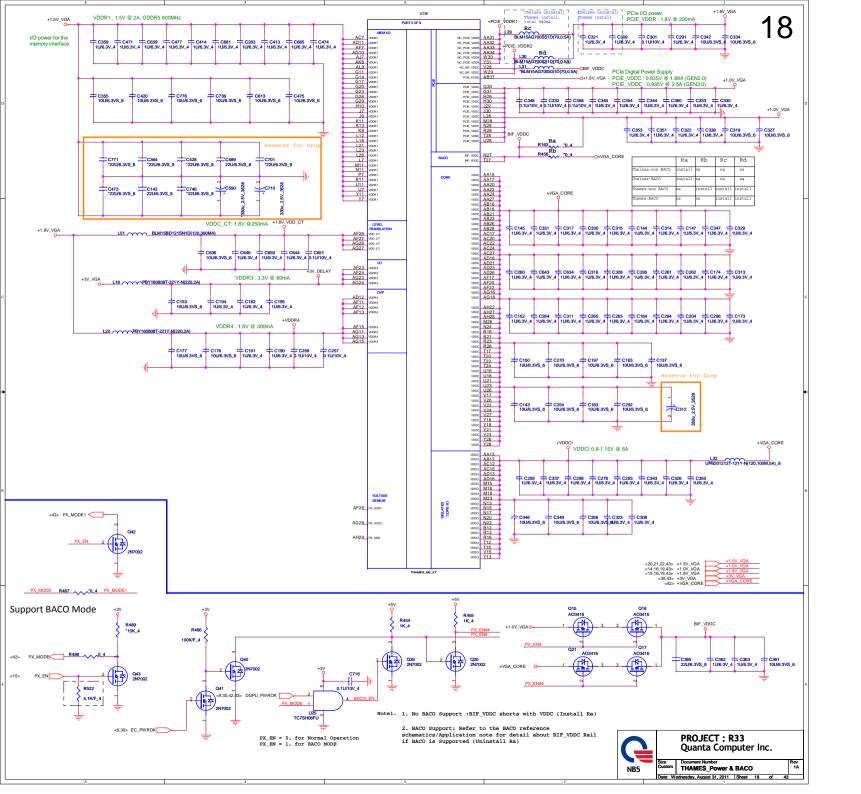


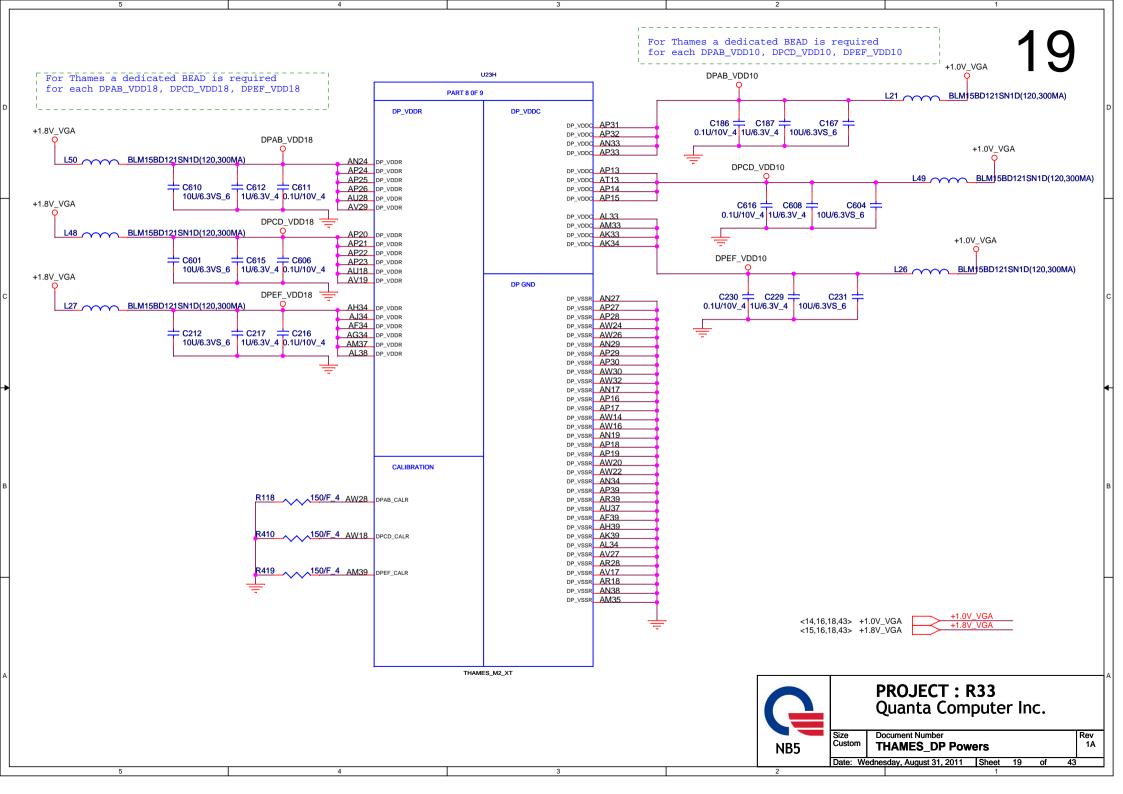


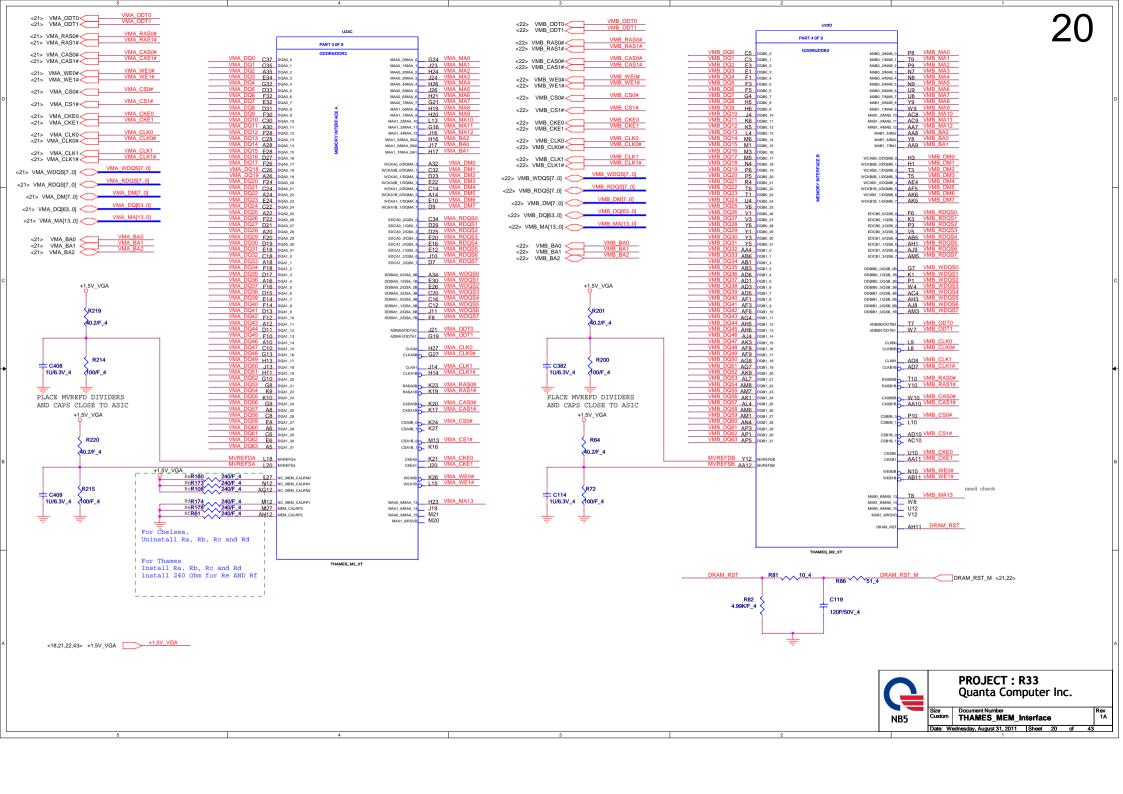


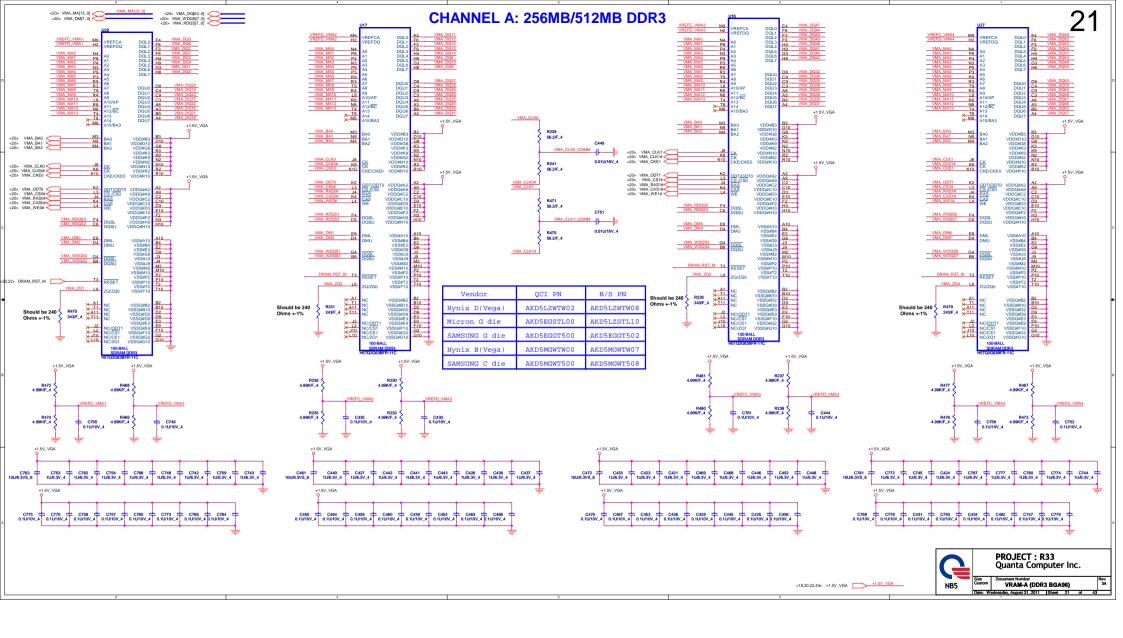


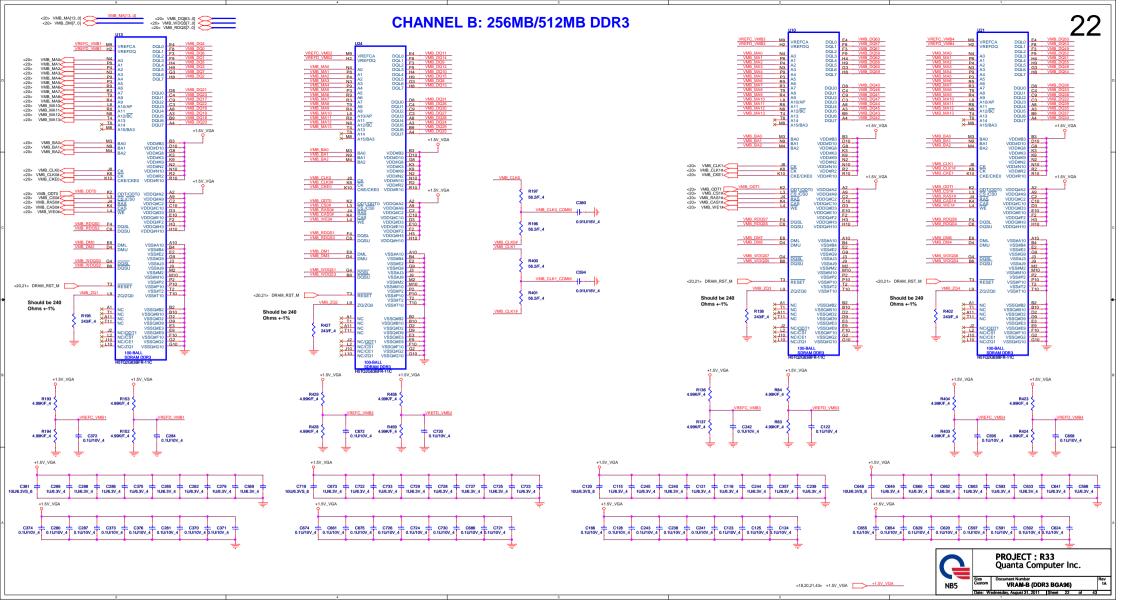

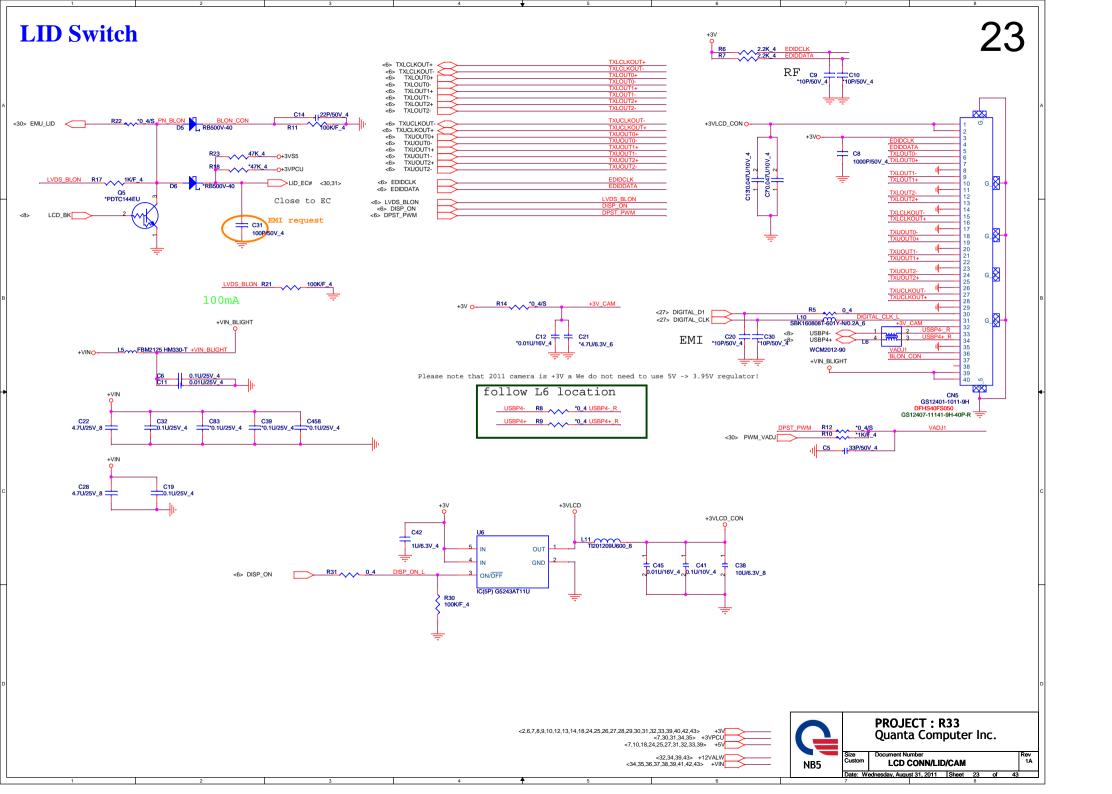

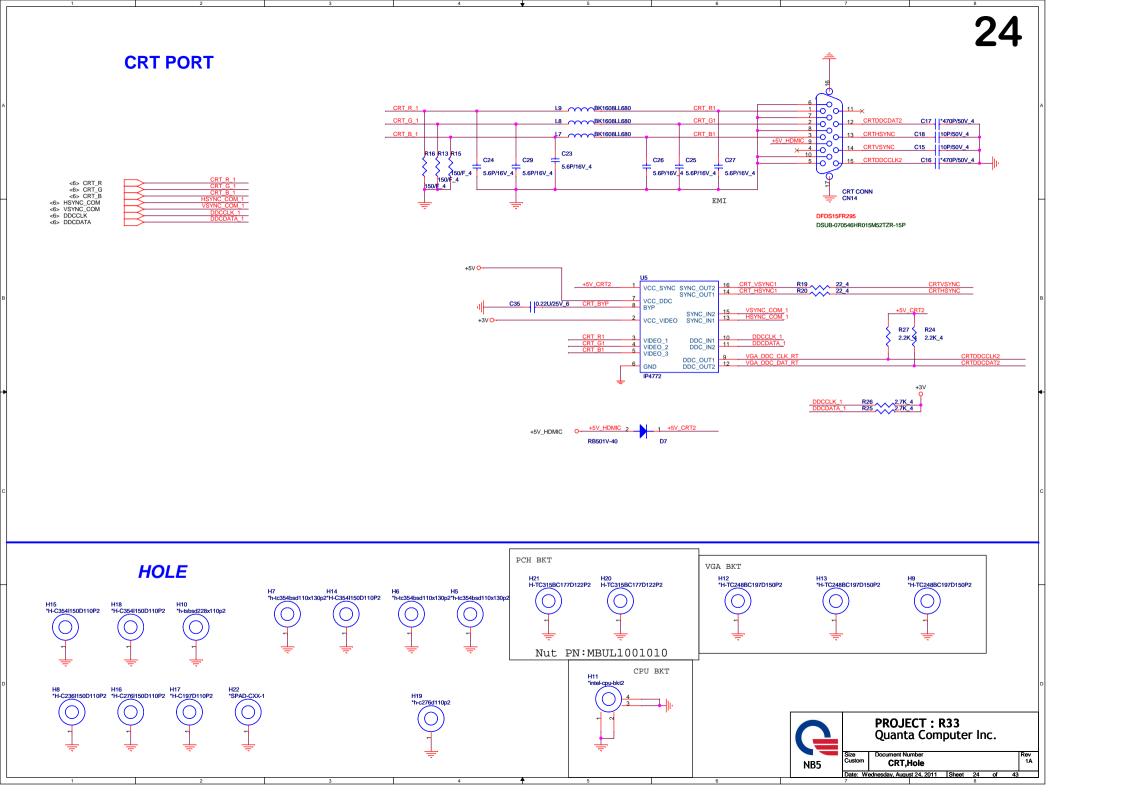


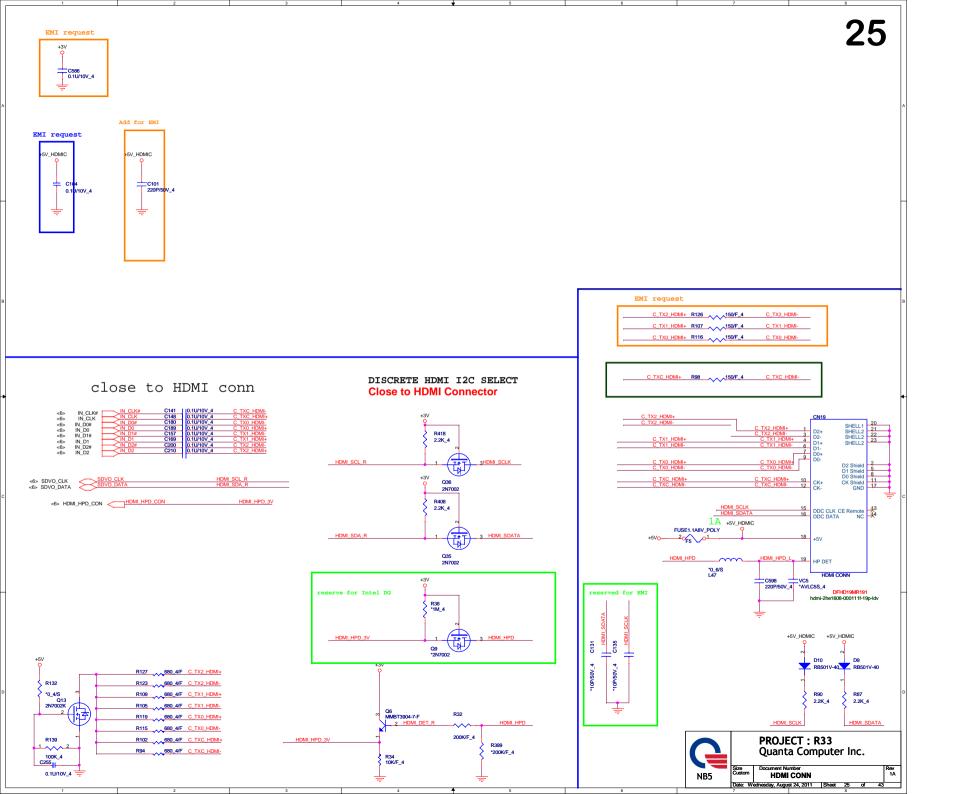


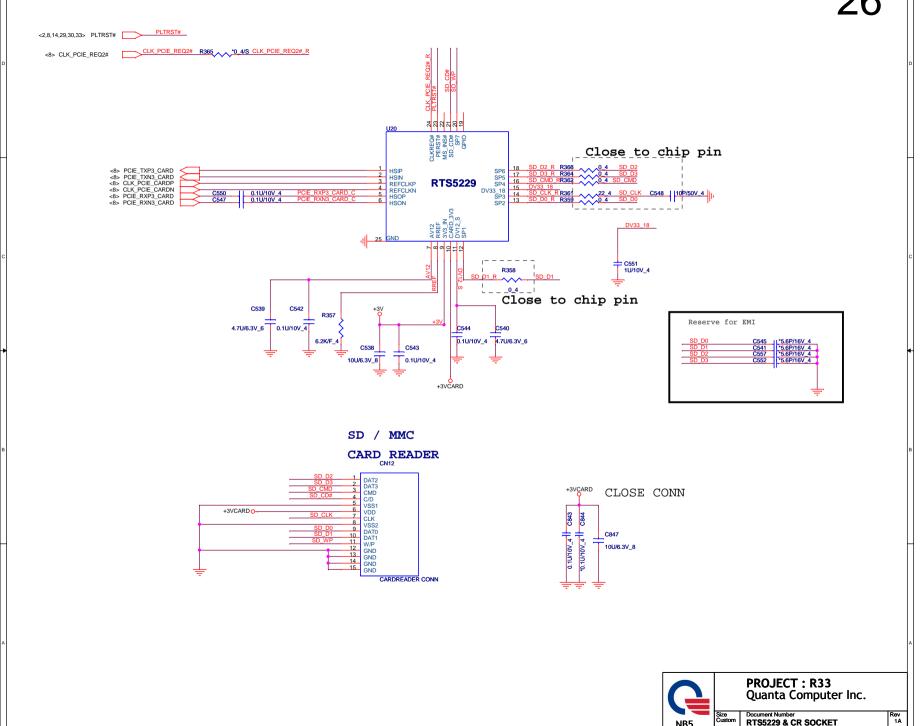



NB5


Date: Thursday, August 25, 2011 Sheet 26 of

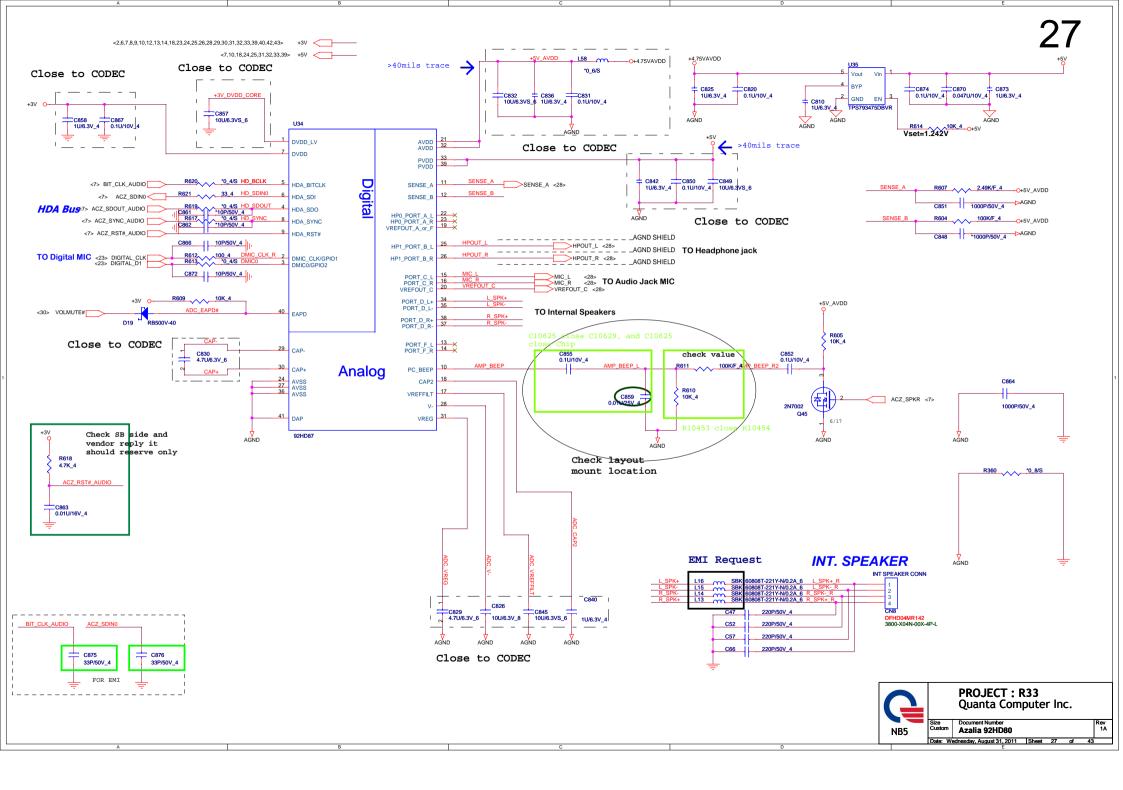


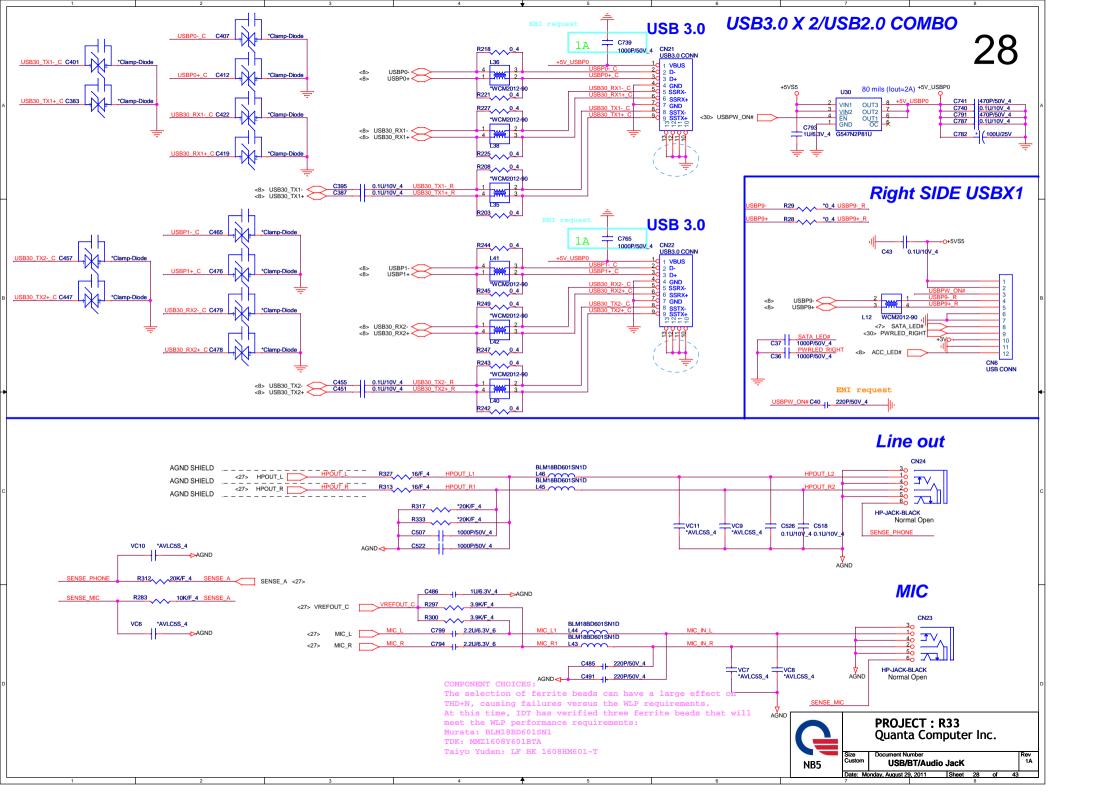


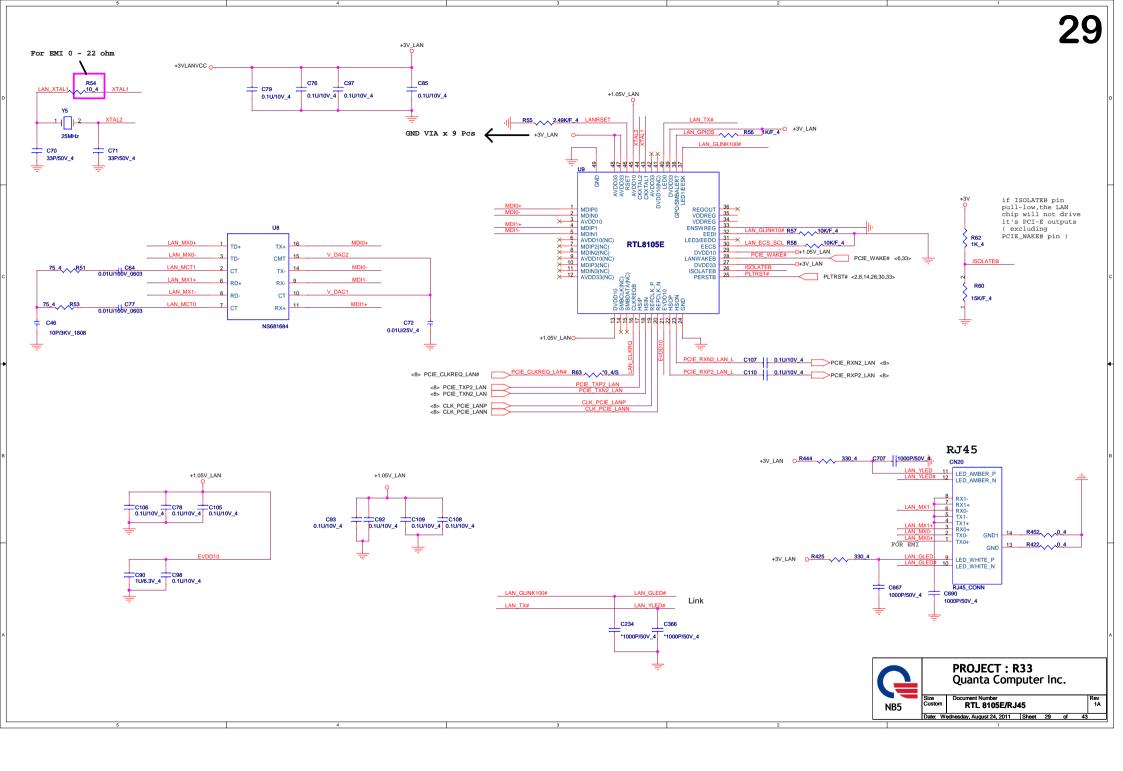

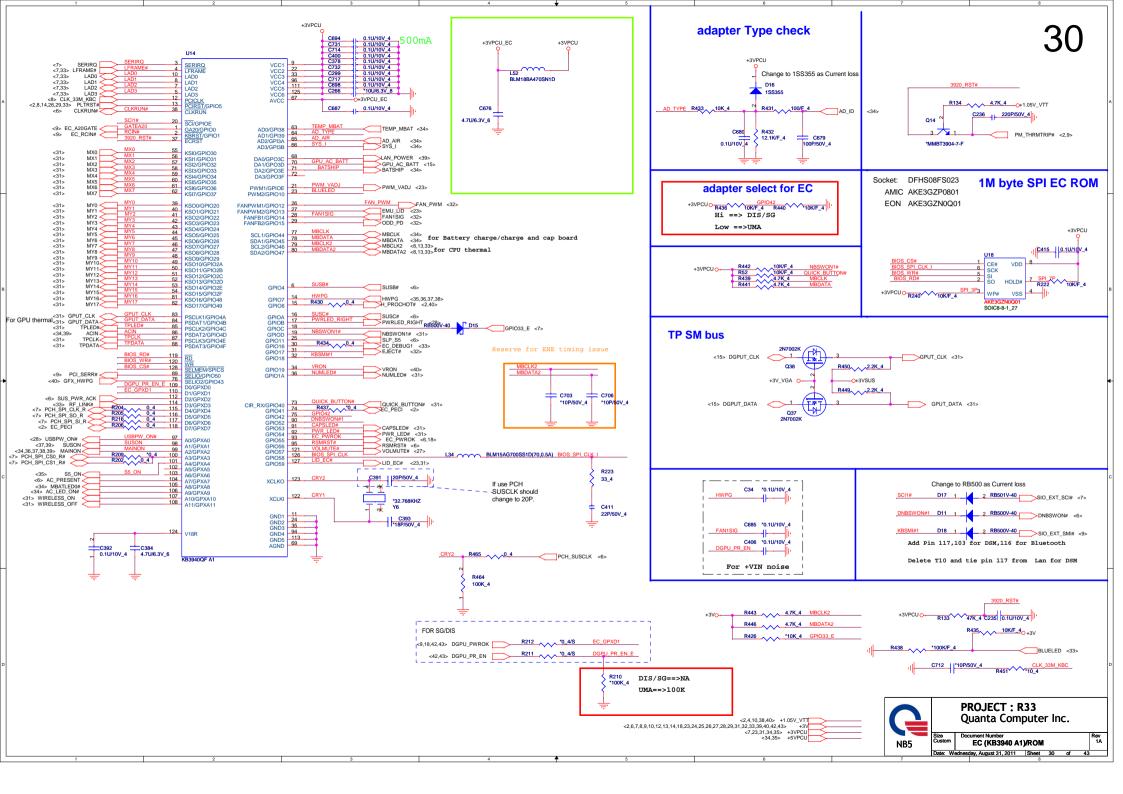


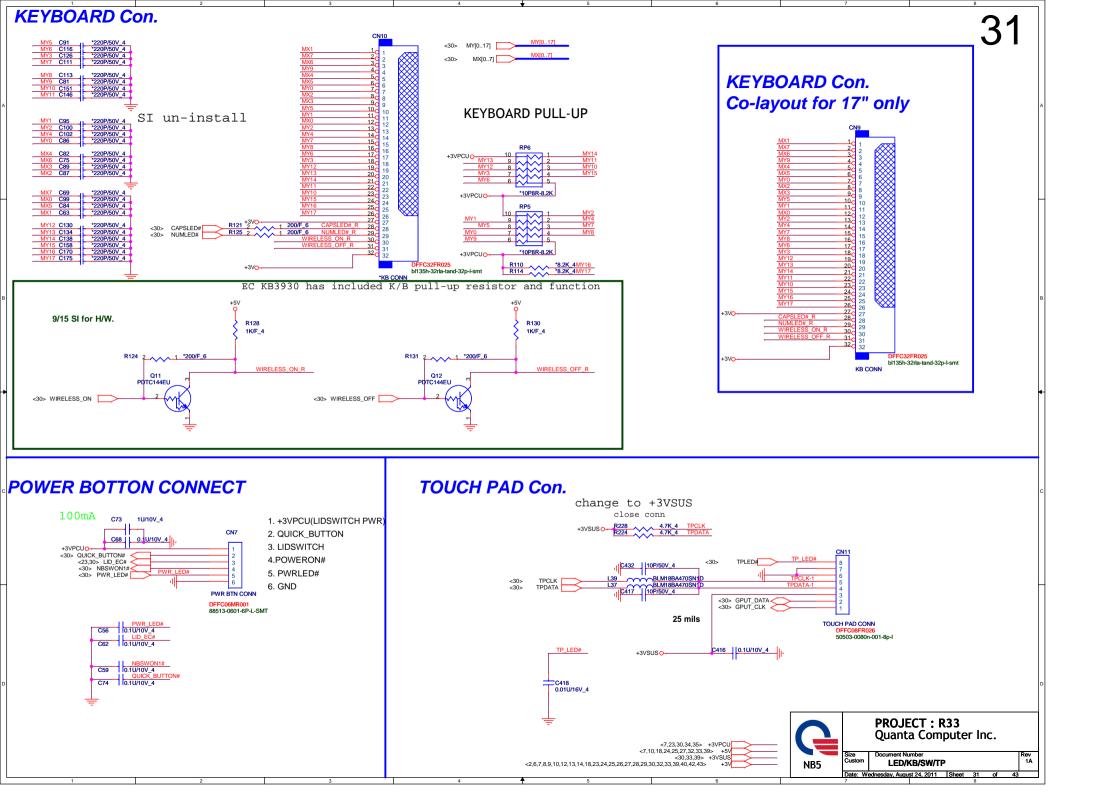


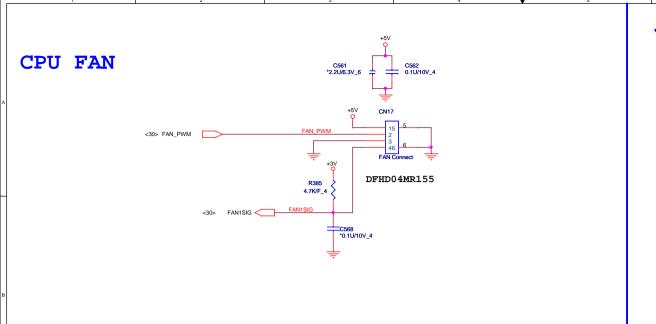

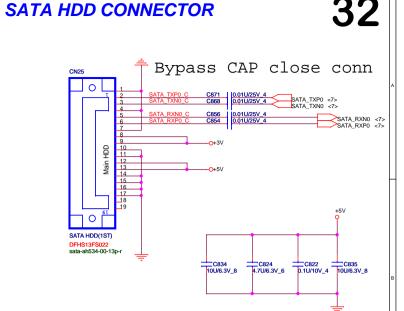


SATA ODD CONNECTOR

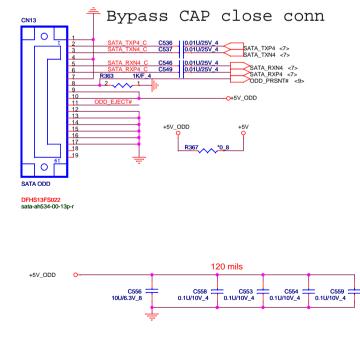


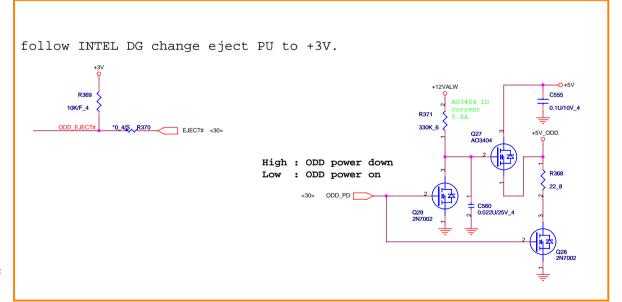



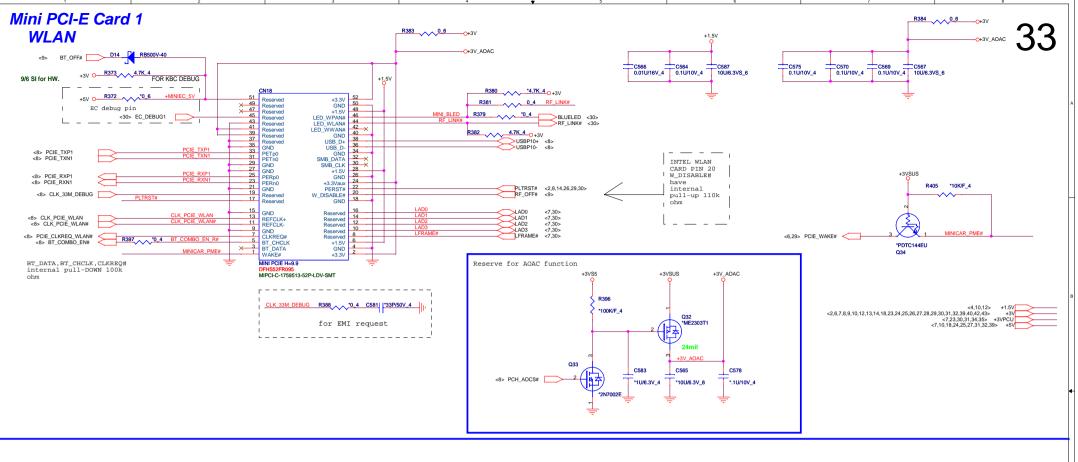



Accelerometer Sensor

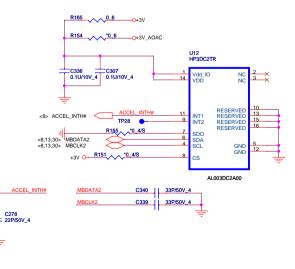





PROJECT: R33
Quanta Computer Inc.

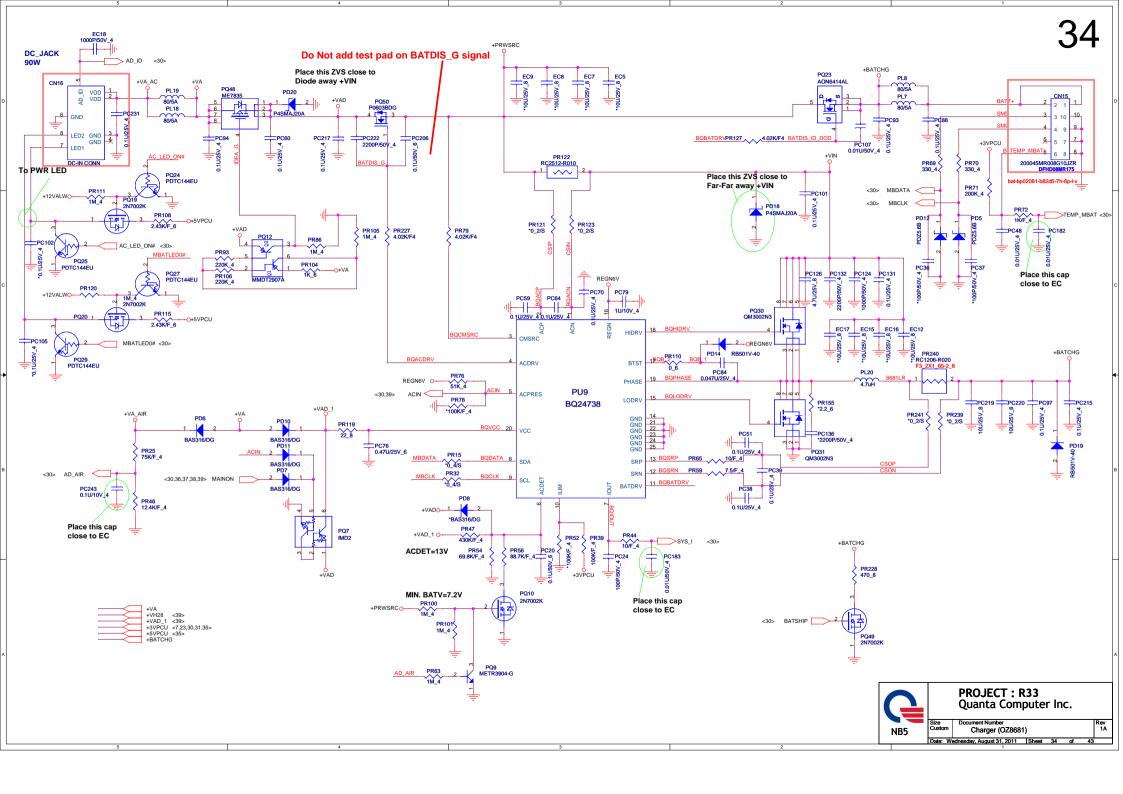

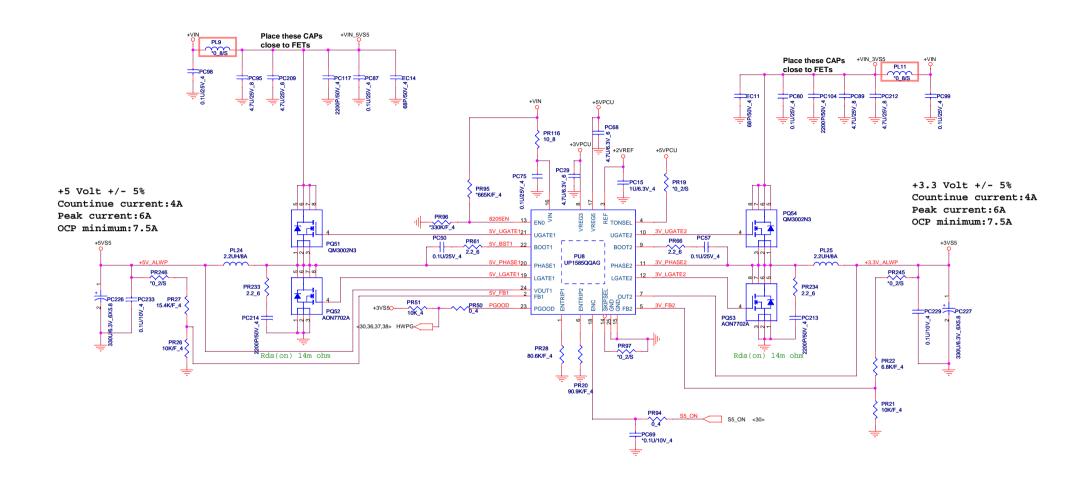




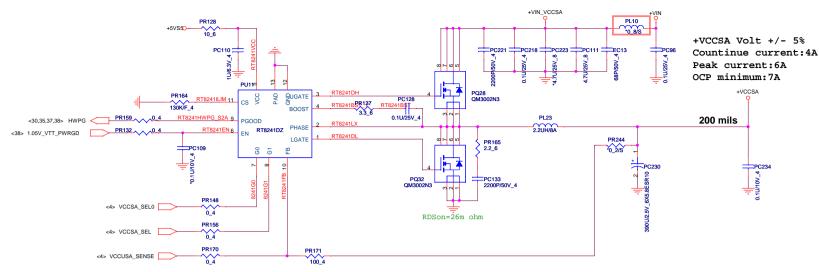



CPU system agent

voltage slew rate of 0.5 -10 mV/us


voltage siew rate of 0.5 -10 mv/µs			
H_FC_C22	VCCSA_SEL	Vout	
VID0	VID1	Vout	
0	0	0.9V	
0	1	0.80V (SV-RT8241DZGQW)	
		0.85V (LV-RT8241EZGQW)	
1	0	0.725V	
1	1	0.675V	

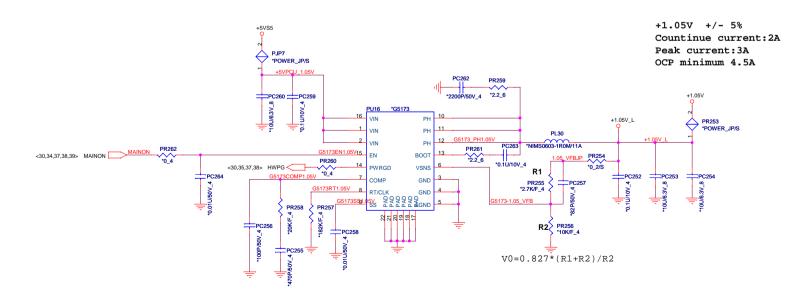





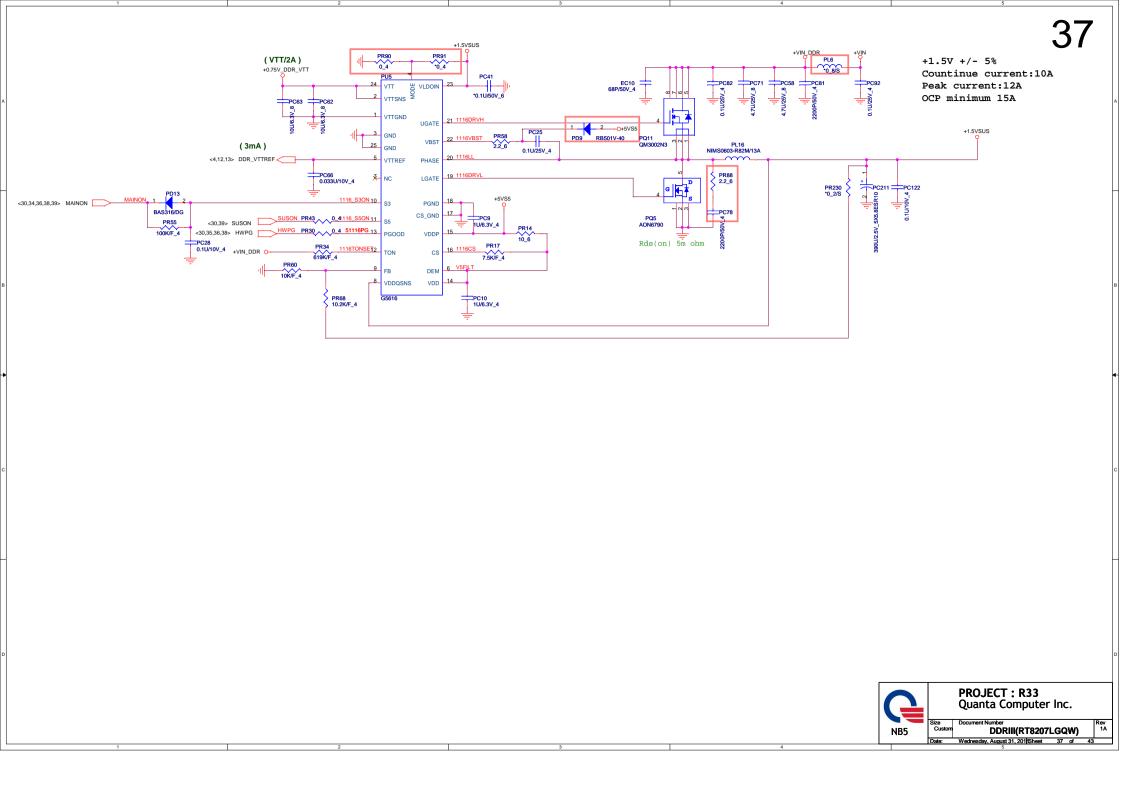





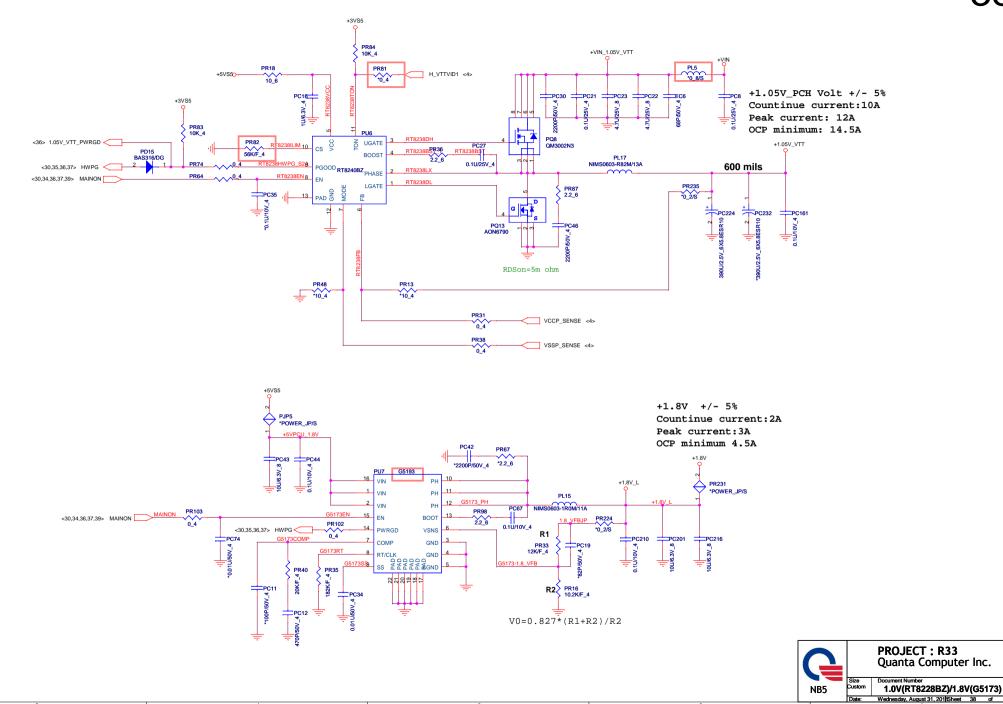

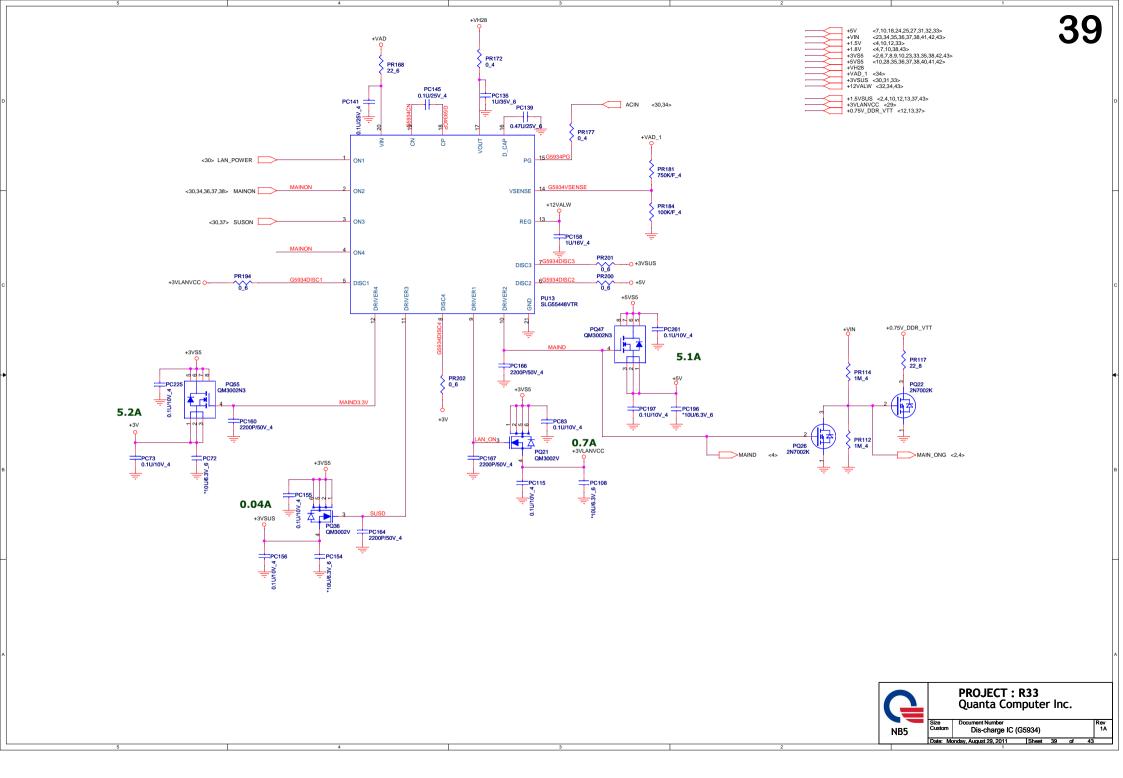

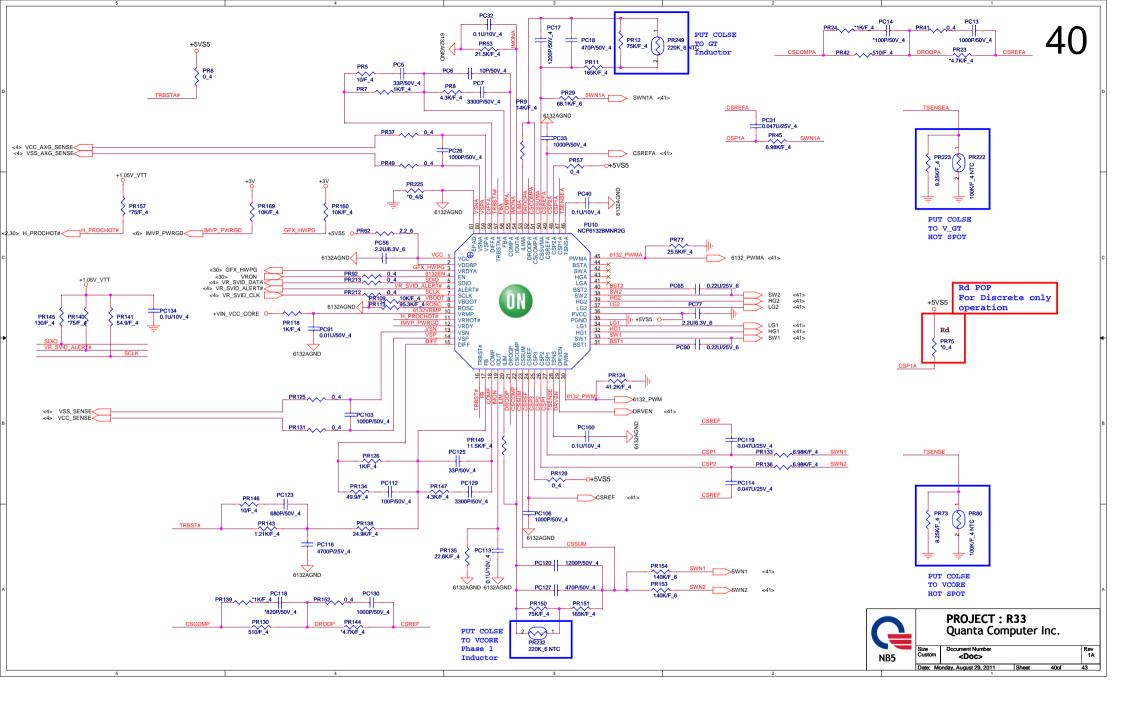

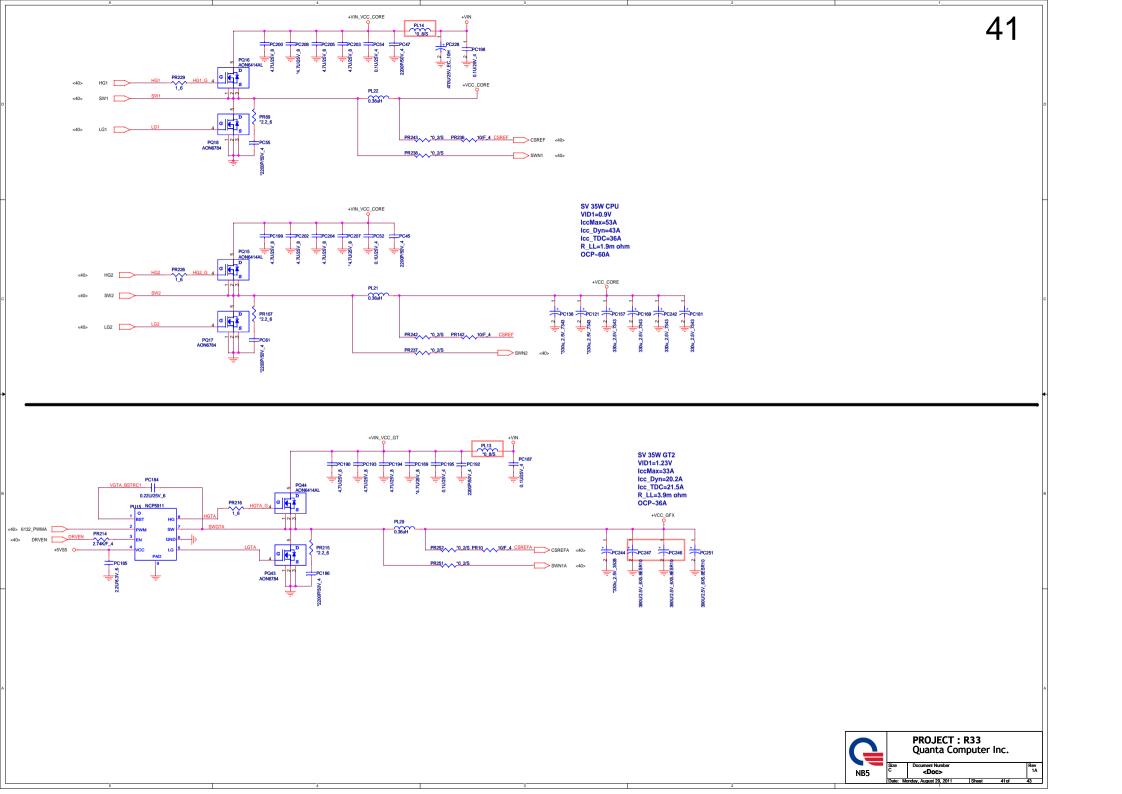

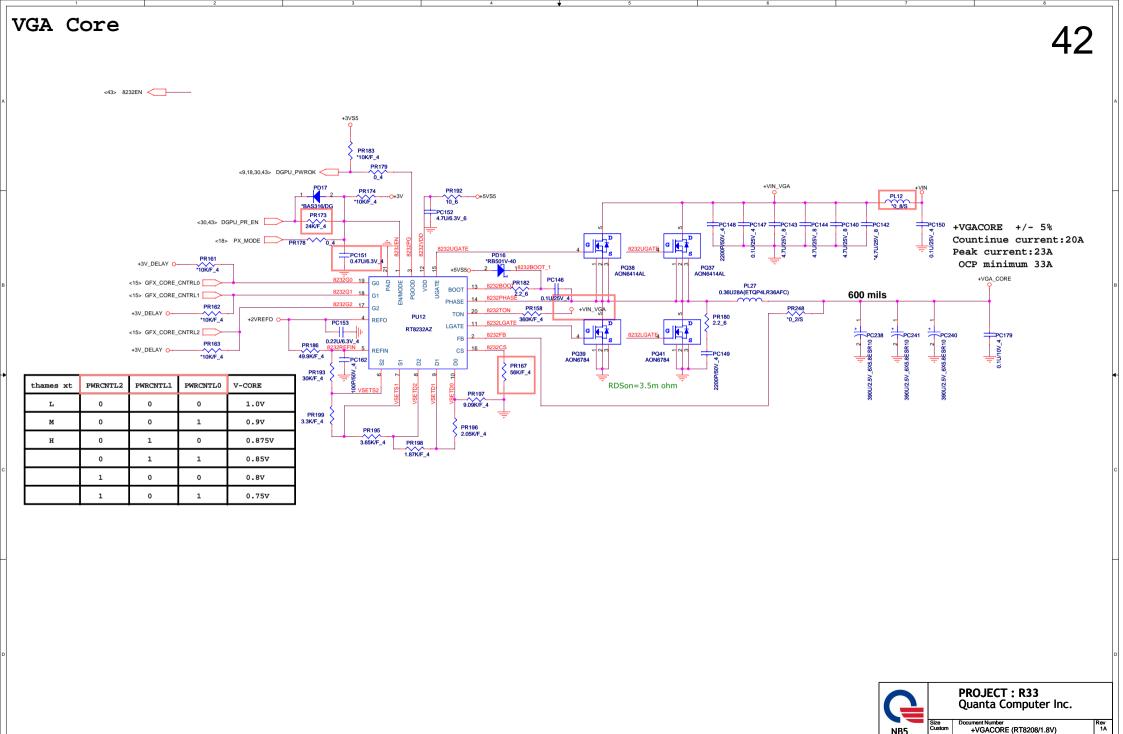

Date: Monday, August 29, 2011 | Sheet 42 of

