

Concept Review

Servo Motors

Why use Servo Motors?

For many mechatronic applications, it is necessary to be able to control the position of an actuator with precision. Unlike open-loop controllers which have no feedback on the state of the motor, closed-loop leverages a position sensor attached to the motor to provide information about the required control signal to drive the motor to the desired position. That is the case with a servo motor where a commanded position is achieved through a controller, which drives the motor based on feedback from a position sensor, such as a potentiometer. The key feature that distinguishes servo motors from other types of motors is their built-in feedback mechanism, making them a good choice for applications that require accurate and reliable position control.

Introduction

A servomechanism is a device that uses a feedback sensor to automatically adjust the behavior of a system using feedback control. A DC servo motor (often colloquially referred to simply as a servo) is a rotary actuator that transforms electrical energy into mechanical energy and incorporates a feedback mechanism for position control. It holds the commanded position, even under load, until it is instructed to do otherwise. Because they operate in closed-loop control, they can correct disturbances or mechanical load changes by comparing measured versus desired positions.

Basic Construction and Operation

A typical servo consists of four components: a motor (which tends to be a DC motor for hobby servos), a reduction gearbox, a position sensor (typically a potentiometer), and a control circuit. These 4 components can be seen in Figure 1.

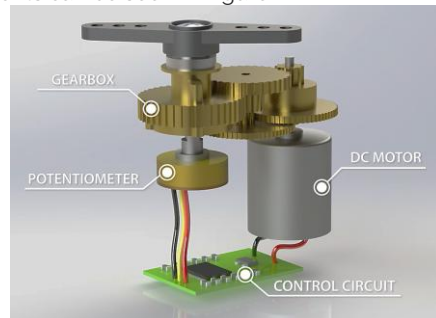


Figure 1. Internal Layout of a Servomotor

The gearbox is used to convert the high speed, low torque motor into a high torque, lower speed output, thus having a high holding torque compared to standalone motors of a similar size.

The potentiometer measures the current position of the output shaft. The position measurement and the control circuit, which receives an input signal of the desired position, are what allow for closed-loop control.

The control circuit monitors the real time position data from the potentiometer and compares it with the desired position signal; the controller then uses this error between measured and desired position to adjust the input voltage to the motor to move it until the error is minimized and the servo is at the desired position. This allows the servo to keep its position even as load changes dynamically, making them ideal for precise applications. Some systems also use PID control algorithms to optimize accuracy, speed, and stability.

Most servos allow for position control with a limited range, usually around 180° , however, some have a larger or smaller range, consult the motor's datasheet for more information. However, some servos are made for continuous rotation, like a DC motor, where the control signal is for speed control instead of position control like described above.

Commented [RD1]: Redundant information found elsewhere

Wiring

The wires of hobby servos tend to look like Figure 2. Servos have three cables going into the connector: power, ground and signal. The power cable is typically the middle connector as a safety measure to prevent major damage to the servo if it is connected backwards. The ground wire is usually either brown or black. The signal wire is often orange, but can vary between brands to be yellow, white or even blue. Confirm your servo wiring diagram based on your motor's datasheet.

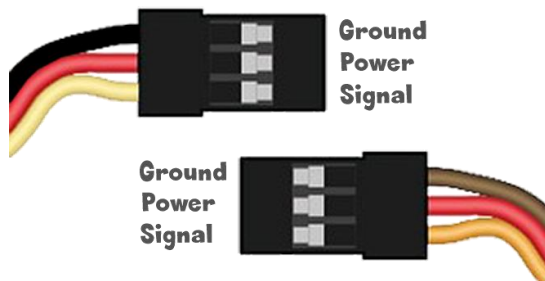


Figure 2. Hobby Servomotors Wiring Connector

Driving a Servomotor

The position of a servo motor is generally commanded using a series of pulses using a PWM (pulse width modulation) signal. The servo expects a pulse every 20 milliseconds, which is at a frequency of 50 Hz. The motor's internal circuitry interprets the pulse width and moves the shaft accordingly to reach the desired position.

Whenever the servo is pulsed with a low pulse width, also called Minimum Pulse, the motor will move to the minimum angle. A neutral pulse will result in a rotation of half the range, and a large pulse, also referred to as Maximum Pulse, will result in a rotation to the full range of the servo. The amplitude, or voltage, of this pulse depends on the servo's operating voltage, which tends to be a range which typically includes 5V as part of that range. The duration, or width, of the pulse determines the position of the servo. For a typical hobby servo with a maximum range of 180°, the low pulse is usually a 1 ms pulse for a position at 0°, the neutral pulse is a 1.5 ms pulse for a position at 90°, and the large pulse is a 2 ms pulse for a 180° position. However, the minimum and maximum pulse could vary depending on the servo, some servos, like the one provided with the actuators trainer, which accepts a pulse between 0.5 ms to 2.5 ms as shown in Figure 3.

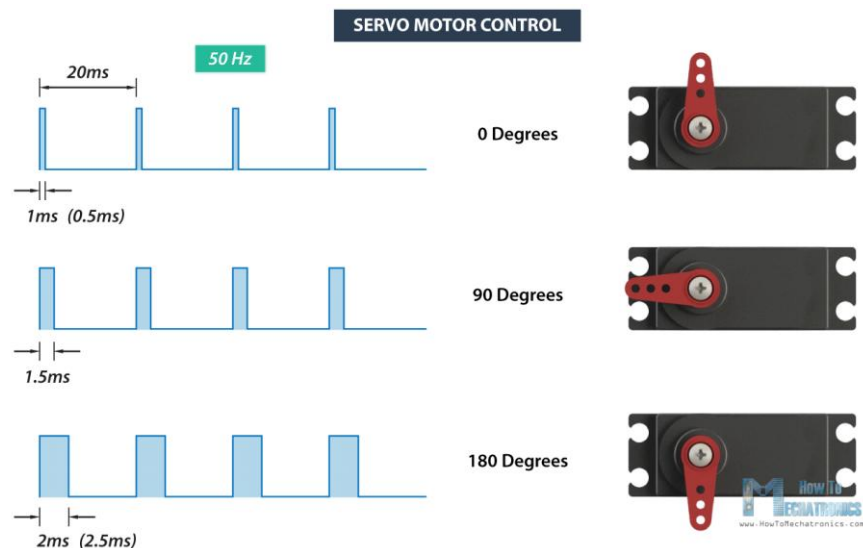


Figure 3. Control Signal for a Servomotor

Note that if you use a 1-2 ms pulse range for a servo that accepts 0.5 to 2.5 ms range, the servo might not be able to get to all its possible positions, but it will not get damaged. The same cannot be said about the opposite, using a 0.5 to 2.5 ms range for a servo that only accepts a 1-2 ms pulse might damage or even break the servo.

Commented [RD2]: why

Datasheet And Considerations

The motor's datasheet summarizes its key electrical and mechanical characteristics and are essential when selecting a motor for a project or application.

Understanding a Servomotor Datasheet

The datasheet lists some properties that should be considered when selecting a servomotor for a project. Figure 4 shows two excerpts from the datasheet for the servomotor provided with the actuators trainer.

This section will mostly focus on the electrical information, however, note that datasheets also contain mechanical information about the motor, usually in the form of a mechanical drawing. This information is important for deciding if a motor will physically fit in a required space, or mount effectively.

4.电气特性 Electrical Specification					
No	Item	Specification			
4.1	工作电压 Operat voltage	4.8V	6.0V	7.2V	8.4V
4.2	静态电流 Idle current	<40mA			
4.3	空载转速 No load speed	0.10sec/60°	0.09sec/60°	0.08sec/60°	0.07sec/60°
4.4	空载电流 Runnig current	210mA	260mA	350mA	450mA
4.5	堵转扭矩 Peak stall torque	12kg.cm	14.5kg.cm	15.5kg.cm	16.5kg.cm
4.6	堵转电流 Stall current	2700mA±10%	3200mA±10%	3900mA±10%	4300mA±10%
5.控制特性 Control Specification					
No	Item	Specification			
5.1	控制信号 Command signal	Pulse width modification			
5.2	放大器类型 Amplifier type	Digital controller			
5.3	脉冲宽度范围 Pulse width range	500~2500usec			
5.4	中点位置 Neutral position	1500usec			
5.5	旋转角度 Running degree	180°±3°(when 500~2500usec)			
5.6	死区宽度 Dead band width	3 usec			

Figure 4. Servomotor Datasheet Excerpt

This is typical data that is generally available for analog servos. Key information which should be provided for a servo motor includes:

1. Operating Voltage
2. Maximum (stall) torque
3. Maximum (stall) current
4. No Load Speed
5. Deadband
6. Resolution

Given the specification data discussed above, there are several design criteria which will likely be important for deciding if a motor is appropriate for your application.

Rated Voltage

This is the voltage at which the motor is designed to run, and at which the motor will have been tested for other specifications. If the motor voltage is significantly greater than that of the power supply driving it, the system will be unable to produce the rated torque. If the supply voltage exceeds the rated voltage, there is a risk of damage to the motor hardware. Most hobby servos operate at 4.8–7.4 V, but industrial versions can handle higher ranges.

Peak Current

This is the current which the motor will draw. For a servo motor, the peak current will be drawn when the servo is exerting peak torque. This will occur when commanding a large step in angle, or when the servo is resisting a large external torque. Current draw varies with load and activity—peak current occurs during acceleration or when resisting force. Some designs benefit from separate power sources for the motor and control electronics to avoid brownouts or signal instability.

Max/Holding Torque

Most applications will have a torque requirement either to actuate a particular mechanical assembly, or to hold position in the face of a specified external load. This is the highest load the servo can resist or apply. Exceeding it causes position errors, but the servo will typically return to its target once the load is removed.

Servo motors are usually rated in kilograms per centimeter (kg/cm), and most hobby servos like the SG90, MG995 etc, are rated between 3kg/cm to 12kg/cm. This rating indicates the weight the motor can lift at a specific distance. For example, a 25kg/cm servo can lift 25kg when the load is 1cm from the motor shaft as shown in Figure 5. The maximum load at each position is the torque divided by the distance in cm.

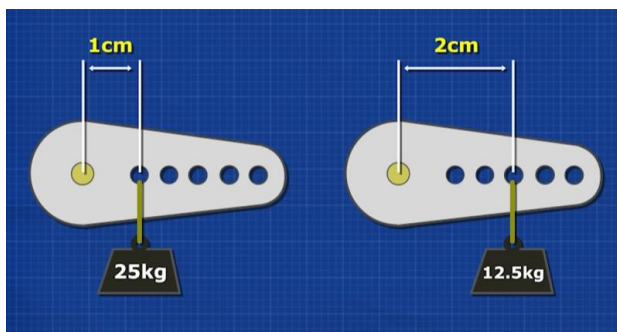


Figure 5. Motor Torque measured in kg/cm

Servo Speed

Servo speed is usually given as the time to move a fixed angle (e.g., 0.1 s per 60°) at a specific voltage. This gives a more practical measure of responsiveness compared to RPM.

Range

The range of a servo motor refers to the minimum and maximum angle it can rotate from its neutral position. Most hobby servos provide a range of 180°, although some models support extended motion up to 270°, or even continuous rotation. The required range depends on the mechanical setup—some applications only need limited angular motion, while others benefit from wider or unrestricted travel.

Design Decisions

Cost

Cost will often be the principal driver in a design. The final cost of a motor will depend on a large number of variables, including volume of production, and the location of the manufacturer. Hobby servos are low-cost and widely available, while industrial-grade models are more expensive due to higher torque, precision, and durability.

Efficiency

The efficiency of servos is mostly a concern in terms of the amount of heat which is generated as a byproduct of normal operation. Servo motors are extremely efficient under low/no load, only drawing power when correcting position; however, they may heat up when subjected to high variable torques as the control circuitry must constantly drive high currents through the motor coils to resist the applied torque.

Ease of Use

This is harder to quantify based on technical documentation; however, the overriding factor in ease of use is the complexity of the motor control circuitry. However, most servos are simple to use with standard PWM signals and require no external control circuitry. More advanced models may use digital protocols and require configuration.

Lifespan

The estimated lifespan of the motor is listed either in hours of operation or number of rotations. Servo components include brushed DC motors or plastic gears that wear over time. Lifespan varies based on use, load, and component quality.

Range of Motion

While we have focused mainly on servo motors with a limited range of motion, there are also free-turning or continuous servos available on the market. However, for continuous motion in one direction, DC motors are a more robust and cost-effective choice for a given torque and power requirement, omitting the extra components needed for positional control in a servo.

Position Control Accuracy

This is an area where the servo motor has significant advantages over other motors. Servos provide reliable position control through internal feedback. Gear reduction and PID control ensure good repeatability, even under varying loads without the loss of torque.

© Quanser Inc., All rights reserved.



Solutions for teaching and research. Made in Canada.