

# High Accuracy, Low Power, Barometric Pressure

# and Temperature Sensor IC

#### **GENERAL INFORMATION**

The ICP-10111 pressure sensor family is based on MEMS capacitive technology which provides ultra-low noise at the lowest power, enabling industry leading relative accuracy, sensor throughput, and temperature stability. The pressure sensor can measure pressure differences with an accuracy of ±1 Pa, enabling altitude measurement differentials as small as 8.5 cm, less than the height of a single stair step.

Consuming only 1.3  $\mu$ A @1 Hz, available in footprint of 2 mm x 2.5 mm x 0.92 mm, the ICP-10111 is ideally suited for mobile phones, wearable fitness monitoring, drones, and battery powered IoT.

The ICP-10111 offers an industry leading temperature coefficient offset of  $\pm 0.5$  Pa/°C. The combination of high accuracy, low power, temperature stability, waterproofing in a small footprint enables higher performance barometric pressure sensing for sports activity identification, mobile indoor/outdoor navigation, and altitude-hold in drones.

## **DEVICE INFORMATION**

| PART<br>NUMBER | PACKAGE                | LID OPENING | MSL** |
|----------------|------------------------|-------------|-------|
| ICP-10111*     | 2x2.5x0.92mm<br>LGA-8L | 1-Hole      | 1     |


<sup>\*</sup> Denotes RoHS and Green-Compliant Package

## **APPLICATIONS**

- Altitude Control of Drones and Flying Toys
- Mobile Phones
- Virtual Reality and Gaming Equipment
- Indoor/Outdoor Navigation (dead-reckoning, floor/elevator/step detection)
- Vertical velocity monitoring
- Leisure, Sports, and Fitness Activity Identification
- Weather Forecasting


## **FEATURES**

- Pressure operating range: 30 to 110 kPa
- Noise and current consumption
  - 0.4 Pa @ 10.4 μA (ULN mode)
  - 0.8 Pa @ 5.2 μA (LN mode)
  - 3.2 Pa @ 1.3 μA (LP mode)
- Pressure Sensor Relative Accuracy: ±1 Pa for any 10 hPa change over 950 hPa-1050 hPa at 25°C
- Pressure Sensor Absolute Accuracy: ±1 hPa over 950 hPa-1050 hPa, 0°C to 65°C
- Pressure Sensor Temperature Coefficient Offset:
   ±0.5 Pa/°C over 25°C to 45°C at 100 kPa
- Temperature Sensor Absolute Accuracy: ±0.4°C
- Temperature operating range: -40 °C to 85 °C
- Host Interface: I<sup>2</sup>C at up to 400 kHz
- Single Supply voltage: 1.8V ±5%
- RoHS and Green compliant



1-Hole Lid Opening

#### **BLOCK DIAGRAM**

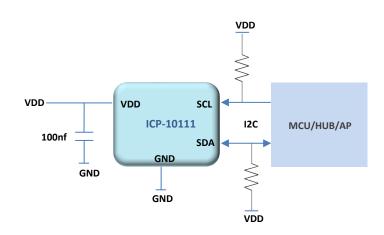

<sup>\*\*</sup> Moisture Sensitivity Level of the package



# **TABLE OF CONTENTS**

|   | GEN          | NERAL INFORMATION                                    | 1  |
|---|--------------|--|----|
|   | DEVI         | VICE INFORMATION                                     | 1  |
|   | APPL         | PLICATIONS   | 1  |
|   | FEAT         | ATURES   | 1  |
|   | BLOG         | OCK DIAGRAM  | 1  |
| 1 | II           | INTRODUCTION   | 5  |
|   | 1.1          | Purpose and Scope                                    | 5  |
|   | 1.2          |  |    |
| 2 | P            | PRESSURE AND TEMPERATURE SENSOR SPECIFICATIONS       | 6  |
|   | 2.1          | OPERATION RANGES                                     | 6  |
|   | 2.2          | OPERATION MODES                                      | 6  |
|   | 2.3          | Pressure Sensor Specifications                       | 7  |
|   | 2.4          | TEMPERATURE SENSOR SPECIFICATIONS                    | 7  |
|   | 2.5          | RECOMMENDED OPERATION CONDITIONS                     | 7  |
| 3 | E            | ELECTRICAL SPECIFICATIONS                            | 8  |
|   | 3.1          | ELECTRICAL CHARACTERISTICS                           | 8  |
|   | 3.2          | ABSOLUTE MAXIMUM RATINGS                             | 9  |
|   | 3.3          | SENSOR SYSTEM TIMING                                 | 9  |
|   | 3.4          | I <sup>2</sup> C TIMING CHARACTERIZATION             | 10 |
| 4 | Α            | APPLICATIONS INFORMATION                             | 11 |
|   | 4.1          | Interface Specifications                             | 11 |
|   | 4.2          | PIN OUT DIAGRAM AND SIGNAL DESCRIPTION               | 11 |
|   | IC           | ICP-10111: 2x2.5x0.92 mm 8-pin LGA                   | 11 |
|   | 4.3          |  |    |
|   | 4.4          | BILL OF MATERIALS FOR EXTERNAL COMPONENTS            | 13 |
| 5 | 0            | OPERATION AND COMMUNICATION                          | 14 |
|   | 5.1          |  |    |
|   | 5.2          | Measurement Commands                                 | 14 |
|   | 5.3          |  |    |
|   | 5.4          |  |    |
|   | 5.5          |  |    |
|   | 5.6          |  |    |
|   | 5.7          |  |    |
|   | 5.8          |  |    |
|   | 5.9          |  |    |
|   | 5.10         |  |    |
|   | 5.11         |  |    |
|   | 5.12<br>5.13 | ,  |    |
|   | 5.14         | ·  |    |
| _ |              | ASSEMBLY   |    |
| 6 |              |  |    |
|   | 6.1          |  |    |
|   |              | Soldering<br>Chemical Exposure and Sensor Protection |    |
| _ |              | ·  |    |
| 7 | P            | PACKAGE DIMENSIONS                                   | 23 |





| 8  | PART NUMBER PART MARKINGS | 26 |
|----|---------------------------|----|
| 9  | TAPE & REEL SPECIFICATION | 27 |
|    | ORDERING GUIDE            |    |
|    | REFERENCES                |    |
|    | REVISION HISTORY          |    |
| 12 |                           | 50 |



# **LIST OF FIGURES**

| Figure 1. Digital I/O Pads Timing                                   | 10 |
|---|----|
| Figure 2. Pin Out Diagram for ICP-10111 2 mm x 2.5 mm x 0.92 mm LGA | 11 |
| Figure 3. ICP-10111 Application Schematic                           |    |
| Figure 4. Example: Typical Application Circuit                      |    |
| Figure 5. Communication Data Sequences                              | 21 |
| Figure 6. ICP-10111 Package Diagrams                                |    |
| Figure 7. ICP-10111 recommended PCB land pattern                    | 24 |
| Figure 8. Part Number Part Markings for 2x2.5mm (ICP-10111)         |    |
| Figure 9. ICP-10111 Tape Dimensions                                 |    |
| Figure 10. ICP-10111 Tape and Reel Drawing                          | 27 |
| LIST OF TABLES  |    |
| LIST OF TABLES  |    |
| Table 1. Operation Ranges   |    |
| Table 2. Operation Modes  |    |
| Table 3. Pressure Sensor Specifications                             |    |
| Table 4. Temperature Sensor Specifications                          |    |
| Table 5. Electrical Specifications                                  |    |
| Table 6. Absolute Maximum Ratings                                   |    |
| Table 7. System Timing Specifications                               |    |
| Table 8. I <sup>2</sup> C Parameters Specification                  |    |
| Table 9. Signal Descriptions  |    |
| Table 10. Bill of Materials   |    |
| Table 11. ICP-10111 I <sup>2</sup> C Device Address                 |    |
| Table 12. Measurement Commands                                      |    |
| Table 13. Soft Reset Command  |    |
| Table 14. Read-Out Command of ID Register                           | 15 |
| Table 15. 16-bit ID Structure                                       |    |
| Table 16. ICP-10111 I <sup>2</sup> C CRC Properties                 |    |
| Table 17. ICP-10111 Package Dimensions                              |    |
| Table 18. Part Number Part Markings                                 | 26 |



## 1 INTRODUCTION

## 1.1 PURPOSE AND SCOPE

This document is a preliminary product specification, providing a description, specifications, and design related information for the ICP-10111 Pressure Sensor.

Specifications are subject to change without notice. Final specifications will be updated based upon characterization of production silicon.

## 1.2 PRODUCT OVERVIEW

The ICP-10111 is an ultra-low power, low noise, digital output barometric pressure and temperature sensor IC. It is based on an innovative MEMS capacitive pressure sensor technology that can measure pressure differences with an accuracy of ±1 Pa at the industry's lowest power. The high accuracy MEMS capacitive pressure sensor is capable of measuring altitude differentials down to 8.5 cm without the penalty of increased power consumption or reduced sensor throughput.

The capacitive pressure sensor has a  $\pm 1$  hPa absolute accuracy over its full range of 300 hPa -1100 hPa. The pressure sensor has an embedded temperature sensor and 400 kHz I<sup>2</sup>C bus for communication. For power-critical applications, the ICP-10111 features a low power mode of 1.3  $\mu$ A at a noise of 3.2 Pa or for high performance applications, it features a low noise mode of 0.8 Pa while only consuming 5.2  $\mu$ A.

The ICP-10111 also offers industry leading temperature stability of the pressure sensor with a temperature coefficient offset of  $\pm 0.5$  Pa/°C. The high accuracy, temperature stability, and market leading low power consumption of 1.3  $\mu$ A @1 Hz offered by ICP-10111 makes it ideally suited for applications such as mobile phones, drone flight control and stabilization, indoor/outdoor navigation (elevator, floor, and stair step detection), sports and fitness activity monitoring, and battery-powered IoT.

Document Number: DS-000177



## 2 PRESSURE AND TEMPERATURE SENSOR SPECIFICATIONS

## 2.1 OPERATION RANGES

The sensor shows best performance when operated within the recommended temperature and pressure range (hereafter called normal conditions) of  $0^{\circ}$ C –  $45^{\circ}$ C and 95 kPa – 105 kPa, respectively. The following ranges are defined for the device:

| OPERATION RANGE | PRESSURE (KPA) | TEMPERATURE (°C) |  |  |
|-----------------|----------------|------------------|--|--|
| Normal          | 95 to 105      | 0 to 45          |  |  |
| Extended        | 30 to 110      | -20 to 65        |  |  |
| Maximum         | 25 to 115      | -40 to 85        |  |  |

**Table 1. Operation Ranges** 

## 2.2 OPERATION MODES

The sensor can be operated in up to four different measurement modes to satisfy different requirements for power consumption vs. noise, accuracy and measurement frequency. An overview of the operation modes is given in Table 2.

| PARAMETER          | CONDITIONS  | SENSOR MODE              | TYP  | MAX  | UNITS | NOTES |
|--------------------|---|--------------------------|------|------|-------|-------|
|                    |   | Low Power (LP)           | 1.6  | 1.8  |       | 1     |
|                    | Time between sending last bit of measurement command, and | Normal (N)               | 5.6  | 6.3  |       | 1     |
| Conversion Time    | sensor data ready for                                     | Low Noise (LN)           | 20.8 | 23.8 | ms    | 1     |
|                    | measurement   | Ultra Low Noise<br>(ULN) | 83.2 | 94.5 |       | 1     |
|                    |   | Low Power (LP)           | 1.3  |      |       |       |
| Commont            |   | Normal (N)               | 2.6  |      |       |       |
| Current            | 1 Hz ODR  | Low Noise (LN)           | 5.2  |      | μΑ    |       |
| Consumption        |   | Ultra Low Noise<br>(ULN) | 10.4 |      |       |       |
|                    |   | Low Power (LP)           | 3.2  |      |       |       |
|                    | V-11-1 f D 400 l-D- T 25°C                                | Normal                   | 1.6  |      |       |       |
| Pressure RMS Noise | Valid for P = 100 kPa, T = 25°C,<br>and U = 1.8V          | Low Noise (LN)           | 0.8  |      | Pa    |       |
|                    | and U = 1.8V  | Ultra Low Noise<br>(ULN) | 0.4  |      |       |       |

**Table 2. Operation Modes** 

#### Notes:

1. Guaranteed by design.

Low Power modes supports ODR greater than 500 Hz while the Low Noise mode provides industry leading RMS noise at a fast 40 Hz ODR. Further decrease in noise may be achieved by software oversampling and filtering through customer's software implementation or custom TDK-InvenSense operation modes available upon request.



#### 2.3 PRESSURE SENSOR SPECIFICATIONS

Pressure sensor specifications are given in Table 3. Default conditions of 25 °C and 1.8V supply voltage apply, unless otherwise stated.

| PARAMETER                      | CONDITIONS               | TYP  | UNITS  | NOTES   |
|--------------------------------|--------------------------|------|--------|---------|
| Absolute Accuracy              | Normal range             | ±1   | hPa    | 1, 3    |
| Absolute Accuracy              | Extended range           | ±1.5 | IIPa   | 1, 3    |
|                                | Any step ≤ 1 kPa, 25 °C  | ±1   |        |         |
| Relative Accuracy              | Any step ≤ 10 kPa, 25 °C | ±3   | Pa     | 3       |
| Long-term drift                | Normal Range             | ±35  | Pa/y   |         |
| During 1 year                  | Extended Range           | ±40  | Pa/y   |         |
| Solder drift                   |                          | 0.5  | hPa    | 1, 2, 4 |
| Townseature coefficient effect | P = 100 kPa              | +0.5 | Do /°C | 3       |
| Temperature coefficient offset | 25°C 45°C                | ±0.5 | Pa/°C  | 3       |
| Resolution                     | Maximum range            | 0.01 | Pa     |         |

**Table 3. Pressure Sensor Specifications** 

#### Notes:

- 1. Absolute accuracy may be improved through One Point Calibration.
- 2. Sensor accuracy post Solder reflow may be improved through One Point Calibration.
- 3. Parameter specifications shown are component-level. They may be different at the board-level and may depend on PCB characteristics including but not limited to PCB material, number of layers, PCB thickness. They may also depend on usage conditions.
- 4. Specification value is based on PCBs with no solder mask under the device. Specification value may depend on PCB characteristics including but not limited to PCB material, number of layers, PCB thickness. It may also depend on usage conditions.

## 2.4 TEMPERATURE SENSOR SPECIFICATIONS

Specifications of the temperature sensor are shown in Table 4.

| PARAMETER         | CONDITIONS     | TYP   | UNITS |
|-------------------|----------------|-------|-------|
| Absolute Accuracy | Extended range | ±0.4  | °C    |
| Repeatability     | Extended range | ±0.1  | °C    |
| Resolution        | Maximum range  | 0.01  | °C    |
| Long-term drift   | Normal range   | <0.04 | °C/y  |

**Table 4. Temperature Sensor Specifications** 

## 2.5 RECOMMENDED OPERATION CONDITIONS

The pressure sensor exhibits best performance when operated within the normal pressure and temperature range  $0^{\circ}\text{C} < \text{T} < 45^{\circ}\text{C}$  and 95 kPa < P < 105 kPa.

Injected photo current due to strong light sources can influence the sensor performance and should be avoided to guarantee best operation.

The sensor should not be exposed to high mechanical stress, the resulting deformation of the package can alter internal dimensions and therefore falsify the sensor signal. Solder reflow may affect device performance. One-point calibration can improve the sensor accuracy post solder reflow.



# **3 ELECTRICAL SPECIFICATIONS**

## 3.1 ELECTRICAL CHARACTERISTICS

Default conditions of 25 °C and 1.8V supply voltage apply to values in Table 5, unless otherwise stated.

| PARAMETER                | SYMBOL          | CONDITIONS   | MIN                 | ТҮР  | MAX                 | UNITS | COMMENTS  |
|--------------------------|-----------------|--|---------------------|------|---------------------|-------|---|
| Supply voltage           | $V_{DD}$        |  | 1.71                | 1.8  | 1.89                | V     |   |
| Power-up/down level      | $V_{POR}$       | Static power supply  | 1.0                 | 1.25 | 1.5                 | ٧     |   |
| Supply Ramp Time         | $T_RAMP$        | Monotonic ramp. Ramp rate is 10% to 90% of the final value | 0.01                |      | 100                 | ms    |   |
|                          |                 | Idle state   | -                   | 1.0  | 2.5                 | μΑ    |   |
|                          | I <sub>DD</sub> | Measurement  | -                   | 210  | 300                 | μΑ    | Current consumption while sensor is measuring.                    |
| Supply current           |                 | Average  | 1                   | 1.3  | -                   | μΑ    | Current consumption in continuous operation @ 1 Hz ODR in LP Mode |
|                          |                 |  | ı                   | 5.2  | ı                   | μА    | Current consumption in continuous operation @1 Hz ODR in LN Mode  |
| Low level input voltage  | $V_{IL}$        |  | 0                   | -    | 0.3 V <sub>DD</sub> | V     |   |
| High level input voltage | $V_{IH}$        |  | 0.7 V <sub>DD</sub> | -    | $V_{DD}$            | V     |   |
| Low level output voltage | V <sub>OL</sub> | 0 < IOL < 3 mA   | -                   | -    | 0.2 V <sub>DD</sub> | V     | _   |
| Output Sink Commont      |                 | V <sub>OL</sub> = 0.4V                                     | 3.1                 | 4.1  | -                   | mA    | _   |
| Output Sink Current      | I <sub>OL</sub> | V <sub>OL</sub> = 0.6V                                     | 3.5                 | 4.5  | =                   | mA    |   |

**Table 5. Electrical Specifications** 



## 3.2 ABSOLUTE MAXIMUM RATINGS

Stress levels beyond those listed in Table 6 may cause permanent damage to the device. These are stress ratings only and functional operation of the device at these conditions cannot be guaranteed. Exposure to the absolute maximum rating conditions for extended periods may affect the reliability of the device.

| PARAMETER                       | RATING            |
|---------------------------------|-------------------|
| Supply voltage, VDD             | -0.3V to 2.16V    |
| Supply Voltage, SCL & SDA       | -0.3V to VDD 0.3V |
| Operating temperature range     | -40°C to 85°C     |
| Storage temperature range       | -40°C to 125°C    |
| ESD HBM                         | 2.0 kV            |
| ESD CDM                         | 250V              |
| Latch up, JESD78 Class II, 85°C | 100 mA            |
| Overpressure                    | >600kPa           |

**Table 6. Absolute Maximum Ratings** 

## 3.3 SENSOR SYSTEM TIMING

Default conditions of 25°C and 1.8V supply voltage apply to typ. values listed in Table 7, unless otherwise stated. Max. values apply over the specified operating range of VDD and over the operating temperature range.

| PARAMETER SYMBOL CONDITIONS                                   |                   | MIN              | ТҮР | MAX  | UNITS | COMMENTS   |   |
|---|-------------------|------------------|-----|------|-------|--|---|
| Power-up time $t_{PU}$ After hard reset, $V_{DD} \ge V_{POR}$ |                   | ı                | 170 | -    |       | Time between V <sub>DD</sub> reaching V <sub>PU</sub> and sensor entering idle state |   |
| Soft reset time   | t <sub>SR</sub>   | After soft reset | ı   | 170  | -     | μs   | Time between ACK of soft reset command and sensor entering idle state |
| Measurement duration  | t <sub>MEAS</sub> | LN Mode          | ı   | 20.8 | 23.8  | ms   | Duration for a pressure and temperature measurement                   |

**Table 7. System Timing Specifications** 



## 3.4 I<sup>2</sup>C TIMING CHARACTERIZATION

Default conditions of 25°C and 1.8V supply voltage apply to values in Table 8, unless otherwise stated.

| PARAMETER                                  | SYMBOL              | CONDITIONS  | MIN | ТҮР | MAX | UNITS |
|--|---------------------|---|-----|-----|-----|-------|
| SCL clock frequency                        | f <sub>SCL</sub>    |   | 0   | -   | 400 | kHz   |
| Hold time (repeated) START condition       | t <sub>HD;STA</sub> | After this period, the first clock pulse is generated | 0.6 | -   | -   | μs    |
| LOW period of the SCL clock                | t <sub>LOW</sub>    |   | 1.3 | -   | -   | μs    |
| HIGH period of the SCL clock               | t <sub>HIGH</sub>   |   | 0.6 | -   | -   | μs    |
| Set-up time for a repeated START condition | t <sub>SU;STA</sub> |   | 0.6 | -   | -   | μs    |
| SDA hold time                              | t <sub>HD;DAT</sub> |   | 0   | -   | -   | μs    |
| SDA set-up time                            | t <sub>SU;DAT</sub> |   | 100 | -   | -   | ns    |
| SCL/SDA rise time                          | t <sub>R</sub>      |   | 20  | -   | 300 | ns    |
| SCL/SDA fall time                          | t <sub>F</sub>      |   | -   | -   | 300 | ns    |
| SDA valid time                             | t <sub>VD;DAT</sub> |   | -   | -   | 0.9 | μs    |
| Set-up time for STOP condition             | t <sub>su;sto</sub> |   | 0.6 | -   | -   | μs    |
| Capacitive load on bus line                | C <sub>B</sub>      |   | -   | -   | 400 | pF    |

Table 8. I<sup>2</sup>C Parameters Specification

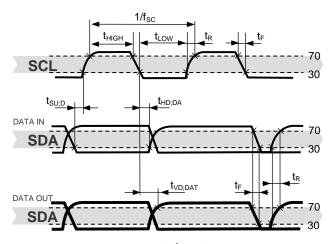


Figure 1. Digital I/O Pads Timing



# **4 APPLICATIONS INFORMATION**

## 4.1 INTERFACE SPECIFICATIONS

The ICP-10111 supports I<sup>2</sup>C fast mode, SCL clock frequency from 0 to 400 kHz.

## 4.2 PIN OUT DIAGRAM AND SIGNAL DESCRIPTION

ICP-10111: 2x2.5x0.92 mm 8-pin LGA

| PIN NUMBER | PIN NAME | DESCRIPTION  |
|------------|----------|--|
| 1          | GND      | Connect to Ground  |
| 2          | RESV     | No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC |
| 3          | SDA      | I <sup>2</sup> C Serial Data   |
| 4          | SCL      | I <sup>2</sup> C Serial Clock  |
| 5          | RESV     | Connect to Ground  |
| 6          | RESV     | No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC |
| 7          | GND      | Connect to Ground  |
| 8          | VDD      | Power Supply VDD   |

**Table 9. Signal Descriptions** 

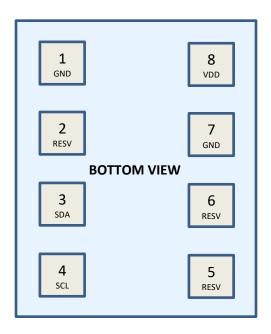


Figure 2. Pin Out Diagram for ICP-10111 2 mm x 2.5 mm x 0.92 mm LGA



#### 4.3 TYPICAL OPERATING CIRCUIT

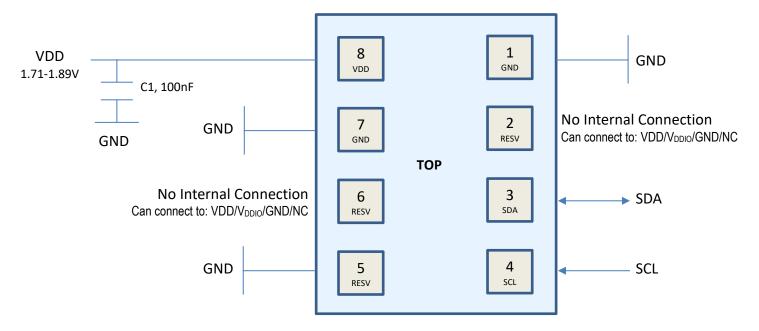


Figure 3. ICP-10111 Application Schematic

Power supply pins supply voltage (Vdd) and ground (Vss) must be decoupled with a 100 nF capacitor that shall be placed as close to the sensor as possible (see Figure 4).

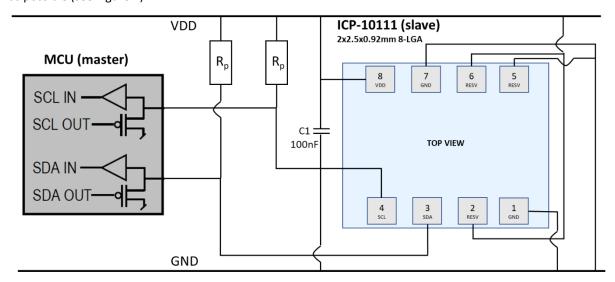


Figure 4. Example: Typical Application Circuit

SCL is used to synchronize the communication between the microcontroller and the sensor. The master must keep the clock frequency within 0 to 400 kHz as specified in Table 8.

The SDA pin is used to transfer data in and out of the sensor. For safe communication, the timing specifications defined in the I2C manual must be met.

To avoid signal contention, the microcontroller must only drive SDA and SCL low. External pull-up resistors (i.e.  $10 \text{ k}\Omega$ ) are required to pull the signal high. For dimensioning resistor sizes, user should also consider bus capacity requirements. It should be noted that pull-up resistors may be included in I/O circuits of microcontrollers.



User should refer to AN-000140 "TDK-InvenSense Pressure Sensor PCB Design Guidelines" for PCB guidelines and sensor integration.

## 4.4 BILL OF MATERIALS FOR EXTERNAL COMPONENTS

| COMPONENT            | LABEL | SPECIFICATION             | QUANTITY |
|----------------------|-------|---------------------------|----------|
| VDD Bypass Capacitor | C1    | Ceramic, X7R, 100 nF ±10% | 1        |

Table 10. Bill of Materials



## 5 OPERATION AND COMMUNICATION

All commands and memory locations of the ICP-10111 are mapped to a 16-bit address space which can be accessed via the  $I^2$ C protocol.

| ICP-10111                | BINARY   | DECIMAL | HEXADECIMAL |
|--------------------------|----------|---------|-------------|
| I <sup>2</sup> C address | 110'0011 | 99      | 0x63        |

Table 11. ICP-10111 I<sup>2</sup>C Device Address

#### 5.1 POWER-UP AND COMMUNICATION START

Upon VDD reaching the power-up voltage level V<sub>POR</sub>, the ICP-10111 enters idle state after a duration of t<sub>PU</sub>. In idle state, the ICP-10111 is ready to receive commands from the master (microcontroller).

Each transmission sequence begins with START condition (S) and ends with an (optional) STOP condition (P) as described in the  $I^2$ C-bus specification. Whenever the sensor is powered up, but not performing a measurement or communicating, it automatically enters idle state for energy saving.

## **5.2 MEASUREMENT COMMANDS**

The ICP-10111 provides the possibility to define the sensor behavior during measurement as well as the transmission sequence of measurement results. These characteristics are defined by the appropriate measurement command.

Each measurement command triggers both a temperature and a pressure measurement.

| OPERATION MODE        | TRANSMIT T FIRST | TRANSMIT P FIRST |
|-----------------------|------------------|------------------|
| Low Power (LP)        | 0x609C           | 0x401A           |
| Normal (N)            | 0x6825           | 0x48A3           |
| Low Noise (LN)        | 0x70DF           | 0x5059           |
| Ultra-Low Noise (ULN) | 0x7866           | 0x58E0           |

**Table 12. Measurement Commands** 

## **5.3 STARTING A MEASUREMENT**

A measurement communication sequence consists of a START condition followed by the I<sup>2</sup>C header with the 7-bit I<sup>2</sup>C device address and a write bit (write W: '0', 8-bit word including I<sup>2</sup>C header: 0xC6). The sensor indicates the proper reception of a byte by pulling the SDA pin low (ACK bit) after the falling edge of the 8th SCL clock. Then the sensor is ready to receive a 16-bit measurement command. Again, the ICP-10111 acknowledges the proper reception of each byte with ACK condition. A complete measurement cycle is presented in Figure 5.

With the acknowledgement of the measurement command, the ICP-10111 starts measuring pressure and temperature.

#### 5.4 SENSOR BEHAVIOR DURING MEASUREMENT

In general, the sensor does not respond to any I<sup>2</sup>C activity during measurement, i.e. I<sup>2</sup>C read and write headers are not acknowledged (NACK).

## 5.5 READOUT OF MEASUREMENT RESULTS

After a measurement command has been issued and the sensor has completed the measurement, the master can read the measurement results by sending a START condition followed by an  $I^2C$  read header (8-bit word including  $I^2C$  header: 0xC7). The sensor will acknowledge the reception of the read header and send the measured data in the specified order to the master. The MSB of the corresponding data is always transmitted first. Temperature data is transmitted in two 8-bit words and pressure data is transmitted in four 8-bit words. Regarding the pressure data, only the first three words MMSB, MLSB and LMSB contain information about the ADC pressure value  $p\_dout$ . Therefore, for retrieving the ADC pressure value, LLSB must be disregarded:

 $p\_dout = MMSB \ll 16 \mid MLSB \ll 8 \mid LMSB.$ 



Two bytes of data are always followed by one byte CRC checksum, for calculation see section 5.8. Each byte must be acknowledged by the microcontroller with an ACK condition for the sensor to continue sending data. If the ICP-10111 does not receive an ACK from the master after any byte of data, it will not continue sending data.

Whether the sensor sends out pressure or temperature data first depends on the measurement command that was sent to the sensor to initiate the measurement (see Table 12).

The I<sup>2</sup>C master can abort the read transfer with a NACK condition after any data byte if it is not interested in subsequent data, e.g. the CRC byte or the second measurement result, to save time.

#### **5.6 SOFT RESET**

The ICP-10111 provides a soft reset mechanism that forces the system into a well-defined state without removing the power supply. If the system is in idle state (i.e. if no measurement is in progress) the soft reset command will be accepted by ICP-10111. This triggers the sensor to reset all internal state machines and reload calibration data from the memory.

| COMMAND    | HEXADECIMAL CODE | BINARY CODE         |
|------------|------------------|---------------------|
| Soft reset | 0x805D           | 1000'0000'0101'1101 |

**Table 13. Soft Reset Command** 

## 5.7 READ-OUT OF ID REGISTER

The ICP-10111 has an ID register which contains a specific product code. The read-out of the ID register can be used to verify the presence of the sensor and proper communication. The command to read the ID register is shown in Table 14.

| COMMAND          | HEXADECIMAL CODE | BINARY CODE         |
|------------------|------------------|---------------------|
| Read ID register | 0xEFC8           | 1110′1111′1100′1000 |

Table 14. Read-Out Command of ID Register

It needs to be sent to the ICP-10111 after an I<sup>2</sup>C write header. After the ICP-10111 has acknowledged the proper reception of the command, the master can send an I<sup>2</sup>C read header and the ICP-10111 will submit the 16-bit ID followed by 8 bits of CRC. The structure of the ID is described in Table 15. Bits 15:6 of the ID contain unspecified information (marked as "x"), which may vary from sensor to sensor, while bits 5:0 contain the ICP-10111 specific product code.

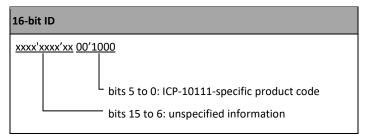


Table 15. 16-bit ID Structure

## 5.8 CHECKSUM CALCULATION

The 8-bit CRC checksum transmitted after each data word is generated by a CRC algorithm with the properties displayed in Table 16. The CRC covers the contents of the two previously transmitted data bytes.



| PROPERTY       | VALUE                                  |
|----------------|--|
| Name           | CRC-8                                  |
| Width          | 8 bits                                 |
| Polynomial     | $0x31(x^8 + x^5 + x^4 + 1)$            |
| Initialization | 0xFF                                   |
| Reflect input  | false                                  |
| Reflect output | false                                  |
| Final XOR      | 0x00                                   |
| Examples       | CRC(0x00) = 0xAC<br>CRC(0xBEEF) = 0x92 |

Table 16. ICP-10111 I<sup>2</sup>C CRC Properties

## 5.9 CONVERSION OF SIGNAL OUTPUT

Pressure measurement data is always transferred as 4 8-bit words; temperature measurement data is always transferred as two 8-bit words. Please see section 5.5 for more details.

Temperature measurement values  $t\_dout$  are linearized by the ICP-10111 and must be calculated to °C by the user via the following formula:

$$T = -45^{\circ}\text{C} + \frac{175^{\circ}\text{C}}{2^{16}} \times t\_dout.$$

For retrieving physical pressure values in Pa the following conversion formula has to be used:

$$P = A + \frac{B}{C + p_{\text{dout}}},$$

where  $p\_dout$  is the sensor's raw pressure output. The converted output is compensated for temperature effects via the temperature dependent functions A, B and C. Besides the raw temperature output  $t\_dout$ , the calculation of A, B and C requires to access calibration parameters OTP0, OTP1, OTP2, OTP3 stored in the OTP of the sensor. Read-out of OTP parameters is described in section 5.10.

Full sample code for calculating physical pressure values is given in section 5.11. The general workflow of the conversion is done by:

- 1) Import class Invensense\_pressure\_conversion
- 2) Read out values OTP0, ..., OTP3 and save to c1, ..., c4
- Create object name for an individual sensor with parameter values c1, ..., c4 name = Invensense\_pressure\_conversion ([c1,c2,c3,c4])
- 4) Get raw pressure p\_dout and temperature t\_dout data from the sensor as described in chapter 5.5.
- 5) Call function get\_pressure: name.get\_pressure(p\_dout, t\_dout)

The sample code from section 5.13 gives an example of this workflow.



#### **5.10 READ-OUT OF CALIBRATION PARAMETERS**

For converting raw pressure data to physical values, four calibration parameters have to be retrieved from the OTP of the sensor.

#### Set up of OTP read:

- 1) Send I<sup>2</sup>C write header 0xC6
- 2) Send command 0xC595 (move pointer in address register)
- 3) Send address parameter together with its CRC 0x00669C

Steps 1) -3) can be executed on many platforms by a single I<sup>2</sup>C write of the value 0xC59500669C.

## Read out parameters:

Repeat the following procedure 4 times:

- a) Send I<sup>2</sup>C write header 0xC6
- b) Send command 0xC7F7 (incremental read-out of OTP)
- c) Send I<sup>2</sup>C read header 0xC7
- d) Read 3B (2B of data and 1B of CRC)
- e) Decode data as 16bit big endian signed integer and store result into n-th calibration parameter cn.

Steps a) to d) can be executed on many platforms by a single write 0xC7F7 to the chip address followed by a single read of 3 B from the chip address.

#### **5.11 SAMPLE CODE: EXAMPLE C SYNTAX**

```
/* data structure to hold pressure sensor related parameters */
typedef struct inv_invpres
 struct inv_invpres_serif serif;
 uint32_t min_delay_us;
 uint8_t pressure_en;
 uint8_t temperature_en;
  float sensor_constants[4]; // OTP values
 float p_Pa_calib[3];
 float LUT_lower;
 float LUT_upper;
 float quadr_factor;
 float offst_factor;
} inv_invpres_t;
int inv_invpres_init(struct inv_invpres * s)
 short otp[4];
 read_otp_from_i2c(s, otp);
init base(s, otp);
 return 0;
int read_otp_from_i2c(struct inv_invpres * s, short *out)
 unsigned char data_write[10];
 unsigned char data_read[10] = {0};
 int status;
 int i:
  // OTP Read mode
 data\_write[0] = 0xC5;
 data_write[1] = 0x95;
 data\_write[2] = 0x00;
 data_write[3] = 0x66;
 data_write[4] = 0x9C;
```



```
status = inv_invpres_serif_write_reg(&s->serif, ICC_ADDR_PRS, data_write, 5);
  if (status)
             return status;
  // Read OTP values
  for (i = 0; i < 4; i++) {
             data_write[0] = 0xC7;
             data_write[1] = 0xF7;
             status = inv_invpres_serif_write_reg(&s->serif, ICC_ADDR_PRS, data_write, 2);
             if (status)
                        return status:
             status = inv_invpres_serif_read_reg(&s->serif, ICC_ADDR_PRS, data_read, 3);
             if (status)
                        return status:
            out[i] = data_read[0]<<8 | data_read[1];</pre>
  return 0;
void init_base(struct inv_invpres * s, short *otp)
{
  int i;
  for(i = 0; i < 4; i++)
             s->sensor_constants[i] = (float)otp[i];
 s->p_Pa_calib[0] = 45000.0;
s->p_Pa_calib[1] = 80000.0;
  s \rightarrow p_p a_calib[2] = 105000.0;
  s->LUT_Lower = 3.5 * (1<<20);
s->LUT_upper = 11.5 * (1<<20);
  s->quadr_factor = 1 / 16777216.0;
  s->offst_factor = 2048.0;
}
// p_LSB -- Raw pressure data from sensor
// T_LSB -- Raw temperature data from sensor
int inv_invpres_process_data(struct inv_invpres * s, int p_LSB, int T_LSB,
                                                                    float * pressure, float * temperature)
{
  float t;
  float s1.s2.s3;
  float in[3];
  float out[3];
  float A,B,C;
  t = (float)(T_LSB - 32768);
  s1 = s->LUT_lower + (float)(s->sensor_constants[0] * t * t) * s->quadr_factor;
s2 = s->offst_factor * s->sensor_constants[3] + (float)(s->sensor_constants[1] * t * t) * s->quadr_factor;
  s3 = s->LUT_upper + (float)(s->sensor_constants[2] * t * t) * s->quadr_factor;
  in[0] = s1;
  in[1] = s2;
  in[2] = s3;
  calculate_conversion_constants(s, s->p_Pa_calib, in, out);
  A = out[0];
  B = out[1];
  C = out[2];
  *pressure = A + B / (C + p_LSB);
*temperature = -45.f + 175.f/65536.f * T_LSB;
  return 0;
// p_Pa -- List of 3 values corresponding to applied pressure in Pa
// p_LUT -- List of 3 values corresponding to the measured p_LUT values at the applied pressures.
void calculate_conversion_constants(struct inv_invpres * s, float *p_Pa,
                                                                                           float *p_LUT, float *out)
  float A,B,C;
   C = (p\_LUT[0] * p\_LUT[1] * (p\_Pa[0] - p\_Pa[1]) + \\ p\_LUT[1] * p\_LUT[2] * (p\_Pa[1] - p\_Pa[2]) + \\ p\_LUT[2] * p\_LUT[0] * (p\_Pa[2] - p\_Pa[0])) /
```



```
(p_LUT[2] * (p_Pa[0] - p_Pa[1]) +
             p_LUT[0] * (p_Pa[1] - p_Pa[2]) +
p_LUT[1] * (p_Pa[2] - p_Pa[0]));
A = (p\_Pa[0] * p\_LUT[0] - p\_Pa[1] * p\_LUT[1] - (p\_Pa[1] - p\_Pa[0]) * C) / (p\_LUT[0] - p\_LUT[1]); B = (p\_Pa[0] - A) * (p\_LUT[0] + C);
out[0] = A;
out[1] = B;
out[2] = C;
```

```
5.12 SAMPLE CODE: CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX)
class InvensensePressureConversion:
    """ Class for conversion of the pressure and temperature output of the Invensense sensor"""
   def __init__(self, sensor_constants):
       """ Initialize customer formula
       Arguments:
       sensor_constants -- list of 4 integers: [c1, c2, c3, c4]
       self.sensor_constants = sensor_constants
       # configuration for ICP-10111 Samples
       self.p_Pa_calib = [45000.0, 80000.0, 105000.0]
       self.LUT_lower = 3.5 * (2**20)
       self.LUT\_upper = 11.5 * (2**20)
       self.quadr_factor = 1 / 16777216.0
       self.offst_factor = 2048.0
    def calculate_conversion_constants(self, p_Pa, p_LUT):
        """ calculate temperature dependent constants
       Arguments:
       p Pa -- List of 3 values corresponding to applied pressure in Pa
       p_LUT -- List of 3 values corresponding to the measured p_LUT values at the applied pressures.
       ....
       C = (p_LUT[0] * p_LUT[1] * (p_Pa[0] - p_Pa[1]) +
            p_LUT[1] * p_LUT[2] * (p_Pa[1] - p_Pa[2]) +
            p_LUT[2] * p_LUT[0] * (p_Pa[2] - p_Pa[0])) / \
           (p_LUT[2] * (p_Pa[0] - p_Pa[1]) +
            p_LUT[0] * (p_Pa[1] - p_Pa[2]) +
            p_LUT[1] * (p_Pa[2] - p_Pa[0]))
       A = (p_{a[0]} * p_{u[0]} - p_{a[1]} * p_{u[1]} - (p_{a[1]} - p_{a[0]}) * C) / (p_{u[0]} - p_{u[1]})
       B = (p_Pa[0] - A) * (p_LUT[0] + C)
       return [A, B, C]
    def get_pressure(self, p_LSB, T_LSB):
```



""" Convert an output from a calibrated sensor to a pressure in Pa. Arguments: p\_LSB -- Raw pressure data from sensor T\_LSB -- Raw temperature data from sensor  $t = T_LSB - 32768.0$ s1 = self.LUT\_lower + float(self.sensor\_constants[0] \* t \* t) \* self.quadr\_factor s2 = self.offst\_factor \* self.sensor\_constants[3] + float(self.sensor\_constants[1] \* t \* t) \* self.quadr\_factor s3 = self.LUT\_upper + float(self.sensor\_constants[2] \* t \* t) \* self.quadr\_factor A, B, C = self.calculate\_conversion\_constants(self.p\_Pa\_calib, [s1, s2, s3]) return A + B /  $(C + p_LSB)$ [end of the pseudocode] 5.13 SAMPLE CODE: USING CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX) def read\_otp\_from\_i2c(): # TODO: implement read from I2C # refer to data sheet for I2C commands to read OTP return 1000, 2000, 3000, 4000 def read\_raw\_pressure\_temp\_from\_i2c(): # TODO: implement read from I2C # refer to data sheet for I2C commands to read pressure and temperature return 8000000, 32000 # Sample code to read from Invensense\_pressure\_conversion import Invensense\_pressure\_conversion # -- initialization c1, c2, c3, c4 = read\_otp\_from\_i2c() conversion = Invensense\_pressure\_conversion([c1, c2, c3, c4]) # -- read raw pressure and temp data, calculate pressure p, T = read\_raw\_pressure\_temp\_from\_i2c() pressure = conversion.get\_pressure(p, T) print 'Pressure: %f' % pressure [end of the pseudocode] 5.14 COMMUNICATION DATA SEQUENCES 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 0 <del>X</del> ICP-10111 measuring 1 1 0 0 0 0 1 0 1 0 0 0 0 0 1 0 1 1 0 0 1


I2C address + write

S


Measurement command

Measurement in progress


Measurement command

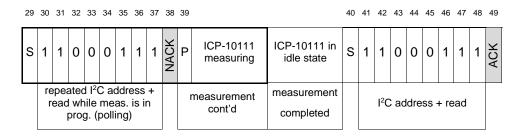


50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76



 $77 \ \ 78 \ \ 79 \ \ 80 \ \ 81 \ \ 82 \ \ 83 \ \ 84 \ \ 85 \ \ 86 \ \ 87 \ \ 88 \ \ 89 \ \ 90 \ \ 91 \ \ 92 \ \ 93 \ \ 94 \ \ 95 \ \ 96 \ \ 97 \ \ 98 \ \ 99 \ \ 100 \ 101 \ 102 \ 103$ 





**Figure 5. Communication Data Sequences** 



## 6 ASSEMBLY

This section provides general guidelines for assembling TDK-InvenSense Micro Electro-Mechanical Systems (MEMS) pressure sensors.

## 6.1 IMPLEMENTATION AND USAGE RECOMMENDATIONS

## **Soldering**

When soldering, use the standard soldering profile IPC/JEDEC J-STD-020 with peak temperatures of 260°C. ICP-10111 may exhibit a pressure offset after soldering, some settling time may be required depending on soldering properties, PCB properties, and ambient conditions.

The ICP-10111 is an open cavity package, it is mandatory to use no-clean solder paste and no board wash should be applied.

## **Chemical Exposure and Sensor Protection**


The ICP-10111 is an open cavity package, and should not be exposed to particulates or liquids. If any type of protective coating must be applied to the circuit board, the sensor must be protected during the coating process.

Page 22 of 31




# 7 PACKAGE DIMENSIONS

Package dimensions for the ICP-10110 & ICP-10111:

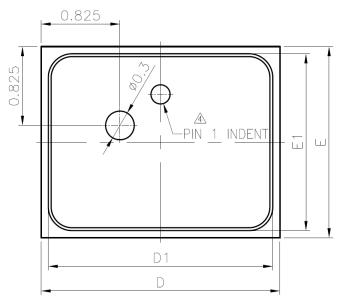

Top View: ICP-10111

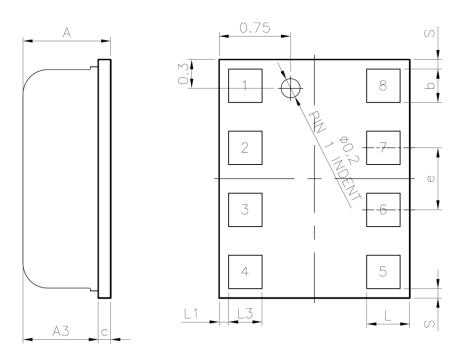

Bottom View: ICP-10111

Figure 6. ICP-10111 Package Diagrams



| SYMBOLS   | DIMENSIONS IN MILLIMETERS |           |      |  |
|-----------|---------------------------|-----------|------|--|
| STIVIDULS | MIN.                      | NOM.      | MAX. |  |
| А         | 0.84                      | 0.92      | 1.00 |  |
| A3        |                           | 0.79 REF. |      |  |
| b         |                           | 0.35      |      |  |
| С         |                           | 0.13 REF. |      |  |
| E         | 1.90                      | 2.00      | 2.10 |  |
| E1        |                           | 1.85      |      |  |
| D         | 2.40                      | 2.50      | 2.60 |  |
| D1        |                           | 2.35      |      |  |
| е         |                           | 0.65      |      |  |
| L         | 0.35                      | 0.45      | 0.55 |  |
| L1        | 0.05                      | 0.10      | 0.15 |  |
| L3        | 0.30                      | 0.35      | 0.40 |  |
| S         |                           | 0.10      |      |  |

Table 17. ICP-10111 Package Dimensions

Recommended PCB land pattern for the ICP-10111:


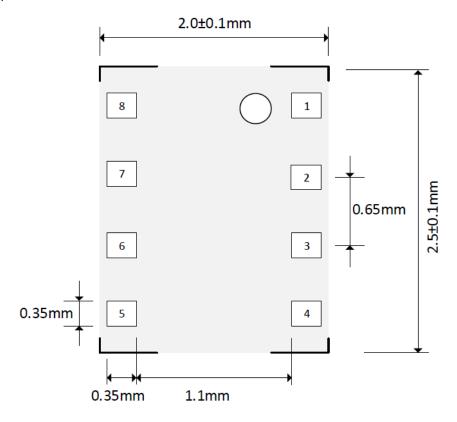


Figure 7. ICP-10111 recommended PCB land pattern

Product artwork for the ICP-10111:



Package Artwork: ICP-10111

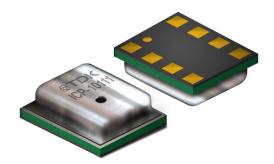

# 8 PART NUMBER PART MARKINGS

The part number part markings for ICP-10111 devices are summarized below:

| PART NUMBER | PART MARKING |  |
|-------------|--------------|--|
| ICP-10111   | P6           |  |

**Table 18. Part Number Part Markings** 

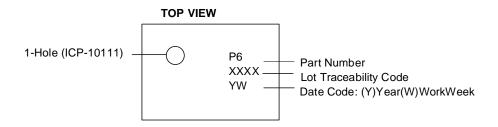


Figure 8. Part Number Part Markings for 2x2.5mm (ICP-10111)

# 9 TAPE & REEL SPECIFICATION

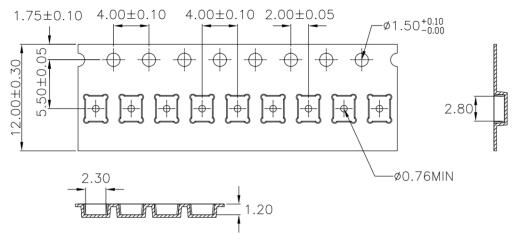
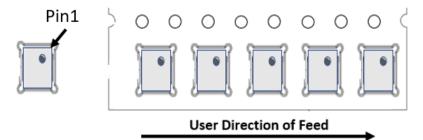


Figure 9. ICP-10111 Tape Dimensions



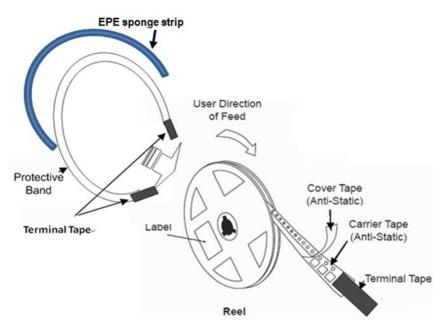


Figure 10. ICP-10111 Tape and Reel Drawing



# 10 ORDERING GUIDE

|   | PART       | TEMP RANGE     | PACKAGE BODY        | PACKAGE LID | QUANTITY | PACKAGING         |
|---|------------|----------------|---------------------|-------------|----------|-------------------|
| Ī | ICP-10111† | -40°C to +85°C | 2x2.5x0.92mm LGA-8L | 1-Hole      | 10,000   | 13" Tape and Reel |

<sup>†</sup>Denotes RoHS and Green-Compliant Package



# 11 REFERENCES

Please refer to "InvenSense MEMS Handling Application Note (AN-IVS-0002A-00)" for the following information:

- Manufacturing Recommendations
  - Assembly Guidelines and Recommendations
  - o PCB Design Guidelines and Recommendations
  - o MEMS Handling Instructions
  - o ESD Considerations
  - o Reflow Specification
  - o Storage Specifications
  - o Package Marking Specification
  - o Reel & Pizza Box Label
  - o Packaging
  - o Representative Shipping Carton Label
- Compliance
  - o Environmental Compliance
  - DRC Compliance
  - o Compliance Declaration Disclaimer



# 12 REVISION HISTORY

| Revision Date | Revision | Description  |
|---------------|----------|--|
| 01/11/2017    | 0.1      | Initial Release  |
| 01/17/2017    | 0.2      | Updated Sections 6, 7  |
| 10/02/2020    | 1.0      | Updated all sections   |
| 10/07/2020    | 1.1      | Updated document title   |
| 04/06/2021    | 1.2      | Updated Long-Term Drift specification (Table 3).                                 |
| 05/03/2021    | 1.3      | Added MSL information (Cover Page); Added Tape & Reel Specification (Section 9). |



This information furnished by InvenSense, Inc. ("InvenSense") is believed to be accurate and reliable. However, no responsibility is assumed by InvenSense for its use, or for any infringements of patents or other rights of third parties that may result from its use. Specifications are subject to change without notice. InvenSense reserves the right to make changes to this product, including its circuits and software, in order to improve its design and/or performance, without prior notice. InvenSense makes no warranties, neither expressed nor implied, regarding the information and specifications contained in this document. InvenSense assumes no responsibility for any claims or damages arising from information contained in this document, or from the use of products and services detailed therein. This includes, but is not limited to, claims or damages based on the infringement of patents, copyrights, mask work and/or other intellectual property rights.

Certain intellectual property owned by InvenSense and described in this document is patent protected. No license is granted by implication or otherwise under any patent or patent rights of InvenSense. This publication supersedes and replaces all information previously supplied. Trademarks that are registered trademarks are the property of their respective companies. InvenSense sensors should not be used or sold in the development, storage, production or utilization of any conventional or mass-destructive weapons or for any other weapons or life threatening applications, as well as in any other life critical applications such as medical equipment, transportation, aerospace and nuclear instruments, undersea equipment, power plant equipment, disaster prevention and crime prevention equipment.

©2021 InvenSense. All rights reserved. InvenSense, MotionTracking, MotionProcessing, MotionProcessor, MotionFusion, MotionApps, DMP, AAR, and the InvenSense logo are trademarks of InvenSense, Inc. The TDK logo is a trademark of TDK Corporation. Other company and product names may be trademarks of the respective companies with which they are associated.



©2021 InvenSense. All rights reserved.