1. Description


1.1. Project

Project Name	Nicolas_Lum
Board Name	NUCLEO-F429ZI
Generated with:	STM32CubeMX 5.2.0
Date	05/29/2019

1.2. MCU

MCU Series	STM32F4
MCU Line	STM32F429/439
MCU name	STM32F429ZITx
MCU Package	LQFP144
MCU Pin number	144


2. Pinout Configuration

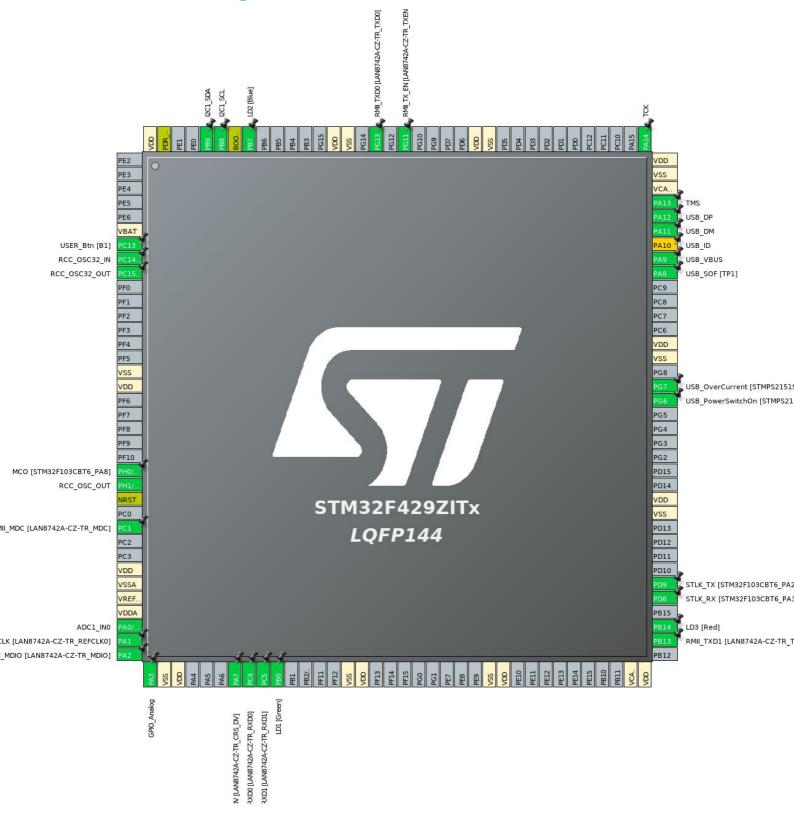

3. Pins Configuration


Pin Number	Pin Number Pin Name		Alternate	Label
LQFP144	(function after		Function(s)	
	reset)			
6	VBAT	Power		
7	PC13	I/O	GPIO_EXTI13	USER_Btn [B1]
8	PC14/OSC32_IN	I/O	RCC_OSC32_IN	
9	PC15/OSC32_OUT	I/O	RCC_OSC32_OUT	
16	VSS	Power		
17	VDD	Power		
23	PH0/OSC_IN	I/O	RCC_OSC_IN	MCO [STM32F103CBT6_PA8]
24	PH1/OSC_OUT	I/O	RCC_OSC_OUT	
25	NRST	Reset		
27	PC1	I/O	ETH_MDC	RMII_MDC [LAN8742A-CZ- TR_MDC]
30	VDD	Power		
31	VSSA	Power		
32	VREF+	Power		
33	VDDA	Power		
34	PA0/WKUP	I/O	ADC1_IN0	
35	PA1	I/O	ETH_REF_CLK	RMII_REF_CLK [LAN8742A-CZ- TR_REFCLK0]
36	PA2	I/O	ETH_MDIO	RMII_MDIO [LAN8742A-CZ- TR_MDIO]
37	PA3 *	I/O	GPIO_Analog	
38	VSS	Power		
39	VDD	Power		
43	PA7	I/O	ETH_CRS_DV	RMII_CRS_DV [LAN8742A- CZ-TR_CRS_DV]
44	PC4	I/O	ETH_RXD0	RMII_RXD0 [LAN8742A-CZ- TR_RXD0]
45	PC5	I/O	ETH_RXD1	RMII_RXD1 [LAN8742A-CZ- TR_RXD1]
46	PB0 *	I/O	GPIO_Output	LD1 [Green]
51	VSS	Power		
52	VDD	Power		
61	VSS	Power		
62	VDD	Power		
71	VCAP_1	Power		

Pin Number LQFP144	Pin Name (function after	Pin Type	Alternate Function(s)	Label
	reset)			
72	VDD	Power		
74	PB13	I/O	ETH_TXD1	RMII_TXD1 [LAN8742A-CZ- TR_TXD1]
75	PB14 *	I/O	GPIO_Output	LD3 [Red]
77	PD8	I/O	USART3_TX	STLK_RX [STM32F103CBT6_PA3]
78	PD9	I/O	USART3_RX	STLK_TX [STM32F103CBT6_PA2]
83	VSS	Power		
84	VDD	Power		
91	PG6 *	I/O	GPIO_Output	USB_PowerSwitchOn [STMPS2151STR_EN]
92	PG7 *	I/O	GPIO_Input	USB_OverCurrent [STMPS2151STR_FAULT]
94	VSS	Power		
95	VDD	Power		
100	PA8	I/O	USB_OTG_FS_SOF	USB_SOF [TP1]
101	PA9	I/O	USB_OTG_FS_VBUS	USB_VBUS
102	PA10 **	I/O	USB_OTG_FS_ID	USB_ID
103	PA11	I/O	USB_OTG_FS_DM	USB_DM
104	PA12	I/O	USB_OTG_FS_DP	USB_DP
105	PA13	I/O	SYS_JTMS-SWDIO	TMS
106	VCAP_2	Power		
107	VSS	Power		
108	VDD	Power		
109	PA14	I/O	SYS_JTCK-SWCLK	TCK
120	VSS	Power		
121	VDD	Power		
126	PG11	I/O	ETH_TX_EN	RMII_TX_EN [LAN8742A- CZ-TR_TXEN]
128	PG13	I/O	ETH_TXD0	RMII_TXD0 [LAN8742A-CZ- TR_TXD0]
130	VSS	Power		
131	VDD	Power		
137	PB7 *	I/O	GPIO_Output	LD2 [Blue]
138	BOOT0	Boot		
139	PB8	I/O	I2C1_SCL	
140	PB9	I/O	I2C1_SDA	
143	PDR_ON	Reset		
144	VDD	Power		



^{**} The pin is affected with a peripheral function but no peripheral mode is activated

4. Clock Tree Configuration

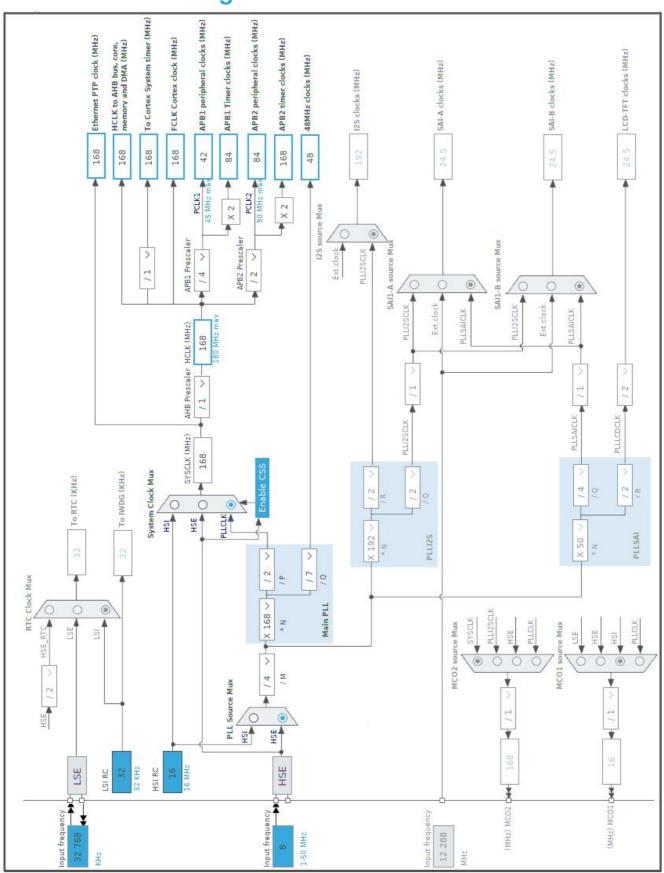

5. Software Project

5.1. Project Settings

Name	Value	
Project Name	Nicolas_Lum	
Project Folder	/home/damien/Documents/NUCLEO/Nicolas_Lum	
Toolchain / IDE	TrueSTUDIO	
Firmware Package Name and Version	STM32Cube FW_F4 V1.24.1	

5.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy only the necessary library files
Generate peripheral initialization as a pair of '.c/.h' files	Yes
Backup previously generated files when re-generating	Yes
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power	No
consumption)	

6. Power Consumption Calculator report

6.1. Microcontroller Selection

Series	STM32F4
Line	STM32F429/439
MCU	STM32F429ZITx
Datasheet	024030_Rev9

6.2. Parameter Selection

Temperature	25
Vdd	3.6

7. IPs and Middleware Configuration 7.1. ADC1

mode: IN0

7.1.1. Parameter Settings:

ADCs_Common_Settings:

Mode Independent mode

ADC_Settings:

Clock Prescaler PCLK2 divided by 4

Resolution 12 bits (15 ADC Clock cycles)

Data Alignment Right alignment

Scan Conversion Mode Disabled
Continuous Conversion Mode Disabled
Discontinuous Conversion Mode Disabled
DMA Continuous Requests Disabled

End Of Conversion Selection EOC flag at the end of single channel conversion

ADC_Regular_ConversionMode:

Number Of Conversion 1

External Trigger Conversion Source Regular Conversion launched by software

External Trigger Conversion Edge None Rank 1

Channel Channel 0
Sampling Time 3 Cycles

ADC_Injected_ConversionMode:

Number Of Conversions 0

WatchDog:

Enable Analog WatchDog Mode false

7.2. ETH

Mode: RMII

7.2.1. Parameter Settings:

Advanced : Ethernet Media Configuration:

Auto Negotiation Enabled

General: Ethernet Configuration:

Ethernet MAC Address 00:80:E1:00:00:00

PHY Address 0 *

Ethernet Basic Configuration:

Rx Mode Polling Mode
TX IP Header Checksum Computation By hardware

7.2.2. Advanced Parameters:

External PHY Configuration:

PHY LAN8742A_PHY_ADDRESS

PHY Address Value 0

PHY Reset delay these values are based on a 1 ms

Systick interrupt

0x000000FF *

PHY Configuration delay

PHY Read TimeOut

Ox0000FFF *

PHY Write TimeOut

Ox0000FFF *

Common: External PHY Configuration:

Transceiver Basic Control Register 0x00 * Transceiver Basic Status Register 0x01 * **PHY Reset** 0x8000 * Select loop-back mode 0x4000 * Set the full-duplex mode at 100 Mb/s 0x2100 * Set the half-duplex mode at 100 Mb/s 0x2000 * Set the full-duplex mode at 10 Mb/s 0x0100 * Set the half-duplex mode at 10 Mb/s 0x0000 * Enable auto-negotiation function 0x1000 * Restart auto-negotiation function 0x0200 * Select the power down mode 0x0800 * Isolate PHY from MII 0x0400 * Auto-Negotiation process completed 0x0020 * Valid link established 0x0004 * Jabber condition detected 0x0002 *

Extended: External PHY Configuration:

PHY special control/status register Offset

Ox1F *

PHY Speed mask

Ox0004 *

PHY Duplex mask

Ox0010 *

PHY Interrupt Source Flag register Offset

Ox001D *

PHY Link down inturrupt

Ox000B *

7.3. I2C1

12C: 12C

7.3.1. Parameter Settings:

Master Features:

I2C Speed Mode Standard Mode

I2C Clock Speed (Hz) 100000

Timing configuration:

Coefficient of Digital Filter 0

Analog Filter Enabled

Slave Features:

Clock No Stretch Mode Disabled
Primary Address Length selection 7-bit
Dual Address Acknowledged Disabled
Primary slave address 0
General Call address detection Disabled

7.4. RCC

High Speed Clock (HSE): BYPASS Clock Source

Low Speed Clock (LSE): Crystal/Ceramic Resonator

7.4.1. Parameter Settings:

System Parameters:

VDD voltage (V) 3.3
Instruction Cache Enabled
Prefetch Buffer Enabled
Data Cache Enabled

Flash Latency(WS) 5 WS (6 CPU cycle)

RCC Parameters:

HSI Calibration Value 16

TIM Prescaler Selection Disabled

HSE Startup Timout Value (ms) 100

LSE Startup Timout Value (ms) 5000

Power Parameters:

Power Regulator Voltage Scale Power Regulator Voltage Scale 1

Power Over Drive Disabled

7.5. SYS

Debug: Serial Wire

Timebase Source: TIM8

7.6. USART3

Mode: Asynchronous

7.6.1. Parameter Settings:

Basic Parameters:

Baud Rate 115200

Word Length 8 Bits (including Parity)

Parity None
Stop Bits 1

Advanced Parameters:

Data Direction Receive and Transmit

Over Sampling 16 Samples

7.7. USB_OTG_FS

Mode: Device_Only mode: Activate_SOF mode: Activate_VBUS

7.7.1. Parameter Settings:

Speed Device Full Speed 12MBit/s

Low powerDisabledLink Power ManagementDisabledVBUS sensingEnabledSignal start of frameEnabled

7.8. FREERTOS

Interface: CMSIS_V1

7.8.1. Config parameters:

API:

FreeRTOS API CMSIS v1

Versions:

FreeRTOS version 10.0.1 CMSIS-RTOS version 1.02

Kernel settings:

USE_PREEMPTION Enabled

CPU_CLOCK_HZ SystemCoreClock

TICK_RATE_HZ 1000 7 MAX_PRIORITIES 128 MINIMAL_STACK_SIZE MAX_TASK_NAME_LEN 16 USE_16_BIT_TICKS Disabled Enabled IDLE_SHOULD_YIELD USE_MUTEXES Enabled Disabled USE_RECURSIVE_MUTEXES Disabled USE_COUNTING_SEMAPHORES 8 QUEUE_REGISTRY_SIZE USE_APPLICATION_TASK_TAG Disabled Enabled Enabled

ENABLE_BACKWARD_COMPATIBILITY Enabled
USE_PORT_OPTIMISED_TASK_SELECTION Enabled
USE_TICKLESS_IDLE Disabled
USE_TASK_NOTIFICATIONS Enabled
RECORD_STACK_HIGH_ADDRESS Disabled

Memory management settings:

Memory Allocation Dynamic / Static

TOTAL_HEAP_SIZE 15360

Memory Management scheme heap_4

Hook function related definitions:

USE_IDLE_HOOK Disabled
USE_TICK_HOOK Disabled
USE_MALLOC_FAILED_HOOK Disabled
USE_DAEMON_TASK_STARTUP_HOOK Disabled
CHECK_FOR_STACK_OVERFLOW Disabled

Run time and task stats gathering related definitions:

GENERATE_RUN_TIME_STATS Disabled
USE_TRACE_FACILITY Disabled
USE_STATS_FORMATTING_FUNCTIONS Disabled

Co-routine related definitions:

USE_CO_ROUTINES Disabled

MAX_CO_ROUTINE_PRIORITIES 2

Software timer definitions:

USE_TIMERS Disabled

Interrupt nesting behaviour configuration:

LIBRARY_LOWEST_INTERRUPT_PRIORITY 15
LIBRARY_MAX_SYSCALL_INTERRUPT_PRIORITY 5

7.8.2. Include parameters:

Include definitions:

vTaskPrioritySet Enabled Enabled uxTaskPriorityGet Enabled vTaskDelete Disabled vTaskCleanUpResources Enabled vTaskSuspend Disabled vTaskDelayUntil vTaskDelay Enabled xTaskGetSchedulerState Enabled xTaskResumeFromISREnabled xQueueGetMutexHolder Disabled Disabled xSemaphoreGetMutexHolder Disabled pcTaskGetTaskName uxTaskGetStackHighWaterMark Disabled xTaskGetCurrentTaskHandle Disabled eTaskGetState Disabled xEventGroupSetBitFromISR Disabled xTimerPendFunctionCall Disabled xTaskAbortDelay Disabled xTaskGetHandle Disabled

* User modified value

8. System Configuration

8.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
ADC1	PA0/WKUP	ADC1_IN0	Analog mode	No pull-up and no pull-down	n/a	
ETH	PC1	ETH_MDC	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_MDC [LAN8742A- CZ-TR_MDC]
	PA1	ETH_REF_CLK	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_REF_CLK [LAN8742A-CZ- TR_REFCLK0]
	PA2	ETH_MDIO	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_MDIO [LAN8742A- CZ-TR_MDIO]
	PA7	ETH_CRS_DV	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_CRS_DV [LAN8742A-CZ- TR_CRS_DV]
	PC4	ETH_RXD0	Alternate Function Push Pull	No pull-up and no pull-down	Very High *	RMII_RXD0 [LAN8742A- CZ-TR_RXD0]
	PC5	ETH_RXD1	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_RXD1 [LAN8742A- CZ-TR_RXD1]
	PB13	ETH_TXD1	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_TXD1 [LAN8742A- CZ-TR_TXD1]
	PG11	ETH_TX_EN	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_TX_EN [LAN8742A- CZ-TR_TXEN]
	PG13	ETH_TXD0	Alternate Function Push Pull	No pull-up and no pull-down	Very High	RMII_TXD0 [LAN8742A- CZ-TR_TXD0]
I2C1	PB8	I2C1_SCL	Alternate Function Open Drain	Pull-up	Very High	
	PB9	I2C1_SDA	Alternate Function Open Drain	Pull-up	Very High	
RCC	PC14/OSC3 2_IN	RCC_OSC32_IN	n/a	n/a	n/a	
	PC15/OSC3 2_OUT	RCC_OSC32_O UT	n/a	n/a	n/a	
	PH0/OSC_I	RCC_OSC_IN	n/a	n/a	n/a	MCO [STM32F103CBT6_PA8]
	PH1/OSC_O UT	RCC_OSC_OUT	n/a	n/a	n/a	
SYS	PA13	SYS_JTMS- SWDIO	n/a	n/a	n/a	TMS
	PA14	SYS_JTCK-	n/a	n/a	n/a	TCK

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
		SWCLK				
USART3	PD8	USART3_TX	Alternate Function Push Pull	Pull-up	Very High	STLK_RX [STM32F103CBT6_PA3]
	PD9	USART3_RX	Alternate Function Push Pull	Pull-up	Very High	STLK_TX [STM32F103CBT6_PA2]
USB_OTG_ FS	PA8	USB_OTG_FS_ SOF	Alternate Function Push Pull	No pull-up and no pull-down	Very High	USB_SOF [TP1]
	PA9	USB_OTG_FS_ VBUS	Input mode	No pull-up and no pull-down	n/a	USB_VBUS
	PA11	USB_OTG_FS_ DM	Alternate Function Push Pull	No pull-up and no pull-down	Very High	USB_DM
	PA12	USB_OTG_FS_ DP	Alternate Function Push Pull	No pull-up and no pull-down	Very High	USB_DP
Single Mapped Signals	PA10	USB_OTG_FS_I D	Alternate Function Push Pull	No pull-up and no pull-down	Very High	USB_ID
GPIO	PC13	GPIO_EXTI13	External Interrupt Mode with Rising edge trigger detection	No pull-up and no pull-down	n/a	USER_Btn [B1]
	PA3	GPIO_Analog	Analog mode	No pull-up and no pull-down	n/a	
	PB0	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD1 [Green]
	PB14	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD3 [Red]
	PG6	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	USB_PowerSwitchOn [STMPS2151STR_EN]
	PG7	GPIO_Input	Input mode	No pull-up and no pull-down	n/a	USB_OverCurrent [STMPS2151STR_FAULT]
	PB7	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD2 [Blue]

8.2. DMA configuration

nothing configured in DMA service

8.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority	
Non maskable interrupt	true 0		0	
Hard fault interrupt	true	0	0	
Memory management fault	true	0	0	
Pre-fetch fault, memory access fault	true	0	0	
Undefined instruction or illegal state	true	0	0	
System service call via SWI instruction	true	0	0	
Debug monitor	true	0	0	
Pendable request for system service	true	15	0	
System tick timer	true	15	0	
TIM8 update interrupt and TIM13 global interrupt	true 0		0	
PVD interrupt through EXTI line 16	unused			
Flash global interrupt	unused			
RCC global interrupt		unused		
ADC1, ADC2 and ADC3 global interrupts		unused		
I2C1 event interrupt		unused		
I2C1 error interrupt		unused		
USART3 global interrupt		unused		
EXTI line[15:10] interrupts		unused		
Ethernet global interrupt	unused			
Ethernet wake-up interrupt through EXTI line 19		unused		
USB On The Go FS global interrupt	unused			
FPU global interrupt	unused			

^{*} User modified value

9. Software Pack Report