


Handson Technology

User Guide

L298N Dual H-Bridge Motor Driver

This dual bidirectional motor driver, is based on the very popular L298 Dual H-Bridge Motor Driver Integrated Circuit. The circuit will allow you to easily and independently control two motors of up to 2A each in both directions. It is ideal for robotic applications and well suited for connection to a microcontroller requiring just a couple of control lines per motor. It can also be interfaced with simple manual switches, TTL logic gates, relays, etc. This board equipped with power LED indicators, on-board +5V regulator and protection diodes.

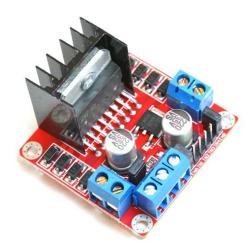


SKU: MDU-1049

Brief Data:

- Input Voltage: 3.2V~40Vdc.
- Driver: L298N Dual H Bridge DC Motor Driver
- Power Supply: DC 5 V 35 V
- Peak current: 2 Amp
- Operating current range: 0 ~ 36mA
- Control signal input voltage range:
- Low: $-0.3V \leq Vin \leq 1.5V$.
- High: $2.3V \leq Vin \leq Vss$.
- Enable signal input voltage range:
 - o Low: $-0.3 \le \text{Vin} \le 1.5\text{V}$ (control signal is invalid).
 - o High: $2.3V \le Vin \le Vss$ (control signal active).
- Maximum power consumption: 20W (when the temperature $T = 75 \,^{\circ}\text{C}$).
- Storage temperature: -25 °C ~ +130 °C.
- On-board +5V regulated Output supply (supply to controller board i.e. Arduino).
- Size: 3.4cm x 4.3cm x 2.7cm


Schematic Diagram:

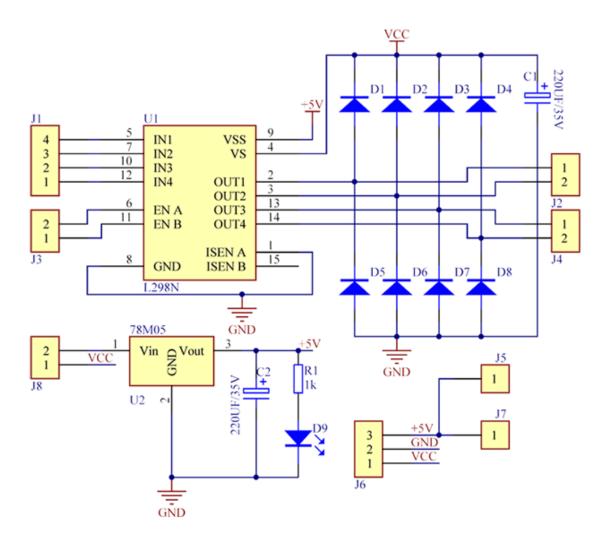



Enable	Input 1	Input 2	Description
0	Χ	Χ	Motor A off
1	0	0	Motor A stopped
1	0	1	Motor A on moving backward
1	1	0	Motor A on moving forward
1	1	1	Motor A stopped


Enable	Input 1	Input 2	Description
0	Χ	X	Motor B off
1	0	0	Motor B stopped
1	0	1	Motor B on moving backward
1	1	0	Motor B on moving forward
1	1	1	Motor B stopped

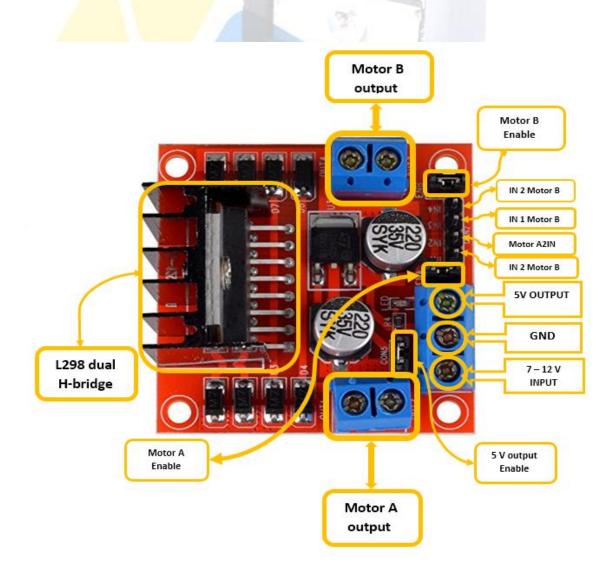

Connection Examples:

Controlling 2-DC Motor with +5V Arduino onboard Power Supply:

Below is the circuit connection use the on-board +5V power supply from Arduino board, and should be done without the 5V Enable Jumper on (Active 5V). This connection can drive two 5V DC motors simultaneously.

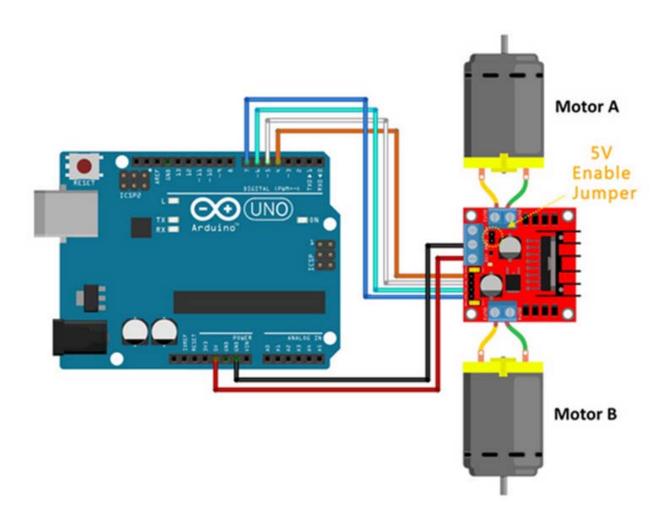

Sketch Listing:

Copy and paste the sketch below to Arduino IDE and upload to Arduino Uno/Mega board.

```
: Handson Technology
  Author
  Project
          : Arduino Uno
  Description: L298N Motor Driver
  Source-Code : L298N_Motor.ino
  Program: Control 2 DC motors using L298N H Bridge Driver
//----
// Definitions Arduino pins connected to input H Bridge
int IN1 = 4;
int IN2 = 5;
int IN3 = 6;
int IN4 = 7;
void setup()
// Set the output pins
```


```
pinMode(IN1, OUTPUT);
pinMode(IN2, OUTPUT);
pinMode(IN3, OUTPUT);
pinMode(IN4, OUTPUT);
void loop()
 // Rotate the Motor A clockwise
digitalWrite(IN1, HIGH);
digitalWrite(IN2, LOW);
delay(2000);
 // Motor A
digitalWrite(IN1, HIGH);
digitalWrite(IN2, HIGH);
delay(500);
 // Rotate the Motor B clockwise
digitalWrite(IN3, HIGH);
digitalWrite(IN4, LOW);
delay(2000);
 // Motor B
digitalWrite(IN3, HIGH);
digitalWrite(IN4, HIGH);
delay(500);
 // Rotates the Motor A counter-clockwise
digitalWrite(IN1, LOW);
 digitalWrite(IN2, HIGH);
delay(2000);
 // Motor A
digitalWrite(IN1, HIGH);
digitalWrite(IN2, HIGH);
delay(500);
 // Rotates the Motor B counter-clockwise
digitalWrite(IN3, LOW);
digitalWrite(IN4, HIGH);
delay(2000);
// Motor B
digitalWrite(IN3, HIGH);
digitalWrite(IN4, HIGH);
delay(500);
}
```

Controlling Stepper Motor

In this example we have a typical <u>NEMA-17</u> stepper motor with four wires:



The key to successful stepper motor control is identifying the wires - that is which one is which. You will need to determine the A+, A-, B+ and B- wires. With our example motor these are red, green, yellow and blue. Now let's get the wiring done.

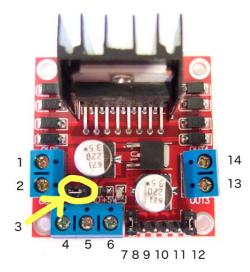


Connect the A+, A-, B+ and B- wires from the stepper motor to the module connections 1, 2, 13 and 14 respectively. Place the jumpers included with the L298N module over the pairs at module points 7 and 12. Then connect the power supply as required to points 4 (positive) and 5 (negative/GND).

Once again if your stepper motor's power supply is less than 12V, fit the jumper to the module at point 3 which gives you a neat 5V power supply for your Arduino.

Next, connect L298N module pins IN1, IN2, IN3 and IN4 to Arduino digital pins D8, D9, D10 and D11 respectively. Finally, connect Arduino GND to point 5 on the module, and Arduino 5V to point 6 if sourcing 5V from the module.

Controlling the stepper motor from your sketches is very simple, thanks to the *Stepper* Arduino library included with the Arduino IDE as standard.

To demonstrate your motor, simply load the "stepper_oneRevolution" sketch that is included with the Stepper library, for example:

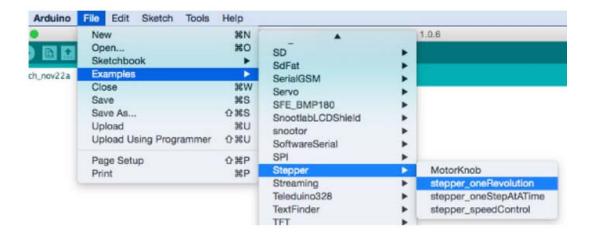

Finally, check the value for

```
const int stepsPerRevolution = 200;
```


in the sketch and change the 200 to the number of steps per revolution for your stepper motor, and also the speed which is preset to 60 RPM in the following line:

```
myStepper.setSpeed(60);
```

Now you can save and upload the sketch, which will send your stepper motor around one revolution, then back again. This is achieved with the function

```
myStepper.step(stepsPerRevolution); // for clockwise
myStepper.step(-stepsPerRevolution); // for anti-clockwise
```

Connection for the sketch "stepper_oneRevolution":

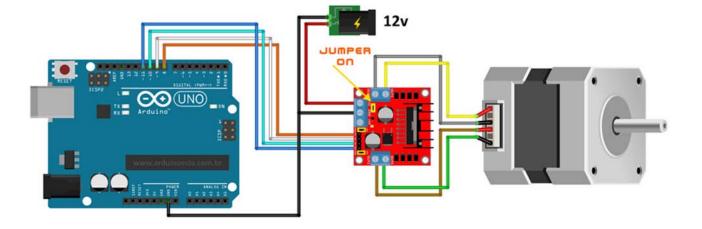

Web Resources: