


Willard InterContinental — Lobby Soft Goods

Existing vs proposed · Maggie O'Neill / Mariella Cruzado · Splendor Styling

28 September 2026 · Est 838 issued 18 September 2026 · Addendum still DRAFT

OPENINGS 1–4 · MARIELLA LABELED PHOTOGRAPH

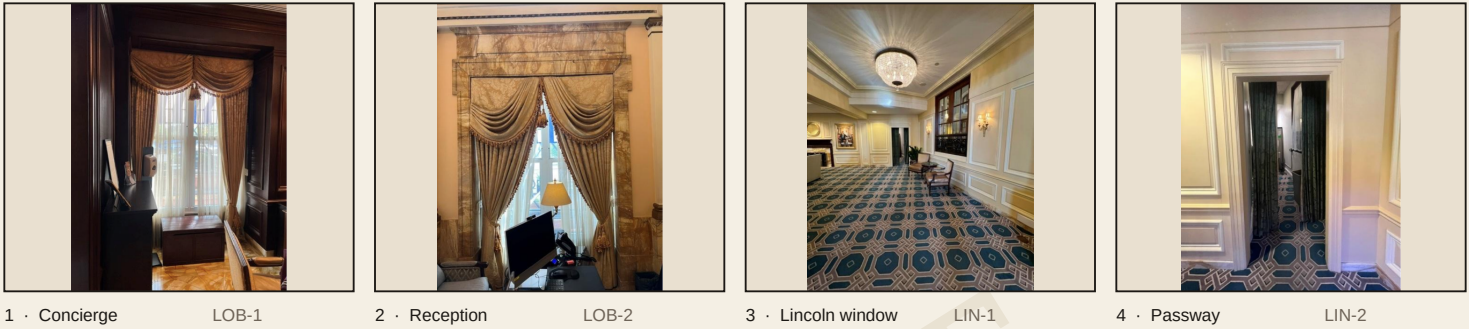

PROPOSED SCOPE · EST 838 BASE PLUS ADDENDUM INTENT

- 1 · LOB-1 Concierge.** Ripplefold pair, inside mount. Add a single wide swag with center tassel and bottom trim, leading-edge fringe, bullion tiebacks, and a sheer layer.
- 2 · LOB-2 Reception.** Same pair. Add double overlapping swags with center tassel and bottom trim, leading-edge fringe, bullion, and a sheer layer.
- 3 · LIN-1 Lincoln window.** Two stationary panels. Add a formal valance with tassel and trim — style not chosen — plus leading-edge fringe and bullion. No sheers.
- 4 · LIN-2 Passway.** Two double-sided panels. Leading-edge fringe and bullion only. No valance. No sheers.

FIELD SHEET VS EST 838 · SUBMITTED PRICES CONTROL

Item	June field sheet	Est 838 submitted	How this pack treats it
Lobby make	2 pairs @ 2W × 105" L	Each pair @ 2W × 106" L	Length not reconciled. Do not cut.
Lobby opening	72 3/16" W × 105 5/8" H, one outside size	Opening size not stated	Same field size shown on 1 and 2.
Lobby yardage	Main 27 yd · lining 23 yd	Main 13 1/2 + 13 1/2 yd · lining 25 yd	Main matches. Lining field is 2 yd less.
Lincoln window	2 panels, non-operable, 1 1/2 W, 73" × 125 1/2", 12 yd with lining	LIN-1 matches that make. Lining priced separate, 11 yd	Match. Field yardage is one scribble.
Passway	102 1/2" H, double-sided, 10 rings/panel, 2 @ 3W, 20 yd	LIN-2 matches. Width not on the estimate either	Match. Width still not measured.
Inside office	68 1/4" × 104 1/4", tracks 8 ft × 2, 72 carriers	Not on Est 838	Gap. Out of this lobby pack.

MONEY · EST 838 FIGURES AS SUBMITTED · ADDENDUM NOT LOCKED

EST 838 SUBMITTED \$4,824.09 Nelma estimate 18 Sep 2026. Deposit printed \$2,412.05.	ADDENDUM LINES · DRAFT \$5,266.34 BALLPARK \$2,531.00 · INV 909 anchor \$2,735.34.	COMBINED IF APPROVED \$10,090.43 Not a client total. 50% of addendum lines \$2,633.17 is draft.
---	---	--


Fabric scribbles on the June 9 sheet — Madalyn 30.50 and 49.95, Holloway 15.40 and 29.95 — are notes only. No COM is selected. Face fabric on Est 838 is client supplied, 58 1/2 yd.

PRESENTATION · Opening 1 · LOB-1

DRAFT

2 / 6

Opening 1 · Concierge Window

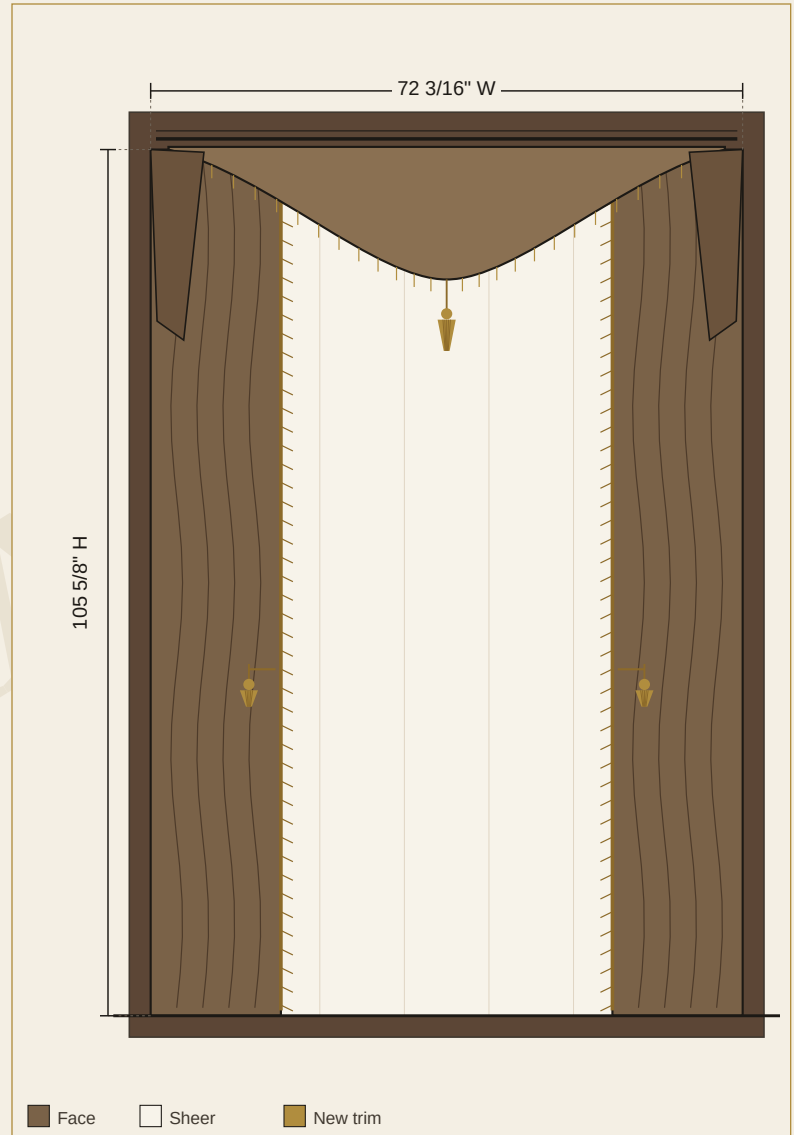*LOB-1 · single wide swag, ripplefold pair, sheers*EXISTING · PHOTOGRAPHPROPOSED · SCHEMATIC ELEVATIONFIELD

Outside opening 72 3/16" W × 105 5/8" H.
 Inside mount, ripplefold.
 Main fabric only, plus lining.
 Sheet totals 2 pairs @ 2W × 105" L.
 This window is one of those pairs.
 Main 27 yd and lining 23 yd are for both pairs together.

EST 838

Submitted \$1,074.75.
 1 pair @ 2W × 106" L, up to 120".
 Labor 4 widths @ \$114.00.
 Main 13 1/2 yd, client supplied.
 Napped lining 12 1/2 yd @ \$11.10.
 Track 10 ft unit, \$300.00. Rem / install \$180.00.
 Line note: replaces swag valance.

ADDENDUM

ADD-V1 swag / valance make \$425.00 BALLPARK.
 ADD-VT center tassel \$95.94 INV 909 unit.
 ADD-VF bottom trim \$125.00 BALLPARK. Trim COM.
 ADD-BT two bullion tiebacks @ \$95.94 INV 909.
 ADD-LE two leading edges @ \$210.00 INV 909. Trim COM.
 ADD-SH 4 sheer widths @ \$72.00 BALLPARK.
 ADD-SI sheer rem / install \$90.00 BALLPARK.


Opening 2 · Reception Window

LOB-2 · double overlapping swags, ripplefold pair, sheers

EXISTING · PHOTOGRAPH



PROPOSED · SCHEMATIC ELEVATION

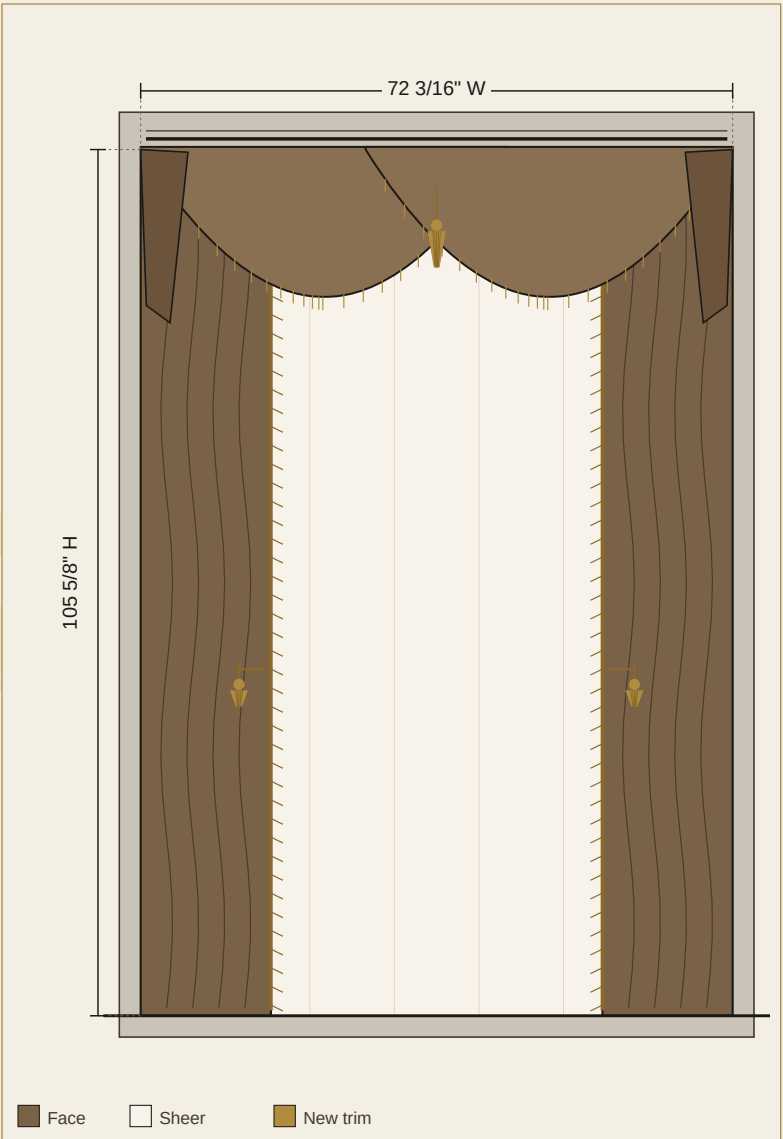

FIELD	EST 838	ADDENDUM
No separate reception size on the sheet.	Submitted \$1,074.75.	ADD-V2 double swags \$525.00 BALLPARK.
The one outside opening is used here: 72 3/16" × 105 5/8".	1 pair @ 2W × 106" L, up to 120".	ADD-VT center tassel \$95.94 INV 909 unit.
Inside mount, ripplefold.	Labor 4 widths @ \$114.00.	ADD-VF bottom trim \$125.00 BALLPARK. Trim COM.
Second pair of the sheet's 2 pairs @ 2W × 105" L.	Main 13 1/2 yd, client supplied.	ADD-BT two bullion tiebacks @ \$95.94 INV 909.
Confirm this window matches before cut.	Napped lining 12 1/2 yd @ \$11.10.	ADD-LE two leading edges @ \$210.00 INV 909.
	Track 10 ft unit, \$300.00. Rem / install \$180.00.	ADD-SH 4 sheer widths @ \$72.00 BALLPARK.
	Line note: replaces swag valance.	ADD-SI sheer rem / install \$90.00 BALLPARK.

Opening 3 · Lincoln Lobby Window

LIN-1 · stationary panels, formal valance still open, no sheers

EXISTING · PHOTOGRAPH




FIELD

2 panels, non-operable.
73" W × 125 1/2" H.
1 1/2 W per panel. Sheet wrote this as one-and-a-half widths.
12 yd with lining — one scribble, not a split.

EST 838

Submitted \$1,210.02.
2 panels @ 1 1/2 W × 125 1/2" L.
Labor 3 widths @ \$150.00, over 120" length.
Main 12 yd, client supplied.
Lining 11 yd @ \$10.74.
Two holdback cylinders @ \$35.94.
Hardware set \$420.00, finish TBD.
Removal and installation \$150.00.

PROPOSED · SCHEMATIC ELEVATION

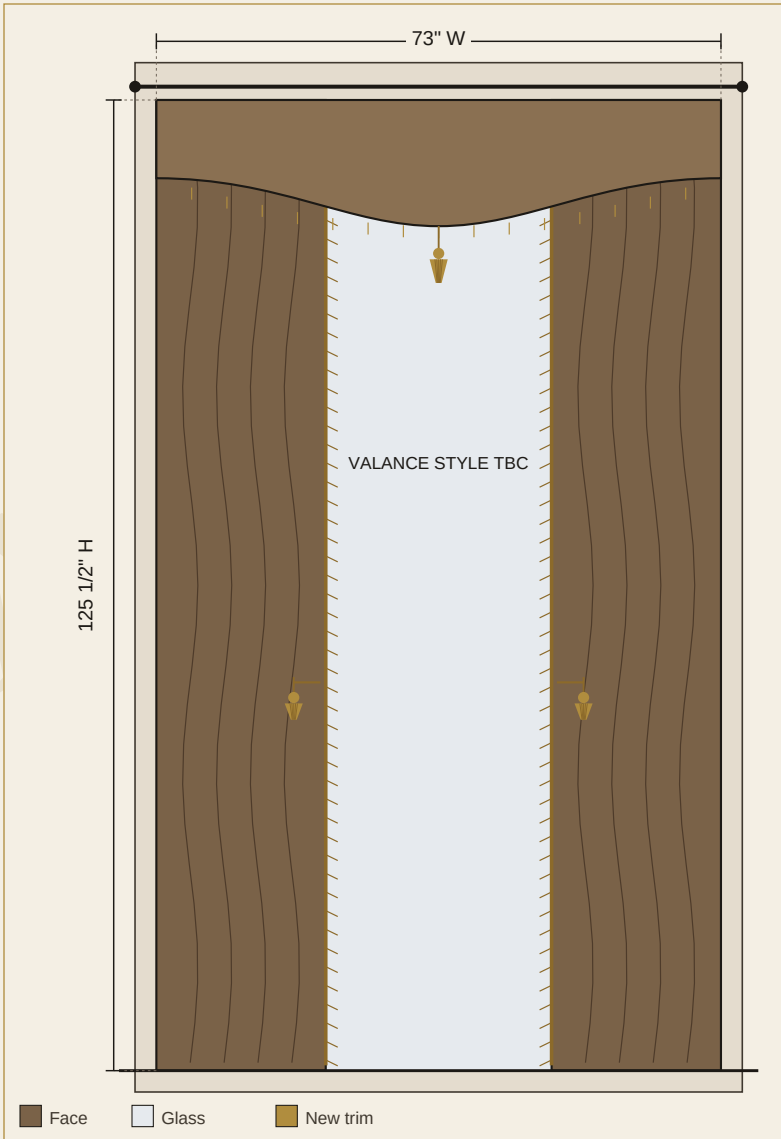

ADDENDUM

ADD-V3 formal valance \$450.00 BALLPARK. Style TBC.
ADD-VT center tassel \$95.94 INV 909 unit.
ADD-VF bottom trim \$125.00 BALLPARK.
ADD-BT two bullion @ \$95.94 INV 909.
ADD-LE two leading edges @ \$210.00 INV 909.
No sheers on this opening.
Holdback vs bullion is open. No credit taken.

Opening 4 · Lincoln Lobby Passway

LIN-2 · double-sided panels. No valance. No sheers.

EXISTING · PHOTOGRAPH




FIELD

Doorway / passway.
Height 102 1/2". Width was not written.
Double-sided. 1 1/2 W per face.
10 rings per panel.
2 panels @ 3W × 102 1/2".
20 yd beside that make.

EST 838

Submitted \$1,464.57.
2 panels @ 3W × 102 1/2" L.
1 1/2 W per face. Labor 6 widths @ \$114.00.
Main 20 yd, client supplied.
Lining 18 1/2 yd @ \$10.74.
20 rings. Two holdback cylinders @ \$35.94.
Hardware set \$420.00.
Removal and installation \$90.00.

PROPOSED · SCHEMATIC ELEVATION

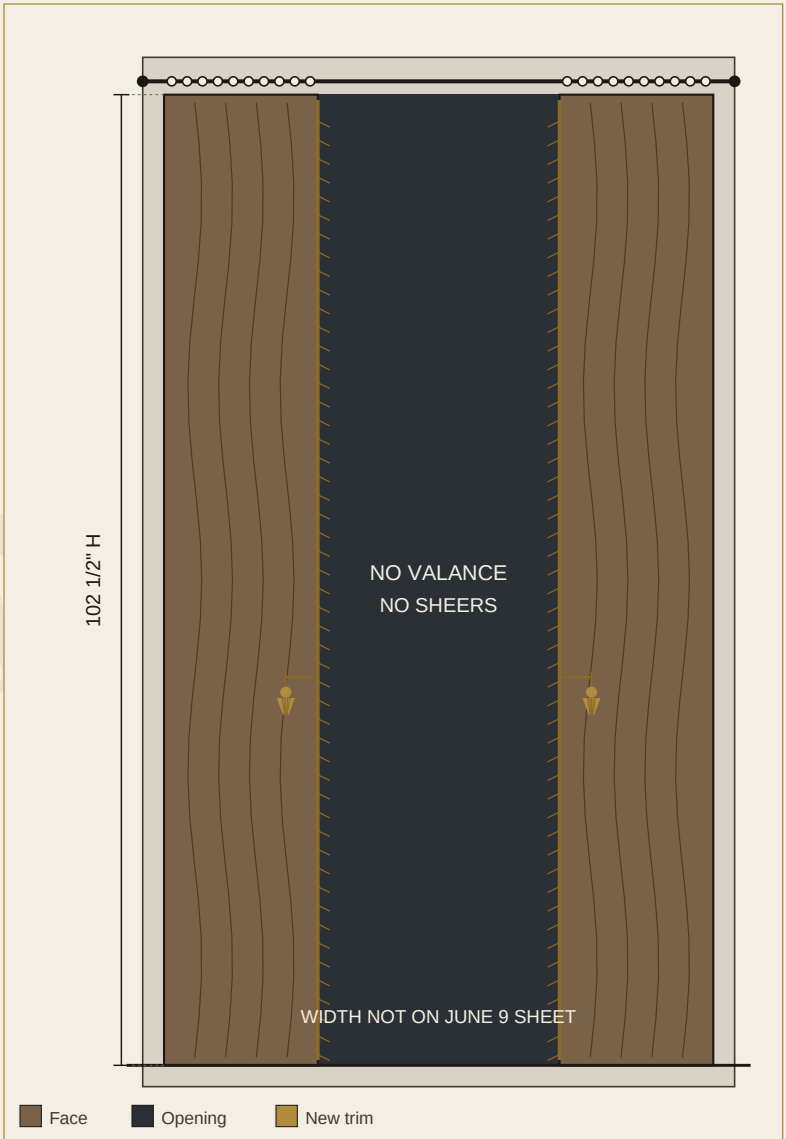


ADDENDUM

No valance line. Photograph shows none.
No sheer line.
ADD-BT two bullion @ \$95.94 INV 909.
ADD-LE two leading edges @ \$210.00 INV 909.
Priced as one edge per panel, lobby face.
Both faces of the double-sided panel: open.
Holdback vs bullion: open. No credit taken.

Concierge Office — inside office, not a lobby opening

Recorded on the same June sheet as the outside lobby drapery. Omitted from Est 838.

GAP · NOT ON EST 838 · OUT OF THIS LOBBY PACK · NO PRICE · NO PROPOSED TREATMENT

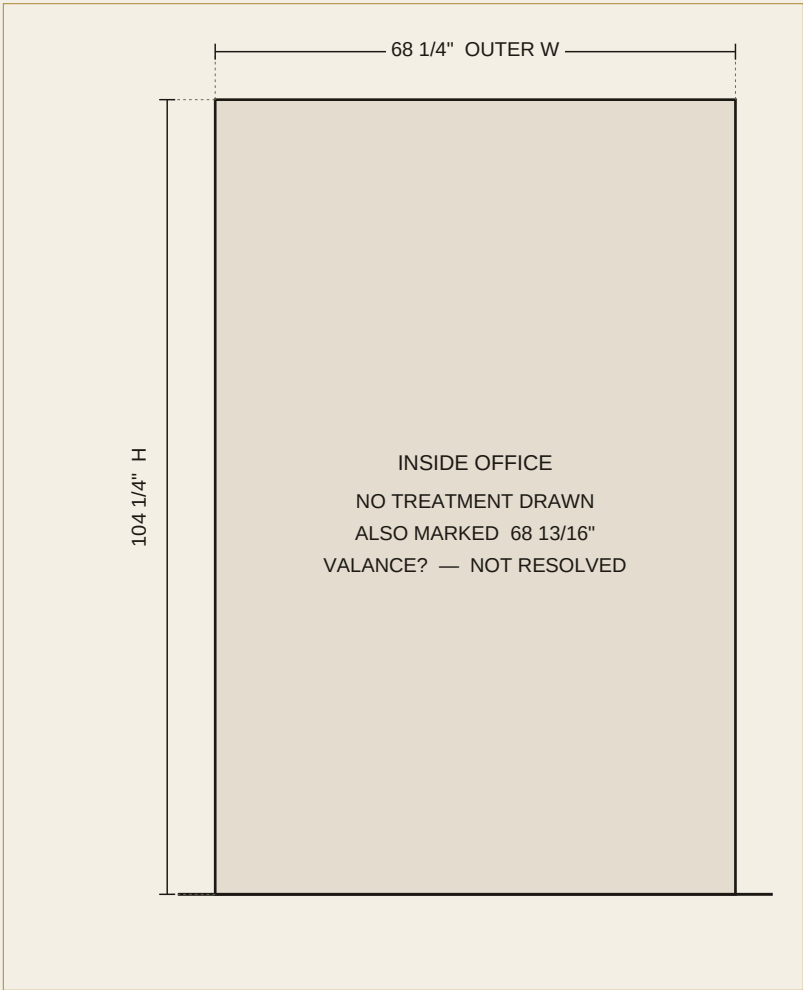

WHAT THE SHEET SAYS

Outer width 68 1/4".
Height 104 1/4".
A second figure, 68 13/16", is marked VALANCE? The sheet does not say whether that is an inner width, a valance width, or a mis-measure.
Hardware note: tracks at 8 ft × 2, and 72 carriers.
A circled rate, \$95 per width. That is a field scribble. It is not Invoice 894 and it is not on Est 838.
The sheet does not give a pair count, a finished length, a lining yardage, or a fabric.

WHAT THIS PACK DOES NOT DO

It does not fold this opening into LOB-1. LOB-1 is the lobby concierge window in the labeled photograph.
It does not invent a ripplefold, a swag, a sheer, or a price.
It does not treat \$95 per width as a submitted rate. Lobby ripplefold labor on Est 838 is \$114.00 per width, from Invoice 894.
A separate line is possible later, if Rafael wants it measured and priced on its own.

WHY IT IS EASY TO MIX UP WITH WINDOW 1

Both notes say concierge. Window 1 is the outside lobby window (photograph 1, LOB-1, wood surround, existing swag and sheers). This opening is marked INSIDE OFFICE on the same sheet, with its own width, height, and track count. The sizes do not match: 68 1/4" × 104 1/4" here, against 72 3/16" × 105 5/8" on the outside lobby opening.