ADVANTECH
Enabling an Intelligent Planet

Product Change Notice

ECOM-165390

Description of Change:

SOM-5871 PCIe x1 lanes reduce due to PLX PEX8605-AB50TQI PCIe Bridge EOL and no replacement.
All PCIe x1 lanes will be changed to connect from chipset directly. For detail, please refer to the appendix.
Before change (with PEX8605-AB50TQI): I210 LAN + 6 PCIe lanes for max. 6 devices
After change (without PEX8605-AB50TQI): I210 LAN + 5 PCIe lanes for max. 4 devices

Affected Product Model No.:

SOM-5871 all series includes STD, T-P/N, fixed BOM P/N

Old P/N	Replacement P/N
1. 1410024446-01 IC PEX8605-AB50TQI G	**1. N/A**
2. 1420046725 BIOS SOM-5871 0060V110 CS: A35B	**2. 1420050267** BIOS SOM-5871 0060V111 CS:18C4

Potential impacts to customers:

PCB: no change required
BIOS: change required
EC Firmware: no change required
OS: no change required
Driver: no change required

Ordering Information:

No Change

Impact of change & recommended action date:

STD-P/N Users:
All STD-P/N models will remove **1410024446-01** due to no replacement P/N from vendor side. SOM-5871 SPEC will be changed accordingly.
T-P/N & Fixed BOM P/N users:
For T-P/N & fixed BOM models, please inform customers to change the PCIe devices usage of their system accordingly.


Key Information & Milestones:

ECOM number: **ECOM-165390**
ECOM released date: **October, 2020**
Last Time Buy date: N/A

Appendix:

1. Comparison of SOM-5871 PCIe Configuration

SOM-5871 with 1410024446-01: Support **6** PCIe Lanes

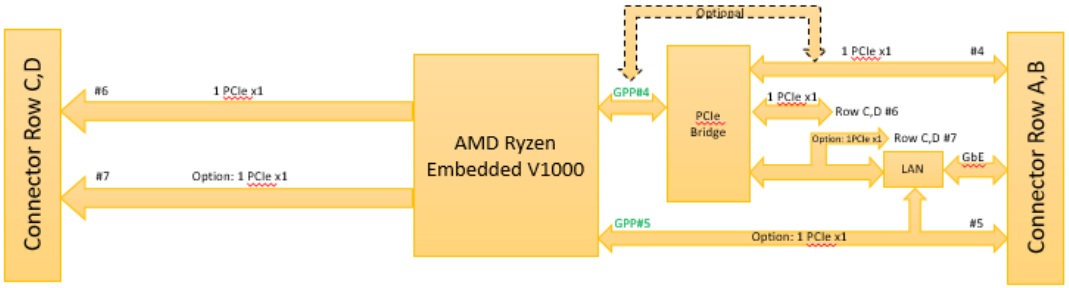

SOM-5871 remove 1410024446-01: Support **5** PCIe Lanes

