

> New Comment

▼ Comments

Created by : **Daniel E.** (4/9/2026, 23:48)

[Attachments: [apgdt006_python_tx_test.zip](#)

(https://microchip.my.salesforce.com/sfc/p/o0000000KAK/a/V4000007A7Qn/PSAt16K216Oyz1M6jjTJB0oguHNHr9sAR_m1pZzocLY).]

Hi Ramisetty,

Unfortunately the transmission software is not released yet.

I'm attaching a Python script for a minimal transmission test: **apgdt006_python_tx_test.zip**.

Steps

1. Install Python and locate the installation folder.

On my PC this is the installation folder:

C:\Python311\

It is assumed that this path was added to system paths and the "python" application is recognized at Command Prompt in Windows.

2. Create a new folder, for example C:\can_test\ and unzip the archive **apgdt006_python_tx_test.zip** there.

The folder should contain the following files:

mba-1.3.0-py3-none-any.whl

MbaInterface.dll

CAN_FD_pythonTxTest.py

3. Open Windows Command Prompt and install **mba 1.3.0** library using the following command:

```
python -m pip install C:\can_test\mba-1.3.0-py3-none-any.whl
```

Check if the **mba** library was installed with command:


```
python -m pip list
```

Package	Version
Js2Py	0.74
mba	1.3.0
pip	22.3.1

4. Bug fix.

Locate the "mba.py (<https://mba.py/>)" file in Python installation folder.

On my PC the path is C:\Python311\Lib\site-packages\mba\mba.py

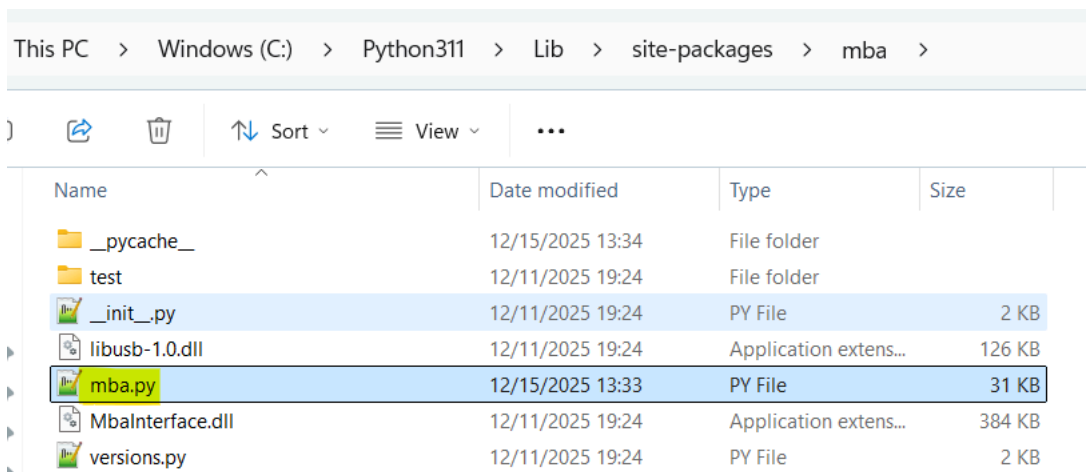

Open the "mba.py (<https://mba.py/>)" file and replace line 491:

```
490     try:
491         driver = CDLL(dll_file)
```

with this one:

```
490     try:
491         driver = CDLL(dll_dir + dll_file)
```

5. Install CBA driver.


Download the driver from <https://ww1.microchip.com/downloads/aemDocuments/documents/APG/ProductDocuments/SoftwareTools/APGDT006-driver-Oct2023.zip>

(<https://ww1.microchip.com/downloads/aemDocuments/documents/APG/ProductDocuments/SoftwareTools/APGDT006-driver-Oct2023.zip>).

Connect the board to PC using USB cable.

Go to Device Manager (administrator privileges are required) and locate the **MBAnalyzer**.

Double click on it and update the driver with mba.inf/mba.cat from the previously downloaded zip.

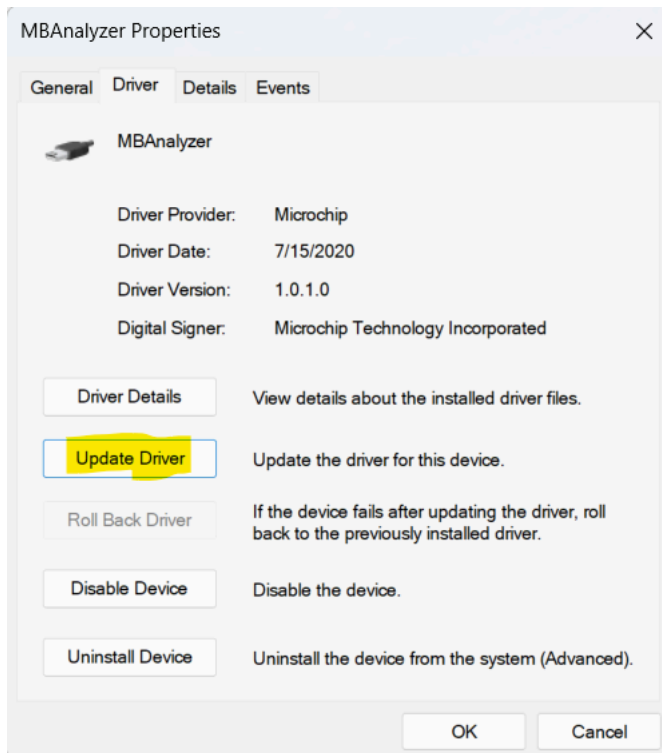


After installing the driver, the CAN Analyzer tool should look in this way in Control Panel.



6. Connect CAN_HI and CAN_LO from CAN0 DB9 connector to the corresponding pins on CAN1 DB9 Connector.

DB9 pin 2= CAN_HI

DB9 pin 7= CAN_LO

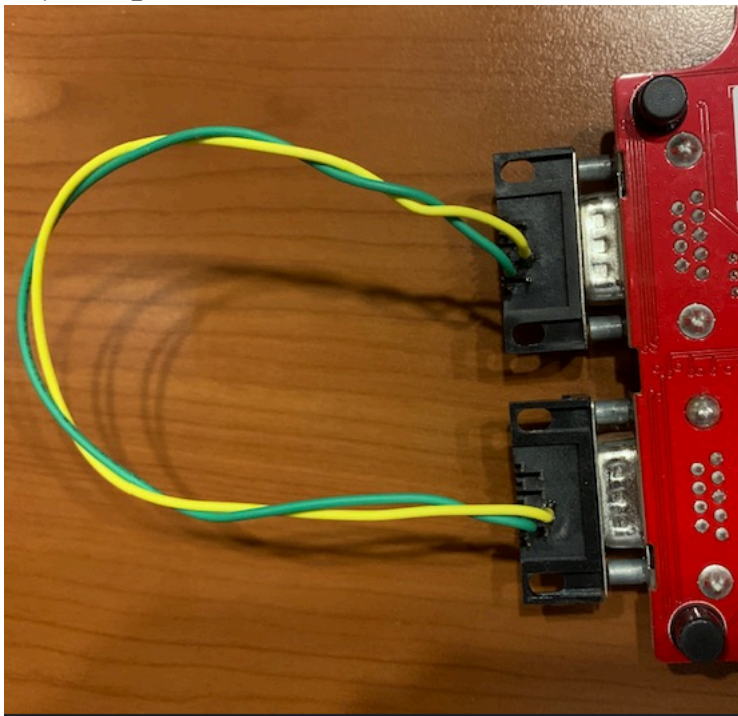

7. Run the Python script **CAN_FD_pythonTxTest.py** with command:

```
python CAN_FD_pythonTxTest.py
```

The script transmits a message on CAN0 bus and this should be received on CAN1 bus. If the transmission is successful the output should look in the following way:

```
Command Prompt
Microsoft Windows [Version 10.0.26100.7171]
(c) Microsoft Corporation. All rights reserved.

C:\Users\M16715>cd C:\APGDT006\APGDT006_Tx_Test

C:\APGDT006\APGDT006_Tx_Test>python CAN_FD_pythonTxTest.py
Found 1 device
Trying to open fcc23d0fe62a
This is a tool test
Transmission initiated.
Callback | Type: BITRATE | BusID: 0x0
Callback | Type: BITRATE | BusID: 0x1
Callback | Type: MODE | BusID: 0x0
Callback | Type: MODE | BusID: 0x1
Callback | Type: RX | BusID: 0x1 | Flags: XTD|FD|BRS | ID: 0x12345678 | Length: 64 | Data: 00 01 02 03 04 05 06 07 08 09
0A 0B 0C 0D 0E 0F 10 11 12 13 14 15 16 17 18 19 1A 1B 1C 1D 1E 1F 20 21 22 23 24 25 26 27 28 29 2A 2B 2C 2D 2E 2F 30 31
32 33 34 35 36 37 38 39 3A 3B 3C 3D 3E 3F
Callback | Type: TX | BusID: 0x0 | Flags: XTD|FD|BRS | ID: 0x12345678 | Length: 64 | Data: 00 01 02 03 04 05 06 07 08 09
0A 0B 0C 0D 0E 0F 10 11 12 13 14 15 16 17 18 19 1A 1B 1C 1D 1E 1F 20 21 22 23 24 25 26 27 28 29 2A 2B 2C 2D 2E 2F 30 31
32 33 34 35 36 37 38 39 3A 3B 3C 3D 3E 3F

C:\APGDT006\APGDT006_Tx_Test>
```

Please let me know if you have any problem when executing the above steps.

Regards,
Daniel



<https://www.microchip.com>

[Legal](https://www.microchip.com/legal) | [Privacy Policy](https://www.microchip.com/en-us/about/legal-information/privacy-policy) | [Cookies](https://www.microchip.com/en-us/about/legal-information/microchip-cookie-statement) | [Microchip.com](https://www.microchip.com)

©Copyright 1998-2025 Microchip Technology Inc. All rights reserved.