

INTERNATIONAL CIVIL AVIATION ORGANIZATION ASIA AND PACIFIC OFFICE

ADS-B IMPLEMENTATION AND OPERATIONS GUIDANCE DOCUMENT

Edition 7.0 – September 2014

Intentionally left blank

TABLE OF CONTENTS

| 1. | INTRODUCTION | 6 |
|-----|----------------------------------------------------------------|----|
| 1.1 | Arrangement of the AIGD | 6 |
| 1.2 | Document History and Management | 6 |
| 1.3 | Copies | |
| 1.4 | Changes to the AIGD | 7 |
| 1.5 | Editing conventions | 7 |
| 1.6 | AIGD Request for Change Form | 7 |
| 1.7 | Amendment Record | 9 |
| 2. | ACRONYM LIST & GLOSSARY OF TERMS | 10 |
| 2.1 | Acronym List | 10 |
| 2.2 | Glossary of Terms | 11 |
| 3. | REFERENCE DOCUMENTS | 12 |
| 4. | ADS-B DATA | 13 |
| 5. | ADS-B IMPLEMENTATION | 14 |
| 5. | | |
| 5.1 | Introduction | 14 |
| | 5.1.1 Planning | |
| | 5.1.2 Implementation team to ensure international coordination | |
| | 5.1.3 System compatibility | |
| | 5.1.4 Integration | |
| | 5.1.6 Coverage Predictions | 16 |
| 5.2 | Implementation checklist | 16 |
| | 5.2.1 Introduction | 16 |
| | 5.2.2 Activity Sequence | |
| | 5.2.3 Concept Phase | |
| | 5.2.4 Design Phase | |
| | 5.2.5 Implementation Phase | 18 |
| 6. | HARMONIZATION FRAMEWORK FOR | 10 |
| | ADS-B IMPLEMENTATION | 19 |
| 6.1 | Background | |
| 6.2 | Template of Harmonization Framework for ADS-B Implementation | 20 |
| 7. | SYSTEM INTEGRITY AND MONITORING | 23 |
| 7.1 | Introduction | 23 |
| 7.2 | Personnel Licensing and Training | 23 |
| 7.3 | System Performance Criteria for an ATC separation service | |
| 7.4 | ATC system validation | 24 |
| | | |

| | 7.4.1 | Safety Assessment Guidelines | 24 |
|-----|--------|-------------------------------------------------------------|----|
| | 7.4.2 | System safety assessment | |
| | 7.4.3 | Integration test | |
| | 7.4.4 | ATS Operation Manuals | |
| | 7.4.5 | ATS System Integrity | |
| 7.5 | Syster | n Monitoring | 25 |
| | 7.5.1 | Problem Reporting System (PRS) | 25 |
| | 7.5.2 | The monitoring process | |
| | 7.5.3 | Distribution of confidential information | |
| | 7.5.4 | ADS-B problem reports | |
| | 7.5.5 | ADS-B periodic status report. | |
| | 7.5.6 | Processing of Reports | |
| 7.6 | APAN | NPIRG | 28 |
| 7.7 | Local | Data Recording and Analysis | 28 |
| | 7.7.1 | Data recording | 28 |
| | 7.7.2 | Local data collection | |
| | 7.7.3 | Avionics problem identification and correction | 28 |
| 7.8 | ADS- | B Problem Report | 29 |
| | 7.8.1 | Report Form | 29 |
| | 7.8.2 | Description of Fields | 30 |
| 7.9 | ADS- | B Performance Report Form | 31 |
| 8. | RELI | ABILITY & AVAILABILITY CONSIDERATIONS | 32 |
| 8.1 | Reliab | pility | 32 |
| 8.2 | Availa | ability | 32 |
| 8.3 | Recon | nmendations for high reliability/availability ADS-B systems | 33 |
| | A: | System design | 33 |
| | B: | Logistics strategy | 34 |
| | C: | Configuration Management | 35 |
| | D: | Training & Competency plans | 36 |
| | E: | Data collection & Review | 36 |
| 9. | ADS- | B REGULATIONS AND PROCEDURES | 37 |
| 9.1 | Introd | uction | 37 |
| 9.2 | | B Regulations | |
| 9.3 | | rs to be considered when using ADS-B | |
| | 9.3.1 | Use of ADS-B Level data | |
| | 9.3.2 | Position Reporting Performance | 38 |
| | 9.3.3 | GNSS Integrity Prediction Service | |
| | 9.3.4 | Sharing of ADS-B Data | 39 |
| | 9.3.5 | Synergy between GNSS and ADS-B | 40 |

| 9.4 | Repor | ting Rates | 41 |
|------|---------|---------------------------------------------------------|----|
| | 9.4.1 | General | 41 |
| 9.5 | Separa | ation | 41 |
| | 9.5.1 | General | 41 |
| | 9.5.2 | Identification Methods | 41 |
| | 9.5.3 | ADS-B Separation | 41 |
| | 9.5.4 | Vertical Separation | 42 |
| 9.6 | Air Tr | raffic Control Clearance Monitoring | 42 |
| | 9.6.1 | General | 42 |
| | 9.6.2 | Deviation from ATC clearances | |
| 9.7 | Alertii | ng service | 42 |
| 9.8 | Positio | on Reporting | 42 |
| | 9.8.1 | Pilot position reporting requirements in ADS-B coverage | 42 |
| | 9.8.2 | Meteorological reporting requirement in ADS-B airspace | 42 |
| 9.9 | Phrase | eology | 43 |
| | 9.9.1 | Phraseology standard | 43 |
| | 9.9.2 | Operations of Mode S Transponder and ADS-B | 43 |
| 9.10 | Flight | Planning | 45 |
| | 9.10.1 | ADS-B Flight Planning Requirement – Flight Identity | 45 |
| | 9.10.2 | ADS-B Flight Planning Requirements | 45 |
| | 9.10.3 | Setting Flight Identification (Flight ID) in Cockpits | 46 |
| 9.11 | Procee | dures to Handle Non-compliant ADS-B Aircraft or | |
| | Mis-le | eading ADS-B Transmissions | 47 |
| 9.12 | Emerg | gency Procedures | 50 |
| 10. | Secur | ity Issues Associated with ADS-B | 51 |
| 10.1 | | uction | |
| 10.2 | Consid | derations | 51 |
| | | | |

Appendix 1 – An Example of Commissioning Checklist

Appendix 2 – Guidance Materials on Monitoring and Analysis of ADS-B Avionics Performance

1. INTRODUCTION

The Eleventh ICAO Air Navigation Conference held in 2003 recommended that States recognize ADS-B as an enabler of the global ATM concept bringing substantial safety and capacity benefits; support the cost-effective early implementation of it; and ensuring it is harmonized, compatible and interoperable with operational procedures, data linking and ATM applications.

The Twelve ICAO Air Navigation Conference held in 2012 endorsed the Aviation System Block Upgrades (ASBU) to provide a framework for global harmonization and interoperability of seamless ATM systems. Among the Block Upgrades, the Block 0 module "Initial Capability for Ground Surveillance" recommends States to implement ADS-B which provides an economical alternative to acquire surveillance capabilities especially for areas where it is technically infeasible or commercially unviable to install radars.

This ADS-B Implementation and Operations Guidance Document (AIGD) provides guidance material for the planning, implementation and operational application of ADS-B technology in the Asia and Pacific Regions.

The procedures and requirements for ADS-B operations are detailed in the relevant States' AIP. The AIGD is intended to provide key information on ADS-B performance, integration, principles, procedures and collaboration mechanisms.

The content is based upon the work to date of the APANPIRG ADS-B Study and Implementation Task Force (SITF) and various ANC Panels developing provisions for the operational use of ADS-B. Amendment to the guidance material will be required as new/revised SARPs and PANS are published.

1.1 ARRANGEMENT OF THE AIGD

| The | AIGD | consists | of the | f_011 | owing | Parte: |
|------|-------|----------|--------|---------|-------|--------|
| i ne | AICID | COHSISTS | or me | 1011 | OWINE | Parts. |

| Section 1 | Introduction |
|---------------------------------------------------------|---------------------------------------------|
| Section 2 Acronyms and Glossary of Terms | |
| Section 3 | Reference Documents |
| Section 4 | ADS-B Data |
| Section 5 | ADS-B Implementation |
| Section 6 Template of Harmonization Framework for ADS-B | |
| | Implementation |
| Section 7 | System Integrity and Monitoring |
| Section 8 | Reliability and Availability Considerations |
| Section 9 | ADS-B Regulations and Procedures |
| Section 10 | Security Issues Associated with ADS-B |

1.2 DOCUMENT HISTORY AND MANAGEMENT

This document is managed by the APANPIRG. It was introduced as draft to the first Working Group meeting of the ADS-B SITF in Singapore in October 2004, at which it was agreed to develop the draft to an approved working document that provides implementation guidance for States. The first edition was presented to APANPIRG for adoption in August 2005. It is intended to supplement SARPs, PANS and relevant provisions contained in ICAO documentation and it will be regularly updated to reflect evolving provisions.

1.3 COPIES

Paper copies of this AIGD are not distributed. Controlled and endorsed copies can be found at the following web site: http://www.icao.int/APAC/Pages/edocs.aspx

Copy may be freely downloaded from the web site, or by emailing APANPIRG through the ICAO Asia and Pacific Regional Office who will send a copy by return email.

1.4 CHANGES TO THE AIGD

Whenever a user identifies a need for a change to this document, a Request for Change (RFC) Form (see Section 1.6 below) should be completed and submitted to the ICAO Asia and Pacific Regional Office. The Regional Office will collate RFCs for consideration by the ADS-B Study and Implementation Task Force.

When an amendment has been agreed by a meeting of the ADS-B Study and Implementation Task Force then a new version of the AIGD will be prepared, with the changes marked by an "|" in the margin, and an endnote indicating the relevant RFC, so a reader can see the origin of the change. If the change is in a table cell, the outside edges of the table will be highlighted; e.g.:

Final approval for publication of an amendment to the AIGD will be the responsibility of APANPIRG.

1.5 EDITING CONVENTIONS (Intentionally blank)

1.6 AIGD REQUEST FOR CHANGE FORM

| RFC Nr: | |
|---------|--|

Please use this form when requesting a change to any part of this AIGD. This form may be photocopied as required, emailed, faxed or e-mailed to ICAO Asia and Pacific Regional Office +66 (2) 537-8199 or APAC@icao.int

| 1. SUBJECT: |
|-----------------------------------------------------------------------------|
| 2. REASON FOR CHANGE: |
| 3. DESCRIPTION OF PROPOSAL: [expand / attach additional pages if necessary] |

| | REFERENCE(S): | | | |
|----|----------------------------------------------------|---------------------|---------------------|------|
| | PERSON INITIATING: | | DATE: | |
| | ORGANISATION: | | | |
| | TEL/FA/X/E-MAIL: | | | |
| 6 | CONSULTATION | RESPONSE DUE BY DAT | `E• | |
| 0. | Organization Organization | Name | Agree/Disagree | Date |
| | Summerion | 1 (MIII) | 115100121305100 | Dute |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| 7. | ACTION REQUIRE: | | DATE DEC'2D. | |
| 8. | ACTION REQUIRE : AIGD EDITOR FEEDBACK PASSED | | DATE REC'D : DATE : | |

1.7 AMENDMENT RECORD

| Amendment Number | Date | Amended by | Comments |
|---------------------|-------------------|---------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 0.1 | 24 December 2004 | W. Blythe H. Anderson | Modified draft following contributions from ADS-B SITF Working Group members. Incorporated to TF/3 Working Paper #3. |
| 0.2 (1.0) | 24 March 2005 | H. Anderson | Final draft prepared at ADS-B SITF WG/3 |
| 0.3 (1.1) | 03 June 2005 | Nick King | Amendments following SASP WG/WHL meeting of May 2005 |
| 0.4 | 15 July 2005 | CNS/MET SG/9 | Editorial changes made |
| 1.0 | 26 August 2005 | APANPIRG/16 | Adopted as the first Edition |
| 2.0 | 25 August 2006 | Proposed by ADS-B SITF/5 and adopted by APANPIRG/17 | Adopted as the second Edition |
| 3.0 | 7 September 2007 | Proposed by ADS-B SITF/6 and adopted by APANPIRG/18 | Adopted as the second amendment (3 rd edition) |
| 4.0 | 5 September 2011 | Proposed by ADS-B SITF/10 and adopted by APANPIRG/22 | Adopted amendment on consequential change to the Flight Plan and additional material on the reliability and availability for ADS-B ground system |
| 5.0 | 14 September 2012 | Proposed by ADS-B SITF/11 and adopted by APANPIRG/23 | Included sample template on harmonization framework |
| 6.0 | June 2013 | Proposed by ADS-B SITF/12 and adopted by APANPIRG/24 | Revamped to include the latest ADS-B developments and references to guidance materials on ADS-B implementation |
| 7.0 | September 2014 | Proposed by ADS-B SITF/13 and adopted by APANPIRG/25 | (i) Included guidance materials on monitoring and analysis of ADS-B equipped aircraft (ii) Included guidance materials on synergy between GNSS and ADS-B (iii) Revised ATC Phraseology (iv) Included clarification on Flight Planning |
| | | | |
| | | | |
| | | | |
| | | | |

2. ACRONYM LIST & GLOSSARY OF TERMS

2.1 ACRONYM LIST

ACID Aircraft Identification

ADS-C Automatic Dependent Surveillance - Contract ADS-B Automatic Dependent Surveillance - Broadcast

AIGD ADS-B Implementation and Operations Guidance Document

AIP Aeronautical Information Publication

AIT ADS-B Implementation Team

AMSL Above Mean Sea Level

APANPIRG Asia/Pacific Air Navigation Planning and Implementation Regional Group

ARINC Aeronautical Radio Incorporate

ATC Air Traffic Control (or Air Traffic Controller)

ATM Air Traffic Management
ATS Air Traffic Services
ATSP ATS Provider
ATSU ATS unit

CNS Communications, Navigation, Surveillance

CRC Cyclic Redundancy Check

CDTI Cockpit Display Traffic Information
DAIW Danger Area Infringement Warning

FIR Flight Information Region FLTID Flight Identification

FMS Flight Management System

FOM Figure of Merit used in ASTERIX messaging

GPS Global Positioning System (USA)
HPL Horizontal Protection Level

ICAO International Civil Aviation Organization

MSAW Minimum Safe Altitude Warning
MTBF Mean Time Between Failures
MTCA Medium Term Conflict Alert
MTTR Mean Time To Restore

NAC Navigation Accuracy Category
NIC Navigation Integrity Category
PRS Problem Reporting System
RAI Restricted Area Intrusion
RAM Route Adherence Monitoring

RAIM Receiver Autonomous Integrity Monitoring

RFC Request for Change

RNP Required Navigation Performance SIL Surveillance Integrity Level

SITF Study and Implementation Task Force

STCA Short Term Conflict Alert

2.2 GLOSSARY OF TERMS

| ADS-B In | An ADS-B system feature that enables the display of |
|----------------------------------------|-------------------------------------------------------|
| | real time ADS-B tracks on a situation display in the |
| | aircraft cockpit. |
| ADS-B Out | An ADS-B system feature that enables the frequent |
| | broadcast of accurate aircraft position and vector |
| | data together with other information. |
| Asterix 21 | Eurocontrol standard format for data message |
| | exchange |
| FOM (Figure of Merit) | A numeric value that is used to determine the |
| | accuracy and integrity of associated position data. |
| HPL (Horizontal Position Limit) | The containment radius within which the true |
| | position of the aircraft will be found for 95% of the |
| | time (See DO229c). |
| NAC (Navigational Accuracy Category) | Subfield used to announce the 95% accuracy limits |
| | for the horizontal position data being broadcast. |
| NIC (Navigational Integrity Category) | Subfield used to specify the containment radius |
| | integrity associated with horizontal position data. |
| NUCp (Navigation Uncertainty Category) | A numeric value that announces the integrity of the |
| | associated horizontal position data being broadcast. |
| SIL (Surveillance Integrity Level) | Subfield used to specify the probability of the true |
| | position lying outside the containment radius defined |
| | by NIC without being alerted. |

3. REFERENCE DOCUMENTS

| Id | Name of the document | Reference | Date | Origin | Domain |
|----|----------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------|-----------|--------|--------|
| 1 | Annex 2: Rules of the Air | Tenth Edition Including Amendment 43 dated 16/7/12 | July 2005 | ICAO | |
| 2 | Annex 4: Aeronautical Chart | Eleventh Edition including Amendment 56 dated 12/7/10 | July 2009 | ICAO | |
| 3 | Annex 10: Aeronautical Telecommunications, Vol. IV – Surveillance Radar and Collision Avoidance Systems | Fourth Edition Including Amendment 87 dated 12/7/10 | July 2007 | ICAO | |
| 4 | Annex 11: Air Traffic Services | Thirteenth Edition including Amendment 48 dated 16/7/12 | July 2001 | ICAO | |
| 5 | Annex 15: Aeronautical Information Services | Thirteen Edition | July 2010 | ICAO | |
| 6 | PAN-ATM (Doc 4444/ATM501) | Fifteen Edition including Amendment 4 applicable on 15/11/12 | 2007 | ICAO | |
| 7 | Manual on Airspace Planning Methodology for the Determination of Separation Minima (Doc 9689/AN953) | First Edition including Amendment 1 dated 30/8/02 | 1998 | ICAO | |
| 8 | Doc 9859 Safety Management Manual (SMM) | Third Edition | 2012 | ICAO | |
| 9 | ICAO Circular 326 AN/188 "Assessment of ADS-B and Multilateration Surveillance to Support Air Traffic Services and Guidelines for Implementation". | First Edition | 2012 | ICAO | |
| 10 | Regional Supplementary Procedures (Doc 7030) | Fifth Edition including Amendment 5 dated 22/7/11 | 2008 | ICAO | |

4. ADS-B DATA

APANPIRG has decided to use 1090MHz Extended Squitter data link for ADS-B data exchange in the Asia and Pacific Regions. In the longer term an additional link type may be required.

To ensure interoperability of ADS-B ground stations in the Asia Pacific (ASIA/PAC) Regions, during the 16th APANPIRG Meeting held in August 2005, the ASTERIX Category 21 version 0.23 (V0.23) which had incorporated DO260 standard was adopted as the baselined ADS-B data format for deployment of ADS-B ground stations and sharing of ADS-B data in the ASIA/PAC Regions. At this time, DO260A and DO260B standards were not defined.

This baselined version provides adequate information so that useful ATC operational services, including aircraft separation, can be provided. V0.23 can be used with DO260, DO260A and DO260B ADS-B avionics/ground stations to provide basic ATC operational services. However, V0.23 cannot fully support the more advanced capabilities offered by DO260A and DO260B.

States intending to implement ADS-B surveillance and share ADS-B data with others might consider to adopt a more updated version of ASTERIX in order to make use of the advanced capabilities offered by DO260A and DO260B compliant avionics.

A guidance material on generation, processing and sharing of ASTERIX Cat. 21 ADS-B messages is provided on the ICAO APAC website "http://www.icao.int/APAC/Pages/edocs.aspx" for reference by States.

In this guidance material, the ADS-B data contained inside ASTERIX Cat 21 are classified as Group 1 (mandatory), Group 2 (Desirable) and Group 3 (Optional). It is required to transmit all data that are operationally desirable (Group 2), when such data are received from the aircraft, in addition to the data that are mandatory (Group 1) in ASTERIX messages. Whether Group 3 optional data will need to be transmitted or not should be configurable on item-by-item basis within the ADS-B ground station depending on specific operational needs.

It is considered necessary that all data that are mandatory in ASTERIX messages (i.e. Group 1 data items) and operationally desirable (i.e. Group 2 data items) when such data are received from aircraft, should be included in data sharing. In the event that the data have to be filtered, the list of optional data items (i.e. Group 3 data items) needs to be shared will be subject to mutual agreement between the two data sharing parties concerned.

5. ADS-B IMPLEMENTATION

5.1 INTRODUCTION

5.1.1 Planning

There are a range of activities needed to progress ADS-B implementation from initial concept level to operational use. This section addresses the issues of collaborative decision making, system compatibility and integration, while the second section of this chapter provides a checklist to assist States with the management of ADS-B implementation activities.

5.1.2 Implementation team to ensure international coordination

- 5.1.2.1 Any decision to implement ADS-B by a State should include consultation with the wider ATM community. Moreover, where ADS-B procedures or requirements will affect traffic transiting between states, the implementation should also be coordinated between States and Regions, in order to achieve maximum benefits for airspace users and service providers.
- 5.1.2.2 An effective means of coordinating the various demands of the affected organizations is to establish an implementation team. Team composition may vary by State or Region, but the core group responsible for ADS-B implementation planning should include members with multidiscipline operational expertise from affected aviation disciplines, with access to other specialists where required.
- 5.1.2.3 Ideally, such a team should comprise representatives from the ATS providers, regulators and airspace users, as well as other stakeholders likely to be influenced by the introduction of ADS-B, such as manufacturers and military authorities. All identified stakeholders should participate as early as possible in this process so that their requirements can be identified prior to the making of schedules or contracts.
- 5.1.2.4 The role of the implementation team is to consult widely with stakeholders, identify operational needs, resolve conflicting demands and make recommendations to the various stakeholders managing the implementation. To this end, the implementation team should have appropriate access to the decision-makers.

5.1.3 System compatibility

- 5.1.3.1 ADS-B has potential use in almost all environments and operations and is likely to become a mainstay of the future ATM system. In addition to traditional radar-like services, it is likely that ADS-B will also be used for niche application where radar surveillance is not available or possible. The isolated use of ADS-B has the potential to foster a variety of standards and practices that, once expanded to a wider environment, may prove to be incompatible with neighbouring areas.
- 5.1.3.2 Given the international nature of aviation, special efforts should be taken to ensure harmonization though compliance with ICAO Standards and Recommended Practices (SARPs). The choice of systems to support ADS-B should consider not only the required performance of individual components, but also their compatibility with other CNS systems.

5.1.3.3 The future concept of ATM encompasses the advantages of interoperable and seamless transition across flight information region (FIR) boundaries and, where necessary, ADS-B implementation teams should conduct simulations, trials and cost/benefit analysis to support these objectives.

5.1.4 Integration

5.1.4.1 ADS-B implementation plans should include the development of both business and safety cases. The adoption of any new CNS system has major implications for service providers, regulators and airspace users and special planning should be considered for the integration of ADS-B into the existing and foreseen CNS/ATM system. The following briefly discusses each element.

5.1.4.2 Communication system

5.1.4.2.1 The communication system is an essential element within CNS. An air traffic controller can now monitor an aircraft position in real time using ADS-B where previously only voice position reports were available. However, a communication system that will support the new services that result from the improved surveillance may be necessary. Consequently, there is an impact of the ongoing ADS-B related work on the communication infrastructure developments.

5.1.4.3 Navigation system infrastructure

- 5.1.4.3.1 ADS-B is dependent upon the data obtained from a navigation system (typically GNSS), in order to enable its functions and performance. Therefore, the navigation infrastructure should fulfill the corresponding requirements of the ADS-B application, in terms of:
 - a) Data items; and
 - b) Performance (e.g. accuracy, integrity, availability etc.).
- 5.1.4.3.2 This has an obvious impact on the navigation system development, which evolves in parallel with the development of the surveillance system.

5.1.4.4 Other surveillance infrastructure

- 5.1.4.4.1 ADS-B may be used to supplement existing surveillance systems or as the principal source of surveillance data. Ideally, surveillance systems will incorporate data from ADS-B and other sources to provide a coherent picture that improves both the amount and utility of surveillance data to the user. The choice of the optimal mix of data sources will be defined on the basis of operational demands, available technology, safety and cost-benefit considerations.
- 5.1.4.4.2 A guidance material on issues to be considered in ATC multi-sensor fusion processing including integration of ADS-B data is provided on the ICAO website http://www.icao.int/APAC/Pages/edocs.aspx for reference by States.

5.1.4.4.3 A guidance material on processing and displaying of ADS-B data at air traffic controller positions is provided on the ICAO website "http://www.icao.int/APAC/Pages/edocs.aspx" for reference by States.

5.1.5 Coverage Predictions

5.1.5.1 Reliable and robust analysis and planning of ADS-B coverage to support seamless ATM initiative requires accurate and reliable coverage modelling. States should ensure that surveillance engineering/technical teams are provided with modelling tools to provide accurate and reliable coverage predictions for ATM planning and analysis.

5.2 IMPLEMENTATION CHECKLIST

5.2.1 Introduction

The purpose of this implementation checklist is to document the range of activities that needs to be completed to bring an ADS-B application from an initial concept to operational use. This checklist may form the basis of the terms of reference for an ADS-B implementation team, although some activities may be specific to individual stakeholders. An example of the checklist used by AirServices Australia is given at Appendix 1.

5.2.2 Activity Sequence

The activities are listed in an approximate sequential order. However, each activity does not have to be completed prior to starting the next activity. In many cases, a parallel and iterative process should be used to feed data and experience from one activity to another. It should be noted that not all activities will be required for all applications.

5.2.3 Concept Phase

- a) construct operational concept:
 - 1) purpose;
 - 2) operational environment;
 - 3) ATM functions; and
 - 4) infrastructure;
- b) identify benefits:
 - 1) safety enhancements;
 - 2) efficiency;
 - 3) capacity;
 - 4) environmental;
 - 5) cost reductions;
 - 6) access; and
 - 7) other metrics (e.g. predictability, flexibility, usefulness);
- c) identify constraints:
 - 1) pair-wise equipage;
 - 2) compatibility with non-equipped aircraft;

- 3) need for exclusive airspace;
- 4) required ground infrastructure;
- 5) RF spectrum;
- 6) integration with existing technology; and
- 7) technology availability;
- d) prepare business case:
 - 1) cost benefit analysis; and
 - 2) demand and justification.

5.2.4 Design Phase

- a) identify operational requirements:
 - 1) security; and
 - 2) systems interoperability;
- b) identify human factors issues:
 - 1) human-machine interfaces;
 - 2) training development and validation;
 - 3) workload demands;
 - 4) role of automation vs. role of human;
 - 5) crew coordination/pilot decision-making interactions; and
 - 6) ATM collaborative decision-making;
- c) identify technical requirements:
 - 1) standards development;
 - 2) data required;
 - 3) functional processing;
 - 4) functional performance; and
 - 5) required certification levels;
- d) equipment development, test, and evaluation:
 - 1) prototype systems built to existing or draft standards/specifications;
 - 2) developmental bench and flight tests; and
 - 3) acceptance test parameters; and
 - 4) select and procure technology;
- e) develop procedures:
 - 1) pilot and controller actions and responsibilities;
 - 2) phraseologies;
 - 3) separation/spacing criteria and requirements;
 - 4) controller's responsibility to maintain a monitoring function, if appropriate;
 - 5) contingency procedures;
 - 6) emergency procedures; and
 - 7) develop AIP and Information documentation

- f) prepare design phase safety case:
 - 1) safety rationale;
 - 2) safety budget and allocation; and
 - 3) functional hazard assessment.

5.2.5 Implementation phase

- a) prepare implementation phase safety case;
- b) conduct operational test and evaluation:
 - 1) flight deck and ATC validation simulations; and
 - 2) flight tests and operational trials;
- c) obtain systems certification:
 - 1) aircraft equipment; and
 - 2) ground systems;
- d) obtain regulatory approvals:
 - 1) flight operations; and
 - 2) air traffic certification of use;
- e) implementation transition:
 - 1) Promulgate procedures and deliver training
 - 2) continue data collection and analysis;
 - 3) resolve any unforeseen issues; and
 - 4) continue feedback into standards development processes;
- f) performance monitoring to ensure that the agreed performance is maintained.
- 5.2.5.1 Once the implementation project is complete, ongoing maintenance and upgrading of both ADS-B operations and infrastructure should continue to be monitored, through the appropriate forums.

6. HARMONIZATION FRAMEWORK FOR ADS-B IMPLEMENTATION

6.1 BACKGROUND

- It is obvious that full benefits of ADS-B will only be achieved by its harmonized implementation and seamless operations. During the 6th meeting of ADS-B SEA/WG in February 2011, Hong Kong, China initiated to strengthen collaboration among concerned States/Administrations for harmonized ADS-B implementation and seamless operations along two ATS routes L642 and M771 with major traffic flow (MTF). An ad-hoc workgroup comprising concerned CAAs/ANSPs from Hong Kong, China, Mainland China, Vietnam and Singapore was subsequently formed to elaborate and agree on a framework regarding implementation timelines, avionics standards, optimal flight levels, and ATC and engineering handling procedures. As a coherent effort, ADS-B implementation along ATS routes L642 and M771 has been harmonized while Hong Kong, China and Singapore have published respective Aeronautical Information Circulars and Airworthiness Notices on ADS-B mandates for these two routes with effect on 12 December 2013.
- 6.1.2 It is considered that the above implementation framework for ATS routes L642/M771 would serve as a useful template for extension to other high density routes to harmonize ADS-B implementation. Paragraph 6.2 shows the detailed framework.

6.2 TEMPLATE OF HARMONIZATION FRAMEWORK FOR ADS-B IMPLEMENTATION

| No. | What to harmonize | What was agreed | Issue / what needs to be further |
|-----|------------------------------|------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|
| | | | discussed |
| 1 | Mandate Effective | Singapore (SG), Hong Kong (HK), China (Sanya): | |
| | | 12 Dec 2013 | |
| | | Vietnam (VN): to be confirmed | |
| 2 | ATC Operating Procedures | No need to harmonize | Refer to SEACG for consideration of impact of expanding ADS-B surveilla on ATC Operating Procedures include Large Scale Weather procedures. |
| 3 | Mandate Publish Date | No need to harmonize | To publish equipment requirements early as possible. |
| 4 | Date of Operational Approval | No need to harmonize | ··· 7 ··· Fassers. |

| 5 | Flight Level | SG, HK, CN: - At or Above FL290 (ADS-B airspace) - Below FL290 (Non-ADS-B airspace) VN to be confirmed | |
|-----|------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 6 | Avionics Standard (CASA/AMC2024) | SG - CASA or AMC2024 or FAA AC No. 20-165 HK - CASA or AMC2024 or FAA AC No. 20-165 VN - CASA or AMC2024 or FAA AC No. 20-165 CN - CASA or AMC2024 or FAA AC No. 20-165 | ADS-B Task Force agreed that DO260B will be accepted as well. SG, HK, and CN agreed their ADS-B GS will accept DO260, DO260A and DO260B by 1 July 2014 (Note 1) |
| 7 | Flight Planning | Before 15 Nov 2012, as per AIDG On or after 15 Nov 2012, as per new flight plan format | |
| 8 | Aircraft Approval | | |
| 8a) | Procedures if Aircraft Not Approved or Aircraft without a Serviceable ADS-B Transmitting Equipment before Flight | SG, HK, CN: FL280 and Below VN to be confirmed | |

| 8b) | Aircraft Approved but Transmitting Bad | For known aircraft, treat as non ADS-B aircraft. | Share blacklisted aircraft among |
|-----|----------------------------------------|--------------------------------------------------------|-----------------------------------------|
| | Data (Blacklisted Aircraft) | | concerned States/Administration |
| | | | |
| 9 | Contingency Plan | | |
| 9a) | Systemic Failure such as Ground System | Revert back to current procedure. | |
| | / GPS Failure | | |
| 9b) | Avionics Failure or Approved Aircraft | Provide other form of separation, subject to bilateral | Address the procedure for aircraft |
| | Transmitting Bad Data in Flight | agreement. | transiting from radar to ADS-B airspace |
| | | From radar/ADS-B environment to ADS-B only | and from ADS-B to ADS-B airspace. |
| | | environment, ATC coordination may be able to | |
| | | provide early notification of ADS-B failure. | |
| 10 | Commonly Agreed Route Spacing | SEACG | Need for commonly agreed minimal in- |
| | | | trail spacing throughout. |

Note 1: Also included two ADS-B GS supplied by Indonesia at Matak and Natuna

7. SYSTEM INTEGRITY AND MONITORING

7.1 INTRODUCTION

The Communications, Navigation, Surveillance and Air Traffic Management (CNS/ATM) environment is an integrated system including physical systems (hardware, software, and communication networks), human elements (pilots, controllers and engineers), and the operational procedures for its applications. ADS-B is a surveillance system that may be integrated with other surveillance technologies or may also operate as an independent source for surveillance monitoring within the CNS/ATM system.

Because of the integrated nature of such system and the degree of interaction among its components, comprehensive system monitoring is recommended. The procedures described in this section aim to ensure system integrity by validation, identification, reporting and tracking of possible problems revealed during system monitoring with appropriate follow-up actions.

These procedures do not replace the ATS incident reporting procedures and requirements, as specified in PANS-ATM (Doc 4444), Appendix 4; ICAO's Air Traffic Services Planning Manual (Doc 9426), Chapter 3; or applicable State regulations, affecting the reporting responsibilities of parties directly involved in a potential ATS incident.

7.2 PERSONNEL LICENSING AND TRAINING

Prior to operating any element of the ADS-B system, operational and technical personnel shall undertake appropriate training as determined by the States, including compliance with the Convention on International Civil Aviation where applicable.

Notwithstanding the above requirement and for the purposes of undertaking limited trials of the ADS-B system, special arrangements may be agreed between the operator and an Air Traffic Services Unit (ATSU).

7.3 SYSTEM PERFORMANCE CRITERIA FOR AN ATC SEPARATION SERVICE

A number of States have started to introduce ADS-B for the provision of Air Traffic Services, including 'radar-like' separation. The ICAO Separation and Airspace Safety Panel (SASP) has completed assessment on the suitability of ADS-B for various applications including provision of aircraft separation based on comparison of technical characteristics between ADS-B and monopulse secondary surveillance radar. It is concluded that that ADS-B surveillance is better or at least no worse than the referenced radar, and can be used to provide separation minima as described in PANS-ATM (Doc 4444) whether ADS-B is used as a sole means of ATC surveillance or used together with radar, subject to certain conditions to be met. The assessment result is detailed in the ICAO Circular 326 AN/188 "Assessment of ADS-B and Multilateration Surveillance to Support Air Traffic Services and Guidelines for Implementation".

States intending to introduce ADS-B separation minima shall comply with provisions of PANS-ATM, Regional Supplementary Procedures (Doc 7030) and Annex 11 paragraph 3.4.1. States should adopt the guidelines contained in this document unless conformance with PANS-ATM specifications requires change.

7.4 ATC SYSTEM VALIDATION

7.4.1 Safety Assessment Guidelines

To meet system integrity requirements, States should conduct a validation process that confirms the integrity of their equipment and procedures. Such processes shall include:

- A system safety assessment for new implementations is the basis for definitions of system performance requirements. Where existing systems are being modified to utilize additional services, the assessment demonstrates that the ATS Provider's system will meet safety objectives;
- b) Integration test results confirming interoperability for operational use of airborne and ground systems; and
- c) Confirmation that the ATS Operation Manuals are compatible with those of adjacent providers where the system is used across a common boundary.

7.4.2 System safety assessment

The objective of the system safety assessment is to ensure the State that introduction and operation of ADS-B is safe. This can be achieved through application of the provisions of Annex 11 paragraph 2.27 and PANS-ATM Chapter 2. The safety assessment should be conducted for initial implementation as well as any future enhancements and should include:

- a) Identifying failure conditions;
- b) Assigning levels of criticality;
- c) Determining risks/ probabilities for occurrence;
- d) Identifying mitigating measures and fallback arrangements;
- e) Categorising the degree of acceptability of risks; and
- f) Operational hazard ID process.

Following the safety assessment, States should institute measures to offset any identified failure conditions that are not already categorized as acceptable. This should be done to reduce the probability of their occurrence to a level as low as reasonably practicable. This could be accomplished through system automation or manual procedures.

Guidance material on building a safety case for delivery of an ADS-B separation service is provided on the ICAO APAC website "http://www.icao.int/APAC/Pages/edocs.aspx" for reference by States.

7.4.3 Integration test

States should conduct trials with suitably equipped aircraft to ensure they meet the operational and technical requirements to provide an ATS. Alternatively, they may be satisfied by test results and analysis conducted by another State or organization deemed competent to provide such service. Where this process is followed, the tests conducted by another State or organization should be comparable (i.e. using similar equipment under similar conditions).

Refer also to the Manual on Airspace Planning Methodology for the Determination of Separation Minima (Doc9689).

7.4.4 ATS Operation Manuals

States should coordinate with adjacent States to confirm that their ATS Operation Manuals contain standard operating procedures to ensure harmonization of procedures that impact across common boundaries.

7.4.5 ATS System Integrity

With automated ATM systems, data changes, software upgrades, and system failures can affect adjacent units. States shall ensure that:

- a) A conservative approach is taken to manage any changes to the system;
- b) Aircrew, aircraft operating companies and adjacent ATSU(s) are notified of any planned system changes in advance, where that system is used across a common boundary;
- c) ATSUs have verification procedures in place to ensure that following any system changes, displayed data is both correct and accurate;
- d) In cases of system failures or where upgrades (or downgrades) or other changes may impact surrounding ATS units, ATSUs should have a procedure in place for timely notification to adjacent units. Such notification procedures will normally be detailed in Letters of Agreement between adjacent units; and
- e) ADS-B surveillance data is provided with equal to or better level of protection and security than existing surveillance radar data.

7.5 SYSTEM MONITORING

During the initial period of implementation of ADS-B technology, routine collection of data is necessary in order to ensure that the system continues to meet or exceed its performance, safety and interoperability requirements, and that operational service delivery and procedures are working as intended. The monitoring program is a two-fold process. Firstly, summarised statistical data should be produced periodically showing the performance of the system. This is accomplished through ADS-B Periodic Status Reports. Secondly, as problems or abnormalities arise, they should be identified, tracked, analyzed and corrected and information disseminated as required, utilizing the ADS-B Problem Report.

Guidance materials on monitoring and analysis of ADS-B Avionics Performance are given at Appendix 2.

7.5.1 Problem Reporting System (PRS)

The Problem Reporting System is tasked with the collection, storage and regular dissemination of data based on reports received from ADS-B SITF members. The PRS tracks problem reports and publish information from those reports to ADS-B SITF members. Problem resolution is the responsibility of the appropriate ADS-B SITF members.

The PRS Administrator shall:

- a) prepare consolidated problem report summaries for each ADS-B SITF meeting;
- b) collect and consolidate ADS-B Problem Reports; and
- c) maintain a functional website (with controlled access) to manage the problem reporting function.

7.5.2 The monitoring process

When problems or abnormalities are discovered, the initial analysis should be performed by the organization(s) identifying the problem. In addition, a copy of the problem report should be entered in to the PRS which will assign a tracking number. As some problems or abnormalities may involve more than one organization, the originator should be responsible for follow-up action to rectify the problem and forward the information to the PRS. It is essential that all information relating to the problem is documented and recorded and resolved in a timely manner.

The following groups should be involved in the monitoring process and problem tracking to ensure a comprehensive review and analysis of the collected data:

- a) ATS Providers;
- b) Organizations responsible for ATS system maintenance (where different from the ATS provider);
- c) Relevant State regulatory authorities;
- d) Communication Service Providers being used;
- e) Aircraft operators; and
- f) Aircraft and avionics manufacturers.

7.5.3 Distribution of confidential information

It is important that information that may have an operational impact on other parties be distributed by the authorised investigator to all authorised groups that are likely to be affected, as soon as possible. In this way, each party is made aware of problems already encountered by others, and may be able to contribute further information to aid in the solution of these problems. The default position is that all states agree to provide the data which will be deidentified for reporting and record keeping purposes.

7.5.4 ADS-B problem reports

Problem reports may originate from many sources, but most will fall within two categories; reports based on observation of one or more specific events, or reports generated from the routine analysis of data. The user would document the problem, resolve it with the appropriate party and forward a copy of the report to the PRS for tracking and distribution. While one occurrence may appear to be an isolated case, the receipt of numerous similar reports by the PRS could indicate that an area needs more detailed analysis.

To effectively resolve problems and track progress, the problem reports should be sent to the nominated point of contact at the appropriate organization and the PRS. The resolution of the identified problems may require:

- a) Re-training of system operators, or revision of training procedures to ensure compliance with existing procedures;
- b) Change to operating procedures;
- c) Change to system requirements, including performance and interoperability; or
- d) Change to system design.

7.5.5 ADS-B periodic status report

The ATS Providers should complete the ADS-B Periodic Status Report annually and deliver the report to the regional meeting of the ADS-B SITF. The Periodic Status Report should give an indication of system performance and identify any trend in system deficiencies, the resultant operational implications, and the proposed resolution, if applicable.

Communications Service Providers, if used, are also expected to submit Periodic Status Reports on the performance of the networks carrying ADS-B data at the annual regional meeting of the ADS-B SITF. These reports could also contain the details of planned or current upgrades to the network.

7.5.6 Processing of Reports

Each group in the monitoring process should nominate a single point of contact for receipt of problem reports and coordination with the other parties. This list will be distributed by the PRS Administrator to all parties to the monitoring process.

Each State should establish mechanisms within its ATS Provider and regulatory authority to:

- a) Assess problem reports and refer them to the appropriate technical or operational expertise for investigation and resolution;
- b) Coordinate with aircraft operators;
- c) Develop interim operational procedures to mitigate the effects of problems until such time as the problem is resolved;
- d) Monitor the progress of problem resolution;
- e) Prepare a report on problems encountered and their operational implications and forward these to the PRS;
- f) Prepare the ADS-B periodic status report at pre-determined times and forward these to the Secretary of the annual meeting of the ADS-B SITF; and
- g) Coordinate with any Communication Service Providers used.

7.6 APANPIRG

APANPIRG, with the assistance of its contributory bodies, shall oversee the monitoring process to ensure the ADS-B system continues to meet its performance and safety requirements, and that operational procedures are working as intended. The APANPIRG'S objectives are to:

- a) review Periodic Status Reports and any significant Problem Reports;
- b) highlight successful problem resolutions to ADS-B SITF members;
- c) monitor the progress of outstanding problem resolutions;
- d) prepare summaries of problems encountered and their operational implications; and
- e) assess system performance based on information in the PRS and Periodic Status Reports.

7.7 LOCAL DATA RECORDING AND ANALYSIS

7.7.1 Data recording

It is recommended that ATS Providers and Communication Service Providers retain the records defined below for at least 30 days to allow for accident/incident investigation processes. These records should be made available on request to the relevant State safety authority. Where data is sought from an adjacent State, the usual State to State channels should be used.

These recordings shall be in a form that permits a replay of the situation and identification of the messages that were received by the ATS system.

7.7.2 Local data collection

ATS providers and communications service providers should identify and record ADS-B system component failures that have the potential to negatively impact the safety of controlled flights or compromise service continuity.

7.7.3 Avionics problem identification and correction

ATS providers need to develop systems to:

- a) detect ADS-B avionics anomalies and faults
- b) advise the regulators and where appropriate the aircraft operators on the detected ADS-B avionics anomalies and faults
- c) devise mechanisms and procedures to address identified faults

Regulators need to develop and maintain systems to ensure that appropriate corrective actions are taken to address identified faults.

7.8 ADS-B PROBLEM REPORT

| 7.8.1 Report Form | | PRS# |
|----------------------------------|--------------------------------|------|
| Date UTC | Time UTC | ' |
| Registration | Aircraft ID | |
| Flight ID | ICAO 24 Bit Code | |
| Aircraft Type | | |
| Flight Sector/ Location | | |
| ATS Unit Description / addition | | |
| | | |
| | | |
| Originator | Originator Reference number | |

7.8.2 Description of Fields

| Field | Meaning |
|--------------------|----------------------------------------------------------------------------------------------------------------------------------------------|
| Number | A unique identification number assigned by the PRS |
| | Administrator to this problem report. Organizations writing problem reports |
| | are encouraged to maintain their own internal list of these problems for |
| | tracking purposes. Once the problems have been reported to the PRS and |
| | incorporated in the database, a number will be assigned by the PRS and used |
| | for tracking by the ADS-B SITF. |
| Date UTC | UTC date when the event occurred. |
| Time UTC | UTC time (or range of times) at which the event occurred. |
| Registration | Registration number (tail number) of the aircraft involved. |
| Aircraft ID (ACID) | Coded equivalent of voice call sign as entered in FPL Field 7. |
| ICAO 24 Bit Code | Unique aircraft address expressed in Hexadecimal form (e.g. 7432DB) |
| Flight ID (FLTID) | The identification transmitted by ADS-B for display on a controller situation |
| | display or a CDTI. |
| Flight | The departure airport and destination airport for the sector being flown by |
| Sector/Location | the aircraft involved in the event. These should be the ICAO identifiers of |
| | those airports. Or if more descriptive, the location of the aircraft during the |
| | event. |
| Originator | Point of contact at the originating organization for this report (usually the |
| | author). |
| Aircraft Type | The aircraft model involved. |
| Organization | The name of the organization (airline, ATS provider or communications |
| A TO LL | service provider) that created the report. |
| ATS Unit | ICAO identifier of the ATC Center or Tower controlling the aircraft at the |
| D : .: | time of the event. |
| Description | This should provide as complete a description of the situation leading up to |
| | the problem as is possible. Where the organization reporting the problem is |
| | not able to provide all the information (e.g. the controller may not know |
| | everything that happens on the aircraft), it would be helpful if they would |
| | coordinate with the other parties to obtain the necessary information. |
| | The description should include: |
| | A complete description of the problem that is being reported |
| | A complete description of the problem that is being reported The route contained in the FMS and flight plan. |
| | The route contained in the FMS and flight plan Any flight deals in light deals in light plan |
| | Any flight deck indications |
| | Any indications provided to the controller when the problem |
| | occurred |
| | Any additional information that the originator of the problem report aggregated as gright he halfful but is not included on the list of our |
| | considers might be helpful but is not included on the list above |
| | If necessary to contain all the information, additional pages may be added. if |
| | the originator considers it might be helpful, diagrams and other additional |
| | information (such as printouts of message logs) may be appended to the |
| | report. |
| | report. |

| 7.9 ADS-B PERFORMANO | CE REPORT FORM |
|--------------------------|----------------|
| Originating Organization | |
| Date of submission | Originator |
| Report Period | |
| TECHNICAL ISSUES | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| OPERATIONAL ISSUES | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| GENERAL COMMENTS | |
| GET (ETUTE CONTINUE) (15 | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |

8. RELIABILITY & AVAILABILITY CONSIDERATIONS

Reliability and Availability of ADS-B systems should normally be equivalent or better than the reliability and availability of radar systems.

Guidance material on Reliability and Availability standards for ADS-B systems and supporting voice communications systems are included in the document "Baseline ADS-B Service Performance Parameters" which is available on the ICAO APAC website at: http://www.icao.int/APAC/Documents/edocs/cns/ADSB ServicePer.pdf

The "Baseline ADS-B Performance Parameters" document contains three Tiers of service performance parameters with different reliability and availability standards for each Tier. The appropriate Tier should be selected for the type of ADS-B service intended:

- (a) Tier 1 standards are for a high performance traffic separation service;
- (b) Tier 2 standards are for a traffic situational awareness service with procedural separation; and
- (c) Tier 3 standards are for a traffic advisory service (flight information service)

To achieve high operational availability of ADS-B systems to support aircraft separation services, it is necessary to operate with duplicated/redundant systems. If one system fails, the service continues using an unduplicated system. This is acceptable for a short period, whilst the faulty system is being repaired, because the probability of a second failure during the short time window of repairing is low.

However, it is necessary to ensure that the repair does not take too long. A long repair time increases the risk of an unexpected failure (loss of service continuity); which in turn, introduces potential loss of service (low availability) and loss of aircraft operational efficiency and/or safety impacts.

8.1 Reliability

- 8.1.1 Reliability is a measure of how often a system fails and is usually measured as Mean Time Between Failure (MTBF) expressed in hours. Continuity is a measure equivalent to reliability, but expressed as the probability of system failure over a defined period. In the context of this document, failure means inability to deliver ADS-B data to the ATC centre. Ie: Failure of the ADS-B system rather than an equipment or component failure.
- 8.1.2 Poor system MTBF has a safety impact because typically it causes unexpected transition from one operating mode to another. For example, aircraft within surveillance coverage that are safely separated by a surveillance standard distance (say, 5 NM) are unexpectedly no longer separated by a procedural standard distance (say 15 mins), due to an unplanned surveillance outage.
- 8.1.3 In general, reliability is determined by design (see para 8.3 B below)

8.2 Availability

8.2.1 Availability is a measure of how often the system is available for operational use. It is usually expressed as a percentage of the time that the system is available.

- 8.2.2 Poor availability usually results in loss of economic benefit because efficiencies are not available when the ATC system is operating in a degraded mode (eg using procedural control instead of say 5 NM separation).
- 8.2.3 Planned outages are often included as outages because the efficiencies provided to the Industry are lost, no matter what the cause of the outage. However, some organisations do not include planned outages because it is assumed that planned outages only occur when the facility is not required.
- 8.2.4 Availability is calculated as

Availability (Ao) = MTBF/(MTBF+MDT)

where MTBF= Mean Time Between SYSTEM Failure MDT = Mean Down Time for the SYSTEM

The MDT includes Mean Time To Repair (MTTR), Turn Around Time (TAT) for spares, and Mean Logistic Delay Time (MLDT)

NB: This relates to the failure of the system to provide a service, rather than the time between individual equipment failures. Some organisations use Mean Time Between Outage (MTBO) rather than MTBF.

8.2.5 Availability is directly a function of how quickly the SYSTEM can be repaired. Ie: directly a function of MDT. Thus availability is highly dependent on the ability & speed of the support organisation to get the system back on-line.

8.3 Recommendations for high reliability/availability ADS-B systems

- A: System design can keep system failure rate low with long MTBF. Typical techniques are:
- to duplicate each element and minimise single points of failure. Automatic changeover or parallel operation of both channels keeps system failure rates low. Ie: the system keeps operating despite individual failures. Examples are:
 - Separate communication channels between ADS-B ground station and ATC centre preferably using different technologies or service providers eg one terrestrial and one satellite
- Consideration of Human factors in design can reduce the number of system failures due to human error. E.g. inadvertent switch off, incorrect software load, incorrect maintenance operation.
- Take great care with earthing, cable runs and lightning protection to minimise the risks of system damage
- Take great care to protect against water ingress to cables and systems
- Establish a system baseline that documents the achieved performance of the site that can be later be used as a reference. This can shorten troubleshooting in future.
- System design can also improve the MDT by quickly identifying problems and alerting maintenance staff. Eg Built in equipment test (BITE) can significantly contribute to lowering MDT.

- **B:** <u>Logistics strategy</u> aims to keep MDT very low. Low MDT depends on logistic support providing short repair times. To achieve short repair times, ANSPs usually provide a range of logistics, including the following, to ensure that the outage is less than a few days:
- ensure the procured system is designed to allow for quick replacement of faulty modules to restore operations
- provide remote monitoring to allow maintainers to identify the faulty modules for transport to site
- provide support tools to allow technicians to repair faulty modules or to configure/setup replacement modules
- provide technicians training to identify & repair the faulty modules
- provide local maintenance depots to reduce the time it takes to access to the site
- provide documentation and procedures to "standardise" the process
- use an in-country spares pool to ensure that replacement modules are available within reasonable times
- use a maintenance contract to repair faulty modules within a specified turnaround time. I.e.: to replenish the spares pool quickly.

Whilst technical training and remote monitoring are usually considered by ANSPs, sometimes there is less focus on spares support.

Difficulties can be experienced if States:

- a) Fail to establish a spares pool because procurement of spares at the time of failure can bring extensive delays due to :
- b) obtaining funds
- c) obtaining approval to purchase overseas
- d) obtaining approval to purchase from a "sole source"
- e) difficulties and delays in obtaining a quotation
- f) delays in delivery because the purchase was unexpected by the supplier
- g) Fail to establish a module repair contract resulting in:
 - long repair times
 - unplanned expenditure
 - inability for a supplier to repair modules because the supplier did not have adequate certainty of funding of the work

Spares pool

ANSPs can establish, preferably as part of their acquisition purchase, adequate spares buffer stock to support the required repair times. The prime objective is to reduce the time period that the system operates un-duplicated. It allows decoupling of the restoration time from the module repair time.

Module repair contract

ANSPs can also enter into a maintenance repair contract, preferably as part of their acquisition purchase, to require the supplier to repair or replace and deliver failed modules within a specified time – preferably with contractual incentives/penalties for compliance. Such support contracts are best negotiated as part of the acquisition contract when competition between vendors is at play to keep costs down. Sometimes it is appropriate to demand that the support contractor also keep a certain level of buffer stock of spares "in country".

It is strongly recommended that maintenance support is purchased under the same contract as the acquisition contract.

The advantages of a module repair contract are:

- The price can be determined whilst in the competitive phase of acquisition
 hence avoids excessive costs
- The contract can include the supplier bearing all shipping costs
- Can be funded by a define amount per year, which support the budget processes. If the costs are fixed, the supplier is encouraged to develop a reliable system minimising module repairs.
- It avoids delays and funding issues at the time of the module failure

Other typical strategies are:

- Establish availability and reliability objectives that are agreed organization wide. In particular agree System response times (SRT) for faults and system failure to ensure that MDT is achieved. An agreed SRT can help organizations to decide on the required logistics strategy including number, location and skills of staff to support the system.
- Establish baseline preventative maintenance regimes including procedures and performance inspections in conjunction with manufacturer recommendations for all subsystems
- Use remote control & monitoring systems to identify faulty modules before travel to site. This can avoid multiple trips to site and reduce the repair time
- Have handbooks, procedures, tools available at the site or a nearby depot so that travel time does not adversely affect down time
- Have adequate spares and test equipment ready at a maintenance depot near the site or at the site itself. Vendors can be required to perform analysis of the number of spares required to achieve low probability of spare "stock out"
- Have appropriate plans to cope with system and component obsolescence. It is possible to contractually require suppliers to regularly report on the ability to support the system and supply components.
- Have ongoing training programs and competency testing to ensure that staff are able to perform the required role

The detailed set of operational and technical arrangements in place and actions required to maintain a system through the lifecycle are often documented in a Integrated Logistics Support Plan.

- **C:** <u>Configuration Management</u> aims to ensure that the configuration of the ground stations is maintained with integrity. Erroneous configuration can cause unnecessary outages. Normally configuration management is achieved by:
- Having clear organizational & individual responsibilities and accountabilities for system configuration.
- Having clear procedures in place which define who has authority to change configuration and records of the changes made including, inter alia

- o The nature of the change including the reason
- o Impact of the change & safety assessment
- O An appropriate transition or cutover plan
- Who approved the change
- o When the change was authorized and when the change was implemented
- Having appropriate test and analysis capabilities to confirm that new configurations are acceptable before operational deployment.
- Having appropriate methods to deploy the approved configuration (Logistics of configuration distribution). Suggested methods;
 - Approved configuration published on intranet web pages
 - Approved configuration distributed on approved media

D: <u>Training & Competency plans</u> aim to ensure that staff has the skills to safety repairs Normally this is achieved by:

- Conduct of appropriate Training Needs Analysis (TNA) to identify the gap between trainee skill/knowledge and the required skill/knowledge.
- Development and delivery of appropriate training to maintainers
- Competency based testing of trainees
- Ongoing refresher training to ensure that skills are maintained even when fault rates are low

E: <u>Data collection & Review</u>:

Regular and scheduled review should be undertaken to determine whether reliability/availability objectives are being met. These reviews need to consider:

- Reports of actual achieved availability & reliability
- Data regarding system failures including "down time" needs to be captured and analysed so the ANSP actually knows what is being (or not being) achieved.
- Any failure trends that need to be assessed. This requires data capture of the root cause of failures
- Any environmental impacts on system performance, such coverage obstructions such as trees, planned building developments, corrosion, RFI etc. Changes in infrastructure may also be relevant including air conditioning (temperature/humidity etc) and power system changes.
- System problem reports especially those that relate to software deficiencies (design)
- System and component obsolescence
- Staff skills and need for refresher training

9. ADS-B REGULATIONS AND PROCEDURES

9.1 INTRODUCTION

ADS-B involves the transmission of specific data messages from aircraft and vehicle systems. These data messages are broadcast at approximately 0.5 second intervals and received at compatible ground stations that relay these messages to ATSU(s) for presentation on ATS situation displays. The following procedures relate to the use of ADS-B data in ATS ground surveillance applications.

The implementation of the ADS-B system will support the provision of high performance surveillance, enhancing flight safety, facilitating the reduction of separation minima and supporting user demands such as user-preferred trajectories.

9.2 ADS-B REGULATIONS

As agreed at APANPRIG 22/8, States intending to implement ADS-B based surveillance services may designate portions of airspace within their area of responsibility by:

- (a) mandating the carriage and use of ADS-B equipment; or
- (b) providing priority for access to such airspace for aircraft with operative ADS-B equipment over those aircraft not operating ADS-B equipment.

In publishing ADS-B mandate/regulations, States should consider to:

- define the ADS-B standards applicable to the State. For interoperability and harmonization, such regulations need to define both the standards applicable for the aircraft ADS-B position source and the ADS-B transmitter.
- define the airspace affected by the regulations and the category of aircraft that the regulation applies to.
- define the timing of the regulations allowing sufficient time for operators to equip. Experience
 in Asia Pacific Regions is that major international carriers are having high equippage rates of
 ADS-B avionics. However the equippage rates of ADS-B avionics for some regional fleets,
 business jets and general aviation are currently low and more time will be required to achieve
 high equippage rates.
- establish the technical and operational standards for the ground stations and air traffic management procedures used for ADS-B separation services, including the associated voice communications services.

States may refer to the APANPIRG Conclusion 22/36 on the template for ADS-B mandate/regulations on provision of ADS-B based ground surveillance. Some States listed below have published their ADS-B mandate/regulations on their web sites that could be used for reference.

(a) Civil Aviation Safety Authority (CASA) of Australia Civil Aviation Order 20.18 Amendment Order (No. 1) 2009, Civil Aviation Order 82.1 Amendment Order (No. 1) 2009, Civil Aviation Order 82.3 Amendment Order (No. 2) 2009, Civil Aviation Order 82.5 Amendment Order (No. 2) 2009 and Miscellaneous Instrument CASA 41/09 – Direction – use of ADS-B in foreign aircraft engaged in private operations in Australian territory "http://www.comlaw.gov.au/Details/F2012C00103/Download"

(b) Civil Aviation Department (CAD) of Hong Kong, China

Aeronautical Information Publication Supplement No. 13/13 dated 29 October 2013

"http://www.hkatc.gov.hk/HK AIP/supp/A13-13.pdf"

(c) Civil Aviation Authority of Singapore (CAAS)

Aeronautical Information Publication Supplment No. 254/13 dated 6 November 2013

"http://www.caas.gov.sg/caasWeb2010/export/sites/caas/en/Regulations/Aeronautical_Information/AIP_Supplements/download/AIPSUP254-13.pdf"

(d) Federal Aviation Administration (FAA)

ADS—B Out Performance Requirements To Support Air Traffic Control (ATC) Service, Final Rule "http://www.gpo.gov/fdsys/pkg/FR-2010-05-28/pdf/2010-12645.pdf"

9.3 FACTORS TO BE CONSIDERED WHEN USING ADS-B

9.3.1 Use of ADS-B Level data

The accuracy and integrity of pressure altitude derived level information provided by ADS-B are equivalent to Mode C level data provided through an SSR sensor and subject to the same operational procedures as those used in an SSR environment. Where the ATM system converts ADS-B level data to display barometric equivalent level data, the displayed data should not be used to determine vertical separation until the data is verified by comparison with a pilot reported barometric level.

9.3.2 Position Reporting Performance

The ADS-B data from the aircraft will include a NUC/NIC/SIL categorization of the accuracy and integrity of the horizontal position data. This figure is determined from NIC/ NAC/ SIL values for DO260A/B compliant avionics and NUC values for DO260/ED102 compliant avionics.

In general, for 5NM separation, if the HPL value used to generate ADS-B quality indicators (NUC or NIC) is greater than 2 nautical miles the data is unlikely to be of comparable quality to that provided by a single monopulse SSR. ADS-B data should not be used for separation unless a suitable means of determining data integrity is used.

The key minimum performance requirements for an ADS-B system to enable the use of a 3 NM or 5 NM separation minimum in the provision of air traffic control is provided in the ICAO Circular 326 (especially Appendix C).

ADS-B reports with low integrity may be presented on situation displays, provided the controller is alerted (e.g. by a change in symbology and/or visual alert) to the change and the implications for the provision of separation. An ANS Provider may elect not to display ADS-B tracks that fail to meet a given position reporting performance criterion.

9.3.3 GNSS Integrity Prediction Service

Early implementations of ADS-B are expected to use GNSS for position determination. As such, availability of GNSS data has a direct influence on the provision of a surveillance service.

ATS Providers may elect to use a GNSS integrity prediction service to assist in determining the future availability of useable ADS-B data. The integrity prediction service alerts users to potential future loss or degradation of the ADS-B service in defined areas. When these alerts

are displayed, the system is indicating to its users that at some time in the future the ADS-B positional data may be inadequate to support the application of ADS-B separation. It is recommended that the prediction service is made available to each ATSU that is employing ADS-B to provide a separation service, to ensure that air traffic controllers are alerted in advance of any predicted degradation of the GNSS service and the associated reduction in their ability to provide ADS-B separation to flights that are within the affected area. This is similar to having advance warning of a planned radar outage for maintenance.

ADS-B should not be used to provide separation between aircraft that will be affected by an expected period of inadequate position reporting integrity.

If an unpredicted loss of integrity occurs (including a RAIM warning report from aircrew) then;

- (a) ADS-B separation should not be applied by ATC to the particular aircraft reporting until the integrity has been assured; and
- (b) The controller should check with other aircraft in the vicinity of the aircraft reporting the RAIM warning, to determine if they have also been affected and establish alternative forms of separation if necessary.

9.3.4 Sharing of ADS-B Data

ADS-B Data-sharing for ATC Operations

Member States should consider the benefits of sharing ADS-B data received from aircraft operating in the proximity of their international airspace boundaries with adjacent States that have compatible technology in an effort to maximize the service benefits and promote operational safety.

Data sharing may involve the use of the data to provide separation services if all the requirements for delivery of separation services are satisfied, In some cases, States may choose to use a lower standard that supports surveillance safety nets and situational awareness whilst operations are conducted using procedural separation standards.

Any agreement on the sharing of surveillance data should be incorporated in Letters of Agreement between the States concerned. Such agreements may also include the sharing of VHF communication facilities.

A template for ADS-B data-sharing agreement is provided on the ICAO APAC website "http://www.icao.int/APAC/Pages/edocs.aspx" for reference by States.

ADS-B Data-sharing for Safety Monitoring

With endorsement of the methodology by both the ICAO Separation and Airspace Safety Panel (SASP) and the Regional Monitoring Agencies Coordination Group (RMACG), ADS-B data can be used for calculating the altimetry system error (ASE) which is a measure of the height-keeping performance of an aircraft. It is an ICAO requirement that aircraft operating in RVSM airspace must undergo periodic monitoring on height-keeping performance. The existing methods to estimate aircraft ASE include use of a portable device, the Enhanced GPS Monitoring Unit, and ground-based systems called Height Monitoring Unit/Aircraft Geometric Height Measurement Element. The use of ADS-B data for height-keeping performance monitoring, on top of providing enhanced and alternative means of surveillance, will provide a

cost-effective option for aircraft operators. States are encouraged to share ADS-B data to support the height-keeping performance monitoring of airframe.

Civil/Military ADS-B Data-sharing

Civil/military data sharing arrangements, including aircraft surveillance, were a key part of civil/military cooperation in terms of tactical operational responses and increasing trust between civil and military units.

Aircraft operating ADS-B technology transmit their position, altitude and identity to all listeners, conveying information from co-operative aircraft that have chosen to equip and publicly broadcast ADS-B messages. Thus there should be no defence or national security issues with the use and sharing of such data.

Some military transponders may support ADS-B using encrypted DF19 messages, but these data are normally not decoded or used at all by civil systems. In most cases today, tactical military aircraft are not ADS-B equipped or could choose to disable transmissions. In future, increasing numbers of military aircraft will be ADS-B capable, with the ability to disable these transmissions. ADS-B data sharing should not influence the decision by military authorities to equip or not equip with ADS-B. Moreover, it is possible for States to install ADS-B filters that prevent data from sensitive flights being shared. These filters can be based on a number of criteria and typically use geographical parameters to only provide ADS-B data to an external party if aircraft are near the boundary.

A guidance material on advice to military authorities regarding ADS-B data sharing is provided on the ICAO APAC website "http://www.icao.int/APAC/Pages/edocs.aspx" for reference by States.

9.3.5 Synergy of ADS-B and GNSS

States intending to implement GNSS/PBN or ADS-B should consider the efficiency of implementing the other technology at the same time due to the inherent efficiencies in doing so. GNSS systems provide navigation solutions to IFR aircraft for the conduct of enroute, terminal and non-precision approaches. The use of GNSS/PBN can provide higher performance and higher safety. Transition to GNSS can avoid significant ground infrastructure costs.

ADS-B systems provide surveillance based upon GNSS position source. ADS-B provides high performance and high update surveillance for both air-air and ATC surveillance. Transition to ADS-B can avoid the costs associated with ground based radar infrastructure. ADS-B system installations rely on acceptable GNSS equipment being installed in the aircraft to provide the position source and integrity.

If the fleet is equipped with ADS-B, they will already have most of the requirements to use GNSS for navigation satisfied. Similarly, if aircraft have suitable GNSS on board, they will have a position source to support ADS-B. It is noted however, that some care is needed to ensure that the requirements of GNSS/PBN and surveillance are both satisfied.

There is significantly less cost for these systems to be installed in an aircraft at the same time. A single installation of GNSS & ADS-B will involve:

- a single design activity instead of two
- a single downtime instead of two
- installation of the connection between GPS and ADS-B transponder
- a single test, certification and aircraft flight test

For the affected aviation community (ANSP, regulator and operator), the lessons learnt and issues faced in both GNSS and ADS-B have significant commonality. This can lead to efficiencies in Industry education and training.

9.4 Reporting Rates

9.4.1 General

The ADS-B system shall maintain a reporting rate that ensures at least an equivalent degree of accuracy, integrity and availability as for a radar system that is used to provide a similar ATC service. The standard reporting rate is approximately 0.5 second from the aircraft, but the rate of update provided to the ATM system (for the situation display) may be less frequent (e.g. 5 seconds), provided the equivalency with radar is preserved.

9.5 SEPARATION

9.5.1 General

ADS-B data may be used in combination with data obtained by other means of surveillance (such as radar, flight plan track, ADS-C) for the application of separation provided appropriate minima as determined by the State are applied. It should be noted that the quality of communications will have a bearing on the determination of appropriate minima.

All safety net features (MSAW, STCA, MTCA, RAM and DAIW/RAI etc) should possess the same responsiveness as equivalent radar safety net features.

9.5.2 Identification Methods

Some of the methods approved by ICAO for establishing identification with radar, may be employed with ADS-B (see PANS-ATM chapter 8). One or more of the following identification procedures are suggested:

- a) direct recognition of the aircraft identification in an ADS-B label on a situation display;
- b) transfer of ADS-B identification;
- c) observation of compliance with an instruction to TRANSMIT ADS-B IDENT.

Note: In automated systems, the "IDENT" feature may be presented in different ways, e.g. as a flashing of all or part of the position indication and associated label.

9.5.3 ADS-B Separation

ADS-B Separation minima has been incorporated by ICAO in PANS-ATM (Doc 4444), and in Regional Supplementary Procedures (Doc 7030).

In a mixed surveillance environment, States should use the larger separation standard applicable between aircraft in the conflict pair being considered.

9.5.4 Vertical separation

9.5.4.1 Introduction

The ADS-B level data presented on the controllers situation display shall normally be derived from barometric pressure altitude. In the event that barometric altitude is absent, geometric altitude shall not be displayed on displays used for provision of air traffic services. Geometric altitude may be used in ATM systems for other purposes.

9.5.4.2 Vertical tolerance standard

The vertical tolerances for ADS-B level information should be consistent with those applied to Mode C level information.

9.5.4.3 Verification of ADS-B level information

The verification procedures for ADS-B level information shall be the same as those employed for the verification of Mode C level data in a radar environment.

9.6 AIR TRAFFIC CONTROL CLEARANCE MONITORING

9.6.1 General

ADS-B track data can be used to monitor flight path conformance with air traffic control clearances.

9.6.2 Deviations from ATC clearances

The ATC requirements relating to monitoring of ADS-B traffic on the situation display should be similar to those contained in PANS-ATM Ch.8.

9.7 ALERTING SERVICE

For ADS-B equipped aircraft, the provision of an alerting service should be based on the same criteria as applied within a radar environment.

9.8 POSITION REPORTING

9.8.1 Pilot position reporting requirements in ADS-B coverage

States should establish voice and/or CPDLC position reporting procedures consistent with those applicable with radar for aircraft that have been identified by ATC.

9.8.2 Meteorological reporting requirements in ADS-B airspace

ATSUs may promulgate in the AIP meteorological reporting requirements that apply within the nominated FIR. The meteorological reporting data required and the transmission methods to be used by aircrew shall be specified in AIP.

9.9 PHRASEOLOGY

9.9.1 Phraseology Standard

States should use common phraseology for both ADS-B and radar where possible, and should note the requirement for ADS-B specific phraseology in some instances. States shall refer to PANS ATM Chapter 12 for ADS-B phraseology:

ADS-B EQUIPMENT DEGRADATION

ADS-B OUT OF SERVICE (appropriate information as necessary).

TO REQUEST THE CAPABILITY OF THE ADS-B EQUIPMENT

- a) ADVISE ADS-B CAPABILITY;
- *b) ADS-B TRANSMITTER (data link);
- *c) ADS-B RECEIVER (data link);
- *d) NEGATIVE ADS-B.
- * Denotes pilot transmission.

Note: For (b) and (c) – the options are not available for aircraft that are not equipped.

TO REQUEST RESELECTION OF AIRCRAFT IDENTIFICATION REENTER FLIGHT IDENTIFICATION.

Note: For some aircraft, this option is not available in-flight

TERMINATION OF RADAR AND/OR ADS-B SERVICE IDENTIFICATION LOST [reasons] (instructions).

TO REQUEST THE OPERATION OF THE MODE S OR ADS-B IDENT FEATURE SQUAWK IDENT.

Note: For some standalone ADS-B equipage affecting General Aviation, the option of "TRANSMIT ADS-B IDENT" may be available

TO REQUEST AIRCRAFT SWITCHING TO OTHER TRANSPONDER OR TERMINATION OF ADS-B TRANSMITTER OPERATION

- a) SWITCH TO OTHER TRANSPONDER
- b) STOP ADS-B TRANSMISSION. SQUAWK (code) ONLY.

Note:

- a) In many cases the ADS-B transmitter cannot be operated independently of the SSR transponder and switching off the ADS-B transmission would also switch off the SSR transponder operation
- b) "STOP ADS-B TRANSMISSION" applies only to aircraft that have the facility to switch off the ADS-B transmission, while maintaining SSR operation.

9.9.2 Operations of Mode S Transponder and ADS-B

It should be noted that independent operations of Mode S transponder and ADS-B will not be possible in many aircraft (e.g. where ADS-B is solely provided by 1090 MHz extended squitter emitted from the transponder). Additionally, some desirable but optional features of ADS-B transmitters may not be fitted

in some aircraft. Controller training on this issue, as it relates to the following examples of radio telephony and/or CPDLC phraseology is recommended.

9.9.2.1 STOP ADSB TRANSMISSION or STOP SQUAWK

<u>Issue</u>: In most commercial aircraft, a common "transponder control head" is used for SSR transponder, ACAS and ADS-B functionality. In this case, a pilot who complies with the instruction to stop operation of one system will also need to stop operation of the other systems – resulting in a loss of surveillance not intended or expected by the controller.

ATC need to be aware that an instruction to "Stop ADS-B Transmission" may require the pilot to switch off their transponder that will then stop all other functions associated with the transponder operations (such as ACARs etc). Pilots need to be aware of their aircraft's equipment limitations, the consequences of complying with this ATC instruction, and be aware of their company policy in regard to this. As with any ATC instruction issued, the pilot should advise ATC if they are unable to comply.

Recommendation: It is recommended that the concatenated phrases STOP ADSB TRANSMISSION, SQUAWK (code) ONLY or STOP SQUAWK, TRANSMIT ADSB ONLY are used. It is recommended that controller training highlights the possible consequences of **issuing** these instructions and that pilot training highlights the consequences of **complying** with this instruction. It is also recommended that aircraft operators have a clearly stated policy on procedures for this situation. Should a pilot respond with UNABLE then the controller should consider alternative solutions to the problem that do not remove the safety defences of the other surveillance technologies. This might include manual changes to flight data, coordination with other controllers and/or change of assigned codes or callsigns.

9.9.2.2 STOP ADSB ALTITUDE TRANSMISSION [WRONG INDICATION or reason] and TRANSMIT ADSB ALTITUDE

<u>Issue</u>: Most aircraft will not have separate control of ADSB altitude transmission. In such cases compliance with the instruction may require the pilot to stop transmission of all ADSB data and/or Mode C altitude – resulting in a loss of surveillance not intended or expected by the controller.

<u>Recommendation</u>: It is recommended that, should the pilot respond with UNABLE, the controller should consider alternative solutions to the problem that do not remove the safety defences of other surveillance data. This might include a procedure that continues the display of incorrect level information but uses pilot reported levels with manual changes to flight data and coordination with other controllers.

9.9.2.3 TRANSMIT ADS-B IDENT

<u>Issue</u>: Some aircraft may not be capable or the ADSB SPI IDENT control may be shared with the SSR SPI IDENT function.

<u>Recommendation</u>: It is recommended that controllers are made aware that some pilots are unable to comply with this instruction. An alternative means of identification that does not rely on the ADSB SPI IDENT function should be used.

9.10 FLIGHT PLANNING

9.10.1 ADS-B Flight Planning Requirement – Flight Identity

The aircraft identification (ACID) must be accurately recorded in section 7 of the ICAO Flight Plan form as per the following instructions:

Aircraft Identification, not exceeding 7 characters is to be entered both in item 7 of the flight plan and replicated exactly when set in the aircraft (for transmission as Flight ID) as follows: Either,

a) The ICAO three-letter designator for the aircraft operating agency followed by the flight identification (e.g. KLM511, BAW213, JTR25), when:

in radiotelephony the callsign used consists of the ICAO telephony designator for the operating agency followed by the flight identification (e.g. KLM 511, SPEEDBIRD 213, HERBIE 25).

Or,

- b) The registration marking of the aircraft (e.g. EIAKO, 4XBCD, OOTEK), when:
 - in radiotelephony the callsign used consists of the registration marking alone (e.g. EIAKO), or preceded by the ICAO telephony designator for the operating agency (e.g. SVENAIR EIAKO),
 - 2) the aircraft is not equipped with radio.
 - Note 1: No zeros, hyphens, dashes or spaces are to be added when the Aircraft Identification consists of less than 7 characters.
 - Note 2: Appendix 2 to PANS-ATM refers. ICAO designators and telephony designators for aircraft operating agencies are contained in ICAO Doc 8585.

9.10.2 ADS-B Flight Planning Requirements

9.10.2.1 ICAO Flight Plan Item 10 – Surveillance Equipment and Capabilities

An appropriate ADS-B designator shall be entered in item 10 of the flight plan to indicate that the flight is capable of transmitting ADS-B messages.

These are defined in ICAO DOC 4444 as follows:

B1 ADS-B with dedicated 1090 MHz ADS-B "out" capability

B2 ADS-B with dedicated 1090 MHz ADS-B "out" and "in" capability

U1 ADS-B "out" capability using UAT

U2 ADS-B "out" and "in" capability using UAT

V1 ADS-B "out" capability using VDL Mode 4

V2 ADS-B "out" and "in" capability using VDL Mode 4

During the ADS-B SITF/13 meeting held in April 2014, clarification of the B1 and B2 descriptors was recommended as follows. This will be progressed for change to ICAO DOC 4444, but may take some time for formal adoption:

B1 ADS-B "out" capability using 1090 MHz extended squitter B2 ADS-B "out" and "in" capability using 1090 MHz extended squitter

States should consider use of the revised descriptors in AIP.

9.10.2.2 ICAO Flight Plan Item 18 – Other Information

Where required by the appropriate authority the ICAO Aircraft Address (24 Bit Code) may be recorded in Item 18 of the ICAO flight plan, in hexadecimal format as per the following example:

CODE/7C432B

States should note that use of hexadecimal code may be prone to human error and is less flexible in regard to airframe changes for a notified flight.

9.10.2.3 Transponder Capabilities

When an aircraft is equipped with a mode S transponder, that transmits ADS-B messages, according to ICAO Doc 4444, an appropriate Mode S designator should also be entered in item 10; i.e.: either

- E Transponder Mode S, including aircraft identification, pressure-altitude and extended squitter (ADS-B) capability, or
- L Transponder Mode S, including aircraft identification, pressure-altitude, extended squitter (ADS-B) and enhanced surveillance capability.

During the ADS-B SITF/13 meeting held in April 2014, clarification of the E and L descriptors was recommended as follows. This will be progressed for change to ICAO DOC 4444, but may take some time for formal adoption:

- E Transponder Mode S, including aircraft identification, pressure-altitude and ADS-B capability, or
- o L Transponder Mode S, including aircraft identification, pressure-altitude, ADS-B and enhanced surveillance capability.

States should consider use of the revised descriptors in AIP.

9.10.3 Setting Aircraft Identification (Flight ID) in Cockpits

(a) Flight ID Principles

The aircraft identification (sometimes called the flight identification or FLTID) is the equivalent of the aircraft callsign and is used in both ADS-B and Mode S SSR technology. Up to seven characters long, it is usually set in airline aircraft by the flight crew via a cockpit interface. It

enables air traffic controllers to identify and aircraft on a display and to correlate a radar or ADS-B track with the flight plan date. Aircraft identification is critical, so it must be entered carefully. Punching in the wrong characters can lead to ATC confusing once aircraft with another.

It is important that the identification exactly matches the aircraft identification (ACID) entered in the flight notification.

Intuitive correlation between an aircraft's identification and radio callsign enhances situational awareness and communication. Airline aircraft typically use a three letter ICAO airline code used in flight plans, NOT the two letter IATA codes.

(b) Setting Flight ID

The callsign dictates the applicable option below for setting ADS-B or Mode S Flight ID:

- (i) the flight number using the ICAO three-letter designator for the aircraft operator if a flight number callsign is being used (e.g. QFA1 for Qantas 1, THA54 for Thai 54).
- (ii) the nationality and registration mark (without hyphen) of the aircraft if the callsign is the full version of the registration (e.g. VHABC for international operations).
- (iii) The registration mark alone of the aircraft if the callsign is the abbreviated version of the registration (eg ABC for domestic operations).
- (iv) The designator corresponding to a particular callsign approved by the ANSP or regulator (e.g. SPTR13 for firespotter 3).
- (v) The designator corresponding to a particular callsign in accordance with the operations manual of the relevant recreational aircraft administrative organization (e.g. G123 for Gyroplane 123).

9.11 PROCEDURES TO HANDLE NON-COMPLANT ADS-B AIRCAFT OR MIS-LEADING ADS-B TRANSMISSIONS

ADS-B technology is increasingly being adopted by States in the Asia/Pacific Region. Asia/Pacific Region adopted 1090 extended squitter technology. Reliance on ADS-B transmissions can be expected to increase over the coming years.

Currently a number of aircraft are transmitting ADS-B data which is misleading or non-compliant with the ICAO standards specified in Annex 10. Examples include:

- a) aircraft broadcasting incorrect message formats;
- b) aircraft broadcasting inertial positional data and occasionally indicating in the messages that the data has high integrity when it does not;
- c) using GPS sources that do not generate correct integrity data, whilst indicating in the messages that the data has high integrity;
- d) transmitting ADS-B data with changing (and incorrect) flight identity; and
- e) transmitting ADS-B data with incorrect flight identity continuously.

If the benefits of ADS-B are to flow to the aviation industry, misleading and non-compliant ADS-B transmissions need to be curtailed to the extent possible.

The transmission of a value of zero for the NUCp or the NIC or the SIL by an aircraft indicates a navigational uncertainty related to the position of the aircraft or a navigation integrity issue that is too significant to be used by air traffic controllers.

As such, the following procedure, stipulated in the Regional Supplementary Procedures Doc 7030, shall be applicable in the concerned FIRs on commencement of ADS-B based surveillance services notified by AIP or NOTAM:

If an aircraft operates within an FIR where ADS-B-based ATS surveillance service is provided, and

- a) carries 1090 extended squitter ADS-B transmitting equipment which does not comply with one of the following:
 - 1) EASA AMC 20-24; or
 - 2) the equipment configuration standards in Appendix XI of Civil Aviation Order 20.18 of the Civil Aviation Safety Authority of Australia; or
 - 3) installation in accordance with the FAA AC No. 20-165 Airworthiness Approval of ADS; or
- b) the aircraft ADS-B transmitting equipment becomes unserviceable resulting in the aircraft transmitting misleading information;

then:

- a) except when specifically authorized by the appropriate ATS authority, the aircraft shall not fly unless the equipment is:
 - 1) deactivated; or
 - 2) transmits only a value of zero for the NUCp or NIC or SIL

States may elect to implement a scheme to blacklist those non-compliant aircraft or aircraft consistently transmitting mis-leading ADS-B information, so as to refrain the aircraft from being displayed to ATC.

A sample template is given below for reference by States to publish the procedures to handle non-compliant ADS-B aircraft or misleading ADS-B transmissions in their ADS-B mandate/regulations:

After <insert earliest date that ADS-B may be used for any relevant operational purpose> if an aircraft carries ADS-B transmitting equipment which does no comply with :

- (a) EASA AMC 20-24; or
- (b) the equivalent configuration standards in Appendix XI of Civil Aviation Order 20.18 of the Civil Aviation Safety Authority of Australia; or
- (c) Installation in accordance with the FAA AC No. 20-165 Airworthiness Approval of ADS;

or the aircraft ADS-B transmitting equipment becomes unserviceable resulting in the aircraft transmitting misleading information;

the aircraft must not fly unless equipment is:

- (a) deactivated; or
- (b) set to transmit only a value of zero for the NUCp or NIC or SIL.

Note:

- 1. It is considered equivalent to deactivation if NUCp or NIC or SIL is set to continually transmit only a value of zero.
- 2. Regulators should take appropriate action to ensure that such regulations are complied with.
- 3. ATC systems should discard ADS-B data when NUC or NIC or SIL =0.

9.12 EMERGENCY PROCEDURES

ATC surveillance systems should provide for the display of safety-related alerts and warnings, including conflict alert, minimum safe altitude warning, conflict prediction and unintentionally duplicated SSR codes and aircraft identifications.

The ADS-B avionics may transmit emergency status messages to any ADS-B ground station within coverage. The controller receiving these messages should determine the nature of the emergency, acknowledge receipt if appropriate, and initiate any assistance required. An aircraft equipped with ADS-B might operate the emergency and/or urgency mode as follows:

- a) emergency;
- b) no communications;
- c) unlawful interference;
- d) minimum fuel; and/or
- e) medical.

Selection of an emergency transponder code (e.g. 7600) automatically generates an emergency indication in the ADS-B message. However, some ADS-B transponders may only generate a generic emergency indication. That means, the specific type of emergency, e.g., communication failure, is not always conveyed to the controller in an ADS-B environment. The controller may only receive a generic emergency indication irrespective of the emergency codes being selected by the pilot.

Due to limitations of some ADS-B transponders, procedures should be developed for ATC to confirm the types of emergency with pilots based on operational needs of States.

Executive control responsibility

The responsibility for control of the flight rests with the ATSU within whose airspace the aircraft is operating. However, if the pilot takes action contrary to a clearance that has already been coordinated with another sector or ATSU and further coordination is not possible in the time available, the responsibility for this action would rest with the pilot in command, and performed under the pilot's emergency authority.

Emergency procedures

The various circumstances surrounding each emergency situation preclude the establishment of exact detailed procedures to be followed. The procedures outlined in PANS-ATM Chapter 15 provide a general guide to air traffic services personnel and where necessary, should be adapted for the use of ADS-B.

10. SECURITY ISSUES ASSOCIATED WITH ADS-B

10.1 INTRODUCTION

ADS-B technologies are currently "open systems" and the openness is an essential component of successful use of ADS-B. It was also noted that ADS-B transmission from commercial aircraft is a "fact of life" today. Many commercial aircraft are already equipped with ADS-B and have been transmitting data for some time.

It was noted that there has been considerable alarmist publicity regarding ADS-B security. To a large extent, this publicity has not considered the nature and complexity of ATC. Careful assessment of security policies in use today for ADS-B and other technologies can provide a more balanced view.

10.2 CONSIDERATIONS

A list of ADS-B vulnerabilities categorised into threats to Confidentiality, Integrity and Availability has been reviewed and documented into the guidance material on security issues associated with ADS-B provided on the ICAO APAC website "http://www.icao.int/APAC/Pages/edocs.aspx" under "Restricted Site" for reference by States. States could contact ICAO Regional Office to get access to the guidance material. The following recommendations are made to States:

- (a) While ADS-B is recognized as a key enabling technology for aviation with potential safety benefits, it is recommended that States made aware of possible ADS-B security specific issues;
- (b) It is recommended that States note that much of the discussion of ADS-B issues in the Press has not considered the complete picture regarding the ATC use of surveillance data;
- (c) For current ADS-B technology implementation, security risk assessment studies should be made in coordination with appropriate national organisations and ANSPs to address appropriate mitigation applicable in each operational environment, in accordance with ATM interoperability requirements; and
- (d) Future development of ADS-B technology, as planned in the SESAR master plan for example, should address security issues. Studies should be made to identify potential encryption and authentication techniques, taking into consideration the operational need of air to ground and air to air surveillance applications. Distribution of encryption keys to a large number of ADS-B receivers is likely to be problematic and solutions in the near and medium term are not considered likely to be deployed worldwide. Internet based encryption strategies are not deployable when ground stations are pass receivers.

| The requirement for this form is specified in the Sy | stem Management Manual (Se | ction 11.2 of V4), C-MAN | 0107 | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------|--------------------------|--------|--|
| Project/Task Name | SAP Project/Task ID: | Sites or Locations affe | ected: | |
| Documentation prepared by: | Date: | Commissioning Date: | | |
| Affected System(s) | System Criticality | Change Consequence | Level | |
| Brief Description of Change: | | | | |
| Commission | oning Readiness En | dorsement | | |
| The endorsement of this form by the appropriate authorities as specified in the System Management Manual certifies that the requirements detailed in this form (with the exception of the non-critical deficiencies listed herein) have been completed prior to the commissioning of the system change or new system. | | | | |
| Chief Engineer or Technical or | Maintenance Autho | rity | | |
| Name: | Signature: | Date: | | |
| Designation: | | | | |
| Name: | Signature: | | Date: | |
| Designation: | 1 | | | |
| Chief Operating/User Authority or Operating/User Authority | | | | |
| Name: | Signature: | | Date: | |
| Designation: | | | | |
| | | | | |

Commissioning Readiness

Records Management Instructions

Place the completed Commissioning Readiness Form, together with any support documents on the Project file

Provide a copy of the completed Commissioning Readiness Form to P&E, Asset Lifecycle Manager, Planning and Integration

Note 1: Non-critical deficiencies (NCD) are those outstanding technical and operational issues that do not prevent the safe and effective use or maintenance of the facility, but will be addressed in a specified and agreed time. NCDs shall be listed on the Commissioning Certificate (C-FORMS0300) and recorded in the relevant system (ASID / HEAT / SAIR). It is preferable for each NCD to be recorded as a separate Issue.

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|------------------|-----------------------------------------------------------------------------------------------------------------|
| 1 OI | PERATIONAL SAFETY | | | |
| 1.1 | Provide a link to the completed SCARD SCARD Template (AA-TEMP-SAF-0042) Note: For unregulated systems the SCARD shall be used to assess the impact of the change and perform a preliminary hazard analysis | Safety Change Management Requirements AA-NOS-SAF-0104 | Completed N/A | Link to SCARD |
| 1.2 | The outcome of the SCARD will be the requirement for one of the following for commissioning: Safety Statement – included in SCARD or standalone Safety Statement which must provide Airservices Australia management with sufficient information to demonstrate that safety has been considered and the change presents minimal or no safety issues. Safety Plan & Safety Assessment Report, or Safety Plan & Safety Case Safety Plans, Safety Assessment Reports and Safety Cases are required to be available in the Document Search Database | Safety Change Management Requirements AA-NOS-SAF-0104 Document Search Database | Completed N/A | Link to Safety statement or Link to Safety Plan & Safety Assessment Report or Link to Safety Plan & Safety Case |
| 1.3 | Safety risk management process completed and includes | Safety Risk Management Procedures AA-PROC-SAF-0105 | Completed N/A | |
| 1.4 | Impacts on the Operational Risk Assessments from residual risks have been assessed and implemented using Operational Risk Assessment Change Request and Acceptance Record – AA-FORM-SAF-0032 | Operational Risk Assessment AA-NOS-SAF-0006 Safety Risk Management Procedures AA-PROC-SAF-0105 | Completed N/A | Link to Operational Risk Assessment Change Request and Acceptance Record: |
| 1.5 | Arrangements for monitoring and review of risks are in place including arrangements for safety performance monitoring following the transition. | Safety Risk Management Procedures AA-PROC-SAF-0105 | Completed N/A | |
| 1.6 | CASA have approved / accepted or been advised of the change, as applicable | Safety Change Management Requirements <u>AA-NOS-SAF-0104</u> | Completed N/A | |

Version 3: Effective 21 August 2012
Form approved by: Branch Manager, Operational Integrity & Compliance

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|-----------------------------------------------------------------------------------------------------------------------|
| 2 W | ORKPLACE HEALTH & SAFETY | | | |
| 2.1 | Initial WHS Hazard Identification must be completed as per the template AA-TEMP-SAF-0020 | Safety Risk Management Procedures AA-PROC-SAF-0105 Initial WHS Hazard Identification AA-TEMP-SAF-0020 Workplace Health and Safety Risk Management Summary AA-TEMP-SAF-0016 | Completed N/A | Link to completed Workplace Health and Safety Management Summary <u>AA-TEMP-SAF-0016</u> |
| 2.2 | Ensure employees and stakeholders are consulted when significant changes to work arrangements are being considered. | Working Together Workplace Consultation AA-PROC-SAF-0009 | Completed N/A | |
| 2.3 | Tower Access / Classification assessed? Working at Heights Safety Checklist & Daily Toolbox Meeting (F098) Fall arrest facility / equipment available | Working at Heights PROC-157 Working at Heights Safety Checklist & Daily Toolbox Meeting_F098 | Completed N/A | |
| 2.4 | WHS hazard controls are in place - Safe Work Method Statement completed - Plant risks managed - Radhaz survey completed, published on the Avnet and general public & occupational exposure boundaries identified | Safe Work Method Statement AA-TEMP-SAF-0017 Managing WHS Risk for Contractors and Projects AA-PROC-SAF-0012 Plant Risk Management PROC-134 RF Radiation, Surveys & Health & Safety Mgmt PROC-121 | Completed N/A | Link to completed Safe Work Method Statement AA-TEMP-SAF-0017 Link to completed F131 Plant Risk Management Checklist |
| 2.5 | At the completion of works ensure WHS Inspections are completed and hazard controls are in place. Building condition; clean, undamaged, all work completed. | Conducting Workplace Safety Inspections AA-PROC-SAF-0008 | Completed N/A | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 3 EN | IVIRONMENT | | | |
| 3.1 | Environmental Impact must be assessed using the Environmental Impact Screening & Assessment Criteria for Changes to On-ground Activities Assistance in assessing the Environmental Impact can be obtained from Environment and Climate Change Unit in Environment Group. | Environmental Screening & Assessment Criteria for Changes to On-ground Activities AA-REF-ENV-0010 Environmental Assessment of Changes to On-ground Activities. AA-NOS-ENV-2.200 | Completed N/A | Link to completed Environmental Impact Screening and Assessment Form If a stage 2 assessment is required provide ARMS reference and links to any Permits, Master Development Plans and relevant correspondence as required. |
| 3.2 | Environmental Clearance obtained for ATM changes as per AA-NOS-ENV-2.100 Assistance in assessing the Environmental Impact can be obtained from Environment and Climate Change Unit in Environment Group. | Environment Assessment Process for ATM Changes AA-NOS-ENV-2.100 | Completed N/A | Provide ARMS reference and NRFC reference if ATM change required |
| 4 PE | OPLE- SUPPORT | | | |
| ATC TR | AINING | | | |
| 4.1 | ATC Training Needs Analysis completed and Training Plan developed? | | Completed N/A | Link to Training Needs Analysis and Training Plan |
| 4.2 | Sufficient number of trained, rated and endorsed ATC staff available. | | Completed N/A | Number Trained: |
| 4.3 | ATC staff individual training records in SAP database have been updated | | Completed N/A | |
| 4.4 | Plans are in place to complete any outstanding training, rating, and endorsement of remaining ATC staff (Normally an identified hazard) | | Completed N/A | HAZLOG Register No: |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|----------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| TECHNIC | CAL TRAINING | | | |
| 4.5 | Training Needs Analysis completed and Training Plan developed for system support staff and field maintenance staff? | | Completed N/A | Link to Training Needs Analysis and Training Plan |
| 4.6 | TechCert codes have been created, assessment criteria developed or existing assessment criteria has been amended | TechCert codes TechCert Guides and Forms | Completed N/A | Link to TechCert Guides and Forms |
| 4.7 | Sufficient system support staff and field maintenance staff appropriately trained? | | Completed N/A | |
| 4.8 | Are plans are in place to complete any outstanding training and certification of system support staff and remaining field maintenance staff? | | Completed N/A | |
| 4.9 | Field maintenance staff hold the relevant TechCert to perform duties. | Technical Certification PROC-141 | Completed N/A | |
| 4.10 | Statutory / special licensing obtained by field maintenance staff including high risk work competencies and licensing requirements? | | Completed N/A | |
| 4.11 | ABS and FMS staff training details sent to <u>Technical Training</u> <u>Coordinator</u> and training records updated as required? | Training PROC-119 | Completed N/A | |
| 4.12 | TechCert details sent to FMS System Support to update the Qualifications (TechCert) Database | Technical Certification PROC-141 | Completed N/A | |
| LOGISTI | CAL SUPPORT | | | |
| 4.13 | CMRD have been consulted regarding special test equipment, test beds, etc | | Completed N/A | |

Version 3: Effective 21 August 2012
Form approved by: Branch Manager, Operational Integrity & Compliance

Page 5 of 17

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 4.14 | CMRD / NDC have been consulted regarding spares holdings and repair of LRUs from this equipment or in-house support of | | Completed | |
| | Depot Level Support Contract / repair contract | | N/A | |
| 4.15 | TEMACC advised of any specialised test equipment requirements. | Test Equipment Management PROC-150 | Completed | |
| | | 11100 100 | N/A | |
| 4.16 | Maintenance support contracts in place (external and/or internal)? | | Completed | |
| | Appropriate vendor and/or internal support? Appropriate Level 3 maintenance arrangements | | N/A 🗌 | |
| 4.17 | Test equipment provided to maintenance base. | | Completed | |
| | Note: Test equipment purchasing and calibration requirements detailed in Engineering Execution Readiness form. | | N/A | |
| 4.18 | Specialised hardware or software system support and field maintenance tools, test / patch leads, adaptors, isolators, | | Completed | |
| | electronic discharge protection (mats, straps), etc supplied? | | N/A 🗌 | |
| 4.19 | System Business Continuity/ Disaster Recovery provisions supplied/updated? | | Completed | |
| | | | N/A 🗌 | |
| 4.20 | Spares – Supplied, storage correct, transport cases supplied? | Management of Goods & Supplies | Completed | |
| | | PROC-118 | N/A | |
| 4.21 | Spares – Software / firmware loaded, tested & configured? | | Completed | |
| | | | N/A 🗌 | |
| 4.22 | Service Restoration Times (SRT) established? | Airways Service Data PROC-207 | Completed | |
| | | PROC-201 | N/A 🗌 | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | (If a requirement is N/A, a reason why it is N/A is required to be entered) | | |
|--------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|-----------------------------------------------------------------------------|--|--|
| 4.23 | Conduct Hardware physical configuration audit and ensure SAP Plant Maintenance has updated information of all installed and/or demolished equipment (including monitoring circuits) and sent to System Operations SAP PM DATA CHANGES. | Equipment Installed/Demolished Advice SAP Data Input Form F104 | Completed N/A | Link to Email from SAP PM Support confirming update/s | | |
| 5 PROCEDURES | | | | | | |
| ATC DO | CUMENTATION | | | | | |
| 5.1 | System Requirements documentation including Operating Concept or Business Process Rules - produced/updated and approved? | | Completed N/A | Link to documentation | | |
| 5.2 | Manual of Air Traffic Services (MATS) reviewed / updated. | | Completed | NRFC No. | | |
| | Aeronautical information publications (AIP Book, AIP SUPP, AIC, DAP, ERSA, Charts, etc) reviewed / updated. | AA Publications | N/A | | | |
| | Amendment times are determined by the AIS Distribution Schedule | AIS Distribution Schedule | | | | |
| 5.3 | National ATC Procedures Manual (NAPM) and any other relevant ATC procedures reviewed / updated. | | Completed N/A | NRFC No. | | |
| 5.4 | ATC contingency / continuity plans reviewed / updated. | ATS Contingency Plans | Completed | ATS-CP No: | | |
| | | Business Continuity Plans C-BCP | N/A | C-BCP No: | | |
| 5.5 | NOTAM and/or AIP SUP issued / amended / cancelled | Works Planning PROC-213 Refer also LOA3024 | Completed N/A | NOTAM No: | | |
| 5.6 | ATC Temporary Local Instruction (TLI) issued notifying Operational staff of change? | Temporary Local Instructions & Database | Completed N/A | NRFC No. | | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|---------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| USER D | OCUMENTATION | | | |
| 5.7 | User/operator manuals updated | | Completed | |
| | | | N/A | |
| 5.8 | User/operator procedures provided/updated as applicable | | Completed | |
| | | | N/A | |
| 5.9 | On-line user/operator documentation completed and published | | Completed | |
| | | | N/A | |
| 5.10 | ARFF instructions updated | | Completed | |
| | | | N/A | |
| 5.11 | Other Business Groups instructions updated? | | Completed | |
| | | | N/A | |
| TECHNIC | CAL DOCUMENTATION | | | |
| 5.12 | Software design documents updated, adequate and supplied to system support? | | Completed | |
| | to system support: | | N/A | |
| 5.13 | Software and/or dataset Version or Release Description Documentation supplied and adequate? | | Completed | Link to Version Description Document or Release Description Document |
| | Social Annual Supplied and adoquate. | | N/A | |
| 5.14 | Software installation procedure and instructions supplied/updated and adequate? | | Completed | Link to Installation Procedure |
| | supplieurapation and adoquato: | | N/A | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|--------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 5.15 | SMP : System Management Plan created / updated and adequate? | SMP Template | Completed | SMP No: |
| | | | N/A | |
| 5.16 | SCP: System Contingency / continuity plans supplied/updated and adequate? | SCP Template | Completed | SCP No: |
| | | | N/A | |
| 5.17 | Technical drawings updated and listed in Data Viewer and list supplied to system supporters and field maintenance staff. | Technical Drawing Management | Completed | |
| | | PROC-178 | N/A | |
| 5.18 | Technical handbooks/manuals supplied to ABS or FMS Engineering/IT support and field maintenance staff (base and | Document Management | Completed | |
| | site copy). | PROC-103 | N/A | |
| 5.19 | On-line system support and field maintenance documentation | | Completed | |
| | completed and published | | N/A | |
| 5.20 | Technical documentation registered and placed under documentation control | Document Management | Completed | |
| | documentation control | PROC-103 | N/A | |
| 5.21 | Appropriate engineering performance requirements specified and issued for ongoing use? | System Performance Requirements & Reporting | Completed | |
| | System Specification documentation supplied/updated and | Specification ASYS-106 | N/A | |
| | adequate? | | | |
| 5.22 | Configuration & Modification AEI: Equipment and System Modifications and Configuration (for hardware and software), | Development of Maintenance Instructions for Equipment | Completed | AEI No/s: Link to documentation detailing configuration and modification |
| | and Software Release Authorisations are documented in a Part 2 AEI (or other approved documentation) | PROC-151 | N/A | |
| 5.23 | Maintenance AEI: Maintenance requirements, including Performance Inspection tolerances, have been defined and | Development of Maintenance Instructions for Equipment | Completed | AEI No/s: |
| | documented in AEIs (or other approved documentation). (AEI Part 3,4,7) | PROC-151 | N/A | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) | |
|-------------|------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|--|
| 5.24 | AEI: New maintenance AEIs trialled by maintenance staff | Development of Maintenance Instructions for Equipment | Completed | | |
| | | PROC-151 | N/A | | |
| 5.25 | TTD: Temporary Technical Dispensation raised and published on the Document Search database. | Temporary Technical Dispensations | Completed | TTD No: | |
| | on the Bocament Ocaron database. | PROC-153 | N/A | | |
| 5.26 | Site Manifest updated | Site Manifests | Completed | | |
| | | FMS-304 | N/A | | |
| 6 SYSTEM | | | | | |
| DESIGN | REQUIREMENTS | | | | |
| 6.1 | System Requirements documentation including Operating Concept or Business Process Rules - supplied/updated and | Design Control PROC-146 | Completed | Links to documentation | |
| | approved? | FROC-146 | N/A | | |
| 6.2 | Standards – Installation and equipment comply with all relevant Australian Standards? | Australian Standards | Completed | | |
| | Building Codes - Structures comply with the relevant Building Codes? | Design Control | N/A | | |
| | The relevant Australian Standards and Building Codes are to | PROC-146 | | | |
| | be determined by the Chief Engineer, Technical Authority or Maintenance Authority | | | | |
| 6.3 | Other applicable Federal and/or State licensing requirements met? | Design Control | Completed | | |
| | mot: | PROC-146 | N/A | | |
| | The relevant licensing requirements are to be determined by the Chief Engineer, Technical Authority or Maintenance Authority | | N/A | | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 6.4 | Electrical Mechanical, Structure and Building impacts have been assessed as adequate or modifications organised and completed through consultation with Engineering Branch, P&E? (Power supply capability / airconditioning capacity / mast loadings) | Design Control PROC-146 | Completed N/A | |
| 6.5 | Earthing and Lightning Protection meets Airservices requirements? | Earthing and Lightning Protection Systems for Operational Facilities AEI 3.1504 Site Earthing and Lightning Protection Systems for Existing Installations AEI 2.3011 | Completed N/A | |
| 6.6 | Battery Procurement as per Airservices requirements? | Lead Acid Batteries (Stationary) Procurement and Acceptance Testing AEI-3.7050 Panel Contract Arrangement C-PROC0140 | Completed N/A | |
| 6.7 | Assessing the impact of information systems against corporate objectives (7 Ticks process). | Information Technology Application Certification –'7 Ticks' MI-0804 and PROC-190 | Completed N/A | Link to completed 7 Ticks Interim Certificate or Final Certificate |
| 6.8 | IT Security measures appropriate and in place(ie. to ensure effective security and control practices to minimise the risks of unauthorised access, inappropriate use, modification, destruction or disclosure of electronically held data). | IT Security Roles and Responsibilities Statement MS-0013 Information Security MI-0808 ICT Resources – Conditions of Use MI-0829 | Completed N/A | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 6.9 | Information Security | Information Security C-PROC0184 | Completed | Link to completed security risk management plan |
| | | | N/A | |
| INSTALI | LATION REQUIREMENTS | | | |
| 6.10 | Has met the regulation and safety requirements for Telecommunications Installations. Cable Markers installed (external)? | Implementing Regulation and Safety Requirements for Telecommunications Installations PROC-138 | Completed N/A | Link to Telecommunications Cabling Advice |
| | Equipment complies with ACMA statutory requirement Telecommunication Labelling (Customer Equipment and Customer Cabling) Notice 2001 as amended (i.e. 'A' ticked on the equipment compliance plate) | Installation of Optical Fibre Cable - Underground AEI 4.5001 Underground Cable Marking AEI 4.3001 | | |
| 6.11 | MDF/IDF Records created / updated? Labelling/Colour Coding – Rack, Cable, Chassis, etc.? | Colour Coding of RJ45 Patch Leads for Voice and Data Installations AEI 7.3241 | Completed N/A | |
| 6.12 | Transmitters licence label affixed | Radio Communication Transmitter Labelling AEI 7.4238 | Completed N/A | |
| 6.13 | Electrical Certificate of Testing and Safety or Testing and Compliance on connection to a source of electricity (i.e. installation conforms to AS3000) are required to be supplied as soon as possible after connection or testing of any electrical installation or change. Labelling – Switch Boards, etc Meets Airservices Electrical Cable Colour Coding requirements? | Electrical Safety Regulation 2002 Sections 15 and 159 AS 3000 – Aust Standard Electrical Cable Colour Coding AEI 3.1502 | Completed N/A | Links to Electrical Certificates |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|-------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 6.14 | All modifications complete and scratch plate labels affixed to equipments | Identification of Airways Systems Equipment Hardware Modifications PROC-154 | Completed N/A | |
| 6.15 | Integration with National Technical Monitoring has been organised and completed through Engineering Branch, P&E? | | Completed N/A | |
| 6.16 | Alarm monitoring installed and tested at TOC for local and remote site? | | Completed N/A | |
| 6.17 | Source media – supplied/backed up, stored, registered with system support? | Software Media Archival and Storage PROC-147 | Completed N/A | |
| 6.18 | Site installable media – supplied/backed up, appropriately stored and registered by field maintainers? | Software Media Archival and Storage PROC-147 | Completed N/A | |
| 6.19 | Software licences provided, registered and appropriately stored? (Including details of any third party licensing) | | Completed N/A | |
| 6.20 | Update HEAT and/or ASID database to incorporate new system/version number and assign issue management roles? | | Completed N/A | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| DESIGN | CONFIRMATION | | | |
| 6.21 | Airservices Physical Security requirements met. The minimum security requirements are specified in C-GUIDE0157. Physical Security advise can be obtained from the relevant Security Advisor in Security and Crisis Planning, Safety & Environment Physical Access requirements are determined and established Siting and accommodation impact has been assessed as being satisfactory or modifications organised through National Property? | Physical Security – Critical Operational Facilities C-GUIDE0157 Site Management PROC-170 | Completed N/A | |
| 6.22 | Network data load impact has been assessed as being satisfactory or modifications organised and completed through Engineering Branch, P&E? | | Completed N/A | |
| 6.23 | Spectrum licences (either cancelled if no longer required or for new licenses including if antenna moves by more than 10 metres) | Frequency Management: Obtaining a Frequency Assignment and Licence AEI 7.4202 | Completed N/A | |
| 6.24 | New system or system change acceptance tests (software and/or hardware) satisfactorily completed against the approved system requirements? Test Plans provided? FAT, SAT, UAT test results complete, passed to the required level and provided? Test identified defect listings and re-test information provided? | System Management Manual SMM Design Control PROC-146 | Completed N/A | |
| 6.25 | Battery Acceptance Tests as per Airservices requirements? | Lead Acid Batteries (Stationary) Procurement and Acceptance Testing AEI-3.7050 | Completed N/A | Link to Battery Acceptance Test Results |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) | | | |
|-------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|-----------------------------------------------------------------------------------------------------|--|--|--|
| 6.26 | Standard Operating Conditions (SOCs) / Site Configuration Data (SCD) established / approved | Standard Operating Conditions & Site Configuration Data Management PROC-143 | Completed N/A | | | | |
| 6.27 | Flight Test results supplied and satisfactory | Certification of Radio Navigation Aid Facilities <u>AEI 7.4003</u> | Completed N/A | | | | |
| 6.28 | Equipment operation is as per AEI specifications and any additionally specified requirements? Relevant requirements and performance specifications to be determined by the Chief Engineer, Technical Authority or Maintenance Authority | | Completed N/A | | | | |
| 7 TF | 7 TRANSITION | | | | | | |
| PLANN | PLANNING | | | | | | |
| 7.1 | Does the system meet all critical user and technical requirements? | | Completed N/A | | | | |
| 7.2 | If non-critical deficiencies are proposed to be accepted into operation, are they managed and tracked via ASID, HEAT or SAIR, including responsibilities and timings and attached to the Commissioning Certificate? | | Completed N/A | | | | |
| 7.3 | Cutover Plan prepared and authorised by: — Appropriate level of engineering authority? | Cutover Plan C-TEMP0045 | Completed N/A | Link to Cutover Plan | | | |
| | Appropriate level of User Authority? | | | | | | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) | | | |
|-------------|------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|--|--|--|
| NOTIFIC | TIFICATION | | | | | | |
| 7.5 | Industry education / notification been completed? | | Completed | | | | |
| | | | N/A | | | | |
| 7.6 | Relevant Business Managers advised of impending change? | | Completed | | | | |
| | | | N/A | | | | |
| 7.7 | Change requester and/or sponsor notified? | | Completed | | | | |
| | | | N/A | | | | |
| 7.8 | System Operations' TOC and Service Desk notified and accepted operating responsibility for the change. | | Completed | | | | |
| | accepted operating responsibility for the change. | | N/A | | | | |
| 7.9 | ABS/FMS Manager has accepted maintenance responsibility | | Completed | | | | |
| | | | N/A | | | | |
| 7.10 | Notify the following (as appropriate) that the system is at "OPERATIONAL READINESS" and provide details of | | Completed | | | | |
| | commissioning and any system changes: | | N/A | | | | |
| | ATC | | | | | | |
| | System Supervisor, Melbourne (ATC) System Supervisor, Brisbane (ATC) | | | | | | |
| | National ATC Systems Manager | Sys to Syc List | | | | | |
| | Operating Authority (relevant) | | | | | | |

| Item No: | Requirement: | Requirement Reference: (Procedure/instruction used to specified required input) | Completed or N/A | Evidence of Compliance (If a requirement is N/A, a reason why it is N/A is required to be entered) |
|-------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|------------------|----------------------------------------------------------------------------------------------------|
| 7.11 | Notify the following (as appropriate) that the system is at "ENGINEERING READINESS" and provide details of commissioning and any system changes: P&E Technical Authority (relevant) Technical Operations Centre – Director Service Desk -Airways SAP PM Support | Sys to Svc List | Completed N/A | |



SYSTEM MANAGEMENT MANUAL **CHANGE CONTROL** C-FORMS0300

| COMMISSIONING CERTIFICATE | | | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------|---------------------------|-------|--|--|
| The requirement for this form is specified in the S | ystem Management Manual (Se | ection 11.2 of V4), C-MAN | 0107 | | |
| Project/Task Name | SAP Project/Task ID: | Sites or Locations affe | cted: | | |
| Documentation prepared by: | Date: | Commissioning Date: | | | |
| Affected System(s) | System Criticality | Change Consequence Level | | | |
| Brief Description of Change: | | | | | |
| | | | | | |
| Co | mmissioning Appro | val | | | |
| The approval of this document by the appropriate authorities as specified in the System Management Manual certifies that the new system or system change is satisfactory to meet the specified service and performance requirements; that system operating and support requirements are in place; that required user and technical training is adequately provisioned; as detailed in the Commissioning Readiness Form and consequently the new system or system change is declared fit-for-purpose and can be deployed and operated until formally decommissioned or otherwise revoked. This approval is provided subject to the non-critical deficiencies listed herein. | | | | | |
| Chief Engineer, Technical or Maintenance Authority | | | | | |
| Name | Signature: | Signature: | | | |
| Designation: | | | | | |
| Name: | Signature: | | Date: | | |
| realite. | Oignature. | | Duto. | | |
| Designation: | | | | | |
| Chief Operating/User Authority or Operating/User Authority | | | | | |
| Name: | Signature: | | Date: | | |
| Designation: | | | | | |
| | | | | | |

Records Management Instructions

Place the completed Commissioning Certificate, together with the completed Commissioning Readiness form on the Project file

Provide a copy of the completed Commissioning Certificate, and the completed Commissioning Readiness Form to P&E, Asset Lifecycle Manager, Planning and Integration

Note 1: Non-critical deficiencies are those outstanding technical and operational issues that do not prevent the safe and effective use of the facility by users or prevent effective technical maintenance, but will be addressed in a specified and agreed time.

C-FORMS0300 Version 7: Effective 21 August 2012

Commercial in Confidence



SYSTEM MANAGEMENT MANUAL CHANGE CONTROL C-FORMS0300

LIST OF NON-CRITICAL DEFICIENCIES WAIVED AT TIME OF COMMISSIONING Either list non-critical deficiencies here or attach a list if space insufficient Proposed Issue Tracking Allocated to Issue Comments Completion Date Reference Number

C-FORMS0300

Guidance Materials on Monitoring and Analysis of ADS-B Avionics Performance

1. Introduction

1.1 The APANPIRG has endorsed the following Conclusion during its 24th Meeting to encourage States/Administration to exchange their ADS-B performance monitoring results and experience gained from the process:

Conclusion 24/45 - Exchange ADS-B Performance Monitoring Result

"That, States be encouraged to exchange findings/result of their ADS-B performance monitoring including experience gained in conducting the required performance monitoring."

- 1.2 Since the ADS-B mandate for some airspace in the Region became effective in December 2013, monitoring and analysis on avionics performance of ADS-B equipped aircraft has become an increasingly important task for concerned States. The APANPIRG has also requested and the ICAO has agreed to support establishing a centralized database to be hosted by the ICAO Regional Sub-office (RSO) for sharing the monitoring results in order to enhance safety for the Region. The specification for the database and relevant access procedures are being developed by the ADS-B Study and Implementation Task Force, and will be shared with States in due course.
- 1.3 This document serves to provide guidance materials on monitoring and analysis of avionics performance of ADS-B equipped aircraft, which is based on the experience gained by States.

2. Problem Reporting and Feedback

- 2.1 For ADS-B avionics problems, it is critical that an appropriate reporting and feedback mechanism be established. It is highly desirable that those discovering the problems should report them to the appropriate parties to take action, such as study and analyse the problems, identify the root causes, and rectify them. Those action parties include:-
 - (a) Air Navigation Service Providers (ANSPs) upon detection of any unacceptable ADS-B reports from an aircraft, report the observed problem to the performance monitoring agent(s), if any, and the Aircraft Operators for investigation. In addition, ANSPs should take all actions to avoid using the ADS-B reports from the aircraft until the problem is rectified (e.g. black listing the aircraft), if usage of such reports could compromise safety.
 - (b) Regulators to initiate any appropriate regulatory action or enforcement.

- (c) Aircraft Operators to allow avionics specialists to examine the causes and as customers of the avionics manufacturers ensure that corrective action will take place.
- (d) Avionics Manufacturers and Aircraft Manufacturers to provide technical evidence and knowledge about the problem and problem rectification
- 2.2 Incentives should be received by those parties acting on the problems including:-
 - (a) Regulations that require deficiencies to be rectified
 - (b) Regulatory enforcement
 - (c) Consequences if conduct of operations with problematic equipment (e.g. no access to the airspace requiring healthy equipment)
- 2.3 When an ADS-B avionics problem is reported, it should come along with adequate details about the problem nature to the action parties. In addition, the problem should be properly categorised, so that appropriate parties could diagnose and rectify them systematically.

3. Problem Categorisation

- 3.1 Regarding ADS-B avionics, their problems are quite diversified in the Region but can be categorized to ensure they will be examined and tackled systematically.
- 3.2 Based on the experience gained from States, the common ADS-B avionics problems in the Region are summarized under different categories in Attachment A. It is noted that only a relatively minor portion of the aircraft population exhibits these problems. It must be emphasized that aircraft transmitting incorrect positional data with NUC = 0 or NIC = 0 should not be considered a safety problem. The data transmitted have no integrity and shall not be used by ATC. This situation exists for many aircraft when their GNSS receivers are not connected to the transponders.

4. Managing the Problem

4.1 There are two major approaches to manage the problems:-

(a) Regulatory approach

Regulations which require non-approved avionics to disable ADS-B transmission (or transmit "no integrity"), and the concerned operators to file flight plans to indicate no ADS-B equipage. APANPIRG has endorsed this approach which is reflected in the Regional Supplementary Procedures (Doc 7030).

(b) Blacklist approach

Filtering out ("black listing") any airframes that do not comply with the regulations or transmitting bad data, and advising the regulator of the non-compliance. This approach is temporary which allows the ANSP to protect the system whilst regulatory action is underway.

5. Systematic Monitoring and Analysis of the Problem

- 5.1 For States who have radar coverage, a systematic and efficient means to monitor and analyse the problem could be considered on top of relying on ATC to report the problem / sample checking. This can be achieved by developing a system to automatically compare radar and flight plan information with ADS-B reported position, and examine the ADS-B quality indicators ¹ and Flight Identification (FLTID) contained in the ADS-B reports.
- 5.2 The system will intake all recorded information on ADS-B, radar targets and ATS flight plans in an offline manner. For each ADS-B flight, the system will compare it with its corresponding radar and flight plan information, and analyse if the following pre-defined criteria are met:-
 - (a) Deviation between ADS-B reported position and independent referenced radar position is greater than 1NM for more than 5% of total number ADS-B updates; or
 - (b) NUC of each ADS-B reported position is smaller than 4 for more than 5% of total number of ADS-B updates; or
 - (c) FLTID entered via cockpit interface and downlinked in ADS-B data (i.e. I021/170 in Asterix CAT 21) does not match with aircraft callsign in the ATS Flight Plan for more than 5% of total number of ADS-B updates.
- 5.3 For (a) above, deviation between ADS-B and radar tracks is set to 1NM in accordance with ICAO Circular 326 defining position integrity (NUC) shall be at least 4 (0.5NM < HPL < 1NM) for 3NM aircraft separation use, on assumption that radar targets are close to actual aircraft position. A threshold of 5% is initially set to exclude aircraft only exhibiting occasional problems during their flight journey. The above criteria should be made configurable to allow fine-turning in future.
- 5.4 The system will generate a list of aircraft meeting the above pre-defined criteria showing full details of each occurrence such as date/time of occurrence, Mode S address, screen capture of radar and ADS-B history tracks, graphs of NUC value changes and deviation between radar and ADS-B tracks along the flight journey. A sample screen shot of the system is given at Attachment B for reference.

* * * * * * * *

¹ Navigational Uncertainty Category (NUC) for Version 0 avionics (DO260) and Navigational Integrity Category (NIC) and Source Integrity Level (SIL) for Version 1 and Version 2 avionics (DO260A and DO260B)

Attachment A – List of known ADS-B avionics problems

| Ref. | Problem | Cause | Safety Implications to ATC | Recommendations |
|------|-------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | | (Yes / No) | |
| 1. | Track Jumping problem with Rockwell Collins TPR901 (See Figure 1) | Software issue with TPR901 transponder initially only affecting Boeing aircraft. Does not occur in all aircraft with this transponder. Subsequent investigation by Rockwell Collins has found that the particular transponder, common to all of the aircraft where the position jumps had been observed, had an issue when crossing ±180 degrees longitude. On some crossings (10% probability), errors are introduced into the position longitude before encoding. These errors are not self-correcting and can only be removed by a power reset of the transponder. The problem, once triggered can last days, since many transponders are not routinely powered down. | Yes. Will present as a few wild/large positional jumps. Nearly all reports are tagged as low quality (NUC=0) and are discarded, however, some occasional non zero reports get through. Problem is very "obvious". Could result in incorrect longitudinal position of Flight Data Record track. Can trigger RAM alerts. | Rockwell Collins has successfully introduced a Service Bulletin that solves the problem in Boeing aircraft. The problem is known to exist on Airbus aircraft. Rockwell has advised that a solution will not be available in the near future because of their commitment to DO260B development. Rockwell Collins may not have a fix for some time. Workaround solutions are being examined by Airbus, Operators and Airservices Australia. The only workaround identified at this time is to power down the transponders before flight to states using ADS-B — after crossing longitude 180. It can be noted that in Airbus aircraft it is not possible to safely power down the transponder in flight. Airbus have prepared a procedure to support power down before flight. Airservices Australia have negotiated with 2 airlines to enact this procedure prior to flights to Australia. |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|----------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | | | An additional partial workaround is: to ensure that procedures exist for ATC to ask the pilot to changeover transponders if the problem is observed. Since there is a 10% chance of the problem occurring on each crossing of ±180 degrees longitude, the chance that both transponders being affected is 1%. There is no complete workaround available for flights that operate across 180 degrees longitude directly to destination without replacing the transponder. Airbus advise that a new TPR901 transponder compliant with DO260B will be available in 2014. This new transponder will not exhibit the problem. |
| 2. | Rockwell Collins TDR94 Old version. The pattern of erroneous positional data is very distinctive of the problem. (See Figure 2) | Old software typically before version -108. The design was completed before the ADS-B standards were established and the message definitions are different to the current DO260. Rockwell has recommended that ADS-B be disabled on these models. | Will present as a few wild positional jumps. Nearly all reports are tagged as low quality (NUC=0) and are discarded, however, some occasional non zero reports get through. Also causes incorrect altitude reports. Problem is very "obvious". | Problem well known. Particularly affects Gulfstream aircraft which unfortunately leave the factory with ADS-B enabled from this transponder model. Rockwell has issued a service bulletin recommending that ADS-B be disabled for aircraft with this transponder software. See Service Information Letter 1-05 July 19, 2005. It is easy to disable the transmission. |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|-------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | | | If a new case is discovered, an entry needs to be made to the black list until rectification has been effected. |
| 3. | Litton GPS with proper RAIM processing | Litton GNSSU (GPS) Mark 1 design problem. (Does not apply to Litton Mark II). GPS does not output correct messages to transponder. | Perceived GPS integrity changes seemingly randomly. With the GPS satellite constellation working properly, the position data is good. However the reported integrity is inconsistent and hence the data is sometimes/often discarded by the ATC system. The effected is perceived extremely poor "coverage". The data is not properly "protected" against erroneous satellite ranging signals – although this cannot be "seen" by ATC unless there is a rare satellite problem. | This GPS is installed in some older, typically Airbus, fleets. Data appears "Correct" but integrity value can vary. Performance under "bad" satellite conditions is a problem. Correction involves replacing the GNSSU (GPS) which is expensive. If a new case is discovered, an entry needs to be made to the black list until rectification has been effected. |
| 4. | SIL programming error for DO260A avionics | Installers of ADS-B avionics using the newer DO260A standard mis program "SIL". a) This problem appears for DO260A transponders, with SIL incorrectly set to 0 or 1 (instead of 2 or 3) b) As the aircraft enters | No. First report of detection appears good (and is good), all subsequent reports not displayed because the data quality is perceived as "bad" by the ATC system. Operational effect is effectively no ADS-B data. Hence no risk. | Would NOT be included in a "black list". Aircraft with "Dynon avionics" exhibit this behavior. They do not have a certified GPS and hence always set SIL = 0. This is actually correct but hence they do not get treated as ADS-B equipped. |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | coverage, the ADS-B ground station correctly assumes DO260 until it receives the version number. c) The transmitted NIC (DO260A) is interpreted as a good NUC (DO260) value, because no SIL message has yet been received. The data is presented to ATC. | | |
| 5. | Garmin "N" Flight ID problem (See Figure 3) | Installers of Garmin transponder incorrectly set "Callsign"/Flight ID. This is caused by poor human factors and design that assumes that GA aircraft are US registered. | Yes. Flight ID appears as "N". Inhibits proper coupling. | Can be corrected by installer manipulation of front panel. Does not warrant "black list" activity. |
| 6. | Flight ID corruption issue 1 – trailing "U" Flight ID's received: GT615, T615U, NEB033, NEB033U, QF7550, QF7550U, QF7583, QF7583U, QF7585, QF7584, QFA7521, QFA7531, QFA7531, QFA7531U, QFA7532, QFA7532U, QFA7552, | TPR901 software problem interfacing with Flight ID source. Results in constantly changing Flight ID with some reports having an extra "U" character. | Yes. Flight ID changes during flight inhibits proper coupling or causes decoupling. | Affects mainly B747 aircraft. Boeing SB is available for Rockwell transponders and B744 aircraft. Rockwell Collins have SB 503 which upgrades faulty -003 transponder to -005 standard. If a new case is discovered, an entry needs to be made to the black list until rectification has been effected. |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|-------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|
| | QFA7581 | | | |
| 7. | Flight ID corruption issue 2 | ACSS software problem results in constantly changing Flight ID. Applies to ACSS XS950 transponder Pn 7517800-110006 and Honeywell FMC (pn 4052508 952). ACSS fix was available in Sept 2007. | Yes. Flight ID changes during flight inhibits proper coupling or causes decoupling. | Software upgrade available. If a new case is discovered, an entry needs to be made to the black list until rectification has been effected. |
| 8. | No Flight ID transmitted | Various causes | No. Flight ID not available. Inhibits proper coupling. | Aircraft could "fail to couple with Flight Data Record". Not strictly misleading – but could cause controller distraction. |
| 9. | ACSS Transponder 10005/6 without Mod A reports NUC based on HFOM. | | Yes. Appears good in all respects until there is a satellite constellation problem (not normally detectable by ground systems). | Not approved and hence not compliant with CASA regulations. If known could be added to black list. Configuration is not permitted by regulation. |
| 10. | Occasional small position jump backwards (See Figure 4) | For some older Airbus aircraft, an occasional report may exhibit a small "jump back" of less than 0.1 nm Root cause not known | No. Not detectable in ATC due to extrapolation, use of latest data and screen ranges used. | ATC ground system processing can eliminate these. |
| 11. | Older ACSS transponders report integrity too | Design error reports integrity one value worse than reality | No. | Can be treated in the same manner as a loss of transponder capability. |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|--------------------------------------------------------|----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | conservatively | | In poor GPS geometry cases the ATC system could discard the data when the data is in fact useable. Will be perceived as loss of ADS-B data. | |
| 12. | Intermittent wiring GPS transponder | ADS-B transmissions switch intermittently between INS position and GPS position. | Yes. Normally the integrity data goes to zero when INS is broadcast, but sometimes during transition between INS and GPS, an INS position or two can be broadcast with "good" NUC value. Disturbing small positional jump. | If a new case is discovered, an entry needs to be made to the black list until rectification has been effected. |
| 13. | Wrong 24 bit code | Installation error | No. No direct ATC impact unless a rare duplicate is detected. | This is not a direct ADS-B problem, but relates to a Mode S transponder issue that can put TCAS at risk. Cannot be fixed by black list entry. Needs to be passed to regulator for resolution. |
| 14. | Toggling between high and low NUC (See Figure 5) | Faulty GPS receiver/ADS-B transponder | No. ATC will see tracks appear and disappear discretely. No safety implications to ATC. | While it is normal for NUC value to switch between a high and low figure based on the geometry of GPS satellites available, it is of the view that more should be done to examine this phenomenon. It is observed that such switching between high and low NUC occurs on certain airframe and |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|-----------------------------------|-------------------------------------------------------------|-------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | | | not on others. The issue was raised to the airlines so as to get a better understanding. On one occasion, the airline replied that a module on their GPS receiver was faulty. On another occasion, the airline replied that one of the ADS-B transponder was faulty. Good NUC was transmitted when the working transponder was in use and poor NUC was transmitted when the faulty ADS-B transponder was in use. |
| 15. | Consistent Low NUC (See Figure 6) | GNSS receivers are not connected to the ADS-B transponders. | No. Data shall be filtered out by the system and not detectable in ATC | Not considered a safety problem but a common phenomenon in the Region – the concerned aircraft will be treated equivalent to "aircraft not equipped with ADS-B". While it is normal for aircraft to transmit low NUC, it is of the view that "consistent low NUC' could be due to the avionics problem (e.g. GNSS receiver is not connected to the ADS-B transponder). |
| | | | | It is recognised that operators may not be aware that their aircraft are transmitting unexpected low NUC / NIC values, due to equipment malfunction. Hence, it is desirable for States to inform the operators when unexpected low NUC |

| Ref. | Problem | Cause | Safety Implications to ATC (Yes / No) | Recommendations |
|------|---------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | | | | values are transmitted, where practicable. |
| | | | | Concerned airline operators are required to take early remedial actions. Otherwise, their aircraft will be treated as if non-ADS-B equipped which will be requested to fly outside the ADS-B airspace after the ADS-B mandate becomes effective. |
| 16. | ADS-B position report with good integrity (i.e. NUC >= "4") but ADS-B position data are actually bad as compared with radar (met criteria 5.2(a)) | Faulty ADS-B avionics | Yes. As the ground system could not "automatically" discard ADS-B data with good integrity (i.e. NUC value >=4), there could be safety implications to ATC. | The problem should be immediately reported to the concerned CAA/operators for problem diagnosis including digging out the root causes, avionics/GPS types etc., and ensure problem rectification before the ADS-B data could be used by ATC. Consider to "blacklist" the aircraft before the problem is rectified. |
| 17. | FLTID transmitted by ADS-B aircraft does not match with callsign in flight plan (see Figures 7a – 7d) | Human errors | Yes. Could lead to screen clutter - two target labels with different IDs (one for radar and another for ADS-B) being displayed, causing potential confusion and safety implications to ATC. | Issue regulations/letters to concerned operators urging them to set FLTID exactly match with callsign in flight plan. |



Figure 1 - Track Jumping problem with TPR901

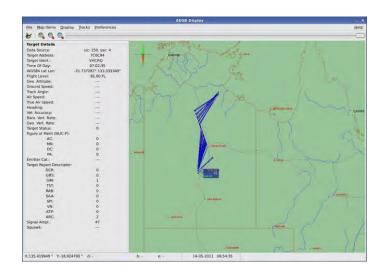


Figure 2 - Rockwell Collins TDR94 Old version. The pattern of erroneous positional data is very distinctive of the problem



Figure 3 - Garmin "N" Flight ID problem

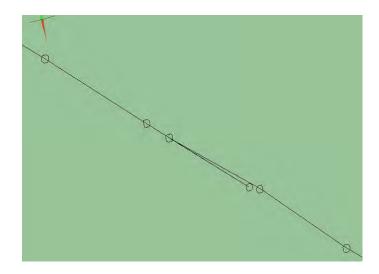


Figure 4 - Occasional small position jump backwards

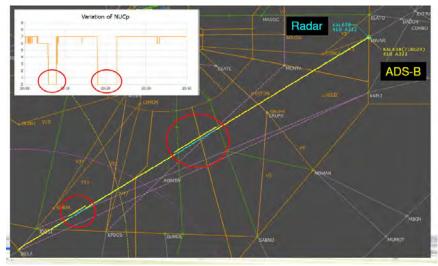


Figure 5 - NUC value toggling

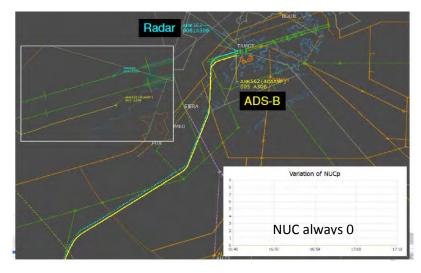


Figure 6 – Consistent low NUC

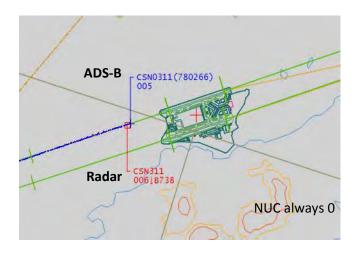


Figure 7a - Additional zero inserted

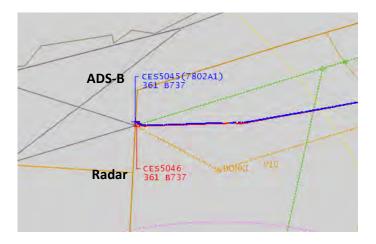


Figure 7c - Wrong numerical codes entered

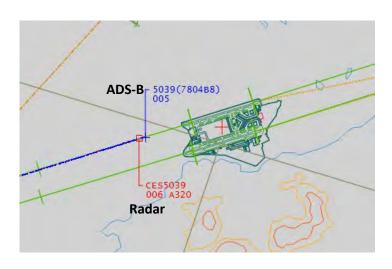


Figure 7b - ICAO Airline Designator Code dropped

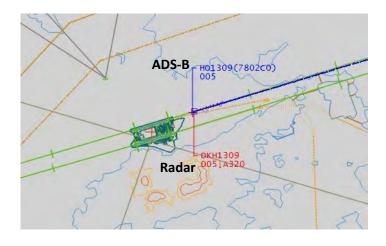


Figure 7d - IATA Airline Designator Code used

Attachment B - Sample screen shot of a system to monitor and analyse performance of ADS-B avionics

