

FLIGHT PLAN SUPPLEMENT

ASTP	
FLIGHT PLAN SUPPLEMENT	
PART NO.	S/N
SKF32100114-103	1002

CONTENTS

SECTION I MISSION TABLES

<u>TABLE</u>	<u>TITLE</u>	<u>PAGE</u>
1-1	ASTP LAUNCH AND RETURN LOOSE EQUIPMENT LIST	1-1
1-2	ASTP CSM LAUNCH STOWAGE MAP	1-11
1-4 1-3	ASTP CSM RETURN STOWAGE MAP	1-12 1-13
1-3 1-4	ASTP DM LAUNCH STOWAGE MAP	1-13 1-12
1-5	ASTP DM SEPARATION STOWAGE MAP	1-14
1-6	ASTP CONSUMABLES CURVES	1-15
1-7	AC MENU	1-19
1-8	AC MEDICAL LOG	1-22
1-9	CP MENU	1-25
1-10	CP MEDICAL LOG	1-28
1-11	DP MENU	1-31
1-12	DP MEDICAL LOG	1-34
1-13	PANTRY FOOD ITEMS	1-37
6-1	ASTRONOMY EXPERIMENT PADS	6-1
	<i>9A ASTRONOMY EXPERIMENT PADS</i>	<i>5-3</i>
	<i>9B ASTRONOMY EXPERIMENT PADS</i>	<i>6-3</i>

DATE: 7/3/75

PAGE: 1-1

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Accessory Bag	3	U2	Under Couch
Access Port Cap	1	A6	A6
Astronaut Preference Kit (APK)	3	R13	R13
Auxiliary Dump Nozzle	1	A1	A1
Backup Drag Thru Cable	1	D1	Front A1
Binoculars	1	A1	A1
Bio Belt	3	Worn	Worn
Bioinstrumentation Assembly (OBS)	3	Worn	Worn
Biostack, Active	1	R1	R1
Biostack, Passtive	1	R1	R1
Bungee	20	LEB	LEB
Cabin Vent (Purge) Q.D.	1	D1	Front A1
Calfax Adapters	4	RHEB	Jett
CB Actuator	1	LEB	LEB
CB Guard (PNL 229)	1	RHEB	Jett
CB Latch Caps	3	IN PGA	PNL 229
Chlorination Ampule	12	R3	R3
Chlorination Buffer	12	B8	B8
Chlorination Knob	1	B8	B8
Chlorination Needle	1	B8	B8
Chlorination Syringe	1	B8	B8
Clamp	8	LEB	LEB
Clip	8	LEB	LEB
Closeout Curtain	1	LEB	LEB
Communications Carrier (COMM Cap)	6	Worn	Worn
		U2	U2
		PNL 861	Front A1
		D1	
Communications Carrier	1	PNL 861	Front A1
Pwr Adapt			
Communications Head	7	LHFEB	LHFEB
		PNL 811	Front A1
		PNL 861	
		D1	
Constant Wear Garments (CWG)	6	A1	Worn
		Worn	A1
Constant Wear Garment Adapter	5	U2	Worn
(W/Dust Cap) (CWG Adapter)		D1	Front A1
		PNL 861	
Container A2	1	A2	Jett
Container D3	1	D3	A2

STOWAGE
LIST

DATE: 7/3/75

PAGE: 1-2

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Container D4	1	D4	D4
Container R12	1	R3	R3
Controller Harness Strap	3	Couch	Couch
Couch Strap	2	R5	R5
Crew Communications Umbilical (CCU) (CM Elect Umbilical)	7	LHFEB PNL 811 PNL 861 D1	LHFEB Front A1
CCU Jumper Cable	1	PNL 811	Front A1
CCU T-Adapter	2	PNL 811 D1	Front A1
Crewman Optical Alignment Sights (COAS)	1	LHEB	LHEB
COAS Bulb	1	U3	U3
COAS Filter	1	U3	U3
Crewman Restrain Straps	2	D1	Front A1
Crystal Growth Experiment	6	U4	U4
Crystal Growth Framing Device	1	U1	U1
Data Acquisition Camera (DAC)	2	B3	B3
		D3	D3 (CM)
DAC Fuse	2	R3	R3
DAC Magazine	26	B5	B5
		B3	B3
		A6	U2
		D3	D3 (CM)
		D3	SOYUZ
DAC Mount	1	U2	U2
DAC Power Cable	2	B3	B3
		D3	D3 (CM)
DAC Remote Control Cable	2	D3	D3 (CM)
DAC S-J Box Adapter	1	D1	Front A1
DAC Timing Cable	1	A6	A6
DAC-TO-TV Adapter Brkt	1	D3	D3 (CM)
Data Card Kit	1	R3	R3
Doppler Recorder	1	A6	A6
Doppler Recorder Power Cable	1	A6	A6
Drogue	1	Tunnel	DM Wall
Drogue Strap	3	R6	DM Wall
Drug Kit	1	R13	R13
Dynamic Science Demonstrations	1	D1	D1
Earth OBS Filter, 250 MM lens	1	B5	B5
Earth OBS Filter, 50 MM lens	1	B5	B5

DATE: 7/3/75PAGE: 1-3

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Earth Observation Hasselblad Mount	1	A6	A6
EMU Maintenance Kit.	1	R13	R13
ETE Camera Bracket	1	A6	A6
ETE Cryo Freezer	1	AFT BLKD	AFT BLKD
ETE Column Cover	1	A6	A6
ETE Power Cable.	1	A6	A6
Exerciser.	1	A5	U2
Eye Patch.	1	R3	R3
Fecal Bags	30	U1	U1
		A2	Jett
Fire Extinguisher.	2	RHEB	RHEB
		DM Wall	DM Wall
Fish Experiment.	1	A6	A6
Flash Assembly	1	B5	B5
Flight Data File	1	R1,2,3	R1,2,3
		A2	Jett
			A3
Flight Data Container (DM)	1	D2	D2
FDF Clips.	6	R3	R3
Foaming Demonstration.	1	A6	Jett
Food	5	B1	Jett
		L3	L3
		A3	Jett
		Front A1	
Food Trays	3	A2	L3
Furnace Cartridges, (Long)	3	A6	B1
Furnace Cartridge, Container (Short) 18		A6	B1
The experiment number can be substituted for this nomenclature. MA-044, MA-041, MA-070, MA-085, MA-131, MA-060			
Furnace O-Ring	1	A6	A6
Grease			
Gas Separator.	1	L2	L2
Germanium Crystal Experiment (M151).	1	R1	R1
Gift Bag	1	D1	A3
Gloves Thermal	3	U2	U2
Hand-Held Absolute Press Gauge (HHAG) 1		D1	Front A1
Hasselblad Data Camera (HDC)	1	B3	B3
HDC Magazines.	8	U1	U1
			U2
		B3	B3
		A6	A6
GODDARD BOOKS		R2	R2

DATE: 7/3/75

PAGE: 1-4

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Hasselblad Reflex Camera (HRC)	1	B5	B5
HRC Magazines	15	U1	U1
		B5	B5
		A6	A6
HRC IR Sun Filter (Black)	1	B5	B5
Hasselblad TM Cable	1	A6	A6
Hasselblad Variable Intervalometer	2	A6	A6
Headrest Pads	3	A1	Couch
Heel Restraints	3	A1	Worn
Helmet Bag	3	U2	Under Couch
HP 65 Calculator Kit	1	U1	U1
Hygiene Kit	1	A5	U2
HZE Dosimeter	1	U1	U1
In-Flight Coveralls	3	U2	Worn
Iodine Tablet Assy	3	A2	Jett
Jettison Stowage Bag	2	U2	Front A1
			Jett
Leg Template and Tape	1	A6	A6
Lens, DAC 5 MM	2	D3	D3 (CM)
Lens, DAC 10 MM	1	B5	D3
Lens, DAC 25 MM	1	B3	B3
Lens, DAC 75 MM	1	B3	B3
Lens, HDC Extender	1	A6	A6
Lens, HDC 60 MM	1	B5	B5
Lens, HDC 80 MM	1	A6	A6
Lens, HDC, 100 MM	1	B5	B5
Lens, HRC 50 MM	1	B5	B5
Lens, HRC 250 MM	1	B5	B5
Lens, NK 35 MM	1	B2	B2
Lens, NK 300 MM	1	A5	A5
LH Couch Polarizing Filter	1	Inst	U2
LH Wall Polarizing Filter	1	Inst	U2
Life Vest	3	Worn	Worn
Light Flash Cassette	1	D4	B1
Light Flash Detector Cable (RED)	1	D4	Front A1
Light Flash Detector Cable (BLUE)	1	D4	Front A1
Light Flash Detector Box (RED)	1	D4	B1
Light Flash Detector Box (BLUE)	1	D4	B1
Light Flash EVENT PB (RED)	1	D4	Front A1
Light Flash EVENT PB (BLUE)	1	D4	Front A1
Light Flash Head Mask	2	D4	B1
Light Flash Power and Logic Unit	1	D4	D4

DATE: 7/3/75

PAGE: 1-5

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Liquid Spreading Cubes	1	A6	Jett
Liquid Spreading Syringe and Ampule.	1	A6	Jett
Lithium Hydroxide Canister (LIOH).	20	A4	A4
(CO2 Absorber)		B6	B6
		D4	D4
		ECU	ECU
LIOH (CO2) Grounding Cable	1	L2	L2
LIOH Shim.	18	A4	A4
		B6	Jett
		B6	B6
		D4	D4
LIOH Tray.	1	A4	A4
Medical Kit.	1	R13	R13
Meter Cover.	2	R3	R3
Mirror, Right Angle	1	B3	B3
Mixing Duct.	1	D2	Front A1
Mixing Duct, Elbow.	1	D2	Front A1
Motion Sickness Bag.	3	Worn	In PGA Bag
Nikon Cable Release.	1	B2	B2
Nikon Camera	1	B2	B2
Nikon Cassette	12	B5	B5
		B2	B2
		U2	U2
Nikon Eyepiece	1	A5	A5
Nikon 300 MM Lens Bracket.	1	A5	A5
Official Flight Kit (OFK).	TBD	R4	R4
		R13	R13
0 Hose Interconnects.	3	A5	A5
0 2 Masks	5	UEB	UEB
0 2		Installed	Installed
		(DM)	(DM)
0 Screen Caps	3	A5	Installed
0 2 Umbilicals	3	LHFEB	LHFEB
0 2 Umbilical Clamp	3	LHFEB	LHFEB
0 2 Umbilical Straps.	2	Installed	Installed
0 2			

DATE: 7/3/75PAGE: 1-6

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
0 Umbilical Tiedown Strap	2	Installed	Installed
2			
Passive Dosimeter	3	Worn	Worn
PCM Shorting Plug	1	R6	R6
Pen	3	Worn	Worn
Pen, Marker	3	Worn	Worn
Pencil	3	Worn	Worn
Pen Lights	8	A5	A5
Personal Dosimeter	3	Worn	Worn
Pin Straightening Tool Kit	1	U3	U3
Pressure Garment Assembly(PGA)	3	Worn	In PGA Bag
PGA Bags	3	U2	On A4,5,6
PGA Electrical Connector Covers	3	A5	On PGA
PGA Gloves	3pr	Worn	In PGA Bag
PGA Helmet	3	Worn	In PGA Bag
PGA Tie-Down Strap	6	On A2,4,6	On A4,6
Portable Fan	1	D2	Jett
Portable Fan Power Cable	1	D2	D2
Portable Light	1	A5	A5
Portable Light Batteries	3	A5	A5
Postlanding Ventilation Duct (PLV Duct)	3	U3	U3
Potable Water Valve	1	A2	Jett
Pouch	2	LEB	LEB
Probe	1	Tunnel	DM Wall
Probe Docking Cable-Aux	1	L2	L2
Probe Strap	2	R5	DM Wall
Pulser	1	A6	A6
Pulser Shorting Plug (MA-060)	2	A6	A6
Radio Beacon Connector	1	R4	R4
Rescue Back Pad A	2	LH Couch	LH Couch
		RH Couch	RH Couch
Rescue Butt Pad	2	CTR Couch	CTR Couch
Rescue Harness - LH	1	Front A3	Front A3
Rescue Harness - RH	1	Front A3	Front A3
Rescue Foot Restraint Strap	2	Front A3	Front A3
Rescue Helmet	2	Front A3	Front A3
RH Couch Light Polarizing Filter	1	Inst	U2

TABLE 1-1 (CONT'D)

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Ring Sight	1	B3	B3
Roll-on Cuffs.	4	R11	R11
Rope	9	A1	Jett
		D1	A1
		Use	Use
Scissors	3	Worn	Use
Sleep Restraint.	3	UEB	Worn
Sliderule.	1	Worn	UEB
Snag Line.	1	U3	Worn
Sodium Iodide Crystal Experiment	1	R1	U3
Spanner Wrench (MA-028).	1	U4	R1
Speaker Box (W/Dust Cap)	1	D1	U4
Spotting Scope (W/Eyepieces)	1	A1	D1
Spotmeter.	1	B3	A1
Stratospheric Aerosol Measurement.	1	A6	B3
(SAM)			A6
Sam Jumper Cable	1	A6	A6
Sam Power Cable.	1	A6	A6
Sun Filter (G&N)	2	R6	R6
Sunglasses	3	Worn	Worn
Survival Kit	2	R4	Worn
Tape	5	R6	R4
		Worn	R6
		D1	Worn
Temporary Storage Bag (TSB).	5	LEB	D1
		LEB	LEB
		UEB	Jett
		D1	UEB
Timer, Interval.	1	B3	D1
Tissues.	9	A1	B3
		A2	A1
		D2	Jett
		D4	D2
Tool Kit	2	U3	D4
		D1	U3
Tool Pouch	2	U3	Front A1
		D1	U3
Tool Tether.	1	U3	Front A1
Tool B, Emergency Wrench.	2	U3	U3
		D1	U3
			Front A1

DATE: 7/3/75PAGE: 1-8

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Tool E, Adapter Handle	2	L2	L2
Tool F, End Wrench	1	U3	U3
Tool L, CPC Driver	1	U3	U3
Tool R, Torque Set Driver	1	U3	U3
Tool V, U-Joint Driver	1	U3	U3
Tool W, Ratchet	2	U3	U3
Tool 1, 3/8 Socket	1	D1	Front A1
Tool 2, Screwdriver Adapter	1	U3	U3
Tool 3, No. 8 Torque TIP	1	U3	U3
Tool 4, No. 10 Torque Tip	2	U3	U3
Tool 5, 5/16 Socket	1	D1	Front A1
Tool 7	1	U3	U3
Towels	8	L2	L2
		A1	A1
		A2	Jett
		D2	
Tunnel Hatch (Hatch No.1)	1	Tunnel	Tunnel
Tunnel Hatch Tie Down Straps	2	On A5	ON A5
TV Camara (TV-C)	4	A5	A5
		MDC	A5
		D3	D3 (CM)
TV Cable Adapter	1	D1	Front A1
TV Camera Polarizing Filter	1	MDC	U2
TV Launch Bracket	1	MDC	Jett
TV Lens	1	A5	A5
TV Light Shield	1	D2	D2
TV Monitor	4	A5	A5
		D3	D3 (CM)
TV Monitor Cable	4	A5	A5
		D3	D3 (CM)
TV/MVA Cable	2	MDC	A5
		D1	Front A1
TV Power Cable	4	A5	A5
		D3	Front A1
		D1	D3 (CM)
TV Wide Angle (W/A) Lens	4	A5	A5
		MDC	A5
		D3	D3
Umbilical Tiedown Strap	3	XX struts	XX struts

DATE: 7/3/75PAGE: 1-9

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
U-Mount Adapter Bracket.	1	A5	A5
U-Mount TV/DAC	6	A5	A5
		D3	D3 (CM)
Underwear.	12	A4	A4
		D4	D4
URINE Bag.	5	U1	U1
Urine Collection Transfers	3	Worn	In PGA BAG
ASSY (UCTA)			
UCTA Clamp	3	R11	R11
UCTA Transfer Adapter.	1	A1	A1
Urine Filter	3	R11	R11
Urine Filter, Hi-Capacity.	1	R11	Jett
Urine Hose Assembly	1	A1	A1
Urine Receptacle Assembly (URA).	1	A1	R11
URA Restraint Strap	1	A1	R11
Urine Transfer System (UTS)	5	R11	R11
			Jett
UTS Receiver Spare	3	R11	R11
USSR TV Camera Cable	1	PNL 861	Front A1
Utility Straps	25	R5	R5
		D1	D1
		D3	D3
UVA (Drag Thru) Cable (W/Dust Caps) 1		Front A1	Front A1
UVA Cable Restraint Strap.	3	Inst	Inst
		Under F2	Under F2
		DM Tunnel	DM Tunnel
UVA/COAS Penlight Bracket.	1	R5	R5
Velcro Straps.	25	D1	Front A1
		U2	Worn
Voice Recorder	2	A4	A4
Voice Recorder Batteries	10	A4	A4
Voice Recorder Cassettes	2	A4	A4
Voice Recorder Tape Kit.	2	A4	A4
Waste Stowage Container.	2	A1	A1
			Jett
WMS Power Cable	1	L2	L2
WMS Pressure Caps.	1	A1	A1
Watch	6	Worn	Worn
Watchband (Long)	3	Worn	In PGA
Watchband (Short)	6	In PGA	Worn

DATE 6/30/75

ASTP LOOSE EQUIPMENT ALPHABETICAL LIST

PROCEDURAL NOMENCLATURE	QTY	LAUNCH LOC	RETURN LOC
Water Bag.	2	A2	Jett
Water Dispenser	1	LHFEB	LHFEB
Water Fill Adapter	1	A2	Jett
Water Panel Disconnect	1	A1	A1
Water Transfer Hose.	1	A2	Jett
Wicking Demonstration.	1	A6	Jett
Window Shade Hatch	1	UEB	UEB
Window Shade LH Rendezvous	1	UEB	UEB
Window Shade LH Side	1	UEB	UEB
Window Shade RH Rendezvous	1	UEB	UEB
Window Shade RH Side	1	UEB	UEB
Zone Forming Fungi (ZFF)	2	R5	R5

STOWAGE
MAPS

ASTP CSM LAUNCH

TABLE 1-2





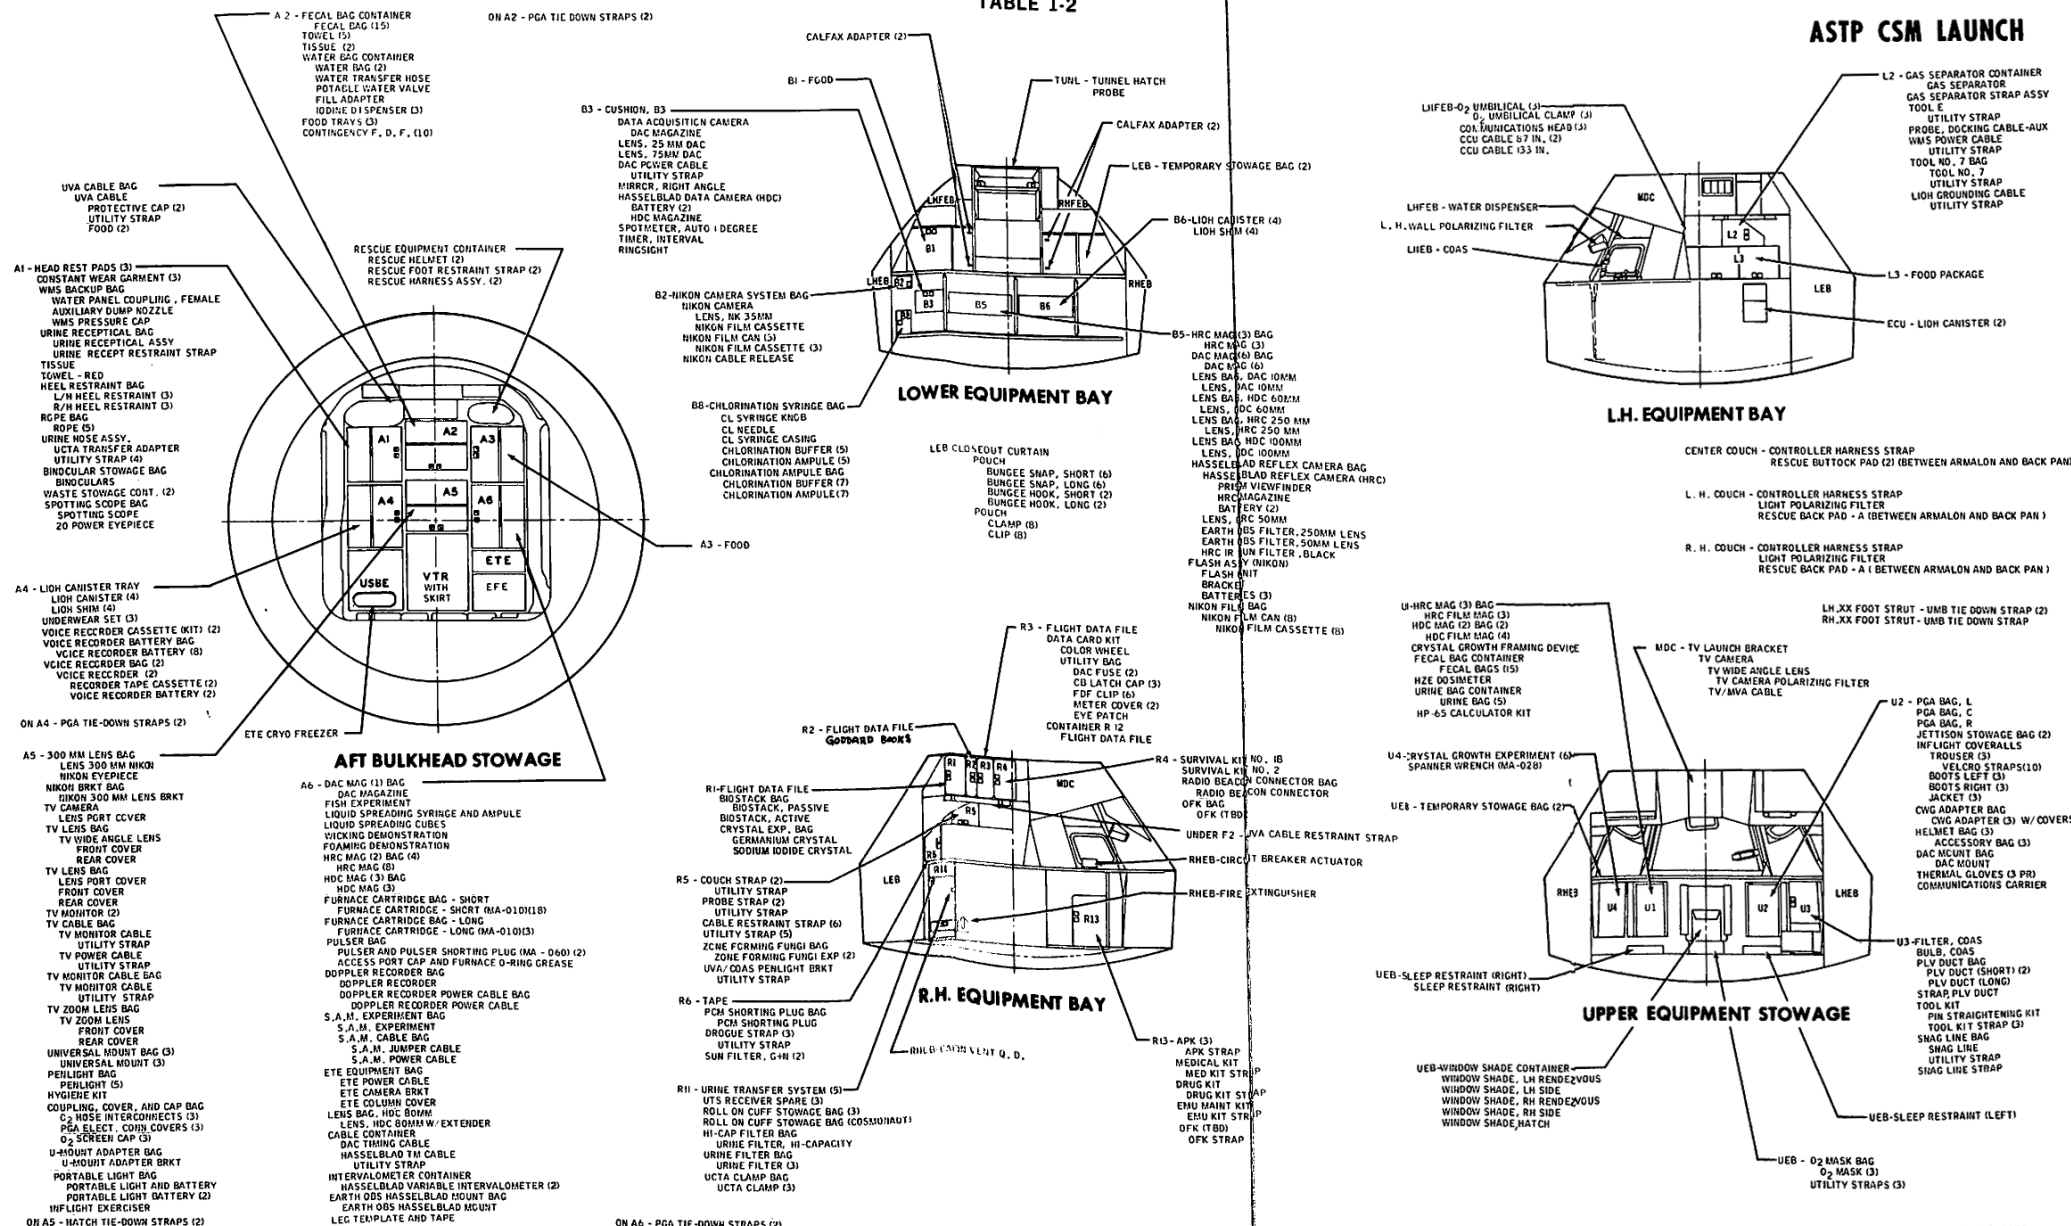


TABLE 1-3

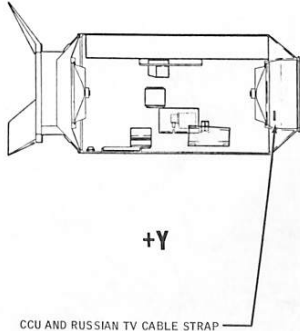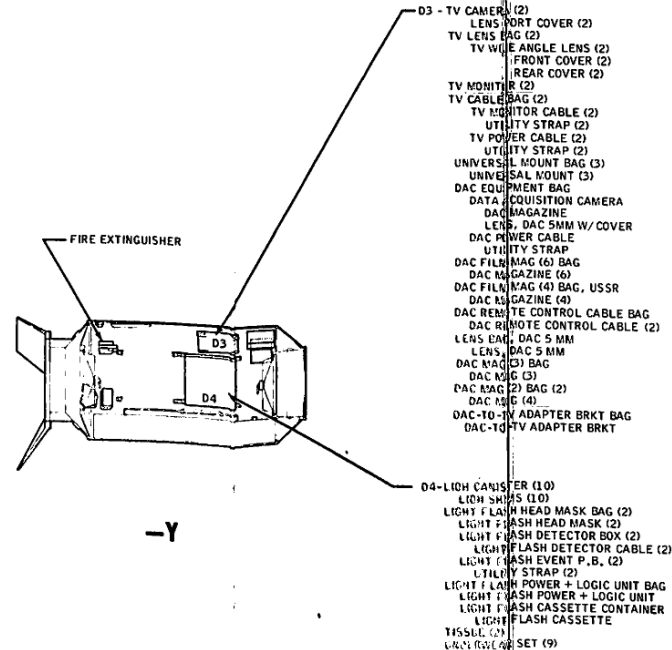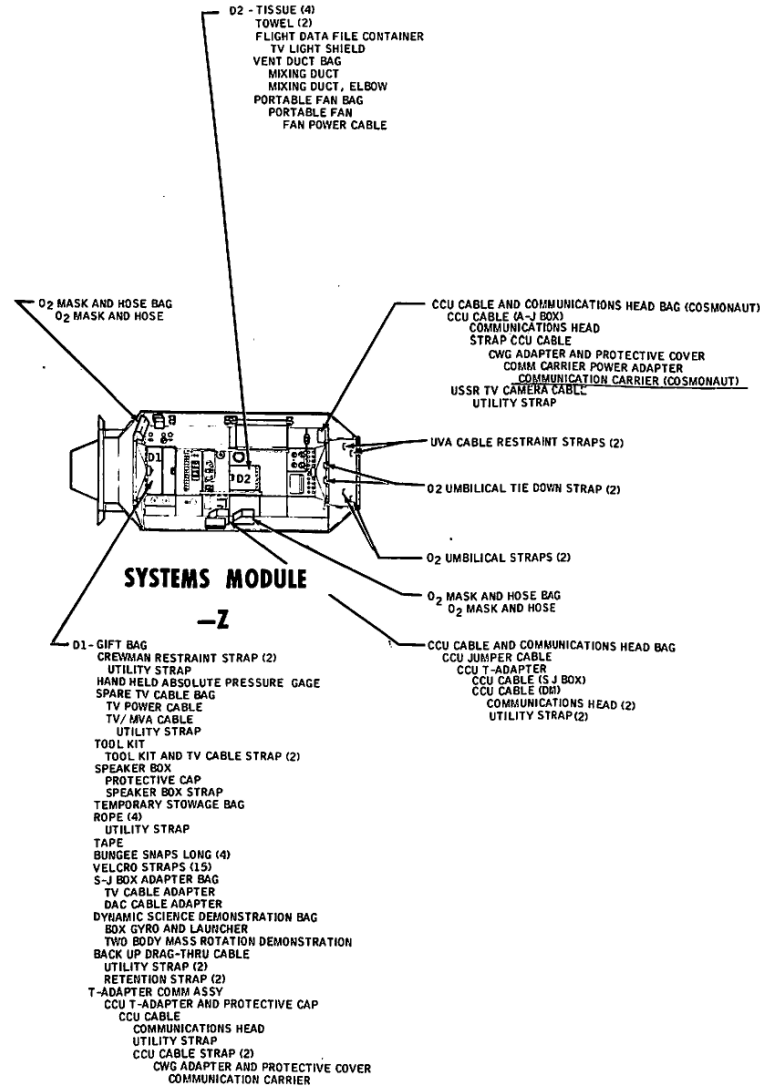



ASTP CSM RETURN

TABLE 1-4

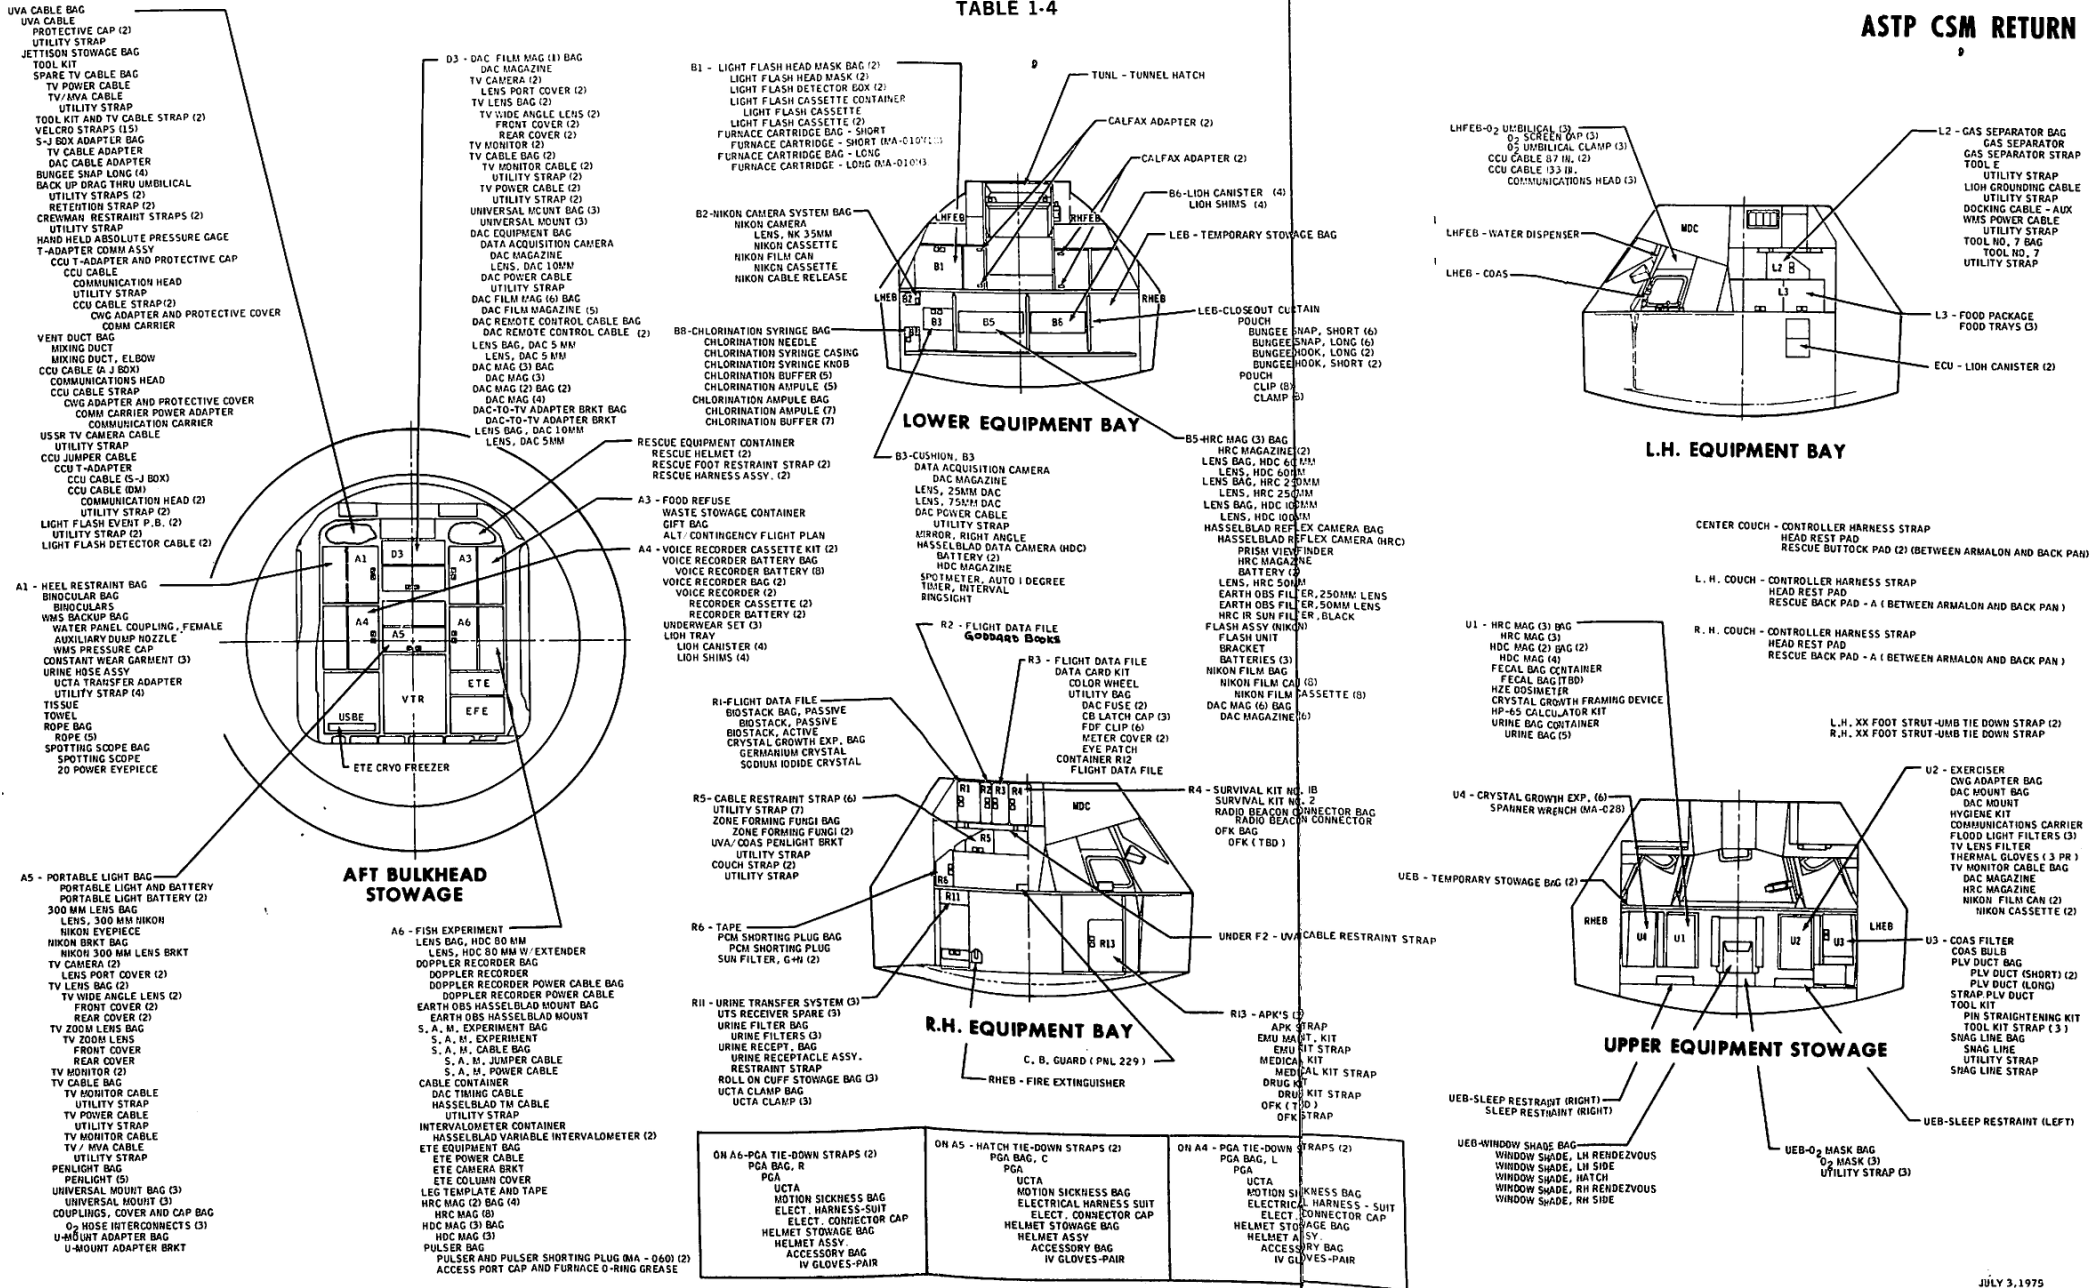


ASTP DM SEPARATION

TABLE 1-5

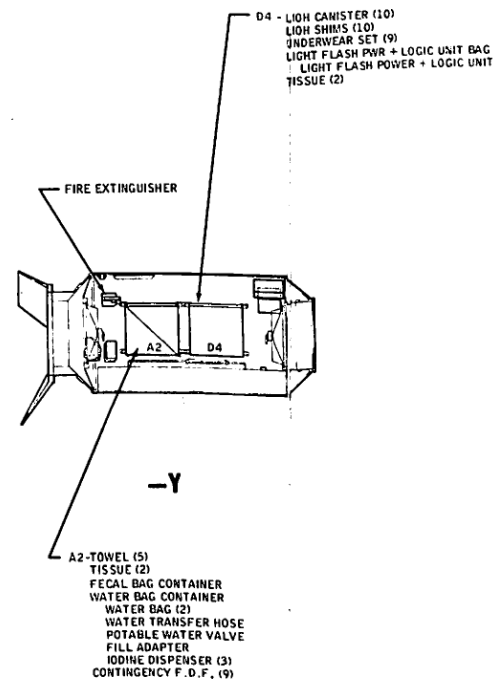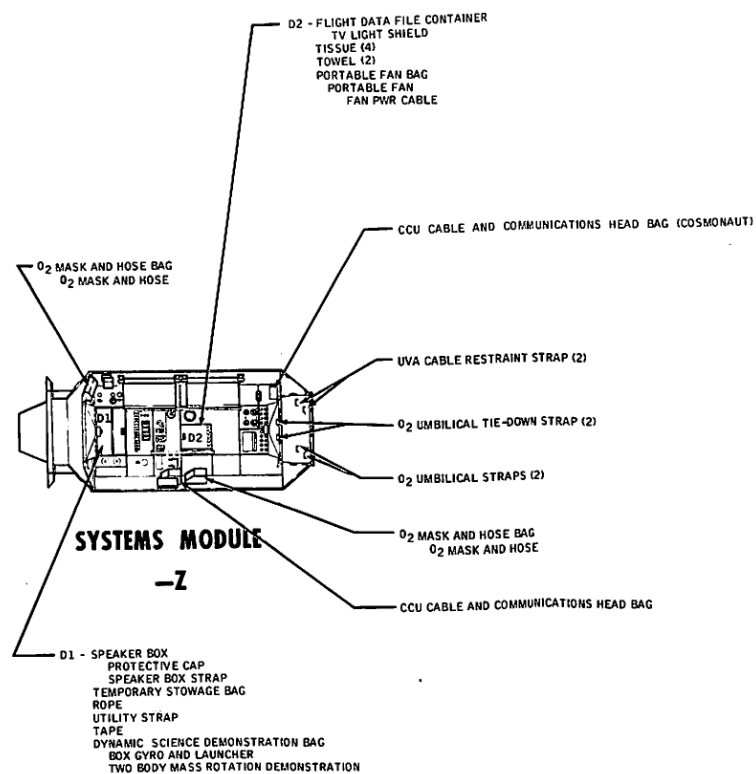


ON A2 - PGA TIE DOWN STRAP (2)
ROPE

DROGUE
DROGUE STRAP (3)
PROBE
PROBE STRAP (2)
ROPE (AROUND PROBE
AND DROGUE)

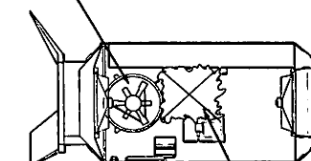

JETTISON STOWAGE BAG
HI-CAP FILTER BAG
URINE FILTER, HIGH-CAP
COSMONAUT ROLL-ON CUFF BAG
CIRCUIT BREAKER ACTUATOR
CABIN VENT Q.D.
COSMONAUT UTS (2)
FOOD REFUSE FROM (A3) AND (B1)
TEMPORARY STOWAGE BAG
TV LAUNCH BRACKET
WASTE STOWAGE CONTAINER
FECAL COLLECTION ASSY (TBD)
LIQUID SPREADING SYRINGE AND AMPULE
LIQUID SPREADING CUBES
WICKING DEMONSTRATION
FOAMING DEMONSTRATION
ROPE (AROUND JETT BAG)

TABLE 1-6
TOTAL SM RCS PROPELLANT USAGE PROFILE

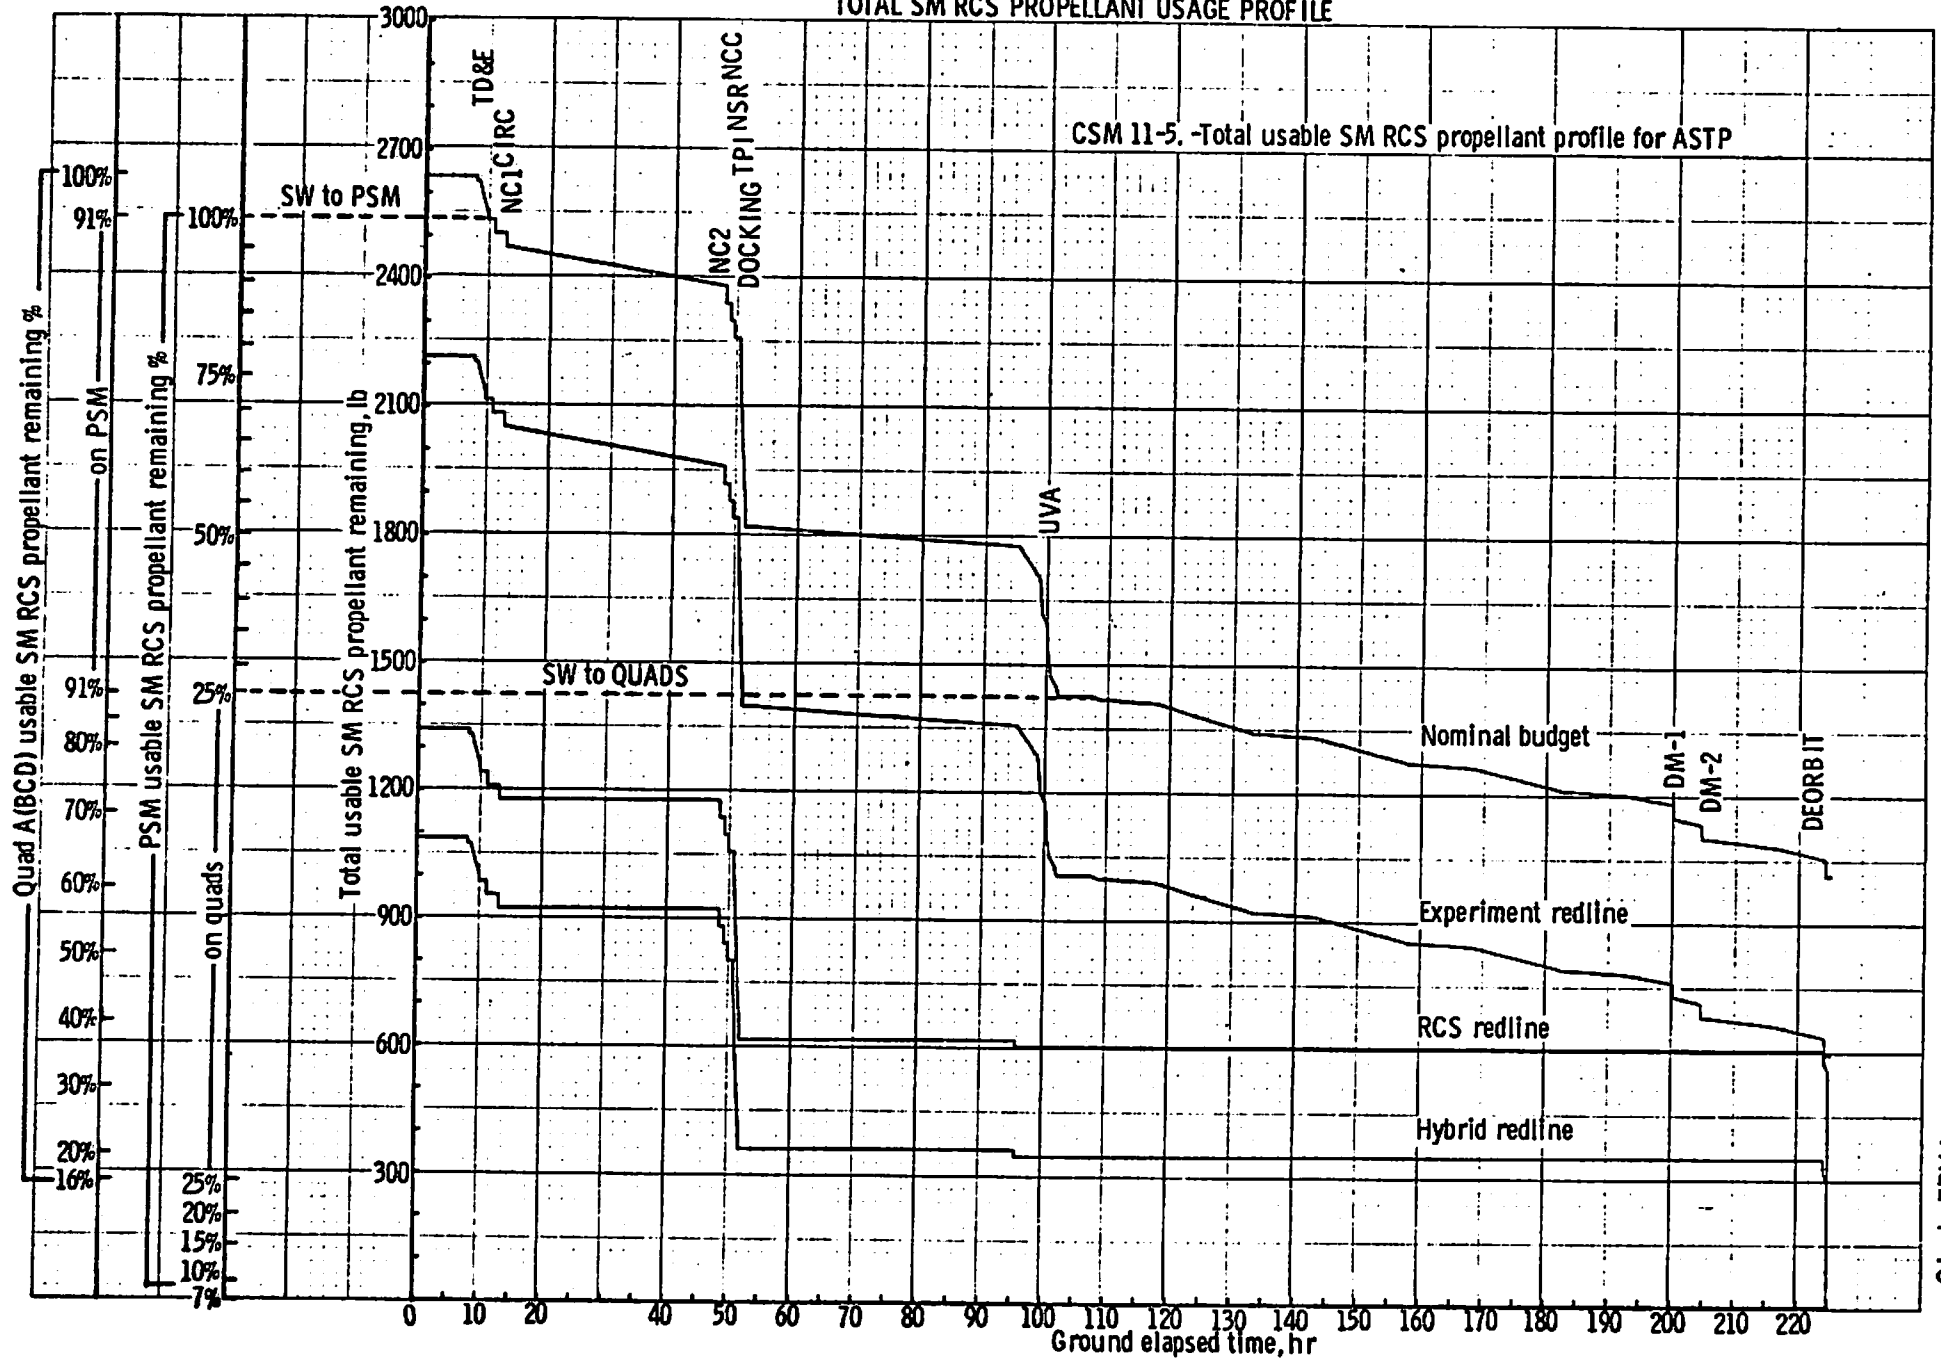

CONSUMABLES CURVES


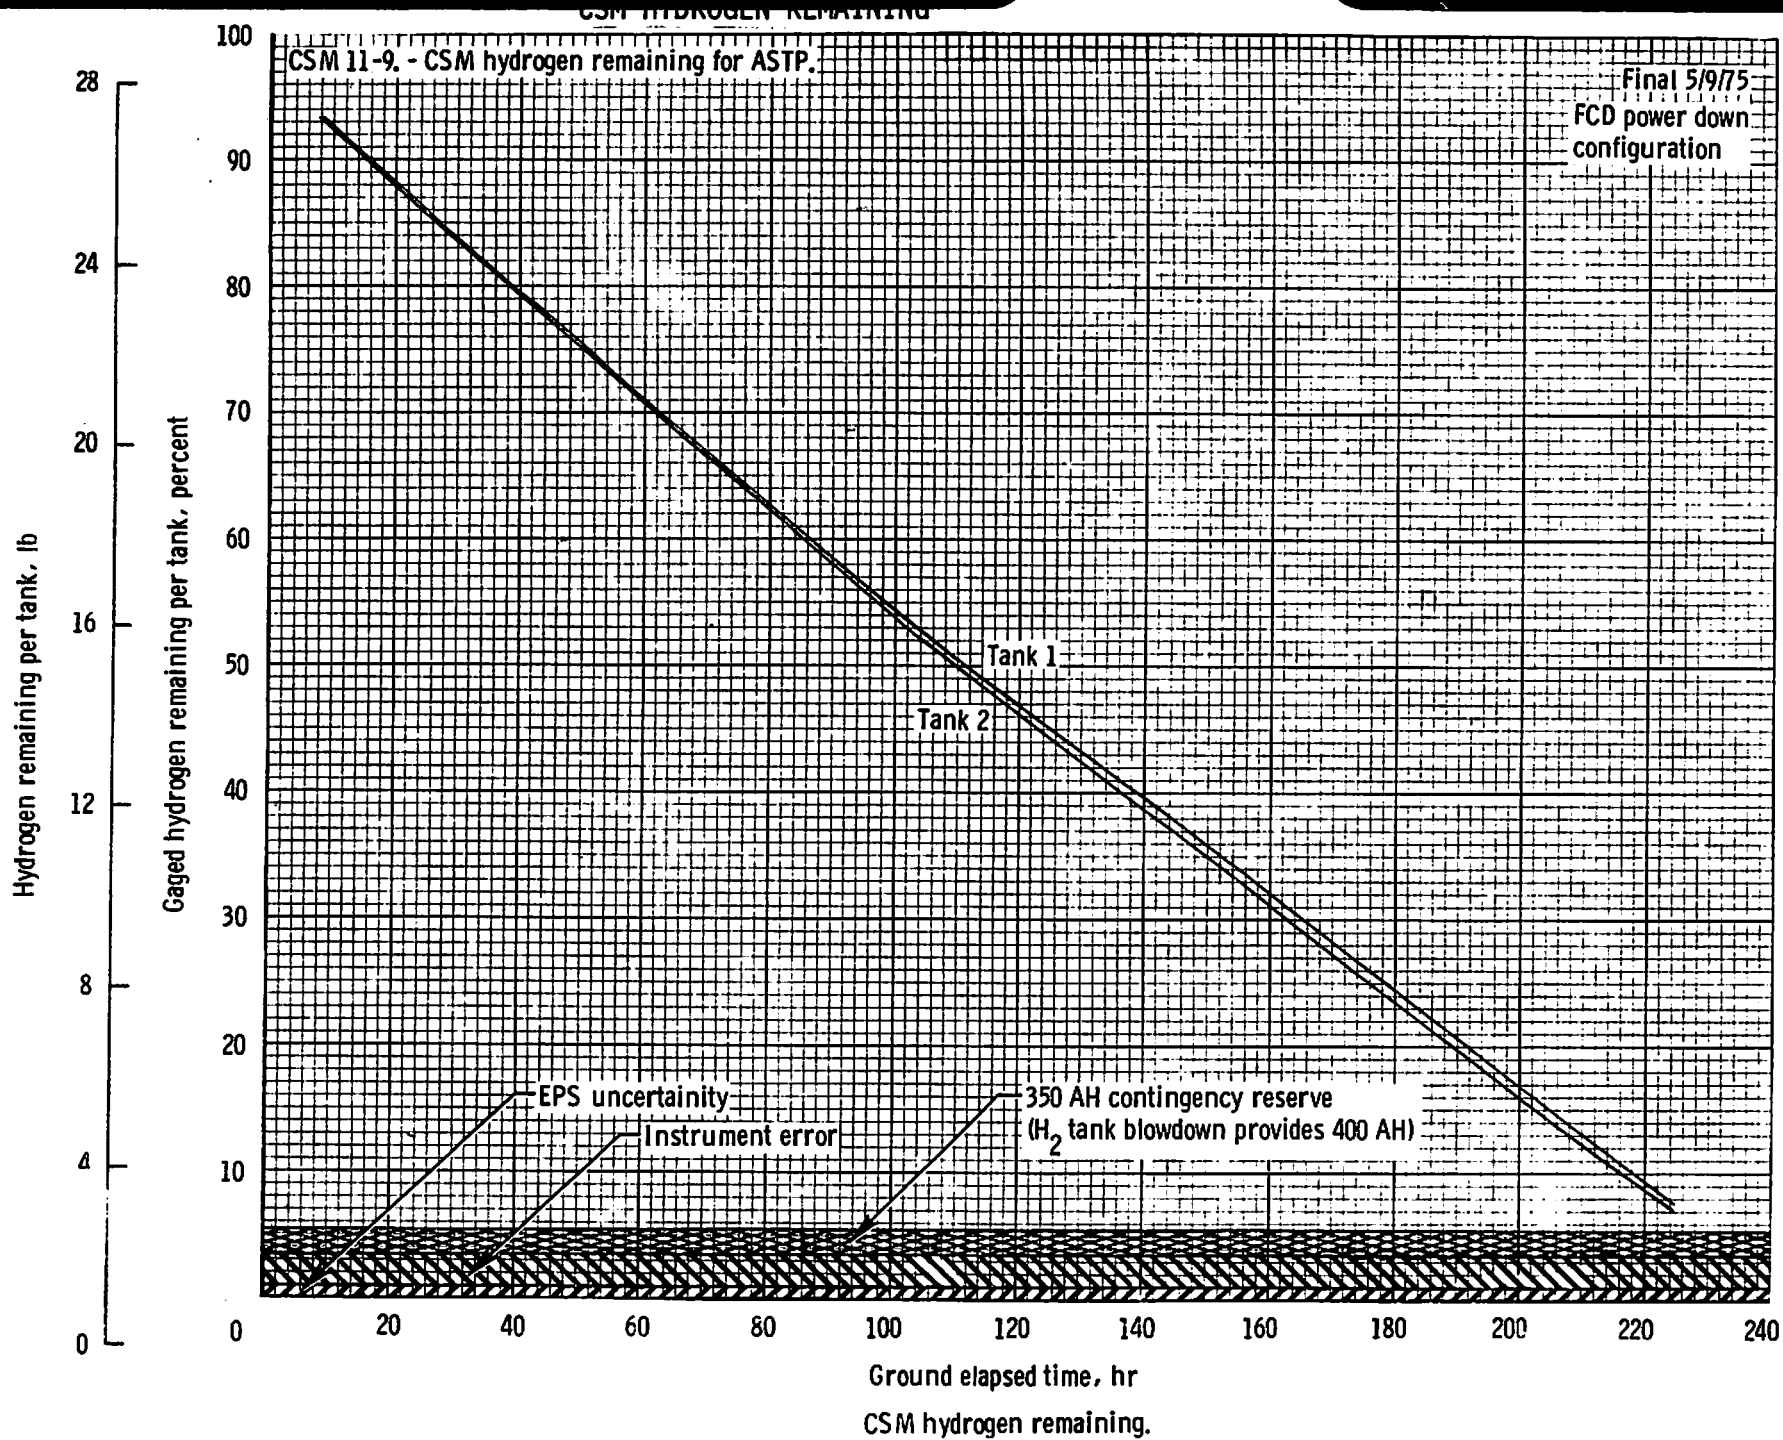


TABLE 1-6 (CONT'D)
CSM OXYGEN REMAINING

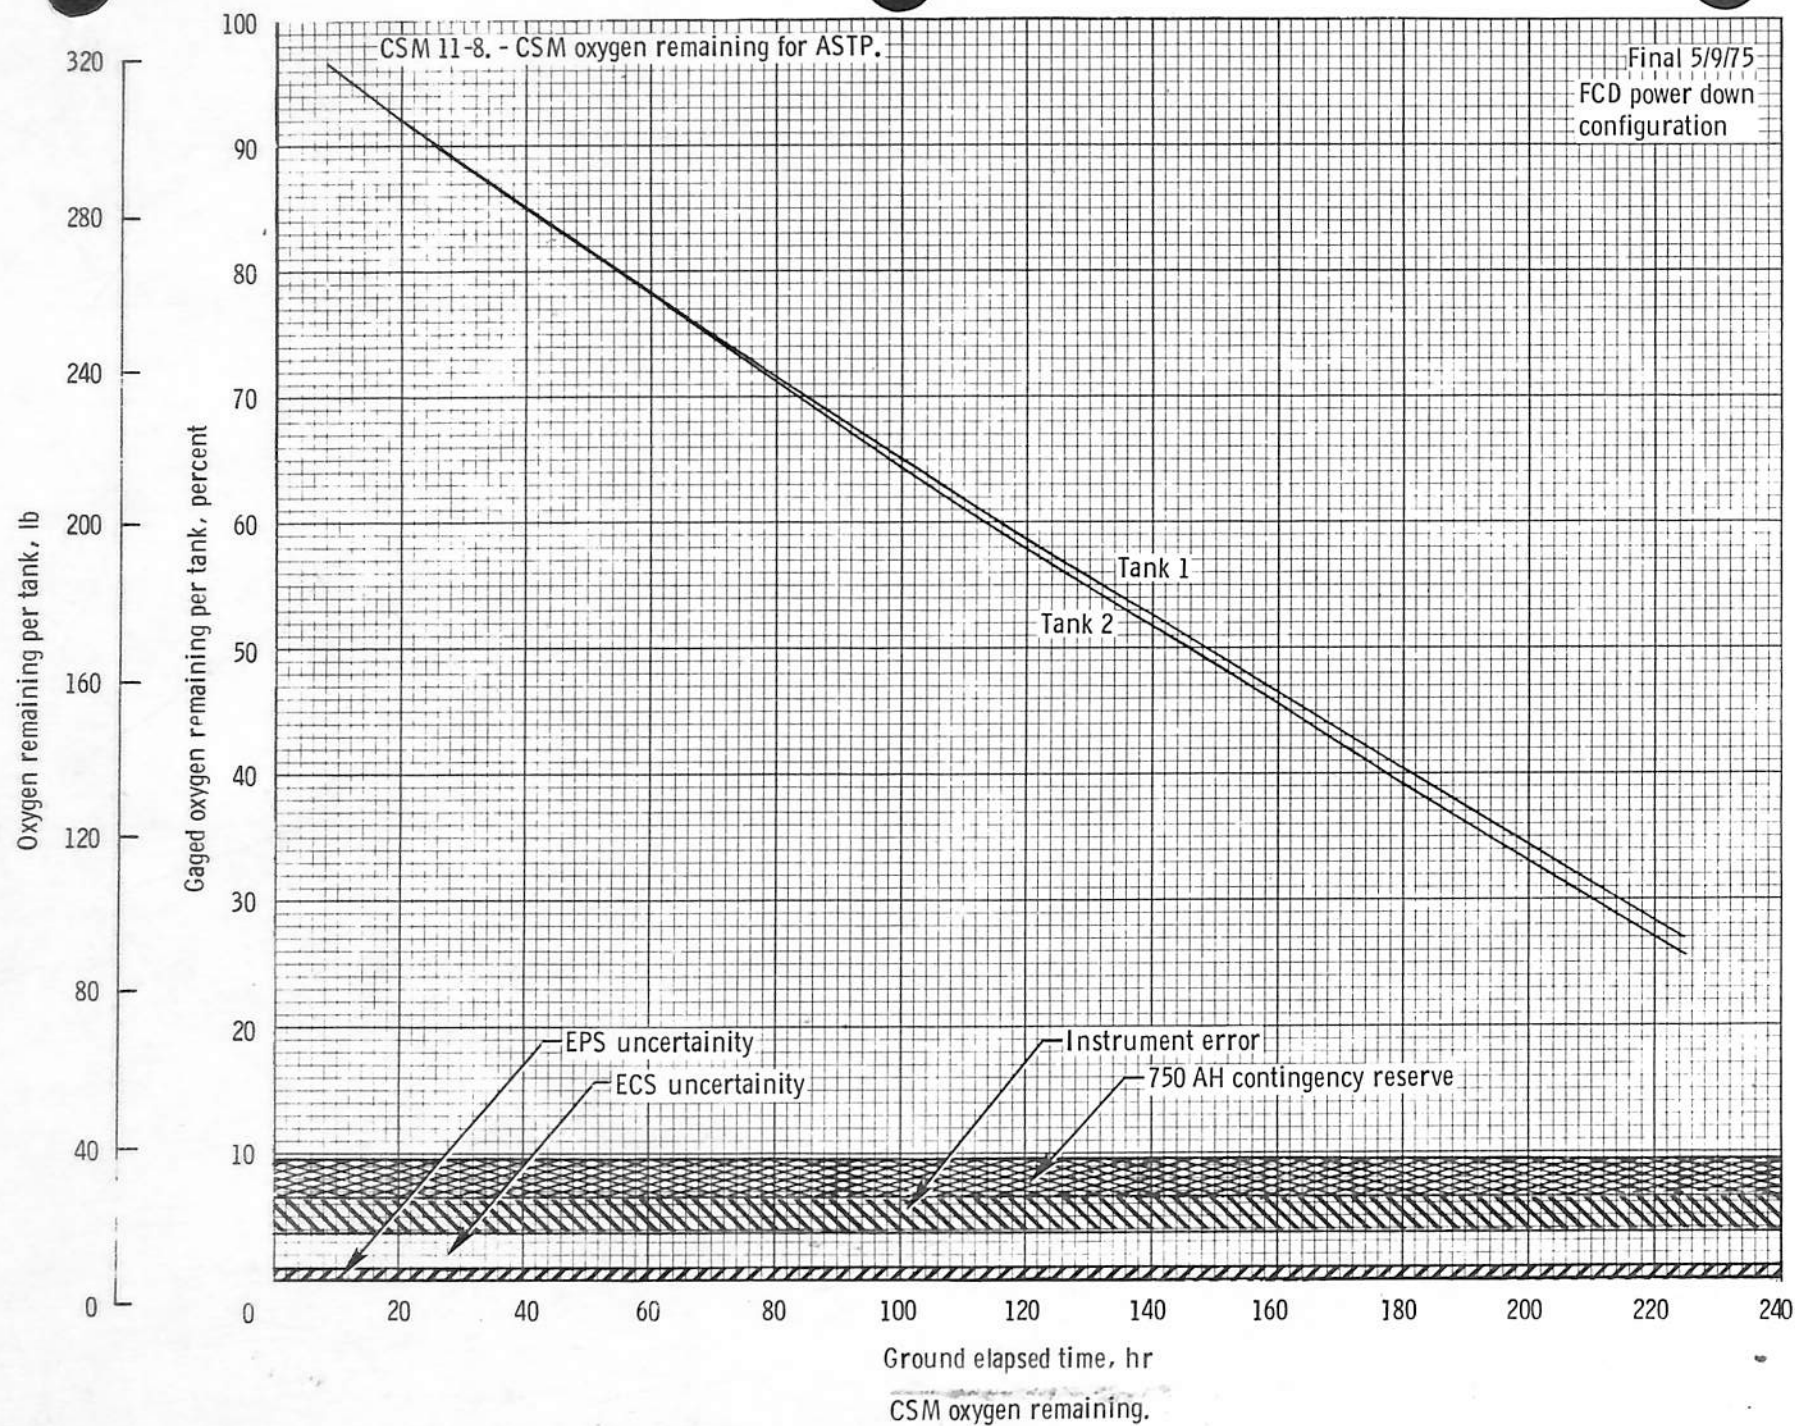

THIS PAGE INTENTIONALLY BLANK

CHECK ITEMS CONSUMED

TABLE 1-7
AC MENU

Thomas P. Stafford, AC - RED VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A			B-1 LOCKER	2	B-1 LOCKER	3	B-1 LOCKER	4
			Scrambled Eggs Bacon Wafers (4) Strawberries Grapefruit Drink Tea w/Lemon & Sugar VITAMINS		Granola Beef Patties Dried Peaches Cocoa VITAMINS		Scrambled Eggs Sausage Patties Pineapple Orange Drink Coffee, Cream & Sugar VITAMINS	
B	SUIT POCKETS	1	B-1 LOCKER	2	B-1 LOCKER	3	B-1 LOCKER	4
	Sandwich Beverage		Chicken Salad Rye Bread Applesauce Orange Drink		Turkey-Rice Soup Cheese Crackers Peanut Butter Strawberry Jam Rye Bread Tea w/Lemon & Sugar		Potato Soup Beef Slices/BBQ Sauce Cheese Spread Rye Bread Peach Ambrosia Strawberry Drink	
C	B-1 LOCKER	1	B-1 LOCKER	2	L-3 LOCKER*	3	B-1 LOCKER	4
	Shrimp Cocktail Beef Steak (I) Shortbread Cookies Vanilla Pudding Orange-Pineapple Drink Almonds		Seafood-Mushroom Soup Meatballs/BBQ Sauce Stewed Tomatoes Cherry-Nut Cake Strawberry Drink		Shrimp Cocktail Chicken a la King Peas Chocolate-Nut Cake Orange-Pineapple Drink		Seafood-Mushroom Soup Turkey & Gravy Cranberry Sauce Brownies Grapefruit Drink Peanuts	

* USE FOR DAY 10 MEAL C IF NEEDED

AC
MENU

AC
MENU

CHECK ITEMS CONSUMED

TABLE 1-7 (CONTD)

Thomas P. Stafford, AC - RED VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	A3 LOCKER	8
	Breakfast Roll Raisin & Spice Cereal Peaches Orange Drink Coffee, Cream & Sugar VITAMINS		Scrambled Eggs Bacon Wafers (4) Strawberries Grapefruit Drink Tea w/Lemon & Sugar VITAMINS		Granola Beef Patties Dried Peaches Cocoa VITAMINS		Scrambled Eggs Sausage Patties Pineapple Orange Drink Coffee, Cream & Sugar VITAMINS	
B	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Pea Soup Salmon Rye Bread Dried Apricots Coffee, Cream & Sugar		Chicken Salad Rye Bread Applesauce Orange Drink		Turkey-Rice Soup Cheese Crackers Peanut Butter Strawberry Jam Rye Bread Tea w/Lemon & Sugar		Potato Soup Beef Slices/BBQ Sauce Cheese Spread Rye Bread Peach Ambrosia Strawberry Drink	
C	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Shrimp Cocktail Beef Steak (I) Shortbread Cookies Vanilla Pudding Orange-Pineapple Drink Almonds		Seafood-Mushroom Soup Meatballs/BBQ Sauce Stewed Tomatoes Cherry-Nut Cake Strawberry Drink		Shrimp Cocktail Chicken a la King Peas Chocolate-Nut Cake Orange-Pineapple Drink		Seafood-Mushroom Soup Turkey & Gravy Cranberry Sauce Brownies Grapefruit Drink Peanuts	

CHECK ITEMS CONSUMED

TABLE 1-7 (CONTD) Pg. 1-21

Thomas P. Stafford, AC - RED VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	L3 LOCKER	9	L3 LOCKER	10	UVA BAY*	11		
	Breakfast Roll		Scrambled Eggs		Granola			
	Raisin & Spice Cereal		Bacon Wafers (4)		Beef Patties			
	Peaches		Strawberries		Dried Peaches			
	Orange Drink		Grapefruit Drink		Cocoa			
	Coffee, Cream & Sugar		Tea w/Lemon & Sugar		VITAMINS			
	VITAMINS		VITAMINS					
B	L3 LOCKER	9	UVA BAY	10	L3 LOCKER*	11		
	Pea Soup		Chicken Salad					
	Salmon		Rye Bread		Snacks From			
	Rye Bread		Applesauce		Pantry			
	Dried Apricots		Orange Drink					
	Coffee, Cream & Sugar							
C	L3 LOCKER	9	L3 LOCKER*	10				
	Shrimp Cocktail		Shrimp Cocktail					
	Beef Steak (I)		Chicken a la King					
	Shortbread Cookies		Peas					
	Vanilla Pudding		Chocolate-Nut Cake					
	Orange-Pineapple Drink		Orange-Pineapple Drink					
	Almonds							

*Not normally planned

DATE 6/30/75

PAGE 1-21

AC MEDICAL LOGGING GUIDELINES

1. PRD READINGS - Read PRDs daily for entire mission.
Record PRD's in Medical Log and report daily
to STDN.

2. SLEEP

A. Record quantity and quality of sleep and report
to STDN (for entire mission).

B. Log in AC Medical Log comments on sleep for
entire mission.

a. Number of dreams recalled.

b. Times awakened.

c. Difficulty in going back to sleep.

3. MEDICATION

Log in AC Medical Log and report daily to STDN
all medication used (including aspirin).

4. FLUID INTAKE

A. Measure quantity of all fluid intake after
suit doffing (PET 03:50) except the water re-
quired to prepare food.

B. Log data in AC Medical Log and report
daily to STDN.

5. FOOD

A. Log and report daily to STDN menu items not
consumed (for entire mission).

B. Log in menu additional foods eaten from pantry
(for entire mission).

6. FECES

Log crewman and GET on each fecal bag used in CM.

CREW STATUS REPORT PAD

AC PRD
AC SLEEP
MED
AC FLUID
AC FOOD

AC Medical Log

- From Menu (Table 1-7)

TABLE 1-8 AC MEDICAL LOG

DATE 6/30/75

PAGE 1-23

DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**	DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**
DAY 1 00:00 - 24:00					DAY 8 168:00 - 192:00				
DAY 2 24:00 - 44:45					DAY 9 192:00 - 91:42+				
DAY 3 44:45 - 67:00									
DAY 4 67:00 - 92:00									
DAY 5 92:00 - 117:30									
DAY 6 117:30 - 142:45									
DAY 7 142:45 - 168:00									

FOOD-SEE AC MENU
 *REPORT QUANTITY AND QUALITY
 **FLUID QUANTITY DETERMINED BY TBD
 †PET

THIS PAGE INTENTIONALLY BLANK

AC
MEDICAL LOG

CHECK ITEMS CONSUMED

TABLE 1-9
CP MENU

Vance D. Brand, CP - WHITE VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A			B-1 LOCKER Natural Cereal Strawberries Grapefruit Drink Coffee Strawberry Drink VITAMINS _____ _____ _____	2	B-1 LOCKER Breakfast Roll Bran Flakes Dried Peaches Coffee Orange Drink Grapefruit Drink VITAMINS _____ _____ _____	3	B-1 LOCKER Natural Cereal Strawberries Orange Drink Coffee Lemonade VITAMINS _____ _____ _____	4
B	SUIT POCKETS Sandwich Beverage _____ _____ _____ _____	1	B-1 LOCKER Ham Applesauce Peanut Butter Graham Crackers (8) Orange Drink _____ _____ _____ _____	2	B-1 LOCKER Beef slices/BBQ Sauce Rye Bread Shortbread Cookies (4) Applesauce Cocoa _____ _____ _____ _____	3	L-3 LOCKER* Tuna Rye Bread Cheese Slice Pecan Cookies (4) Grapefruit Drink _____ _____ _____ _____	4
C	B-1 LOCKER Beef & Gravy Creamed Corn Fruit Cocktail Shortbread Cookies (4) Applesauce Cheese Slice Coffee _____ _____ _____	1	B-1 LOCKER Seafood-Mushroom Soup Beef Steak (I) Mashed Potatoes Cranberry Sauce Pecan Cookies (4) Coffee _____ _____ _____	2	B-1 LOCKER Romaine Soup Turkey & Gravy Cranberry Sauce Cheese Slice Chocolate Pudding Coffee _____ _____ _____	3	B-1 LOCKER Pea Soup Beef Steak (I) Mashed Potatoes Pineapple Peach Ambrosia Coffee _____ _____ _____	4

* USE FOR DAY 10 MEAL C IF NEEDED

CP MENU

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	A3 LOCKER	8
	Breakfast Roll		Natural Cereal		Breakfast Roll		Natural Cereal	
	Raisin & Spice Cereal		Strawberries		Bran Flakes		Strawberries	
	Peaches		Grapefruit Drink		Dried Peaches		Orange Drink	
	Orange Drink		Coffee		Coffee		Coffee	
	Coffee		Strawberry Drink		Orange Drink		Lemonade	
	Grapefruit Drink		VITAMINS		Grapefruit Drink		VITAMINS	
	VITAMINS				VITAMINS			
B	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Salmon		Ham		Beef slices/BBQ Sauce		Tuna	
	Rye Bread		Applesauce		Rye Bread		Rye Bread	
	Dried Apricots		Peanut Butter		Shortbread Cookies (4)		Cheese Slice	
	Cocoa		Graham Crackers (8)		Applesauce		Pecan Cookies (4)	
			Orange Drink		Cocoa		Grapefruit Drink	
C	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Beef & Gravy		Seafood-Mushroom Soup		Romaine Soup		Pea Soup	
	Creamed Corn		Beef Steak (I)		Turkey & Gravy		Beef Steak (I)	
	Fruit Cocktail		Mashed Potatoes		Cranberry Sauce		Mashed Potatoes	
	Shortbread Cookies (4)		Cranberry Sauce		Cheese Slice		Pineapple	
	Applesauce		Pecan Cookies (4)		Chocolate Pudding		Peach Ambrosia	
	Cheese Slice		Coffee		Coffee		Coffee	
	Coffee							

CHECK ITEMS CONSUMED

TABLE 1-9 (CONTD)

Page 1-27

Vance D. Brand, CP - WHITE VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	L3 LOCKER	9	L3 LOCKER	10	UVA BAY*	11		
	Breakfast Roll		Natural Cereal		Breakfast Roll			
	Raisin & Spice Cereal		Strawberries		Bran Flakes			
	Peaches		Grapefruit Drink		Dried Peaches			
	Orange Drink		Coffee		Coffee			
	Coffee		Strawberry Drink		Orange Drink			
	Grapefruit Drink				Grapefruit Drink			
	VITAMINS		VITAMINS		VITAMINS			
B	L3 LOCKER	9	UVA BAY	10	L3 LOCKER*			
	Salmon		Ham					
	Rye Bread		Applesauce		Snacks From			
	Dried Apricots		Peanut Butter		Pantry			
	Cocoa		Graham Crackers (8)					
			Orange Drink					
C	L3 LOCKER	9	L3 LOCKER*	10				
	Beef & Gravy		Tuna					
	Creamed Corn		Rye Bread					
	Fruit Cocktail		Cheese Slice					
	Shortbread Cookies (4)		Pecan Cookies (4)					
	Applesauce		Grapefruit Drink					
	Cheese Slice							
	Coffee							

*Not normally planned

CP MEDICAL LOGGING GUIDELINES

1. PRD READINGS - Read PRDs daily for entire mission.
Record PRD's in Medical Log and report daily to STDN.

2. SLEEP

- A. Record quantity and quality of sleep and report to STDN (for entire mission).
- B. Log in CP Medical Log comments on sleep for entire mission.
 - a. Number of dreams recalled.
 - b. Times awakened.
 - c. Difficulty in going back to sleep.

3. MEDICATION

Log in CP Medical Log and report daily to STDN all medication used (including aspirin).

4. FLUID INTAKE

- A. Measure quantity of all fluid intake after suit doffing (PET 03:50) except the water required to prepare food.
- B. Log data in CP Medical Log and report daily to STDN.

5. FOOD

- A. Log and report daily to STDN menu items not consumed (for entire mission).
- B. Log in menu additional foods eaten from pantry (for entire mission).

6. FECES

Log crewman and GET on each fecal bag used in CM.

CREW STATUS REPORT PAD

CP PRD
CP SLEEP
CP MED
CP FLUID
CP FOOD

CP Medical Log

- From Menu (Table 1-9)

TABLE 1-10 CP MEDICAL LOG

DATE 6/30/75

PAGE 1-29

DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**			DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**		
DAY 1							DAY 8						
00:00							168:00						
-							-						
24:00							192:00						
DAY 2							DAY 9						
24:00							192:00						
-							-						
44:45							91:42+						
DAY 3													
44:45													
-													
67:00													
DAY 4													
67:00													
-													
92:00													
DAY 5													
92:00													
-													
117:30													
DAY 6													
117:30													
-													
142:45													
DAY 7													
142:45													
-													
168:00													

FOOD-SEE CP MENU

*REPORT QUANTITY AND QUALITY OF SLEEP

**FLUID QUANTITY DETERMINED BY TBD

+PET

THIS PAGE INTENTIONALLY BLANK

CHECK ITEMS CONSUMED

TABLE 1-11
DP MENU

Donald K. Slayton, DP - BLUE VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A			B-1 LOCKER Scrambled Eggs Sausage Patties Strawberries Grapefruit Drink Tea w/Lemon & Sugar VITAMINS _____ _____ _____ _____	2	B-1 LOCKER Granola Bacon Squares (4) Pineapple Cocoa Tea w/Lemon & Sugar VITAMINS _____ _____ _____ _____	3	B-1 LOCKER Scrambled Eggs Beef Patties Peaches Orange Drink Tea w/Lemon & Sugar VITAMINS _____ _____ _____ _____	4
B	SUIT POCKETS Sandwich Beverage _____ _____ _____ _____	1	B-1 LOCKER Potato Soup Salmon Rye Bread Beef Jerkey Peach Ambrosia Orange Drink _____ _____ _____ _____	2	B-1 LOCKER Pea Soup Corned Beef Cheese Spread Rye Bread Dried Apricots Brownies Grape Drink _____ _____ _____ _____	3	B-1 LOCKER Macaroni & Cheese Meatballs w/Sauce Rye Bread Almonds Vanilla Pudding Grapefruit Drink _____ _____ _____ _____	4
C	B-1 LOCKER Pea Soup Beef Steak Potato Pattie Stewed Tomatoes Fruit Cocktail Peanuts Grape Drink _____ _____ _____ _____	1	B-1 LOCKER Seafood-Mushroom Soup Beef Steak Spinach Macaroni & Cheese Vanilla Pudding Chocolate Nut Cake Strawberry Drink _____ _____ _____ _____	2	L-3 LOCKER * Shrimp Cocktail Turkey & Gravy Cranberry Sauce Peas Choc. Covered Cookies(2) Grapefruit Drink _____ _____ _____ _____	3	B-1 LOCKER Romaine Soup Beef Slices/BBQ Sauce Potatoes Stewed Tomatoes Peach Ambrosia Cherry-Nut Cake Orange-Pineapple Drink _____ _____ _____ _____	4

* USE FOR DAY 10 MEAL C IF NEEDED

DATE 6/30/75

PAGE 1-31

DP MENU

CHECK ITEMS CONSUMED

TABLE 1-11 (CONTD)

Donald K. Slayton, DP - BLUE VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER,	7	A3 LOCKER	8
	Granola		Scrambled Eggs		Granola		Scrambled Eggs	
	Pears		Sausage Patties		Bacon Squares (4)		Beef Patties	
	Cheese Slice		Strawberries		Pineapple		Peaches	
	Orange Drink		Grapefruit Drink		Cocoa		Orange Drink	
	Tea w/Lemon & Sugar		Tea w/Lemon & Sugar		Tea w/Lemon & Sugar		Tea w/Lemon & Sugar	
	VITAMINS		VITAMINS		VITAMINS		VITAMINS	
B	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Turkey & Rice Soup		Potato Soup		Pea Soup		Macaroni & Cheese	
	Frankfurters		Salmon		Corned Beef		Meatballs w/Sauce	
	Catsup		Rye Bread		Cheese Spread		Rye Bread	
	Rye Bread		Beef Jerkey		Rye Bread		Almonds	
	Dried Apricots		Peach Ambrosia		Dried Apricots		Vanilla Pudding	
	Cocoa		Orange Drink		Brownies		Grapefruit Drink	
					Grape Drink			
C	A3 LOCKER	5	A3 LOCKER	6	A3 LOCKER	7	L3 LOCKER	8
	Pea Soup		Seafood-Mushroom Soup		Shrimp Cocktail		Romaine Soup	
	Tuna		Beef Steak		Turkey & Gravy		Beef Slices/BBQ Sauce	
	Potato Pattie		Spinach		Cranberry Sauce		Potatoes	
	Stewed Tomatoes		Macaroni & Cheese		Peas		Stewed Tomatoes	
	Fruit Cocktail		Vanilla Pudding		Choc. Covered Cookies(2)		Peach Ambrosia	
	Peanuts		Chocolate Nut Cake		Grapefruit Drink		Cherry-Nut Cake	
	Grape Drink		Strawberry Drink				Orange-Pineapple Drink	

CHECK ITEMS CONSUMED

TABLE 1-11 (CONTD)

Donald K. Slayton, DP - BLUE VELCRO

MEAL	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY	STOWAGE & MENU	DAY
A	L3 LOCKER Granola Pears Cheese Slice Orange Drink Tea w/Lemon & Sugar VITAMINS 	9	L3 LOCKER Scrambled Eggs Sausage Patties Strawberries Grapefruit Drink Tea w/Lemon & Sugar VITAMINS 	10	UVA BAY* Granola Bacon Squares (4) Pineapple Cocoa Tea w/Lemon & Sugar VITAMINS 	11		
B	L3 LOCKER Turkey & Rice Soup Frankfurters Catsup Rye Bread Dried Apricots Cocoa 	9	UVA BAY Potato Soup Salmon Rye Bread Beef Jerkey Peach Ambrosia Orange Drink 	10	L3 LOCKER* Snacks From Pantry 			
C	L3 LOCKER Pea Soup Tuna Potato Pattie Stewed Tomatoes Fruit Cocktail Peanuts Grape Drink 	9	L3 LOCKER* Shrimp Cocktail Turkey and Gravy Cranberry Sauce Peas Choc. Covered Cookies(2) 	10				

*Not normally planned

DP MEDICAL LOGGING GUIDELINES

1. PRD READINGS - Read PRDs daily for entire mission.
Record PRD's in Medical Log and report daily to STDN.

2. SLEEP

A. Record quantity and quality of sleep and report to STDN (for entire mission).

B. Log in DP Medical Log comments on sleep for entire mission.

a. Number of dreams recalled.

b. Times awakened.

c. Difficulty in going back to sleep.

3. MEDICATION

Log in DP Medical Log and report daily to STDN all medication used (including aspirin).

4. FLUID INTAKE

A. Measure quantity of all fluid intake after suit doffing (PET 03:50) except the water required to prepare food.

B. Log data in DP Medical Log and report daily to STDN.

5. FOOD

A. Log and report daily to STDN menu items not consumed (for entire mission).

B. Log in menu additional foods eaten from pantry (for entire mission).

6. FECES

Log crewman and GET on each fecal bag used in CM.

CREW STATUS REPORT PAD

DP PRD
DP SLEEP
DP MED
DP FLUID
DP FOOD

DP Medical Log

- From Menu (Table 1-11)

TABLE 1-12 DP MEDICAL LOG

DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**	DAYS	PRD	SLEEP* (COMMENTS)	MEDICATION (TYPE & QTY)	FLUIDS**
DAY 1 00:00					DAY 8 168:00				
-					-				
24:00					192:00				
DAY 2 24:00					DAY 9 192:00				
-					-				
44:45					91:42†				
DAY 3 44:45									
-									
67:00									
DAY 4 67:00									
-									
92:00									
DAY 5 92:00									
-									
117:30									
DAY 6 117:30									
-									
142:45									
DAY 7 142:45									
-									
168:00									

FOOD-SEE DP MENU

*REPORT QUANTITY AND QUALITY

**FLUID QUANTITY DETERMINED BY TBD

†PET

DATE 6/30/75

PAGE 1-35

DP MEDICAL LOG

THIS PAGE INTENTIONALLY BLANK

TABLE 1-13
PANTRY FOOD ITEMS
(LOCKER L-3)

<u>ITEM</u>	<u>QTY</u>	<u>ACCESSORY ITEMS</u>
Coffee (B)	10	Spoon Assemblies
Coffee w/Cream & Sugar	10	Can Opener
Tea w/Lemon & Sugar	10	Chewing Gum
Lemonade	5	Spice Kit (Salt & Pepper)
Strawberry Drink	10	Oral Hygiene Kit
Orange-Pineapple Drink	10	Germicidal Tablets
Cocoa	5	Food Trays
Orange Crystals	10	Vitamin Tablets
Corn Beef	2	
Beef Steak (I)	2	
Turkey (I)	2	
Cheese Slice	5	
Beef Jerky	5	
Tuna Salad Spread	1	
Catsup	3	
Mustard	3	
Jam, Peach	3	
Jam, Strawberry	3	
Dried Peaches	6	
Dried Apricots	6	
Graham Crackers (4)	4	
Pecan Cookies	6	
Shortbread Cookies	6	
Peanuts	3	
Pea Soup	1	
Turkey-Rice Soup	2	
Potato Soup	3	

THIS PAGE INTENTIONALLY BLANK

TABLE 6-1
ASTRONOMY EXPERIMENT PADS

6/18/75

6-1

EUV PAD - REV 72

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 120 14 16 (SS)
35:00				X-RAY CAL/BACKGROUND (CUE CARD) (THRU ATS)
41:00	248.40	250.10	000	
55:00				X-RAY, EUV - OPS
0:00	---	---	---	CONFIGURE DSE: HBR/RCD/FWD/CMD RESET
1:00	245.40			
3:00	242.40	---	---	
4:15	245.40			
6:30	248.40	---	---	
6:45				V21N46E (61102), V46E
7:45	287.80	187.50	---	
10:15				V21N46E (61101), V46E
11:25	290.80	---	---	
14:10	293.80	---	---	
14:25				V21N46E (61102), V46E
15:40	297.30	149.20	---	
17:02				V21N46E (61101), V46E
18:02	294.30	---	---	
20:32	291.30	---	---	
22:42	294.30	---	---	
25:12	297.30	---	---	
25:27				V21N46E (61102), V46E
26:27	294.20	092.70	050.00	
(CON'T)				

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
16	255			
		11:33		357A
			1:00	357A
		:15	1:45	357
		:15	1:00	357B
		:15	2:00	357
		:15		357A
			1:00	
		2:30		198A
			1:10	
		:15	2:30	198
		:15		198B
			1:15	
		1:22		356A
			1:00	
		:15	2:15	356
		:15	1:55	356B
		:15	2:15	356
		:15		356A
			1:00	
		2:32		340A

5/15/75

EUV PAD - REV 73

6-3

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 121 43 08 (SS)
45:00	192.20	112.20	000	
55:00				X-RAY, EUV - OPS
0:00	---	---	---	V21N46E (61101), V46E
1:00	189.20	---	---	
2:15	186.20	---	---	
3:30	171.40	075.20	---	
7:49	149.90	037.50	---	
12:26	146.90	---	---	
12:36				VERIFY DSE TAPE MOTION
15:11	143.90	---	---	
17:26	146.90	---	---	
20:11	149.90	---	---	
20:26				V21N46E (61102), V46E
21:26	160.20	320.00	---	
24:03				V21N46E (61101), V46E
25:03	163.20	---	---	
27:48	166.20	---	---	
30:03	163.20	---	---	
32:48	160.20	---	---	
34:03				CONFIGURE DSE: LBR/RCD /FWD/CMD RESET
				EUV, X-RAY - PWR DWN
				GO TO FP FOR NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		5:08		354A
19	279	---	1:00	354A
23	280	:15	1:00	354
26	280	:15	1:00	354B
27	301	3:19	1:00	351
23	310	3:37	1:00	362A
26	314	:15	2:30	362
		:15	2:00	362B
		:15	2:30	362
		:15		
			1:00	
		2:37		358A
			1:00	
		:15	2:30	358
		:15	2:00	358B
		:15	2:30	358
		:15	1:00	358A

DSE 21:27

THIS PAGE INTENTIONALLY BLANK

5/15/75

HeG SCAN PAD - REV 74/75

6-5

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (123:28:00 (SS+16))																																														
DET	DATA		DET	DATA																																										
40:00	V49 MNVR <table border="1"> <tr><td>+</td><td>2</td><td>2</td><td>5</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>1</td><td>8</td><td>1</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>5</td><td>6</td><td>0</td><td>0</td></tr> </table>		+	2	2	5	0	0	+	1	8	1	0	0	+	3	5	6	0	0	14:50	EUV, X-RAY - PWR DWN																								
+	2	2	5	0	0																																									
+	1	8	1	0	0																																									
+	3	5	6	0	0																																									
55:00	X-RAY, HeG, EUV - OPS		17:35	LOAD P20 OPT 2: 120° SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0																		
+	0	0	0	0	0																																									
+	0	0	0	0	0																																									
+	0	5	0	0	0																																									
+	0	0	0	5	0																																									
55:00	LOAD P20 OPT 2: 140° SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0	20:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>0</td><td>3</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>1</td><td>7</td><td>2</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>1</td><td>7</td><td>0</td><td>0</td></tr> </table>	+	0	3	4	0	0	+	1	7	2	0	0	+	3	1	7	0	0
+	0	0	0	0	0																																									
+	0	0	0	0	0																																									
+	0	5	0	0	0																																									
+	0	0	0	5	0																																									
+	0	3	4	0	0																																									
+	1	7	2	0	0																																									
+	3	1	7	0	0																																									
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>0</td><td>4</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>1</td><td>7</td><td>2</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>1</td><td>7</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E <table border="1"><tr><td>6</td><td>1</td><td>1</td><td>0</td><td>2</td></tr></table>		+	0	4	4	0	0	+	1	7	2	0	0	+	3	1	7	0	0	6	1	1	0	2	24:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																			
+	0	4	4	0	0																																									
+	1	7	2	0	0																																									
+	3	1	7	0	0																																									
6	1	1	0	2																																										
06:10	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		_: _																																											
_: _			29:20	LOAD P20 OPT 2: 100° SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0																		
+	0	0	0	0	0																																									
+	0	0	0	0	0																																									
+	0	5	0	0	0																																									
+	0	0	0	5	0																																									
07:45	LOAD P20 OPT 2: 100° SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>-</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	-	0	5	0	0	0	+	0	0	0	5	0	37:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>0</td><td>7</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>1</td><td>7</td><td>7</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>3</td><td>7</td><td>0</td><td>0</td></tr> </table>	+	0	7	4	0	0	+	1	7	7	0	0	+	3	3	7	0	0
+	0	0	0	0	0																																									
+	0	0	0	0	0																																									
-	0	5	0	0	0																																									
+	0	0	0	5	0																																									
+	0	7	4	0	0																																									
+	1	7	7	0	0																																									
+	3	3	7	0	0																																									
10:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>3</td><td>1</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>1</td><td>7</td><td>7</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>3</td><td>7</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E <table border="1"><tr><td>6</td><td>1</td><td>1</td><td>0</td><td>1</td></tr></table>		+	3	1	4	0	0	+	1	7	7	0	0	+	3	3	7	0	0	6	1	1	0	1	42:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																			
+	3	1	4	0	0																																									
+	1	7	7	0	0																																									
+	3	3	7	0	0																																									
6	1	1	0	1																																										
14:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		_: _	CONTINUE WITH PAD ON NEXT PAGE																																										

DET	DATA	DET	DATA
50:32	LOAD P20 OPT 2: 120° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0	15:40	LOAD P20 OPT 2: 120° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 5 0
52:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 5 9 0 0 + 1 7 2 0 0 + 3 1 7 0 0	18:54	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) V48E, V21N46E 6 1 1 0 1
57:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	22:54	P00 DSE (STOP/REWIND/CMD RESET)
—:—		23:04	EUV, HeG, X-RAY - PWR DWN ACQ ATS: MAN, WIDE P -25, Y 177 S-BD ANT IND >1/3 SCALE HGA: REACQ, NARROW UPTLM - RELAY
		GO TO FP FOR NEXT MNVR	
02:41	LOAD P20 OPT 2: 100° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0		
08:54	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 3 4 4 0 0 + 1 7 7 0 0 + 3 3 7 0 0 V48E, V21N46E 6 1 1 0 2		
13:24	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		
15:22	X-RAY - EUV - OPS		

DSE 32:40

5/15/75

6-7

X-RAY PAD - REV 76

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 126 09 42 (SS)
55:00	211	118	000	VERIFY ATTITUDE X-RAY, EUV - OPS (VERIFY)
0:00	---	---	---	V21N46E (61102), V46E
2:00	203	156	---	
5:17	206	137	---	
10:56	350	124	---	
15:46				V21N46E (61101), V46E
17:46	345	121	---	
23:18	348	100	---	
27:27	356	106	---	
30:19	357	103	---	
31:00				VERIFY DSE TAPE MOTION
32:35	355	100	---	
34:54	355	097	---	
35:09				V21N46E (61102), V46E
37:09	020	---	---	CONFIGURE DSE: STOP/CMD RESET
				EUV, X-RAY - PWR DWN
				GO TO HeG PAD -
				REV 76/77 FOR
				NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
				301
-2	202		2:00	301
-26	188	1:17	2:00	304
-10	194	:39	5:00	302
-27	168	4:50		256
			2:00	
-23	173	:32	5:00	257
-44	177	2:09	2:00	259
-37	172	:52	2:00	260
-40	173	:16	2:00	263
		:19	2:00	261
		:15		262
			2:00	
		:50		

DSE 6:09

THIS PAGE INTENTIONALLY BLANK

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (127:00:32 (SS-38))																																																	
DET	DATA			DET	DATA																																												
50:00	V49 MNVR <table><tr><td>+</td><td>1</td><td>2</td><td>1</td><td>0</td><td>0</td></tr><tr><td>+</td><td>2</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>4</td><td>2</td><td>0</td><td>0</td></tr></table>			+	1	2	1	0	0	+	2	9	0	0	0	+	3	4	2	0	0	_: _																											
+	1	2	1	0	0																																												
+	2	9	0	0	0																																												
+	3	4	2	0	0																																												
55:00	HeG - OPS			14:35	LOAD P20 OPT 2: 40° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	9	0	0	0	-	0	3	7	7	5	+	0	5	0	0	0	+	0	0	0	5	0																		
+	0	9	0	0	0																																												
-	0	3	7	7	5																																												
+	0	5	0	0	0																																												
+	0	0	0	5	0																																												
57:00	LOAD P20 OPT 2: 80° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	9	0	0	0	-	0	3	7	7	5	+	0	5	0	0	0	+	0	0	0	5	0	19:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>1</td><td>6</td><td>8</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>4</td><td>8</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>4</td><td>8</td><td>0</td><td>0</td></tr></table>			+	1	6	8	0	0	+	0	4	8	0	0	+	3	4	8	0	0
+	0	9	0	0	0																																												
-	0	3	7	7	5																																												
+	0	5	0	0	0																																												
+	0	0	0	5	0																																												
+	1	6	8	0	0																																												
+	0	4	8	0	0																																												
+	3	4	8	0	0																																												
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>1</td><td>4</td><td>2</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>2</td><td>7</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>1</td><td>2</td><td>0</td><td>0</td></tr></table>			+	1	4	2	0	0	+	1	2	7	0	0	+	0	1	2	0	0	24:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
+	1	4	2	0	0																																												
+	1	2	7	0	0																																												
+	0	1	2	0	0																																												
04:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)			_: _																																													
_: _				25:58	LOAD P20 OPT 2: 80° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>-</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	9	0	0	0	-	0	3	7	7	5	-	0	5	0	0	0	+	0	0	0	5	0																		
+	0	9	0	0	0																																												
-	0	3	7	7	5																																												
-	0	5	0	0	0																																												
+	0	0	0	5	0																																												
05:57	LOAD P20 OPT 2: 60° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>-</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	9	0	0	0	-	0	3	7	7	5	-	0	5	0	0	0	+	0	0	0	5	0	29:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>1</td><td>4</td><td>1</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>3</td><td>2</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>1</td><td>2</td><td>0</td><td>0</td></tr></table>			+	1	4	1	0	0	+	1	3	2	0	0	+	0	1	2	0	0
+	0	9	0	0	0																																												
-	0	3	7	7	5																																												
-	0	5	0	0	0																																												
+	0	0	0	5	0																																												
+	1	4	1	0	0																																												
+	1	3	2	0	0																																												
+	0	1	2	0	0																																												
09:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>1</td><td>4</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>2</td><td>1</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>4</td><td>3</td><td>0</td><td>0</td></tr></table>			+	1	4	0	0	0	+	2	1	0	0	0	+	3	4	3	0	0	33:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
+	1	4	0	0	0																																												
+	2	1	0	0	0																																												
+	3	4	3	0	0																																												
13:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)			_: _	CONTINUE WITH PAD ON NEXT PAGE																																												

DET	DATA	DET	DATA
35:00	LOAD P20 OPT 2: 60° SCAN N78 (R1 & R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 + 0 5 0 0 0 + 0 0 0 5 0	54:57	LOAD P20 OPT 2: 80° SCAN N78 (R1 & R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 + 0 5 0 0 0 + 0 0 0 5 0
39:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 5 8 0 0 + 3 2 3 0 0 + 0 0 5 0 0	59:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 3 2 0 0 + 2 4 2 0 0 + 3 5 5 0 0 V48E, V21N46E 6 1 1 0 1
44:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	03:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
44:20	X-RAY, EUV - OPS	—:—	
45:31	LOAD P20 OPT 2: 40° SCAN N73 (R1 & R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 - 0 5 0 0 0 + 0 0 0 5 0	06:59	LOAD P20 OPT 2: 60° SCAN N78 (R1 & R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 - 0 5 0 0 0 + 0 0 0 5 0
49:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 6 9 0 0 + 0 5 6 0 0 + 3 5 2 0 0	09:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 5 8 0 0 + 3 2 9 0 0 + 0 0 7 0 0
53:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	13:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
—:—		13:50	EUV, X-RAY - PWR DWN CONTINUE WITH PAD ON NEXT PAGE

5/15/75

HeG SCAN PAD - REV 76/77 (CONT'D)

6-11

DET	DATA																								
<u>16:40</u>	LOAD P20 OPT 2: 40° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>	+	0	9	0	0	0	-	0	3	7	7	5	+	0	5	0	0	0	+	0	0	0	5	0
+	0	9	0	0	0																				
-	0	3	7	7	5																				
+	0	5	0	0	0																				
+	0	0	0	5	0																				
<u>19:00</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>0</td><td>4</td><td>5</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>8</td><td>1</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>5</td><td>6</td><td>0</td><td>0</td></tr></table>	+	0	4	5	0	0	+	1	8	1	0	0	+	3	5	6	0	0						
+	0	4	5	0	0																				
+	1	8	1	0	0																				
+	3	5	6	0	0																				
<u>23:30</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																								
<u>: :</u>																									
<u>31:11</u>	LOAD P20 OPT 2: 140° SCAN N78 (R1 & R2) N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																				
+	0	0	0	0	0																				
+	0	5	0	0	0																				
+	0	0	0	5	0																				
<u>38:30</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) V48E, V21N46E <table><tr><td>6</td><td>1</td><td>1</td><td>0</td><td>2</td></tr></table>	6	1	1	0	2																			
6	1	1	0	2																					
<u>44:40</u>	P00 DSE (STOP/REWIND/CMD RESET)																								
<u>44:50</u>	HeG - PWR DWN GO TO X-RAY PAD - REV 78 FOR NEXT MNVR																								

DSE 6:09 + 44:50 = 50:49

6-12

X-RAY PAD - REV 78

6/18/75

DET	V49 MNVR TO			DATA
	R	P	Y	
				: : COUNTING UP TO 129 07 24 (SS)
45:00	110	129	000	
50:00				ACQ ATS
59:30				X-RAY - OPS
0:00	---	---	---	V21N46E (61101) V46E
2:00	104	115	---	
5:15	099	112	---	
7:45	094	114	---	
8:10				V21N46E (61102), V46E
10:10	067	321	---	
16:20	080	332	---	
16:55				V21N46E (61101), V46E
17:55	078	328	---	
20:20	084	319	---	
22:15	077	318	---	
24:55	079	313	---	
26:25	089	308	---	
28:25	076	308	---	
31:15	076	304	---	
33:05	075	275	---	
36:30				X-RAY - OFF GO TO FP FOR NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		4:10		249
-30	199			
-30	199		2:00	249
-25	187	1:15	2:00	252
-25	186	:30	2:00	253
-25	190	:25		251
			2:00	
-38	23	5:10	1:00	921
-36	41	:35		222
			1:00	
-35	33	:25	2:00	221
-31	26	:55	1:00	220
-33	20	:40	2:00	218
-32	15	:30	1:00	217
-29	15	1:00	1:00	215
-31	7	1:50	1:00	216
-30	2	:50	1:00	214
-23	334	2:25	1:00	211

5/15/75

X-RAY SCAN PAD - REV 79

6-13

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (130:36:14 (SS))																									
DET	DATA																								
46:00	V49 MNVR <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>2</td><td>3</td><td>8</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>4</td><td>3</td><td>0</td><td>0</td></tr> </table>	+	0	5	0	0	0	+	2	3	8	0	0	+	3	4	3	0	0						
+	0	5	0	0	0																				
+	2	3	8	0	0																				
+	3	4	3	0	0																				
54:00 55:00	DSE (STOP/CMD RESET)(VERIFY) X-RAY, EUV - OPS																								
55:00	LOAD P20 OPT 2: 191 SCAN N78(R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																				
+	0	0	0	0	0																				
+	0	5	0	0	0																				
+	0	0	0	5	0																				
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>2</td><td>1</td><td>9</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>2</td><td>5</td><td>2</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>4</td><td>8</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E 6 1 1 0 1	+	2	1	9	0	0	+	2	5	2	0	0	+	3	4	8	0	0						
+	2	1	9	0	0																				
+	2	5	2	0	0																				
+	3	4	8	0	0																				
06:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																								
—:—																									
07:58	LOAD P20 OPT 2: 192 SCAN N78(R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																				
+	0	0	0	0	0																				
+	0	5	0	0	0																				
+	0	0	0	5	0																				
09:50	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>6</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>2</td><td>3</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>2</td><td>3</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E 6 1 1 0 2	+	0	0	6	0	0	+	0	2	3	0	0	+	0	2	3	0	0						
+	0	0	6	0	0																				
+	0	2	3	0	0																				
+	0	2	3	0	0																				
16:50	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																								

DSE 15 + 19:10 = 34:10

EUV PAD - REV 80

[illegible][illegible]
$$\text{DSE } 34:10 + 14 = 48:10$$

6/18/75

6-15

EUV PAD - REV 88

DET	V49 MNVR TO			DATA
	R	P	Y	
				: : COUNTING UP TO
SET DET				145 24 39 (SS)
37:00				X-RAY CAL/BACKGROUND (CUE CARD)(THRU MAD)
44:00	125.90	118.80	000	
58:00				X-RAY, EUV - OPS
0:00	---	---	---	CONFIGURE DSE: HBR/RCD/FWD/CMD RESET
1:15	128.90	---	---	
4:30	131.90	---	---	
6:00	145.50	97.40	---	
9:07	148.50	---	---	
10:52	151.50	---	---	
11:07				V21N46E (61102), V46E
12:07	098.60	359.90	---	
15:43				V21N46E (61101), V46E
16:43	095.60	---	---	
19:28	092.60	---	---	
21:43	095.60	---	---	
24:28	098.60	---	---	
24:43				V21N46E (61102), V46E
25:43	350.10	070.2	310.00	DSE: STOP/CMD RESET X-RAY - PWR DWN
30:49				V21N46E (61101), V46E
33:00				DSE: FWD/CMD RESET
34:30	---	---	---	
35:30	356.10	---	---	
37:00	002.10	---	---	
(CONT'D)				

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		13:36		348A
			1:15	348A
		:15	3:00	348
		:15	1:15	348B
		2:07	1:00	368A
		:15	1:30	368
		:15		368B
			1:00	
		3:36		364A
			1:00	
		:15	2:30	364
		:15	2:00	364B
		:15	2:30	364
		:15		364A
			1:00	
		5:06		343A
			3:41	
			1:00	
		:30	1:00	343
		:30	1:00	343B

5/15/75

6-17

EUV PAD - REV 89

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 146 53 29 (SS)
55:00	178.10	037.60	000	VERIFY ATTITUDE
				X-RAY, EUV - OPS
0:00	---	---	---	
1:00	181.10	---	---	
3:45	184.10	---	---	
6:00	181.10	---	---	
8:45	178.10	---	---	
10:00	172.10	030.60	---	
11:50	169.10	---	---	
14:05	166.10	---	---	
15:20	169.10	---	---	
17:35	172.10	---	---	
18:50	174.30	025.50	---	
20:20	171.30	---	---	
21:12				VERIFY DSE TAPE MOTION
22:35	168.30	---	---	
22:50				V21N46E (61102), V46E
23:50	167.40	278.40	---	
27:25				V21N46E (61101), V46E
28:25	170.40	---	---	
29:40	173.40	---	---	
29:55				V21N46E (61102), V46E
31:15	178.20	250.00	---	
(CONT'D)				

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
				365A
21	303		1:00	
18	303	:15	2:30	365
15	304	:15	2:00	365B
17	305	:15	2:30	365
20	308	:15	1:00	365A
20	311	:50	1:00	352A
23	313	:15	2:00	352
25	315	:15	1:00	352B
23	315	:15	2:00	352
22	315	:15	1:00	352A
17	316	:30	1:00	353A
20	318	:15	2:00	353
		:15		353B
			1:00	
		3:35		338A
			1:00	
		:15	1:00	338
		:15		338B
			1:20	
		1:00		902

[illegible]

DSE 16:00

6/18/75

6-19

EUV PAD - REV 90

DET	V49 MNVR TO			DATA
	R	P	Y	
				: : COUNTING UP TO 148 22 19 (SS)
SET DET				
55:00	210.90	060.50	000	VERIFY ATTITUDE
				X-RAY, EUV - OPS
0:00	---	---	---	
1:00	207.90	---	---	
3:15	204.90	---	---	
4:30	203.70	051.60	---	
6:15	200.70	---	---	
9:00	197.70	---	---	
11:15	200.70	---	---	
14:00	203.70	---	---	
15:15	209.00	025.70	---	
18:45	206.00	---	---	
21:30	203.00	---	---	
21:45				V21N46E (61102), V46E
23:20	191.30	264.20	---	
27:06				VERIFY DSE TAPE MOTION
27:30				V21N46E (61101), V46E
29:00	194.30	---	---	
31:45	197.30	---	---	
33:00	194.30	---	---	
35:45	191.30	---	---	
37:00				CONFIGURE DSE: LBR/RCD/FWD/CMD RESET
				EUV, X-RAY - PWR DWN
				GO TO FP FOR NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
				355A
21	274		1:00	
24	275	:15	2:00	355
27	276	:15	1:00	355B
27	285	:45	1:00	361A
30	287	:15	2:30	361
33	289	:15	2:00	361B
31	290	:15	2:30	361
29	290	:15	1:00	361A
13	310	2:15	1:15	901A
16	312	:15	2:30	901
20	313	:15		901B
			1:35	
		4:10		JUP-A
		:15	2:30	JUP
		:15	1:00	JUP-B
		:15	2:30	JUP
		:15	1:00	JUP-A

DSE 10:00

THIS PAGE INTENTIONALLY BLANK

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (151:35:59 (SS + 16))																																															
DET	DATA		DET	DATA																																											
50:00	V49 MNVR <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>4</td><td>4</td><td>0</td><td>0</td></tr> </table>		+	0	5	4	0	0	+	0	0	4	0	0	+	3	4	4	0	0	—:—																										
+	0	5	4	0	0																																										
+	0	0	4	0	0																																										
+	3	4	4	0	0																																										
55:00	X-RAY, HeG, EUV - OPS		26:39	LOAD P20 OPT 2: 20°SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0																		
+	0	0	0	0	0																																										
+	0	0	0	0	0																																										
+	0	5	0	0	0																																										
+	0	0	0	5	0																																										
56:00	LOAD P20 OPT 2: 340°SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0	30:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>2</td><td>6</td><td>4</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>9</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>2</td><td>4</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E 61101		+	2	6	4	0	0	+	0	0	9	0	0	+	3	2	4	0	0
+	0	0	0	0	0																																										
+	0	0	0	0	0																																										
+	0	5	0	0	0																																										
+	0	0	0	5	0																																										
+	2	6	4	0	0																																										
+	0	0	9	0	0																																										
+	3	2	4	0	0																																										
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>1</td><td>4</td><td>8</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>9</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>2</td><td>4</td><td>0</td><td>0</td></tr> </table>		+	1	4	8	0	0	+	0	0	9	0	0	+	3	2	4	0	0	34:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																									
+	1	4	8	0	0																																										
+	0	0	9	0	0																																										
+	3	2	4	0	0																																										
06:10	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		—:—																																												
06:30	EUV, X-RAY - PWR DWN		41:40	LOAD P20 OPT 2: 0°SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0																		
+	0	0	0	0	0																																										
+	0	0	0	0	0																																										
+	0	5	0	0	0																																										
+	0	0	0	5	0																																										
14:35	LOAD P20 OPT 2: 0°SCAN N78 (R1 & R2) N79 <table border="1"> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1"> <tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr> </table>		+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0	46:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>3</td><td>3</td><td>2</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>1</td><td>6</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>0</td><td>5</td><td>0</td><td>0</td></tr> </table>		+	3	3	2	0	0	+	0	1	6	0	0	+	3	0	5	0	0
+	0	0	0	0	0																																										
+	0	0	0	0	0																																										
+	0	5	0	0	0																																										
+	0	0	0	5	0																																										
+	3	3	2	0	0																																										
+	0	1	6	0	0																																										
+	3	0	5	0	0																																										
19:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table border="1"> <tr><td>+</td><td>2</td><td>1</td><td>2</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>0</td><td>1</td><td>6</td><td>0</td><td>0</td></tr> <tr><td>+</td><td>3</td><td>0</td><td>5</td><td>0</td><td>0</td></tr> </table> V48E, V21N46E 61102		+	2	1	2	0	0	+	0	1	6	0	0	+	3	0	5	0	0	50:55	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																									
+	2	1	2	0	0																																										
+	0	1	6	0	0																																										
+	3	0	5	0	0																																										
23:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		—:—	CONTINUE WITH PAD ON NEXT PAGE																																											

DET	DATA	DET	DATA
58:25	LOAD P20 OPT 2: 20° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0	23:15	LOAD P20 OPT 2: 20° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 3 2 0 0 + 0 0 9 0 0 + 3 2 4 0 0 V48E, V21N46E 6 1 1 0 2	28:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 2 3 4 0 0 + 0 0 4 0 0 + 3 4 4 0 0
04:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	32:30	P00 V49E, PRO, PRO DSE (LBR/CMD RESET)
—:—		32:50	EUV, X-RAY - PWR DWN
07:25	LOAD P20 OPT 2: 0° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0	36:35	LOAD P20 OPT 2: 340° SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0
11:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 9 2 0 0 + 0 1 6 0 0 + 3 0 5 0 0 V48E, V21N46E 6 1 1 0 1	13:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET)
16:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	19:10	P00 DSE (STOP/CMD RESET) UPTLM - RELAY
17:00	X-RAY, EUV - OPS	19:20	HeG - PWR DWN GO TO X-RAY PAD - REV 94 FOR NEXT MNVR

DSE 39:40 (HBR) + 40:30 (LBR)



6-23

X-RAY PAD - REV 94



NOTE 1: P20 OPT 2
V24N78 (+09000)(-03775)
V24N79 (+01000)(+00050)

NOTE 2: P20 OPT 2
V24N78 (-02954)(-03250)
V21N79 (-01000)

THIS PAGE INTENTIONALLY BLANK

6/18/75

PCN-4 7/10/75

X-RAY PAD - REV 104

6-25

[illegible][illegible]

DSE 26:08

X-RAY PAD - REV 105

DET	V49 MNVR TO			DATA
	R	P	Y	
				____:____:____
SET DET				COUNTING UP TO 172 03 24
53:00	291	260	000	
56:00				X-RAY, HeG, EUV - OPS
0:00	---	---	---	CONFIGURE DSE: HBR/RCD/FWD/CMD RESET
2:00	310	250	---	
2:20				DSE: STOP/CMD RESET
3:48				DSE: FWD/CMD RESET
5:48	321	244	---	
6:51				V21N46E (61102), V46E
8:51	349	219	---	DSE: STOP/CMD RESET
10:06				DSE: FWD/CMD RESET
15:06	336	207	---	
15:42				V21N46E (61101), V46E
16:42	326	203	---	
19:36	328	201	---	
20:51	328	193	---	
22:31	332	200	---	
24:12	339	204	---	
26:53	344	204	---	
28:18	341	200	---	
29:43	340	195	---	
32:09	346	193	---	
33:41	341	189	---	
35:14				DSE: STOP/CMD RESET
				EUV, HeG, X-RAY-PWR DWN GO TO FP

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		2:30		232
			2:00	232
		1:48		230
			2:00	
		1:03		228
			2:00	
		1:15		233
			5:00	
		:36		237
			1:00	
		:54	2:00	246
		:15	1:00	245
		:40	1:00	322
		:41	1:00	243
		:41	2:00	236
		:25	1:00	234
		:25	1:00	238
		:26	2:00	240
		:32	1:00	235
		:33	1:00	242

DSE 32:31

5/15/75

X-RAY SCAN PAD - REV 106

6-27

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (173:32:12 (SS))			
DET	DATA		DET DATA
40:00	V49 MNVR + 2 6 4 0 0 + 1 0 4 0 0 + 3 1 6 0 0		___:___
55:00	X-RAY, HeG, EUV - OPS		25:44 LOAD P20 OPT 2: 203 SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 5 0
55:00	LOAD P20 OPT 2: 201SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 5 0		30:20 N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET)
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 1 5 0 0 + 0 9 7 0 0 + 3 2 2 0 0		36:30 P00 DSE (STOP/REWIND/CMD RESET)
06:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		36:40 EUV, HeG, X-RAY - PWR DWN GO TO FP FOR NEXT MNVR
09:18	LOAD P20 OPT 2: 202SCAN N78 (R1 & R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0		
14:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 3 9 0 0 + 0 9 3 0 0 + 3 2 9 0 0		
22:20	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		

DSE 32:31 +20:30 = 53:01

DET	V49 MNVR TO			DATA
	R	P	Y	
				: : :
SET DET				COUNTING UP TO 176 29 48 (SS)
45:00	103.70	113.40	000	V21N46E (61102), V46E (MNVR AFTER EARTH OBS)
48:00				ACO ATS
57:00				V21N46E (61101), V46E X-RAY, HeG, EUV - OPS
0:00	---	---	---	
1:15	100.70	---	---	
4:30	097.70	---	---	
4:45				V21N46E (61102), V46E
6:00	020.60	163.40	---	
9:10				V21N46E (61101), V46E
10:40	017.60	---	---	
13:55	014.60	---	---	
16:10	017.60	---	---	
19:25	020.60	---	---	
21:10	007.20	112.20	---	
26:35	351.00	108.60	---	
28:58	297.10	098.40	---	
34:32	294.10	---	---	
35:47	291.10	---	---	
37:02				EUV, HeG, X-RAY - PWR DWN
				GO TO FP FOR NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		5:56		347A
-30	290			
			1:15	347A
-19	182	:15	3:00	347
		:15		347B
			1:15	
		3:10		350A
			1:30	
25	224	:15	3:00	350
		:15	2:00	350B
25	223	:15	3:00	350
		:15	1:30	350A
-9	202	4:25	1:00	344
-6	204	1:23	1:00	341
		4:34	1:00	338A
5	207	:15	1:00	338
		:15	1:00	338B

5/15/75

6-29

EUV PAD - REV 109

DET	V49 MNVR TO			DATA
	R	P	Y	
SET DET				COUNTING UP TO 177 58 36 (SS)
45:00				V21N46E (61102), V46E
46:00	074.00	073.00	310.00	MANUALLY ROLL TO 160° BEFORE INITIATING MNVR
52:00				ACQ ATS HGA
55:00				V21N46E (61101), V46E
57:00				HeG, EUV - OPS
0:00	---	---	---	X-RAY - OPS
1:00	077.00	---	---	
2:15	080.00	---	---	
2:30				V21N46E (61102), V46E
3:30	132.90	079.60	000	
5:50				V21N46E (61101), V46E
6:50	135.90	---	---	
9:05	138.90	---	---	
10:20	135.90	---	---	
12:35	132.90	---	---	
12:50				V21N46E (61102), V46E
13:50	086.50	339.60	---	
17:26				V21N46E (61101), V46E
18:26	094.60	332.50	---	
20:20	091.60	---	---	
23:05	088.60	---	---	
25:20	091.60	---	---	
28:05	094.60	---	---	
(CON'T)				

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		5:54		367A
-81	190			
-84	213		1:00	367A
-85	188	:15	1:00	367
		:15		367B
-85	151		1:00	
		2:20		383A
-32	148		1:00	
-32	146	:15	2:00	383
-32	144	:15	1:00	383B
-32	144	:15	2:00	383
		:15		383A
-32	144		1:00	
		3:36		195
-44	63		1:00	
-37	59	:54	1:00	382A
-40	57	:15	2:30	382
-42	54	:15	2:00	382B
-40	54	:15	2:30	382
		:15		382A

[illegible]

DSE 40:00 (LBR) + 12:40 (HBR)

9A PADS

EUV PAD - REV 121 (DAY 9A)

DET	V49 MNVR TO			DATA
	R	P	Y	
				____:____:____
SET DET				COUNTING UP TO 197:12:52 (SS)
40:00	008.80	293.40	000	
55:00				X-RAY, HeG, EUV - OPS
00:00	003.80	---	---	CONFIGURE DSE: HBR/RCD/FWD/CMD RESET
00:25				V21N46E (61102), V46E
01:25	326.00	190.20	---	
06:01	285.80	187.50	---	
07:22				V21N46E (61101), V46E
08:22	290.80	---	---	
11:17	295.80	---	---	
11:32				V21N46E (61102), V46E
12:42	299.30	149.20	---	
13:59				V21N46E (61101), V46E
14:59	294.30	---	---	
17:44	289.30	---	---	
19:59	294.30	---	---	
22:44	299.30			
23:09				V21N46E (61102), V46E
24:09	296.20	092.70	050.00	
26:41				V21N46E (61101), V46E
29:03				
30:03	291.20	---	---	
32:18	286.20	---	---	
33:43	291.20	---	---	
(CONT'D)				

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		9:36		347A
		:25		347
			1:00	
		3:36	1:00	196
		1:21		198A
			1:00	
		:25	2:30	198
		:25		198B
			1:10	
		1:17		356A
			1:00	
		:25	2:20	356
		:25	1:50	356B
		:25	2:20	356
		:25		356A
			1:00	
		2:32		340A
			1:00	
		:25	1:50	340
		:25	1:00	340B
		:25	1:50	340

EUV PAD - REV 121 (CONT'D) (DAY 9A)

[illegible]

DSE 18:30 + 37:20 = 55:50

[illegible][illegible]

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (200:10:25(SS))			
DET	DATA		DET DATA
42:00	V49 MNVR + 0 5 8 0 0 + 0 2 9 0 0 + 0 2 0 0 0		—:—
55:00	X-RAY, HeG, EUV - OPS		23:19 LOAD P20 OPT 2: 205° SCAN N78 N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 5 0
55:00	LOAD P20 OPT 2: 208° SCAN N78 N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 5 0		27:20 N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET)
00:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 3 1 8 0 0 + 1 0 0 0 0 + 3 3 2 0 0 V48E, V21N46E 61102		33:30 P00 DSE (STOP/CMD RESET) EUV, HeG, X-RAY-PWR DWN GO TO FP FOR NEXT MNVR
06:10	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		
—:—			
09:40	LOAD P20 OPT 2: 204° SCAN N78 N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 5 0		
14:10	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 4 2 0 0 + 0 9 5 0 0 + 3 3 9 0 0		
19:20	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		

NOTE: 17:30 ON FRONT OF TAPE
19:00 ON END OF TAPE

EUV PAD - REV 124 (DAY 9A)

DET	V49 MNVR TO			DATA
	R	P	Y	
				____:____:____
SET DET				COUNTING UP TO 201:39:11 (SS)
40:00	105.70	113.40	000.00	
51:00				ACQ ATS: MAN, WIDE HGA: REACO, NARROW
55:00				X-RAY, HeG, EUV-OPS
00:00	100.70	---	---	
00:25				V21N46E (61102), V46E
01:15	091.90	343.40	---	
05:36				V21N46E (61101), V46E
06:36	086.90	---	---	
09:21	081.90	---	---	
11:36	086.90	---	---	
14:21	091.90	---	---	
14:46				V21N46E (61102), V46E
15:46	092.30	292.20	---	
17:29				V21N46E (61101), V46E
19:19	097.30	---	---	
19:44	102.30	---	---	
20:09				V21N46E (61102), V46E
21:09	108.50	288.60	---	
21:24				V21N46E (61101), V46E
22:24	113.50	---	---	
23:49	118.50	---	---	
25:14	160.00	---	---	EUV, HeG, X-RAY-PWR DWN
				GO TO HeG-REV 124

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
		7:34		347A
-29	191			
-35	195	:25	1:00	347
-35	72	4:21		350A
			1:00	
-38	69	:25	2:20	350
-42	67	:25	1:50	350B
-40	67	:25	2:20	350
		:25		
			1:00	350A
-37	17	1:43		344A
			1:00	
-37	18	:25	1:00	344
-36	19	:25		344B
			1:00	
-33	22	:15		341A
			1:00	
-32	23	:25	1:00	341
-31	24	:25	1:00	341B
		3:28		

HeG PAD - REV 124 (DAY 9A)

[illegible]

DSE 9:30 + 20:00 = 29:30

DATE 5/26/75

[illegible][illegible]

5-11

DATE 5/26/75

EUV PAD - REV 126 (DAY 9A)

[illegible][illegible]

DSE 33:40

THIS PAGE INTENTIONALLY BLANK

98 PADS

EUV PAD - REV 134 (DAY 9B)

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 217:54:21 (SS)
45:00	194.20	112.00	000	VERIFY ATTITUDE
55:00				X-RAY, EUV - OPS
0:00	---	---	---	
01:00	189.20	---	---	
02:25	184.20	---	---	
03:50	171.40	075.20	---	
08:10	151.90	037.50	---	
12:45	146.90	---	---	
15:40	141.90	---	---	
18:05	146.90	---	---	
18:45				VERIFY DSE TAPE MOTION
21:00	151.90	---	---	
21:25				V21N46E (61102), V46E
22:40	158.20	320.00	---	
25:20				V21N46E (61101), V46E
26:35	163.20	---	---	
29:30	168.20	---	---	
31:55	163.20	---	---	
34:50	158.20	---	---	
36:15				CONFIGURE DSE: LBR/RCD/FWD/CMD RESET
				EUV, X-RAY - PWR DWN
				GO TO FP FOR NEXT MNVR

HGA		FP INFO		
P	Y	MNVR	DATA	TGT
				354A
22	272		1:00	
26	273	:25	1:00	354
29	273	:25	1:00	354B
34	298	3:20	1:00	351
23	315	3:35	1:00	362A
20	319	:25	2:30	362
15	322	:25	2:00	362B
15	322	:25	2:30	362
		:25		362A
			1:15	
		2:40		358A
			1:15	
		:25	2:30	358
		:25	2:00	358B
		:25	2:30	358
		:25	1:00	358A

X-RAY SCAN PAD - REV 135 (DAY 9B)

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (219:23:05 (SS))			
DET	DATA	DET	DATA
<u>47:00</u>	V49 MNVR + 2 2 2 0 0 + 2 3 8 0 0 + 3 4 3 0 0	—:—	
<u>55:00</u>	X-RAY, EUV-OPS	<u>24:40</u>	LOAD P20 OPT 2: 207 SCAN N78 (R1+R2) N79 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 0 0 + 0 0 0 5 0
<u>55:00</u>	LOAD P20 OPT 2: 191 SCAN N78 (R1+R2) N79 + 0 0 0 0 0 + 0 5 0 0 0 + 0 0 0 0 0 + 0 0 0 5 0	<u>27:00</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) V48E, V21N46E 6 1 1 0 1
<u>00:00</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 8 4 0 0 + 2 5 2 0 0 + 3 4 8 0 0 V48E, V21N46E 6 1 1 0 1	<u>32:50</u>	P00 DSE (LBR/RCD/FWD/CMD RESET) EUV, X-RAY - PWR DWN GO TO FP FOR NEXT MNVR
<u>7:00</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		
—:—			
<u>8:40</u>	LOAD P20 OPT 2: 192 SCAN N78 (R1+R2) N79 + 0 0 0 0 0 - 0 5 0 0 0 + 0 0 0 0 0 + 0 0 0 5 0		
<u>13:00</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 0 0 9 0 0 + 0 2 3 0 0 + 0 2 3 0 0 V48E, V21N46E 6 1 1 0 2		
<u>19:00</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		

HeG SCAN PAD - REV 136/137 (DAY 9B)

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (221:04:50 (SS+13))																											
DET	DATA																										
42:00	V49 MHVR <table><tr><td>+</td><td>2</td><td>3</td><td>4</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>8</td><td>1</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>5</td><td>6</td><td>0</td><td>0</td></tr></table>			+	2	3	4	0	0	+	1	8	1	0	0	+	3	5	6	0	0						
+	2	3	4	0	0																						
+	1	8	1	0	0																						
+	3	5	6	0	0																						
55:00	X-RAY, HeG, EUV - OPS																										
55:00	LOAD P20 OPT 2: 140° SCAN N78 (R1+R2) N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																						
+	0	0	0	0	0																						
+	0	5	0	0	0																						
+	0	0	0	5	0																						
0:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>0</td><td>4</td><td>9</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>7</td><td>2</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>1</td><td>7</td><td>0</td><td>0</td></tr></table> V48E, V21N46E <table><tr><td>6</td><td>1</td><td>1</td><td>0</td><td>2</td></tr></table>			+	0	4	9	0	0	+	1	7	2	0	0	+	3	1	7	0	0	6	1	1	0	2	
+	0	4	9	0	0																						
+	1	7	2	0	0																						
+	3	1	7	0	0																						
6	1	1	0	2																							
6:10	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
7:50	LOAD P20 OPT 2: 100° SCAN N78 (R1+R2) N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>-</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	0	0	0	0	+	0	0	0	0	0	-	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																						
+	0	0	0	0	0																						
-	0	5	0	0	0																						
+	0	0	0	5	0																						
10:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>3</td><td>2</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>7</td><td>7</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>3</td><td>7</td><td>0</td><td>0</td></tr></table> V48E, V21N46E <table><tr><td>6</td><td>1</td><td>1</td><td>0</td><td>1</td></tr></table>			+	3	2	0	0	0	+	1	7	7	0	0	+	3	3	7	0	0	6	1	1	0	1	
+	3	2	0	0	0																						
+	1	7	7	0	0																						
+	3	3	7	0	0																						
6	1	1	0	1																							
14:46	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
15:00	EUV, X-RAY - PWR DWN																										
18:30	LOAD P20 OPT 2: 120° SCAN N78 (R1+R2) N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																						
+	0	0	0	0	0																						
+	0	5	0	0	0																						
+	0	0	0	5	0																						
20:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>0</td><td>3</td><td>5</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>7</td><td>2</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>1</td><td>7</td><td>0</td><td>0</td></tr></table>			+	0	3	5	0	0	+	1	7	2	0	0	+	3	1	7	0	0						
+	0	3	5	0	0																						
+	1	7	2	0	0																						
+	3	1	7	0	0																						
24:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
29:50	LOAD P20 OPT 2: 100° SCAN N78 (R1+R2) N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>			+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																						
+	0	0	0	0	0																						
+	0	5	0	0	0																						
+	0	0	0	5	0																						
37:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E <table><tr><td>+</td><td>0</td><td>8</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>7</td><td>7</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>3</td><td>7</td><td>0</td><td>0</td></tr></table>			+	0	8	0	0	0	+	1	7	7	0	0	+	3	3	7	0	0						
+	0	8	0	0	0																						
+	1	7	7	0	0																						
+	3	3	7	0	0																						
42:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																										
	CONTINUE WITH PAD ON NEXT PAGE																										

HeG SCAN - PAD136/137(CONT'D)(DAY 9B)

DET	DATA	DET	DATA
<u>50:10</u>	LOAD P20 OPT 2: 120° SCAN N78 (R1+R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0.5 0 0 0 + 0 0 0.5 0	<u>15:05</u>	LOAD P20 OPT 2: 120° SCAN N78 (R1+R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 - 0.5 0 0 0 + 0 0 0.5 0
<u>52:00</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 6 0 0 0 + 1 7 2 0 0 + 3 1 7 0 0	<u>18:54</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) V48E, V21N46E 6 1 1 0 1
<u>57:00</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	<u>22:54</u>	P00 DSE (STOP/REWIND/CMD RESET) UPTLM - RELAY
<u>—:—</u>		<u>—:—</u>	EUV, HeG, X-RAY - PWR DWN GO TO FP
<u>3:05</u>	LOAD P20 OPT 2: 100° SCAN N78 (R1+R2) N79 + 0 0 0 0 0 + 0 0 0 0 0 + 0.5 0 0 0 + 0 0 0.5 0		
<u>8:54</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 3 3 4 0 0 + 1 7 7 0 0 + 3 3 7 0 0 V48E, V21N46E 6 1 1 0 2		
<u>13:24</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		
<u>15:00</u>	X-RAY, EUV - OPS		

X-RAY PAD - REV 138 (DAY 9B)

DET	V49 MNVR TO			DATA
	R	P	Y	
				: :
SET DET				COUNTING UP TO 223:49:17 (SS)
55:00	110	129	000	VERIFY ATTITUDE
				X-RAY, EUV - OPS
0:00	---	---	---	
2:00	104	115	---	
5:15	099	112	---	
7:45	094	114	---	
8:10				V21N46E (61102), V46E
10:10	067	321	---	
16:20	080	332	---	
16:55				V21N46E (61101), V46E
17:55	078	328	---	
20:20	084	319	---	
22:15	077	318	---	
24:55	079	313	---	
26:25	089	308	---	
28:25	076	308	---	
30:35	076	304	---	
32:00	075	275	---	
35:25				EUV, X-RAY - PWR DWN
				GO TO HeG PAD -
				REV 138/139 FOR
				NEXT MNVR

[illegible]

SET DET COUNTING UP TO _ _ _ : _ _ : _ _ (224:40:01 (SS-38))			
DET	DATA		DET DATA
50:00	V49 MINVR +11800 +28300 +34500		—:—
55:00	HeG - OPS		14:30 LOAD P20 OPT 2: 40° SCAN N78 +09000 -03775 N79 +05000 +00050
55:00	LOAD P20 OPT 2: 80° SCAN N78 (R1+R2) N79 +09000 -03775 +05000 +00050		19:30 N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E +16700 +04400 +34600
0:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E +14300 +12100 +01200 V48E, V21N46E 61102		24:00 P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
4:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		—:—
—:—			26:20 LOAD P20 OPT 2: 80° SCAN N78 +09000 -03775 N79 -05000 +00050
5:55	LOAD P20 OPT 2: 60° SCAN N78 (R1+R2) N79 +09000 -03775 -05000 +00050		29:30 N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E +14200 +12600 +01200
9:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E +14000 +21000 +34300		33:30 P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
13:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)		—:— CONTINUE WITH PAD ON NEXT PAGE

HeG SCAN - PAD 138/139 (CONT'D) (DAY 9B)

DET	DATA	DET	DATA
35:05	LOAD P20 OPT 2: 60° SCAN N78 (R1+R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 + 0 5 0 0 0 + 0 0 0 5 0	55:05	LOAD P20 OPT 2: 80° SCAN N78 (R1+R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 + 0 5 0 0 0 + 0 0 0 5 0
39:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 5 8 0 0 + 3 2 4 0 0 + 0 0 5 0 0	59:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 3 1 0 0 + 2 3 6 0 0 + 3 5 6 0 0 V48E, V21N46E 6 1 1 0 1
44:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	3:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
45:00	X-RAY, EUV - OPS	—:—	
45:20	LOAD P20 OPT 2: 40° SCAN N78 (R1+R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 - 0 5 0 0 0 + 0 0 0 5 0	7:20	LOAD P20 OPT 2: 60° SCAN N78 (R1+R2) N79 + 0 9 0 0 0 - 0 3 7 7 5 - 0 5 0 0 0 + 0 0 0 5 0
49:00	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 6 9 0 0 + 0 5 3 0 0 + 3 5 0 0 0	9:30	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25N22E + 1 5 7 0 0 + 3 3 4 0 0 + 0 0 8 0 0
53:00	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)	13:30	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)
—:—		13:45	EUV, X-RAY - PWR DWN CONTINUE WITH PAD ON NEXT PAGE

HeG SCAN - PAD138/139(CONT'D) (DAY 9B)

DET	DATA																									
<u>16:05</u>	LOAD P20 OPT 2: N78 (R1+R2)	40° SCAN N79 <table><tr><td>+</td><td>0</td><td>9</td><td>0</td><td>0</td><td>0</td></tr><tr><td>-</td><td>0</td><td>3</td><td>7</td><td>7</td><td>5</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>	+	0	9	0	0	0	-	0	3	7	7	5	+	0	5	0	0	0	+	0	0	0	5	0
+	0	9	0	0	0																					
-	0	3	7	7	5																					
+	0	5	0	0	0																					
+	0	0	0	5	0																					
<u>19:30</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET) LOAD V25H22E <table><tr><td>+</td><td>0</td><td>5</td><td>4</td><td>0</td><td>0</td></tr><tr><td>+</td><td>1</td><td>8</td><td>1</td><td>0</td><td>0</td></tr><tr><td>+</td><td>3</td><td>5</td><td>6</td><td>0</td><td>0</td></tr></table>		+	0	5	4	0	0	+	1	8	1	0	0	+	3	5	6	0	0						
+	0	5	4	0	0																					
+	1	8	1	0	0																					
+	3	5	6	0	0																					
<u>24:00</u>	P00 V49E, PRO, PRO DSE (STOP/CMD RESET)																									
<u>31:15</u>	LOAD P20 OPT 2: N78 (R1+R2)	140° SCAN N79 <table><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <table><tr><td>+</td><td>0</td><td>5</td><td>0</td><td>0</td><td>0</td></tr><tr><td>+</td><td>0</td><td>0</td><td>0</td><td>5</td><td>0</td></tr></table>	+	0	0	0	0	0	+	0	0	0	0	0	+	0	5	0	0	0	+	0	0	0	5	0
+	0	0	0	0	0																					
+	0	0	0	0	0																					
+	0	5	0	0	0																					
+	0	0	0	5	0																					
<u>38:30</u>	N34 (PRO) DSE (HBR/RCD/FWD/CMD RESET)																									
<u>44:40</u>	P00 DSE (STOP/REWIND/CMD RESET)																									
<u>44:50</u>	HeG - PWR DWN GO TO X-RAY PAD - REV 140 FOR NEXT MNVR																									

6-11

DATE 5/26/75

X-RAY PAD - REV 140 (DAY 9B)

[illegible][illegible]

6-12

DATE 5/26/75

EUV PAD - REV 141 (DAY 9B)

DET	V49 MNVR TO			DATA	HGA		FP INFO		
	R	P	Y		P	Y	MNVR	DATA	TGT
				: : COUNTING UP TO 228:15:28 (SS)					
SET DET									
45:00	105.70	113.40	000				5:20		347A
55:00				X-RAY, HeG, EUV - OPS					
0:00	100.70	---	---	CONFIGURE DSE: HBR/RCD/FWD/CMD RESET			:10	1:00	347
1:10	119.20	030.60	---				2:50	1:00	384A
5:00	124.20	---	---				:10	2:15	384
7:25	129.20	----	---				:10	1:15	384B
8:50	124.20	---	---				:10	2:15	384
11:15	119.20	----	---				:10	1:00	384A
12:25	162.10	019.60	---				1:30	1:00	328
14:55	185.30	290.00	---				3:05		366A
18:00				V21N46E (61101), V46E				1:15	
19:15	180.30	---	---				:25	2:20	366
22:00	175.30	---	---				:25	1:20	366B
23:45	180.30	---	---				:25	2:20	366
26:30	185.30	---	---				:25		366A
26:55				V21N46E (61102), V46E				1:15	
28:10	175.40	278.40	---				:35	1:00	338A
29:45	170.40	---	---				:10	1:00	338
30:55	165.40	---	---				:10	1:00	338B
32:05	166.60	247.90	---				1:05	1:00	340A
34:10	161.60	---	---				:10	2:00	340
36:20	156.60	---	---				:10	1:00	340B
37:30				DSE: STOP/REWIND/CMD RESET					
				EUV, HeG, X-RAY-PWR DWN GO TO FP FOR NEXT MNVR					

DSE 11:00 + 37:30 = 48:30

NASA-JSC