
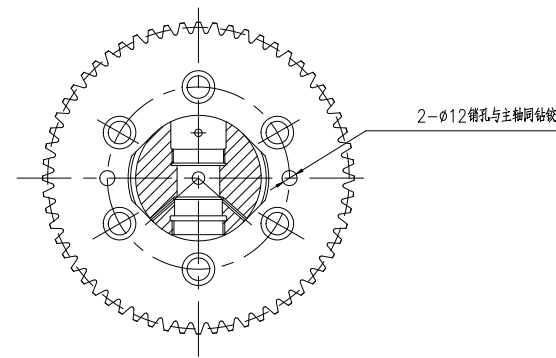
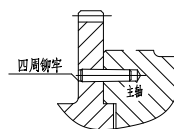
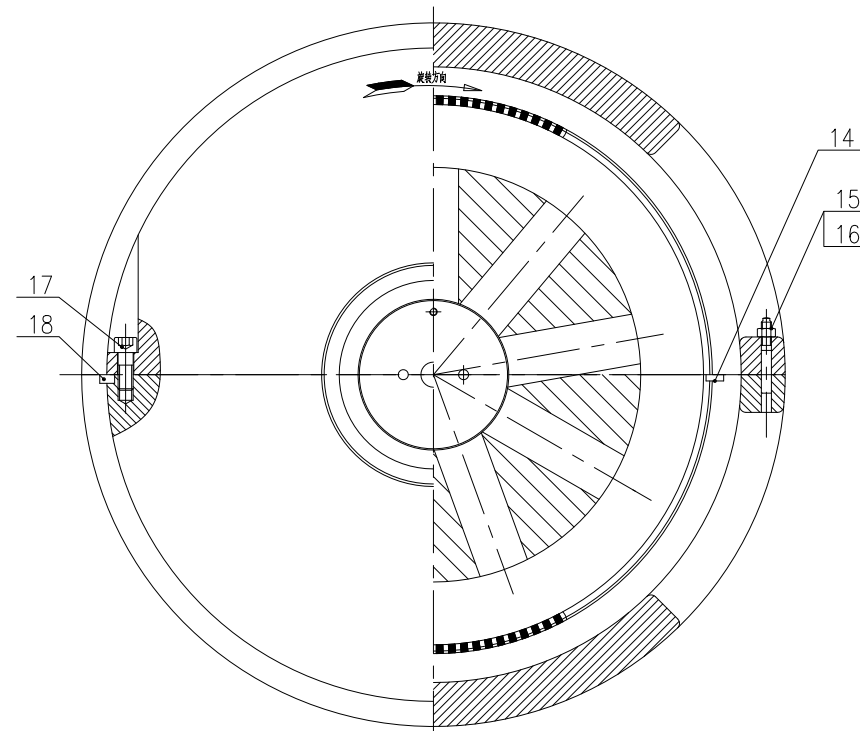


0-0701-0212-0000-00

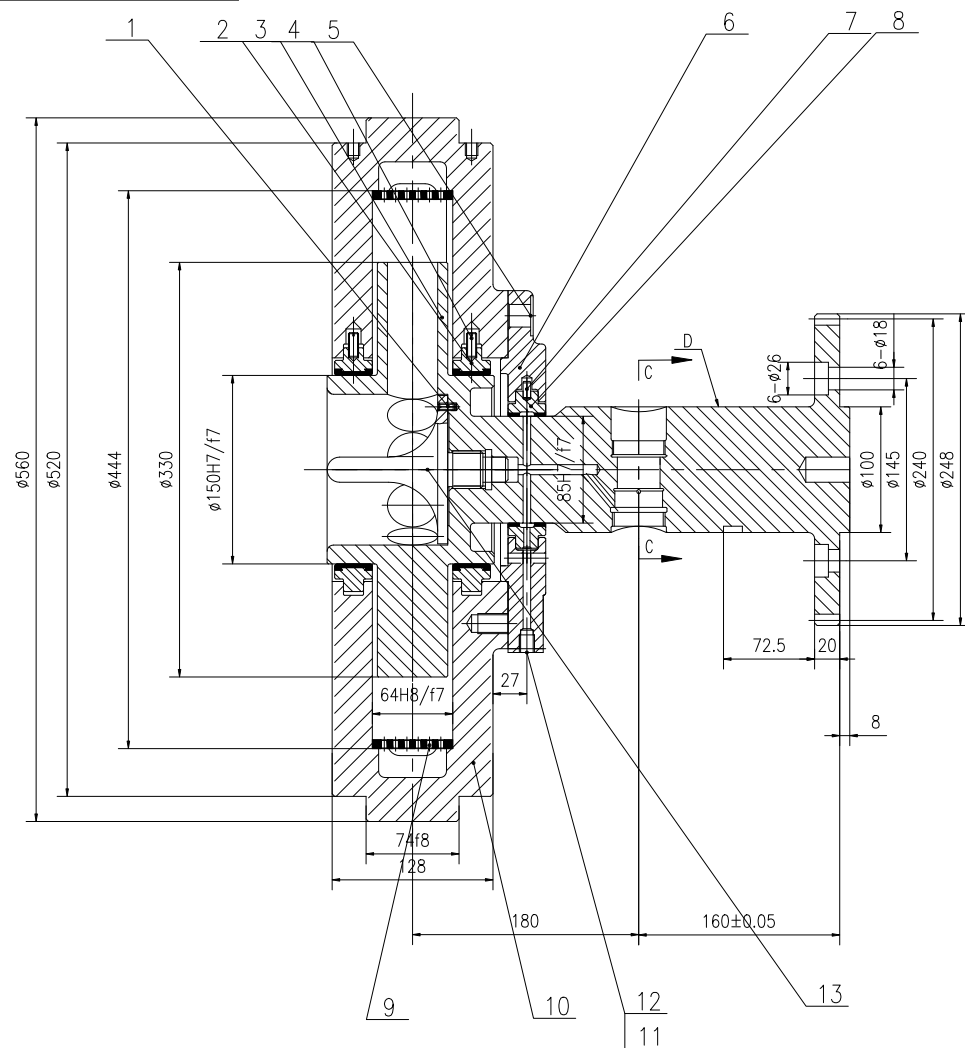

技术要求

1. 件1、19装配后铆死。
2. 油泵压增1.079MPa，特性曲线斜度应不大于0.0049MPa/L/min，流量1200L/min
3. 危急保安器装上后，作静平衡试验，不平衡量从D处去除，试验标准应符合GB3329-1988《汽轮机旋转零部件静平衡试验》的规定

NOTES:
1.Screw 1、19 will be riveted fast after assembly.
2.During the component test for the prototype unit,the mail oil pump will have a pressure increment of 1.079MPa and a characteristic linear gradient not larger than 0.0049MPa/L/min.The flow rate of pump is 1200L/min
3.Take static balance test after the emergency governor mounted,with unbalanced mass balanced at D point,and the test should accord with regulate of JB/T3329-1988 "static balance for turbine rotated parts".

设计
林晓龙
校对
马文肖
日期
2012.11

主油泵				Main Oil Pump		重量(Kg)
标记	处数	更改文件号	签	字	日期	
设计	2	马文肖	审	定	20210118	16.3
校对	2	马文肖	日	期	20210118	
审核	共	页	第	页		

QINGDAO JIENENG STEAM TURBINE GROUP CO.,LTD