




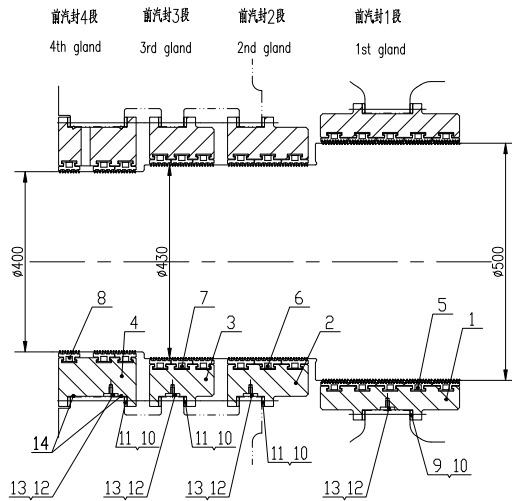


前汽封4段与汽缸装配间隙详图
Assembling details of 4th front gland

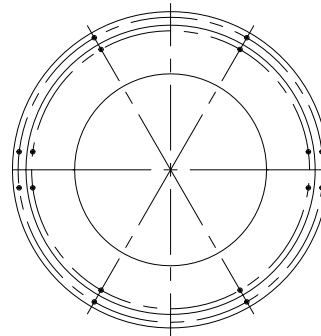



止动垫圈装配示意图
Assembling of external tab washers

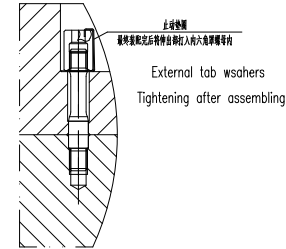



止动垫圈装配示意图
Assembling of external tab washers

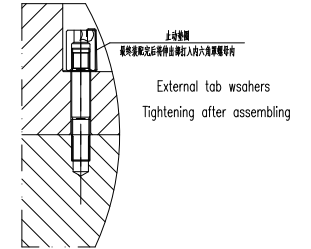

前汽封1、2、3段与汽缸装配间隙详图
Assembling details of 1st~3rd front gland

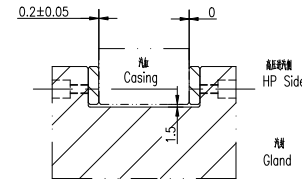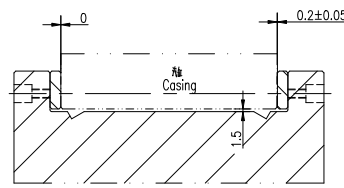


支撑板装配详图
Assembling details of support

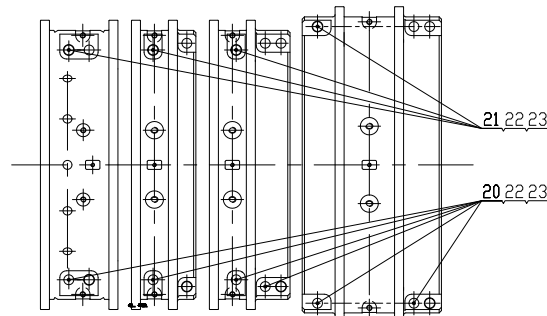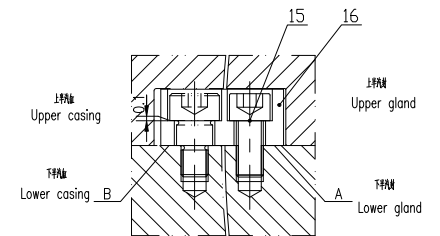


汽封详图
Details of gland

汽封详图
Details of gland

压板装配详图
Assembling details of pressure plate

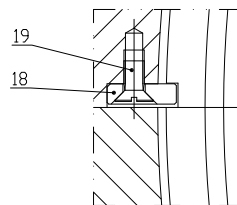

圆头键装配详图
Assembling details of round head key
Total interference 0~0.02

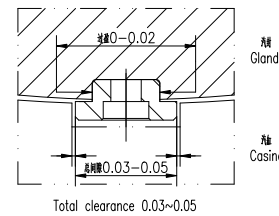

技术要求

- 1、自由状态下汽封体上下半中分面间隙不大于0.05mm。
- 2、汽封环各弧段组装机时接触面须密合，间隙不大于0.05mm。
- 3、支撑板装配详图中接触面A、B应接触均匀，接触面积不小于70%。

Notes

- 1.Under free condition, clearance at the split housing is not greater than 0.05mm.
- 2.In assembling the arc sections of sealing ring, contact surfaces will meet tightly with each other, with clearances not greater than 0.05mm.
- 3.In the detail of suspension pin assembly, the planes A and B will meet evenly, with contact surfaces not less than 70% of the total surfaces.

设计

校对

日期

				前汽封 Front gland	
标记/处数	更改文件号	签字	日期	0-0061-586C-0000-00	重量(Kg)
设计	审核	日期	20260112	青岛捷能汽轮机集团股份有限公司	
校对	共1页	第1页		QINGDAO JIENENG STEAM TURBINE GROUP CO., LTD.	