

THALES AVIONICS, INC. PROPRIETARY
SHEET NOTES:

51 REMOVE AND DISCARD NS/FS PLACARDS WITH CIRCUIT BREAKER/RELAY/SWITCH REMOVAL. CLEAN AREAS IAW BAC 5750.


52 REMOVE K21002-051 MOUNTING PLATE WITH R9512 RELAY. EFF 202-226,228-231,233,234,237-239,241-245,247,248,250-299,
401-464,501-531.

53 RE-INSTALL ORIGINAL POS C9 CIRCUIT BREAKER/WIRING, AS REQUIRED. IF FURTHER RESTORATION OF CIRCUIT BREAKER
PANEL(S) IS REQUIRED, RESTORE TO ORIGINAL CONFIGURATION PER APPLICABLE BOEING IPC.

SEE DETAIL F
P6-1 CIRCUIT BREAKER PANEL
ONLY FOR (-101, -103, -105)

SEE DETAIL G
RELAY PANEL
ALL (-101, -103, -105, -107, -109)

SEE DETAIL H
P6-4 CIRCUIT BREAKER PANEL
ONLY FOR (-101, -103, -105)

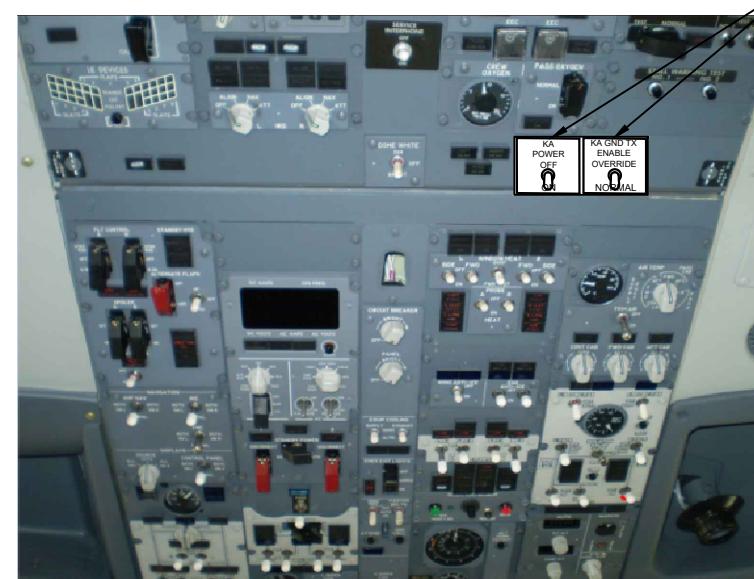


DETAIL E (SHT 3)
REMOVAL OF AFT OVERHEAD P5 PANEL SWITCHES
LOOKING UP
ALL (-101, -103, -105, -107, -109)

REMOVE MS24658-23D [51] PLUG
SWITCH, TOGGLE, LEVER LOCK


REMOVE MS3320-2 QTY 2 (WEB/WDU 9209, DC CNTL 9210
OR ALT PN 2TC2-2
REMOVE 2TC49-5 (DC BUS 9211)
OR ALT PN BACC18AD5 OR 4310-029-5 OR 2TC47-5

[51] [53]

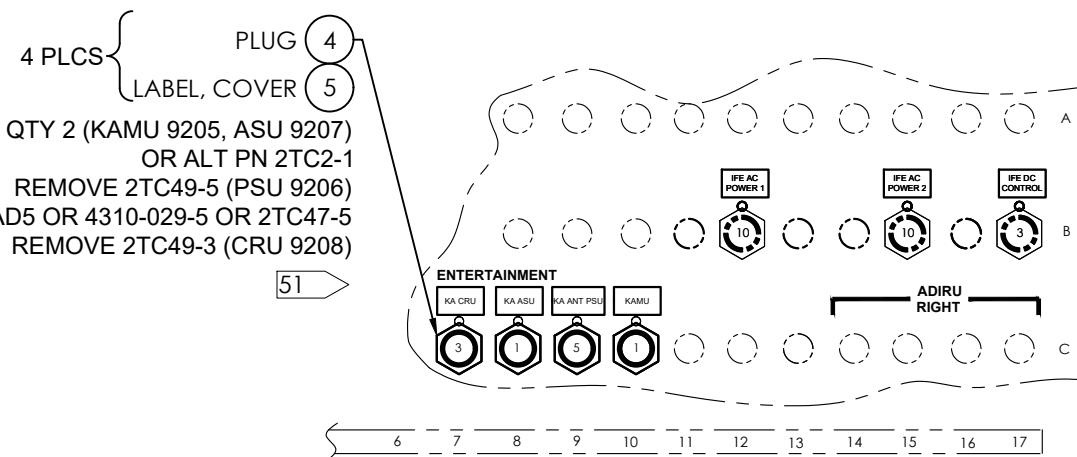


DETAIL F
REMOVAL OF P6-1 KA SYSTEM CIRCUIT BREAKERS
LOOKING AT THE FRONT SIDE OF THE PANEL
FOR ALL (-101, -103, -105, -107, -109)

51 REMOVE THE FOLLOWING RELAY, SOCKET:
52 M83536/16-022M RELAY
OR ALT PN M83536/16-022L
REMOVE M12883/40-13 RELAY SOCKET
(R9512)
REMOVE M82536/10-024M RELAY QTY 2
OR ALT PN M82536/10-024L
REMOVE M12883/41-06 RELAY, SOCKET QTY 2
(R9513, R9514)

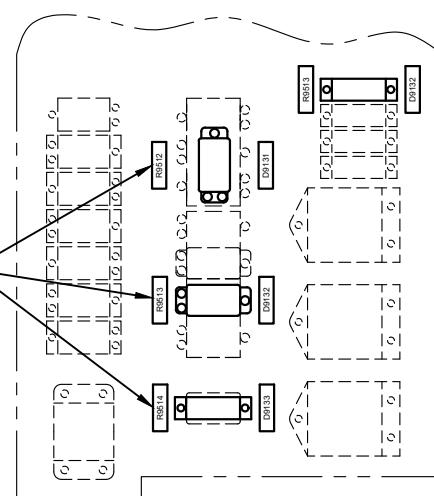

DETAIL G
REMOVAL OF P6-4 KA SYSTEM CIRCUIT BREAKERS
LOOKING AT THE FRONT SIDE OF THE PANEL
ALL (-101, -103, -105, -107, -109)

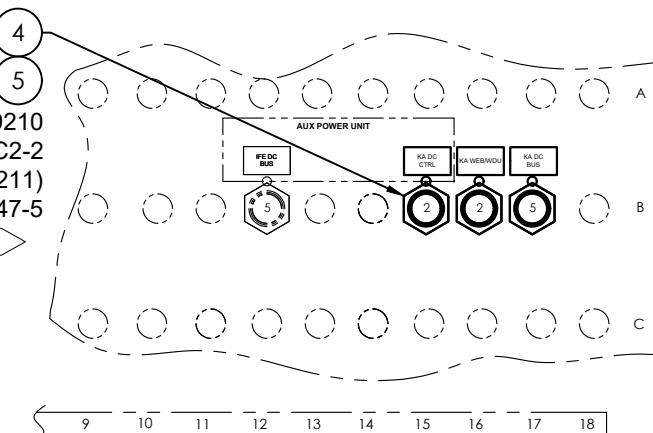

DETAIL H
LOCATION OF P6-4 KA SYSTEM CIRCUIT BREAKERS
LOOKING AT THE FRONT SIDE OF THE PANEL
FOR ALL (-101, -103, -105, -107, -109)