


PICTORIAL — NOT TO SCALE HEAD AT LEFT

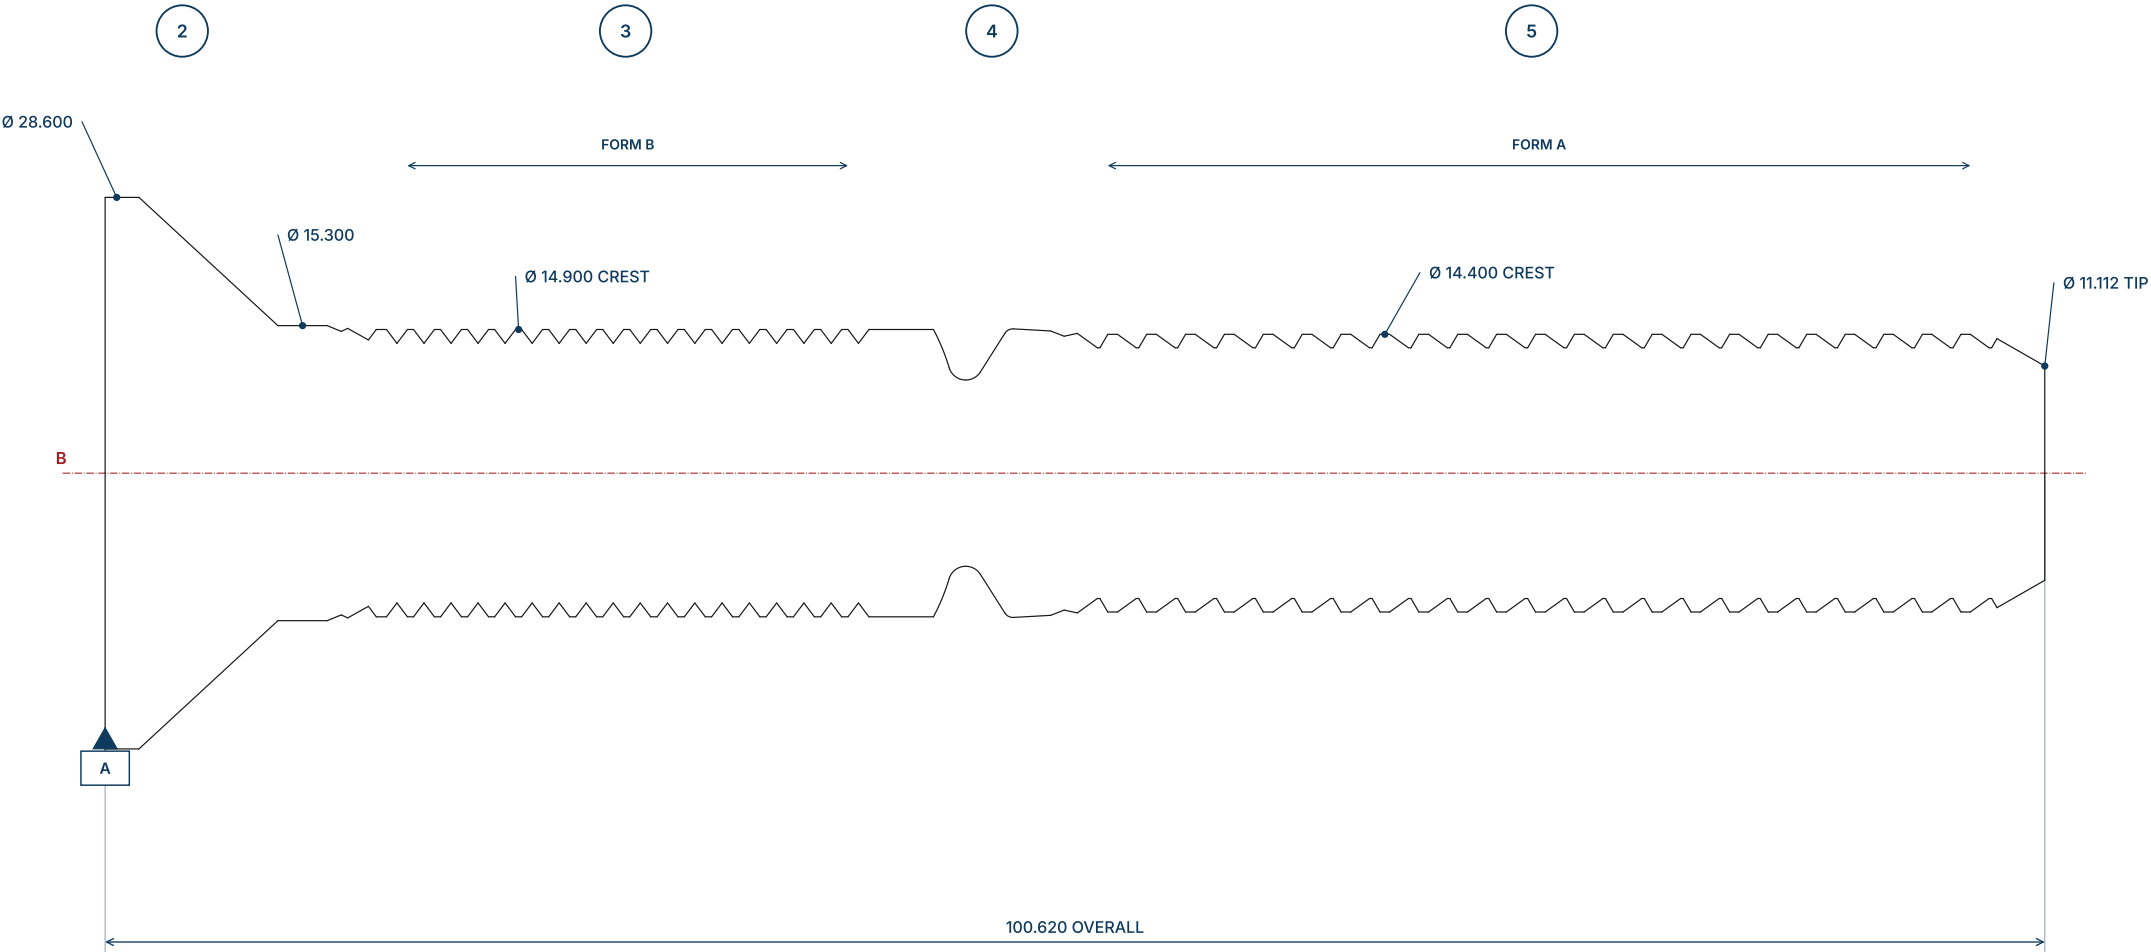

SCALE 2.55 : 1 AXIS HORIZONTAL HEAD AT LEFT FULL PROFILE

Solid of revolution about datum B. Revolve the +R profile.

Sizes are CAD nominals from 2 large nut.STEP (SolidWorks 2018, 2024-10-24).

No tolerance, material, or finish is stored in the model.

Graphic sizes are rounded to 0.001 mm. Sheets 7 and 8 list every segment to 0.00001 mm.

Datum A is the head end face. Positive Z runs from that face toward the small end.

Volume 18063.275 mm³ area 6974.785 mm² centre of mass Z 42.672 on the axis.


Balloons 2, 3, 4 and 5 mark the detail sheets.

Form B: 17 crests, Ø 14.900, 53° both flanks. Form A: 23 crests, Ø 14.400, root Ø 13.000.



PART	2 LARGE NUT	SHEET	1 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0		DATUM B AXIS	

DETAIL 2 SCALE 6 : 1 FULL PROFILE

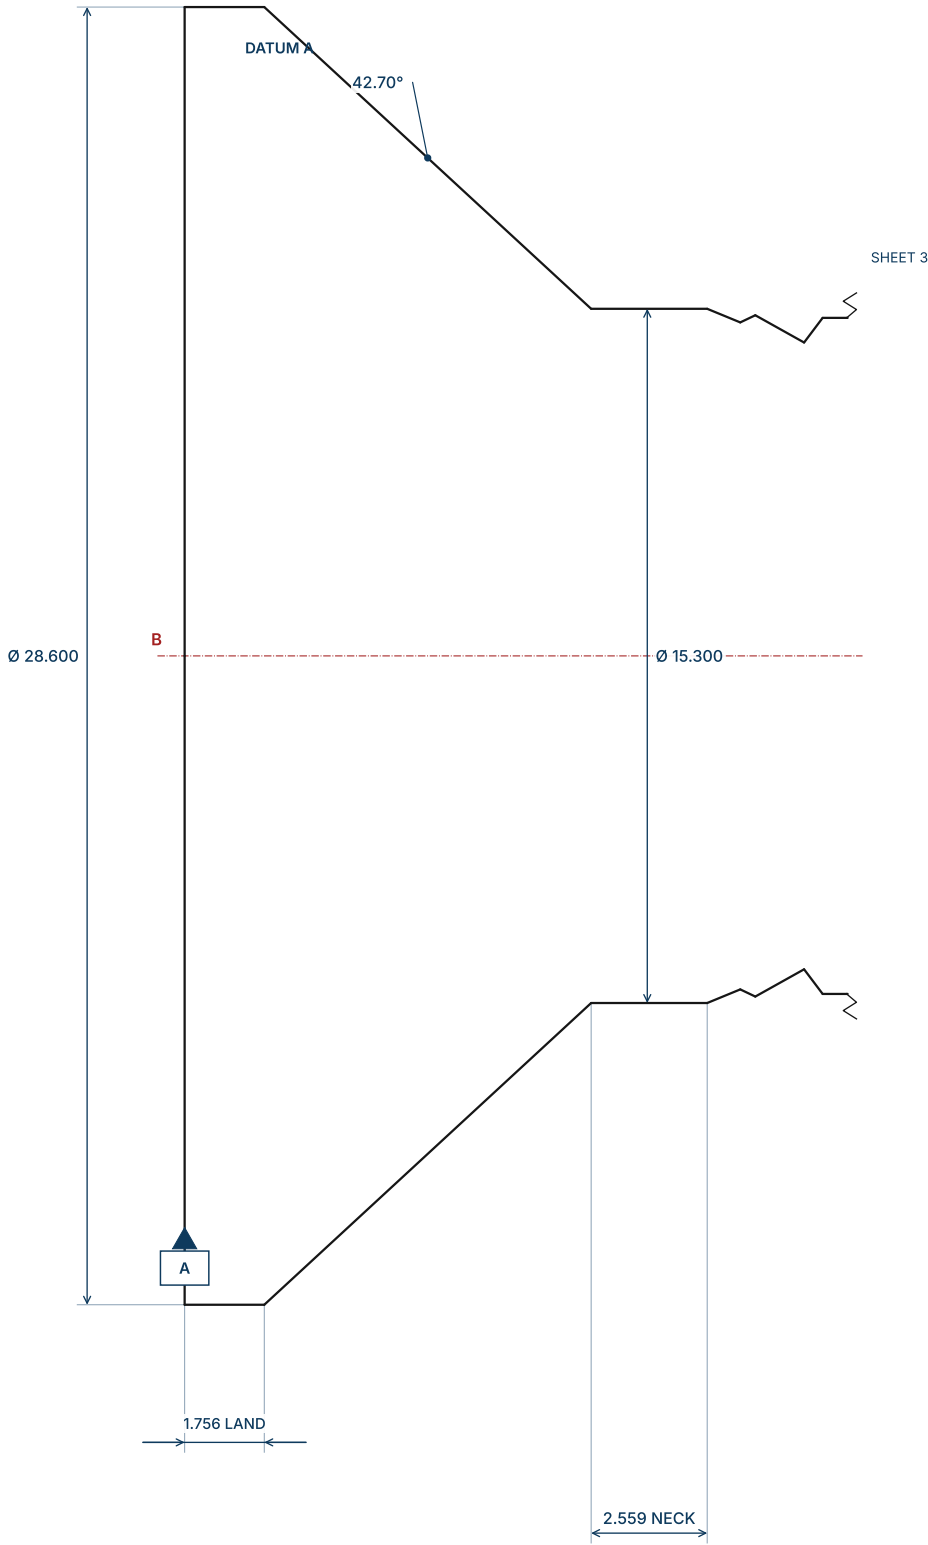

POINT	Z	RADIUS	Ø	NOTE
HEAD FACE	0.00000	0.00000	0.000	ON THE AXIS
HEAD RIM	0.00000	14.30000	28.60000	LARGEST DIAMETER
LAND END	1.75581	14.30000	28.60000	42.70° STARTS
NECK START	8.96235	7.65000	15.30000	TRUE CYLINDER
NECK END	11.52088	7.65000	15.30000	ENTRY TAPERS
RUN-IN	14.06628	7.45000	14.90000	L 0.52921


NECK END TO FORM B RUN-IN				
FEATURE	Z0	Z1	Ø START	Ø END
22.365°	11.52088	12.25000	15.30000	14.70000
25.45°	12.25000	12.58157	14.70000	15.01559
29.185°	12.58157	13.65714	15.01559	13.81409
53.00°	13.65714	14.06628	13.81409	14.90000
CYL L 0.52921	14.06628	14.59549	14.90000	14.90000

The head end face is datum A. It meets the axis.

Ø 28.600 is a true cylinder, then a 42.70° cone.


The neck is Ø 15.300. The entry tapers are tabulated.

The 53° form continues on sheet 3.



PART	2 LARGE NUT	SHEET	2 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0		DATUM B AXIS	

DETAIL 3 ONE REPEATED PITCH POINTED ROOT ANGLES FROM THE AXIS

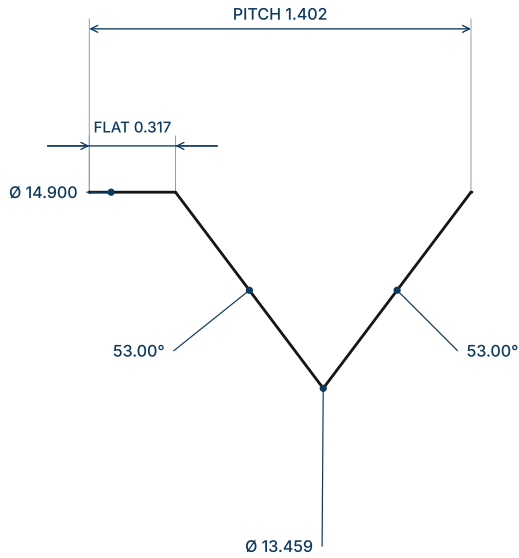

FORM B TOOTH SCALE 36 : 1 MATERIAL BELOW THE LINE 17 CRESTS BOTH FLANKS 53.00°

#	Z0	Z1	FLAT	PITCH
1	15.68115	15.99788	0.31674	—
2	17.08354	17.40828	0.31674	1.40239
3	18.48593	18.80267	0.31674	1.40239
4	19.88832	20.20506	0.31674	1.40239
5	21.29072	21.60745	0.31674	1.40239
6	22.69311	23.00984	0.31674	1.40239
7	24.09550	24.41224	0.31674	1.40239
8	25.49789	25.81463	0.31674	1.40239
9	26.90028	27.21702	0.31674	1.40239
10	28.30268	28.63193	0.32926	1.40239
11	29.71759	30.04685	0.32926	1.41491
12	31.13250	31.46176	0.32926	1.41491
13	32.54742	32.87667	0.32926	1.41491
14	33.96233	34.29159	0.32926	1.41491
15	35.37724	35.70650	0.32926	1.41491
16	36.79216	37.12141	0.32926	1.41491
17	38.20707	38.53633	0.32926	1.41491

FORM B DEFINITION

ITEM	VALUE	NOTE
CREST Ø	14.90000	TRUE CYLINDER
ROOT	13.45929	POINTED, NO FLAT
FLANKS	53.00° / 53.00°	LEAVING / APPROACHING, +Z
CRESTS 1-9	1.40239	FLAT 0.31674 ×9
CRESTS 10-17	1.41491	FLAT 0.32926 ×8
RUN-IN	0.52921	Z 14.06628 Ø 14.900
EXIT LAND	3.34797	Z 39.62198 Ø 14.900

Pitch is crest start to crest start. The interval from crest 9 to crest 10 is 1.40239.




3RD ANGLE

PART	2 LARGE NUT	SHEET	3 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0	DATUM B AXIS		


DETAIL 4 TRUE RADIAL SCALE HALF PROFILE ANGLES FROM THE AXIS

EXIT LAND THROUGH THE FIRST FORM A ROOT					
KIND	Z0	Z1	R0	R1	SIZE
CYL	39.62198	42.96995	7.45000	7.45000	Ø 14.90000 L 3.34797
R 11.00000	42.96995	43.78323	7.45000	5.47033	CTR (2.30000, 33.25000)
R 0.90000	43.78323	44.64504	5.47033	4.82973	CTR (5.72973, 44.64504)
R 0.90000	44.64504	45.40536	4.82973	5.24814	CTR (5.72973, 44.64504)
57.65°	45.40536	46.67301	5.24814	7.24950	Ø 10.49629 → 14.49899
R 0.50000	46.67301	47.12331	7.24950	7.48117	CTR (6.98195, 47.09540)
3.20°	47.12331	49.04840	7.48117	7.37354	Ø 14.96234 → 14.74708
21.30°	49.04840	49.75000	7.37354	7.10000	Ø 14.74708 → 14.20000
12.25°	49.75000	50.43300	7.10000	7.24829	Ø 14.20000 → 14.49659
35.80°	50.43300	51.47054	7.24829	6.50000	Ø 14.49659 → 13.00000
CYL	51.47054	51.60357	6.50000	6.50000	Ø 13.00000 L 0.13303
59.70°	51.60357	52.01261	6.50000	7.20000	Ø 13.00000 → 14.40000

The two R 0.900 arcs meet at the groove bottom. R 11.000 leaves the Ø 14.900 land.

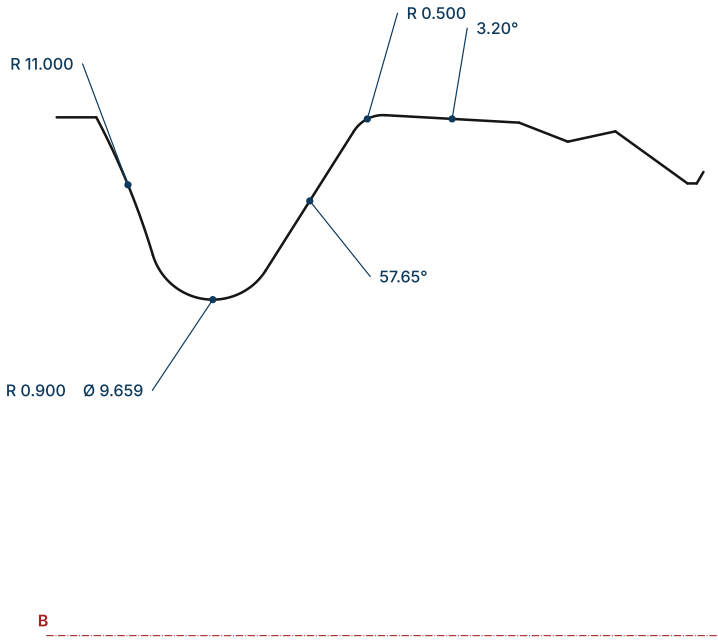


GROOVE SCALE 9.2 : 1 HALF PROFILE EVERY STATION IS IN THE TABLE



PART	2 LARGE NUT	SHEET	4 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0		DATUM B AXIS	

DETAIL 5 ONE REPEATED PITCH TIP AT TRUE RADIAL SCALE

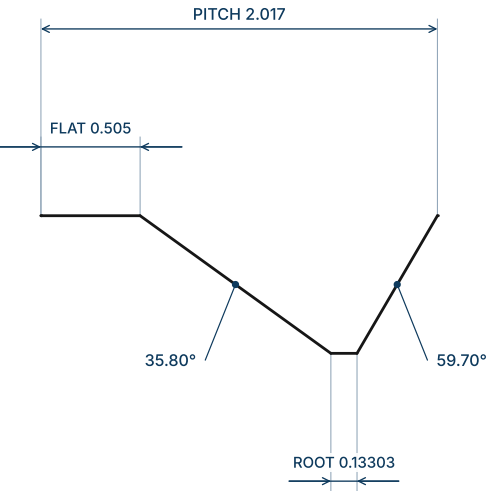


FORM A TOOTH SCALE 26 : 1 Ø 14.400 CREST Ø 13.000 ROOT .23 CRESTS

#	Z0	Z1	FLAT	PITCH	#	Z0	Z1	FLAT	PITCH
1	52.01261	52.51720	0.50459	—	13	76.21949	76.72408	0.50459	2.01724
2	54.02985	54.53444	0.50459	2.01724	14	78.23673	78.74132	0.50459	2.01724
3	56.04709	56.55168	0.50459	2.01724	15	80.25397	80.75856	0.50459	2.01724
4	58.06433	58.56892	0.50459	2.01724	16	82.27121	82.75871	0.48749	2.01724
5	60.08157	60.58616	0.50459	2.01724	17	84.27136	84.75885	0.48749	2.00014
6	62.09881	62.60340	0.50459	2.01724	18	86.27150	86.75900	0.48749	2.00014
7	64.11605	64.62064	0.50459	2.01724	19	88.27165	88.75914	0.48749	2.00014
8	66.13329	66.63788	0.50459	2.01724	20	90.27179	90.75929	0.48749	2.00014
9	68.15053	68.65512	0.50459	2.01724	21	92.27194	92.75943	0.48749	2.00014
10	70.16777	70.67236	0.50459	2.01724	22	94.27208	94.75957	0.48749	2.00014
11	72.18501	72.68960	0.50459	2.01724	23	96.27223	96.75972	0.48749	2.00014
12	74.20225	74.70684	0.50459	2.01724					


FORM A DEFINITION

ITEM	VALUE	NOTE
CREST Ø	14.40000	TWO FLAT LENGTHS
ROOT Ø	13.00000	FLAT 0.13303 ×24
FLANKS	35.80° / 59.70°	LEAVING / APPROACHING, +Z
CRESTS 1–15	2.01724	FLAT 0.50459
CRESTS 16–23	2.00014	FLAT 0.48749
TIP FACE	100.62044	Ø 11.11195 TO THE AXIS

The interval from crest 15 to crest 16 stays on the 2.01724 pitch.

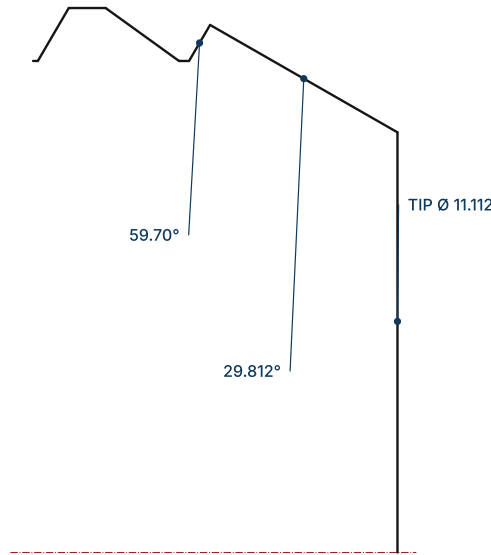

TIP SCALE 10 : 1 HALF PROFILE LAST ROOT, THEN 59.70° STOPS SHORT OF THE CREST



PART	2 LARGE NUT	SHEET	5 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0	DATUM B AXIS		

CONTROLLING SIZES. Z FROM DATUM A, POSITIVE TOWARD THE SMALL END. MODEL VALUES TO 0.00001 mm.

1 OVERALL

ITEM	MODEL	NOTE
OVERALL	100.62044	HEAD FACE TO TIP FACE
HEAD FACE Z	0.00000	Ø 28.60000
LARGEST Ø	28.60000	LAND L 1.75581
GROOVE Ø	9.65945	AT Z 44.64504
TIP FACE Z	100.62044	Ø 11.11195
VOLUME	18063.27457	mm ³ SOLID
SURFACE	6974.78496	mm ²
CON Z	42.67243	ON THE AXIS

2 ARCS

R	CTR R	CTR Z	Z0	Z1
11.00000	2.30000	33.25000	42.96995	43.78323
0.90000	5.72973	44.64504	43.78323	44.64504
0.90000	5.72973	44.64504	44.64504	45.40536
0.50000	6.98195	47.09540	46.67301	47.12331

3 AXIS IN THE STEP FILE

ITEM	X	Y	Z
DIRECTION	1.000000	0.000000	0.000000
POINT ON AXIS	0.00000	0.00000	0.00000

The point is the head-end centre. Drawing +Z is opposite this direction.

4 EVERY CONTROLLING FEATURE

ITEM	Z0	Z1	SIZE
FACE	0.00000	0.00000	Ø 28.60000 TO THE AXIS
CYL	0.00000	1.75581	Ø 28.60000 L 1.75581
42.70°	1.75581	8.96235	Ø 28.60000 → 15.30000
CYL	8.96235	11.52088	Ø 15.30000 L 2.55853
22.365°	11.52088	12.25000	Ø 15.30000 → 14.70000
25.45°	12.25000	12.58157	Ø 14.70000 → 15.01559
29.185°	12.58157	13.65714	Ø 15.01559 → 13.81409
53.00°	13.65714	14.06628	Ø 13.81409 → 14.90000
CYL	14.06628	14.59549	Ø 14.90000 L 0.52921
B ×9	15.68115	27.21702	Ø 14.900 FLAT 0.31674 PITCH 1.40239
B ×8	28.30260	30.53633	FLAT 0.32926 PITCH 1.41491
B FLANK	14.59549	39.62198	53.00° / 53.00° ROOT Ø 13.45929
CYL	39.62198	42.96995	Ø 14.90000 L 3.34797
R 11.000	42.96995	43.78323	CTR (2.30000, 33.25000)
R 0.900	43.78323	44.64504	CTR (5.72973, 44.64504)
R 0.900	44.64504	45.40536	CTR (5.72973, 44.64504)
57.65°	45.40536	46.67301	Ø 10.49629 → 14.49099
R 0.500	46.67301	47.12331	CTR (6.98195, 47.09540)
3.20°	47.12331	49.04840	Ø 14.96234 → 14.74700
21.30°	49.04840	49.75000	Ø 14.74700 → 14.20000
12.25°	49.75000	50.43300	Ø 14.20000 → 14.49659
35.80°	50.43300	51.47054	Ø 14.49659 → 13.00000
A ×15	52.01261	80.75856	Ø 14.400 FLAT 0.50459 PITCH 2.01724
A ×8	82.27121	96.75972	FLAT 0.40749 PITCH 2.00014
A ROOT	51.47054	97.86332	Ø 13.000 FLAT 0.13303 ×24
A FLANK	51.47054	97.86332	35.80° LEAVING / 59.70° APPROACHING
59.70°	97.86332	98.14164	Ø 13.00000 → 13.95255
29.012°	98.14164	100.62044	Ø 13.95255 → 11.11195
FACE	100.62044	100.62044	Ø 11.11195 TO THE AXIS



SHEETS 7 AND 8 LIST ALL 168 PROFILE SEGMENTS, INCLUDING EVERY FLANK.


PART	2 LARGE NUT	SHEET	6 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0		DATUM B AXIS	

ORDERED +R PROFILE, HEAD FACE TO TIP. REVOLVE ABOUT DATUM B. MILLIMETRES TO 0.00001. ANGLE IS FROM THE AXIS.

#	KIND	Z1	R1	Z2	R2	LENGTH	ANGLE	ARC
001	FACE	0.00000	0.00000	0.00000	14.30000	14.30000	90.00	
002	CYL	0.00000	14.30000	1.75581	14.30000	1.75581	0.00	
003	TAPER	1.75581	14.30000	8.96235	7.65000	9.80595	42.70	
004	CYL	8.96235	7.65000	11.52088	7.65000	2.55853	0.00	
005	TAPER	11.52088	7.65000	12.25000	7.35000	0.78843	22.365	
006	TAPER	12.25000	7.35000	12.58157	7.50780	0.36721	25.45	
007	TAPER	12.58157	7.50780	13.65714	6.90705	1.23197	29.185	
008	TAPER	13.65714	6.90705	14.06628	7.45000	0.67985	53.00	
009	CYL	14.06628	7.45000	14.59549	7.45000	0.52921	0.00	
010	TAPER	14.59549	7.45000	15.13832	6.72964	0.90199	53.00	
011	TAPER	15.13832	6.72964	15.68115	7.45000	0.90199	53.00	
012	CYL	15.68115	7.45000	15.99788	7.45000	0.31674	0.00	
013	TAPER	15.99788	7.45000	16.54071	6.72964	0.90199	53.00	
014	TAPER	16.54071	6.72964	17.08354	7.45000	0.90199	53.00	
015	CYL	17.08354	7.45000	17.40028	7.45000	0.31674	0.00	
016	TAPER	17.40028	7.45000	17.94310	6.72964	0.90199	53.00	
017	TAPER	17.94310	6.72964	18.48593	7.45000	0.90199	53.00	
018	CYL	18.48593	7.45000	18.80267	7.45000	0.31674	0.00	
019	TAPER	18.80267	7.45000	19.34550	6.72964	0.90199	53.00	
020	TAPER	19.34550	6.72964	19.88832	7.45000	0.90199	53.00	
021	CYL	19.88832	7.45000	20.20506	7.45000	0.31674	0.00	
022	TAPER	20.20506	7.45000	20.74789	6.72964	0.90199	53.00	
023	TAPER	20.74789	6.72964	21.29072	7.45000	0.90199	53.00	
024	CYL	21.29072	7.45000	21.60745	7.45000	0.31674	0.00	
025	TAPER	21.60745	7.45000	22.15028	6.72964	0.90199	53.00	
026	TAPER	22.15028	6.72964	22.69311	7.45000	0.90199	53.00	
027	CYL	22.69311	7.45000	23.00984	7.45000	0.31674	0.00	
028	TAPER	23.00984	7.45000	23.55267	6.72964	0.90199	53.00	
029	TAPER	23.55267	6.72964	24.09550	7.45000	0.90199	53.00	
030	CYL	24.09550	7.45000	24.41224	7.45000	0.31674	0.00	
031	TAPER	24.41224	7.45000	24.95506	6.72964	0.90199	53.00	
032	TAPER	24.95506	6.72964	25.49789	7.45000	0.90199	53.00	
033	CYL	25.49789	7.45000	25.81463	7.45000	0.31674	0.00	
034	TAPER	25.81463	7.45000	26.35746	6.72964	0.90199	53.00	
035	TAPER	26.35746	6.72964	26.90028	7.45000	0.90199	53.00	
036	CYL	26.90028	7.45000	27.21702	7.45000	0.31674	0.00	
037	TAPER	27.21702	7.45000	27.75985	6.72964	0.90199	53.00	
038	TAPER	27.75985	6.72964	28.30268	7.45000	0.90199	53.00	
039	CYL	28.30268	7.45000	28.63193	7.45000	0.32926	0.00	
040	TAPER	28.63193	7.45000	29.17476	6.72964	0.90199	53.00	
041	TAPER	29.17476	6.72964	29.71759	7.45000	0.90199	53.00	
042	CYL	29.71759	7.45000	30.04685	7.45000	0.32926	0.00	
043	TAPER	30.04685	7.45000	30.58967	6.72964	0.90199	53.00	
044	TAPER	30.58967	6.72964	31.13250	7.45000	0.90199	53.00	
045	CYL	31.13250	7.45000	31.46176	7.45000	0.32926	0.00	
046	TAPER	31.46176	7.45000	32.00459	6.72964	0.90199	53.00	
047	TAPER	32.00459	6.72964	32.54742	7.45000	0.90199	53.00	
048	CYL	32.54742	7.45000	32.87667	7.45000	0.32926	0.00	

#	KIND	Z1	R1	Z2	R2	LENGTH	ANGLE	ARC
049	TAPER	32.87667	7.45000	33.41950	6.72964	0.90199	53.00	
050	TAPER	33.41950	6.72964	33.96233	7.45000	0.90199	53.00	
051	CYL	33.96233	7.45000	34.29159	7.45000	0.32926	0.00	
052	TAPER	34.29159	7.45000	34.83441	6.72964	0.90199	53.00	
053	TAPER	34.83441	6.72964	35.37724	7.45000	0.90199	53.00	
054	CYL	35.37724	7.45000	35.70650	7.45000	0.32926	0.00	
055	TAPER	35.70650	7.45000	36.24933	6.72964	0.90199	53.00	
056	TAPER	36.24933	6.72964	36.79216	7.45000	0.90199	53.00	
057	CYL	36.79216	7.45000	37.12141	7.45000	0.32926	0.00	
058	TAPER	37.12141	7.45000	37.66424	6.72964	0.90199	53.00	
059	TAPER	37.66424	6.72964	38.20707	7.45000	0.90199	53.00	
060	CYL	38.20707	7.45000	38.53633	7.45000	0.32926	0.00	
061	TAPER	38.53633	7.45000	39.07915	6.72964	0.90199	53.00	
062	TAPER	39.07915	6.72964	39.62198	7.45000	0.90199	53.00	
063	CYL	39.62198	7.45000	42.96995	7.45000	3.34797	0.00	
064	ARC	42.96995	7.45000	43.78323	5.47033	2.14360		R11.00000
065	ARC	43.78323	5.47033	44.64504	4.82973	1.15059		R0.90000
066	ARC	44.64504	4.82973	45.40536	5.24814	0.90556		R0.90000
067	TAPER	45.40536	5.24814	46.67301	7.24950	2.36904	57.65	
068	ARC	46.67301	7.24950	47.12331	7.48117	0.53102		R0.50000
069	TAPER	47.12331	7.48117	49.04840	7.37354	1.92810	3.20	
070	TAPER	49.04840	7.37354	49.75000	7.10000	0.75304	21.30	
071	TAPER	49.75000	7.10000	50.43300	7.24829	0.69891	12.25	
072	TAPER	50.43300	7.24829	51.47054	6.50000	1.27923	35.80	
073	CYL	51.47054	6.50000	51.60357	6.50000	0.13303	0.00	
074	TAPER	51.60357	6.50000	52.01261	7.20000	0.81075	59.70	
075	CYL	52.01261	7.20000	52.51720	7.20000	0.50459	0.00	
076	TAPER	52.51720	7.20000	53.48778	6.50000	1.19667	35.80	
077	CYL	53.48778	6.50000	53.62081	6.50000	0.13303	0.00	
078	TAPER	53.62081	6.50000	54.02985	7.20000	0.81075	59.70	
079	CYL	54.02985	7.20000	54.53444	7.20000	0.50459	0.00	
080	TAPER	54.53444	7.20000	55.50502	6.50000	1.19667	35.80	
081	CYL	55.50502	6.50000	55.63805	6.50000	0.13303	0.00	
082	TAPER	55.63805	6.50000	56.04709	7.20000	0.81075	59.70	
083	CYL	56.04709	7.20000	56.55168	7.20000	0.50459	0.00	
084	TAPER	56.55168	7.20000	57.52226	6.50000	1.19667	35.80	
085	CYL	57.52226	6.50000	57.65529	6.50000	0.13303	0.00	
086	TAPER	57.65529	6.50000	58.06433	7.20000	0.81075	59.70	
087	CYL	58.06433	7.20000	58.56892	7.20000	0.50459	0.00	
088	TAPER	58.56892	7.20000	59.53950	6.50000	1.19667	35.80	
089	CYL	59.53950	6.50000	59.67253	6.50000	0.13303	0.00	
090	TAPER	59.67253	6.50000	60.08157	7.20000	0.81075	59.70	
091	CYL	60.08157	7.20000	60.58616	7.20000	0.50459	0.00	
092	TAPER	60.58616	7.20000	61.55674	6.50000	1.19667	35.80	
093	CYL	61.55674	6.50000	61.68977	6.50000	0.13303	0.00	
094	TAPER	61.68977	6.50000	62.09881	7.20000	0.81075	59.70	
095	CYL	62.09881	7.20000	62.60340	7.20000	0.50459	0.00	
096	TAPER	62.60340	7.20000	63.57398	6.50000	1.19667	35.80	

SEGMENTS 001-096 OF 168




PART	2 LARGE NUT	SHEET	7 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0	DATUM B AXIS		

ORDERED +R PROFILE, HEAD FACE TO TIP. REVOLVE ABOUT DATUM B. MILLIMETRES TO 0.00001. ANGLE IS FROM THE AXIS.

#	KIND	Z1	R1	Z2	R2	LENGTH	ANGLE	ARC
097	CYL	63.57398	6.50000	63.70701	6.50000	0.13303	0.00	
098	TAPER	63.70701	6.50000	64.11605	7.20000	0.81075	59.70	
099	CYL	64.11605	7.20000	64.62064	7.20000	0.50459	0.00	
100	TAPER	64.62064	7.20000	65.59122	6.50000	1.19667	35.80	
101	CYL	65.59122	6.50000	65.72425	6.50000	0.13303	0.00	
102	TAPER	65.72425	6.50000	66.13329	7.20000	0.81075	59.70	
103	CYL	66.13329	7.20000	66.63788	7.20000	0.50459	0.00	
104	TAPER	66.63788	7.20000	67.60846	6.50000	1.19667	35.80	
105	CYL	67.60846	6.50000	67.74149	6.50000	0.13303	0.00	
106	TAPER	67.74149	6.50000	68.15053	7.20000	0.81075	59.70	
107	CYL	68.15053	7.20000	68.65512	7.20000	0.50459	0.00	
108	TAPER	68.65512	7.20000	69.62570	6.50000	1.19667	35.80	
109	CYL	69.62570	6.50000	69.75873	6.50000	0.13303	0.00	
110	TAPER	69.75873	6.50000	70.16777	7.20000	0.81075	59.70	
111	CYL	70.16777	7.20000	70.67236	7.20000	0.50459	0.00	
112	TAPER	70.67236	7.20000	71.64294	6.50000	1.19667	35.80	
113	CYL	71.64294	6.50000	71.77597	6.50000	0.13303	0.00	
114	TAPER	71.77597	6.50000	72.18501	7.20000	0.81075	59.70	
115	CYL	72.18501	7.20000	72.68960	7.20000	0.50459	0.00	
116	TAPER	72.68960	7.20000	73.66018	6.50000	1.19667	35.80	
117	CYL	73.66018	6.50000	73.79321	6.50000	0.13303	0.00	
118	TAPER	73.79321	6.50000	74.20225	7.20000	0.81075	59.70	
119	CYL	74.20225	7.20000	74.70684	7.20000	0.50459	0.00	
120	TAPER	74.70684	7.20000	75.67742	6.50000	1.19667	35.80	
121	CYL	75.67742	6.50000	75.81045	6.50000	0.13303	0.00	
122	TAPER	75.81045	6.50000	76.21949	7.20000	0.81075	59.70	
123	CYL	76.21949	7.20000	76.72408	7.20000	0.50459	0.00	
124	TAPER	76.72408	7.20000	77.69466	6.50000	1.19667	35.80	
125	CYL	77.69466	6.50000	77.82769	6.50000	0.13303	0.00	
126	TAPER	77.82769	6.50000	78.23673	7.20000	0.81075	59.70	
127	CYL	78.23673	7.20000	78.74132	7.20000	0.50459	0.00	
128	TAPER	78.74132	7.20000	79.71190	6.50000	1.19667	35.80	
129	CYL	79.71190	6.50000	79.84493	6.50000	0.13303	0.00	
130	TAPER	79.84493	6.50000	80.25397	7.20000	0.81075	59.70	
131	CYL	80.25397	7.20000	80.75856	7.20000	0.50459	0.00	
132	TAPER	80.75856	7.20000	81.72914	6.50000	1.19667	35.80	
133	CYL	81.72914	6.50000	81.86217	6.50000	0.13303	0.00	
134	TAPER	81.86217	6.50000	82.27121	7.20000	0.81075	59.70	
135	CYL	82.27121	7.20000	82.75871	7.20000	0.48749	0.00	
136	TAPER	82.75871	7.20000	83.72928	6.50000	1.19667	35.80	
137	CYL	83.72928	6.50000	83.86231	6.50000	0.13303	0.00	
138	TAPER	83.86231	6.50000	84.27136	7.20000	0.81075	59.70	
139	CYL	84.27136	7.20000	84.75885	7.20000	0.48749	0.00	
140	TAPER	84.75885	7.20000	85.72943	6.50000	1.19667	35.80	
141	CYL	85.72943	6.50000	85.86246	6.50000	0.13303	0.00	
142	TAPER	85.86246	6.50000	86.27150	7.20000	0.81075	59.70	
143	CYL	86.27150	7.20000	86.75900	7.20000	0.48749	0.00	
144	TAPER	86.75900	7.20000	87.72957	6.50000	1.19667	35.80	

#	KIND	Z1	R1	Z2	R2	LENGTH	ANGLE	ARC
145	CYL	87.72957	6.50000	87.86260	6.50000	0.13303	0.00	
146	TAPER	87.86260	6.50000	88.27165	7.20000	0.81075	59.70	
147	CYL	88.27165	7.20000	88.75914	7.20000	0.48749	0.00	
148	TAPER	88.75914	7.20000	89.72971	6.50000	1.19667	35.80	
149	CYL	89.72971	6.50000	89.86274	6.50000	0.13303	0.00	
150	TAPER	89.86274	6.50000	90.27179	7.20000	0.81075	59.70	
151	CYL	90.27179	7.20000	90.75929	7.20000	0.48749	0.00	
152	TAPER	90.75929	7.20000	91.72986	6.50000	1.19667	35.80	
153	CYL	91.72986	6.50000	91.86289	6.50000	0.13303	0.00	
154	TAPER	91.86289	6.50000	92.27194	7.20000	0.81075	59.70	
155	CYL	92.27194	7.20000	92.75943	7.20000	0.48749	0.00	
156	TAPER	92.75943	7.20000	93.73000	6.50000	1.19667	35.80	
157	CYL	93.73000	6.50000	93.86303	6.50000	0.13303	0.00	
158	TAPER	93.86303	6.50000	94.27208	7.20000	0.81075	59.70	
159	CYL	94.27208	7.20000	94.75957	7.20000	0.48749	0.00	
160	TAPER	94.75957	7.20000	95.73015	6.50000	1.19667	35.80	
161	CYL	95.73015	6.50000	95.86318	6.50000	0.13303	0.00	
162	TAPER	95.86318	6.50000	96.27223	7.20000	0.81075	59.70	
163	CYL	96.27223	7.20000	96.75972	7.20000	0.48749	0.00	
164	TAPER	96.75972	7.20000	97.73029	6.50000	1.19667	35.80	
165	CYL	97.73029	6.50000	97.86332	6.50000	0.13303	0.00	
166	TAPER	97.86332	6.50000	98.14164	6.97628	0.55163	59.70	
167	TAPER	98.14164	6.97628	100.62044	5.55597	2.05607	29.812	
168	FACE	100.62044	5.55597	100.62044	0.00000	5.55597	90.00	

SEGMENTS 097–168 OF 168



PART	2 LARGE NUT	SHEET	8 / 8
FILE	2 large nut.STEP	UNITS	MILLIMETRES
DATUM A HEAD FACE Z = 0		DATUM B AXIS	