

Setup Configuration

Scope Details			
Scope Model Number	Scope Serial Number	TekScope Version	Scope Calibration Status
MSO64B	C069984	2.0.3	Pass


Waveform Histogram Results

No Waveform Histogram Results Available

Measurement Results


Name	Meas	Sources	Mean'	Min'	Max'	Pk-Pk'	Std Dev'	Pop'	Accum Mean	Accum Min	Accum Max	Accum Pk-Pk	Accum Std Dev	Accum Pop
Meas1	TIE	Ch 2	3.2175 as	-8.1844 ps	7.8749 ps	16.059 ps	2.0458 ps	12287	202.43 zs	-10.884 ps	11.011 ps	21.895 ps	2.0700 ps	6720989
Meas2	TIE	Ch 3	5.4504 as	-7.9850 ps	7.7369 ps	15.722 ps	2.2905 ps	12288	7.6674 zs	-11.654 ps	10.724 ps	22.378 ps	2.2420 ps	6721536
Meas 3	JS: TIE(σ)	Ch 3	5.4504 as	-7.9850 ps	7.7369 ps	15.722 ps	2.2905 ps	12288	7.6674 zs	-11.654 ps	10.724 ps	22.378 ps	2.2420 ps	6721536
	JS: TJ@	Ch 3	29.421 ps	29.421 ps	29.421 ps	0.0000 s	0.0000 s	1	29.049 ps	15.371 ps	30.887 ps	15.516 ps	1.7855 ps	547
	JS: EW@	Ch 3	8.1086 ns	8.1086 ns	8.1086 ns	0.0000 s	0.0000 s	1	8.1090 ns	8.1071 ns	8.1226 ns	15.516 ps	1.7855 ps	547
	JS: RJ-dd	Ch 3	1.8748 ps	1.8748 ps	1.8748 ps	0.0000 s	0.0000 s	1	1.8323 ps	961.38 fs	1.9192 ps	957.79 fs	113.49 fs	547
	JS: DJ-dd	Ch 3	3.0443 ps	3.0443 ps	3.0443 ps	0.0000 s	0.0000 s	1	3.2700 ps	1.7435 ps	4.3925 ps	2.6490 ps	406.82 fs	547
	JS: PJ	Ch 3	5.8706 ps	5.8706 ps	5.8706 ps	0.0000 s	0.0000 s	1	5.6974 ps	3.0556 ps	7.3997 ps	4.3441 ps	614.40 fs	547
	JS: DDJ	Ch 3	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	1	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	547
Meas 4	JS: DCD	Ch 3	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	1	24.278 fs	0.0000 s	364.52 fs	364.52 fs	59.986 fs	547
	JS: TIE(σ)	Ch 2	3.2175 as	-8.1844 ps	7.8749 ps	16.059 ps	2.0458 ps	12287	202.43 zs	-10.884 ps	11.011 ps	21.895 ps	2.0700 ps	6720989
	JS: TJ@	Ch 2	27.532 ps	27.532 ps	27.532 ps	0.0000 s	0.0000 s	1	27.967 ps	26.746 ps	29.328 ps	2.5815 ps	477.40 fs	547
	JS: EW@	Ch 2	8.1105 ns	8.1105 ns	8.1105 ns	0.0000 s	0.0000 s	1	8.1101 ns	8.1087 ns	8.1113 ns	2.5815 ps	477.40 fs	547
	JS: RJ-dd	Ch 2	1.8452 ps	1.8452 ps	1.8452 ps	0.0000 s	0.0000 s	1	1.8400 ps	1.7698 ps	1.9214 ps	151.63 fs	26.204 fs	547
	JS: DJ-dd	Ch 2	1.5716 ps	1.5716 ps	1.5716 ps	0.0000 s	0.0000 s	1	2.0799 ps	1.3638 ps	3.2198 ps	1.8560 ps	322.64 fs	547
	JS: PJ	Ch 2	3.5570 ps	3.5570 ps	3.5570 ps	0.0000 s	0.0000 s	1	4.2178 ps	2.7463 ps	5.7922 ps	3.0459 ps	489.71 fs	547
	JS: DDJ	Ch 2	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	1	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	547
	JS: DCD	Ch 2	0.0000 s	0.0000 s	0.0000 s	0.0000 s	0.0000 s	1	23.468 fs	0.0000 s	307.10 fs	307.10 fs	57.949 fs	547

Views
Time Domain View

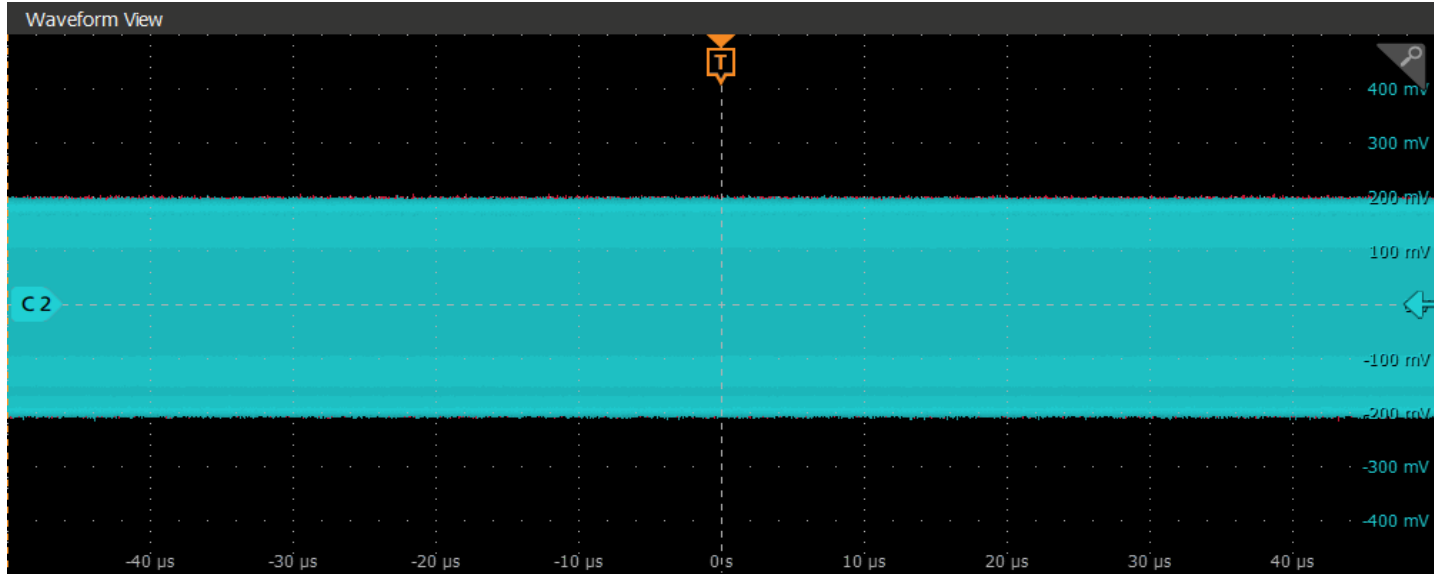

Plots


Plot 7 - TIE Histogram (Meas 4)

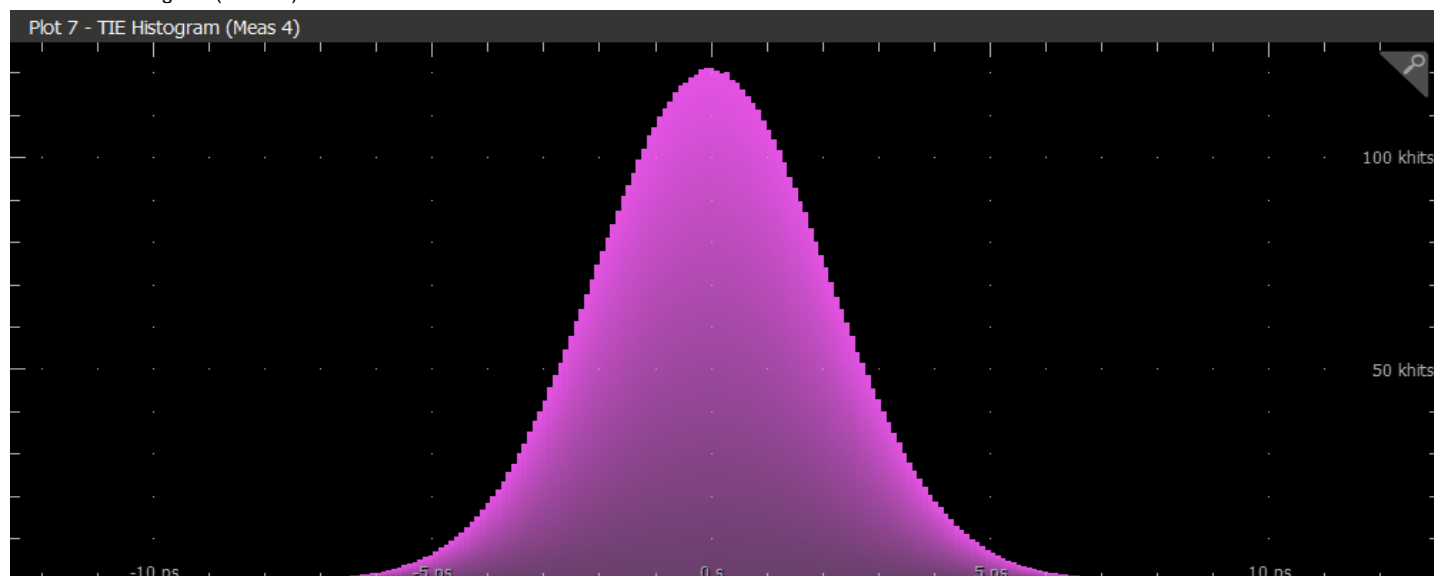


Plot 6 - TIE Spectrum (Meas 4)



Plot 5 - Eye Diagram (Meas 4)

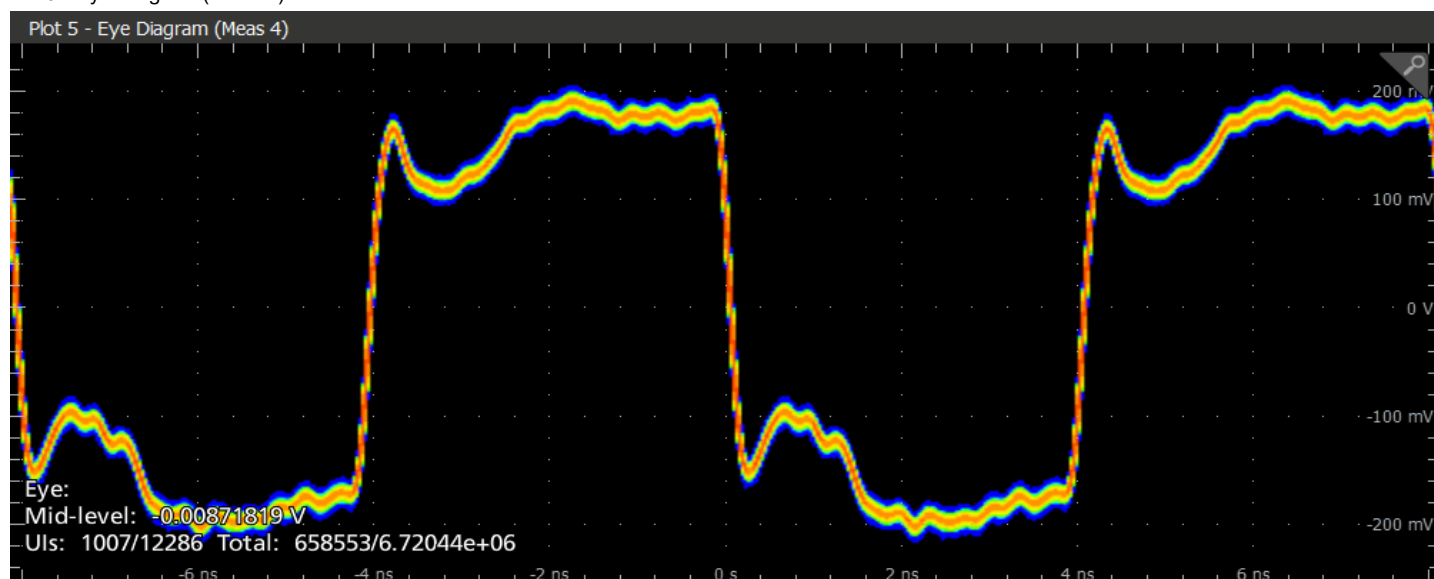


Plot 3 - TIE Histogram (Meas 3)

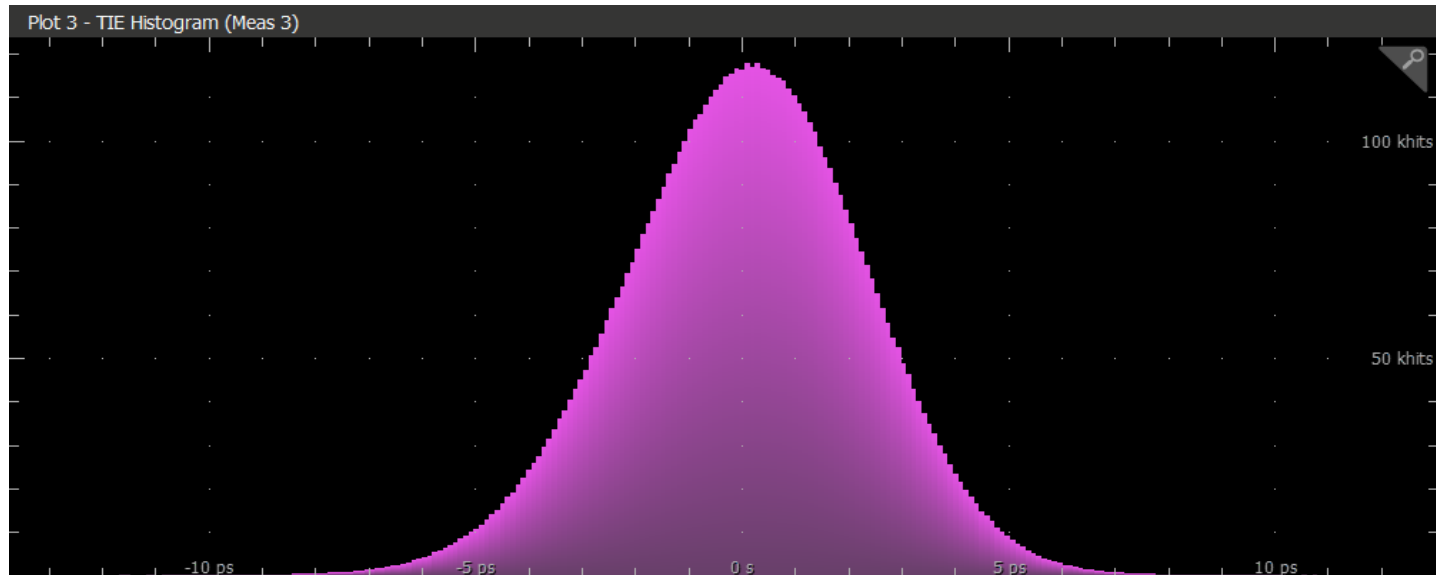

Plot 2 - TIE Spectrum (Meas 3)



Plot 1 - Eye Diagram (Meas 3)

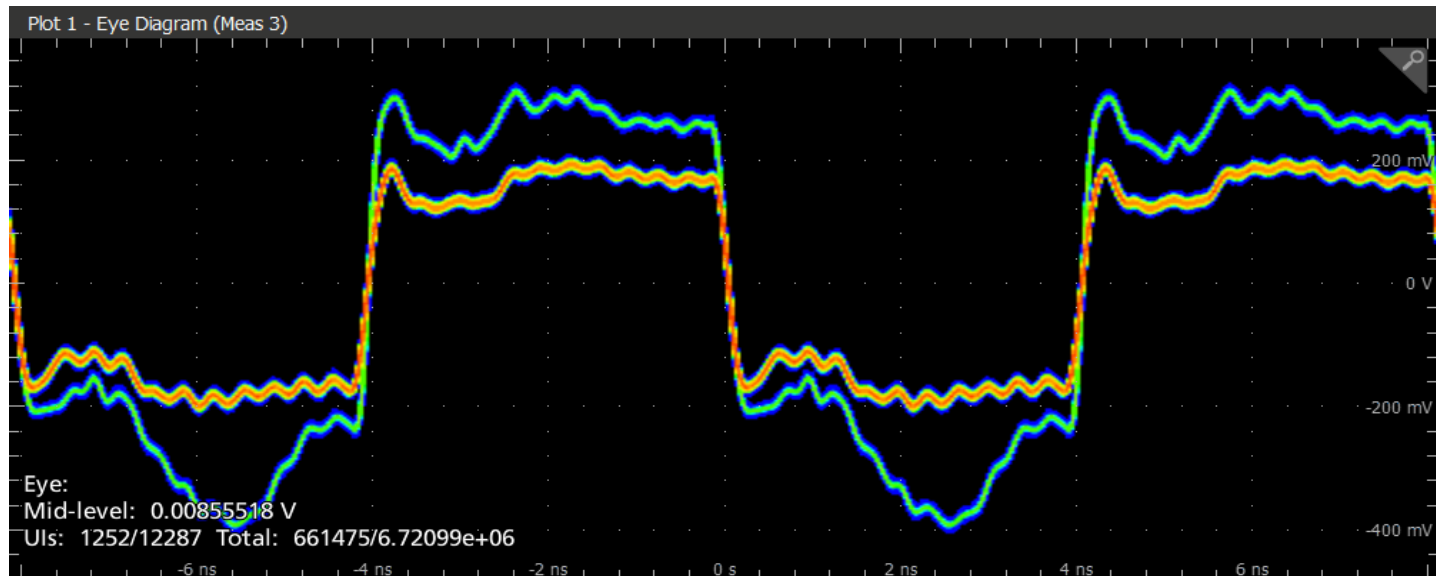

Global Configuration

Standard Configuration

Standard Configuration		Standard	Jitter Separation	Dual Dirac Model	Jitter Reference	Lock RJ	Jitter Analysis
Gating	Display Unit Type	Reference Levels	Model		Levels		Method
Gating	Display Unit Type	Standard	Jitter Separation	Dual Dirac Model	Jitter Reference	Lock RJ	Jitter Analysis
		Reference Levels	Model		Levels		Method
None	Seconds	Every Acquisition	SpectralOnly	PCIExpress	First Acquisition	False	JitterOnly

Reference Levels Configuration

Ref Levels	Ch 2, Ch 3
Ref Level Type	Global
Base Top Method	Automatic
RiseHigh	90%
RiseMid	50%
RiseLow	10%
FallHigh	90%
FallMid	50%
FallLow	10%
Hysteresis	5%

Individual Measurement Configuration

Meas1 - TIE											
Ref Levels		ClockRecovery		Edge		Filter		Configurations		Gating	
Ref Level Type	Global	Method	Constant Clock	Signal Type	Auto	Filter Spec-High Pass(F1)	No Filter	Custom Measureme nt Name	TIE	Gating Type	None
Source(s)	Ch 2	Mode	Mean	Clock Edge	RisingEdge	Filter Spec-Low Pass(F2)	No Filter				
		Calculated On	Every Acquisition								

Meas2 - TIE											
Ref Levels		ClockRecovery		Edge		Filter		Configurations		Gating	
Ref Level Type	Global	Method	Constant Clock	Signal Type	Auto	Filter Spec-High Pass(F1)	No Filter	Custom Measureme nt Name	TIE	Gating Type	None
Source(s)	Ch 3	Mode	Mean	Clock Edge	RisingEdge	Filter Spec-Low Pass(F2)	No Filter				
		Calculated On	Every Acquisition								

Meas 3 - Jitter Summary										
Ref Levels		ClockRecovery		Filter		Configurations		Gating		
Ref Level Type	Global	Method	Constant Clock	Filter Spec-High Pass(F1)	No Filter	Custom Measurement Name	Jitter Summary	Gating Type	None	
Source(s)	Ch 3	Mode	Mean	Filter Spec-Low Pass(F2)	No Filter					
		Calculated On	Every Acquisition							

Meas 4 - Jitter Summary										
Ref Levels		ClockRecovery		Filter		Configurations		Gating		
Ref Level Type	Global	Method	Constant Clock	Filter Spec-High Pass(F1)	No Filter	Custom Measurement Name	Jitter Summary	Gating Type	None	
Source(s)	Ch 2	Mode	Mean	Filter Spec-Low Pass(F2)	No Filter					
		Calculated On	Every Acquisition							