Inspection report, Final: PO003007

KS105293-HAUTE RED: BINA BELT

Online report

1st inspection

Inspector	QC-JOJO Chen	Inspection Date	Dec 15, 2025
Sample Qty	80	Order Qty	800
Location	29° 21' 10" N x 120° 3' 47" E	Checklist Name	Final
Planned Date	Dec 15, 2025	Sampling Method	AQL 2.5/4 Level II
Supplier Name	10 FASHION		

Inspector Conclusion	Rejected	Reasons for Bulk Order Rejection: 1. The logo orientation of the bulk order is inconsistent with the confirmed sample; the logo letters are printed upside down. 2. The logo printing on the bulk order is blurry, and the letters are unclear or discontinuous; re-inspection is required. 3. Belts with rough edges or peeling need to be re-inspected and repaired. 4. Belts have scratches or abrasions; it is recommended to pack them individually in long plastic bags. The above issues require return for reprocessing. (Automatic translation)

SUMMARY

	PO003007:KS105293-HAUTE RED
1 Factory details	
2 Quantity Check	
3 Product	
3.5 Workmanship	1
4 On-site Test	
5 Pack and Packaging	

1 The logo printing direction is inconsistent between the bulk order and the confirmed sample; the logo letters on the bulk order are printed upside down.

The cherry on the front is facing the same direction, while the logo and lettering on the back of the belt are printed upside down.

The logo letters on the truck were printed upside down.

	CRITICAL	MAJOR	MINOR
F9 Printing problem.	-	7	-
F9 Printing problem.	-	-	General Defect
F5 Coarse/thick Yarn.	-	-	10
F13 Scratch marks / cracks in surface.	-	-	8
W3 Stitch, Broken or defect.	-	-	3
F8 Dying problem.	-	-	2
W1 Threads, untrimmed.	-	-	1
TOTAL	**0**	**7**	**24**
AQL MAX	**0**	**5**	**7**

DEFECTS: 31

1	**F9 Printing problem. The print is blurry, the colors are mismatched, and the lettering is unclear.** **(Automatic translation)**	MAJOR Items affected: 7

2	**F9 Printing problem. The logo printing direction is inconsistent between the bulk order and the confirmed sample; the logo letters on the bulk order are printed upside down.** **(Automatic translation)**	MINOR General Defect

3	**F5 Coarse/thick Yarn. The edges are not smooth and there is peeling.** **(Automatic translation)**	MINOR Items affected: 10

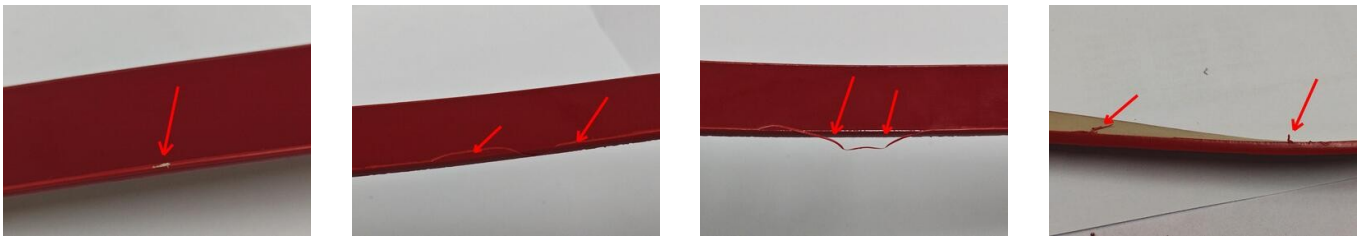

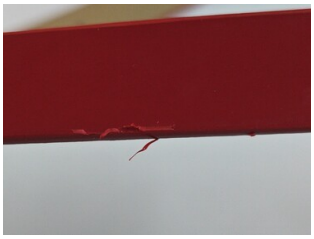
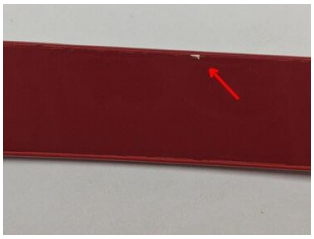
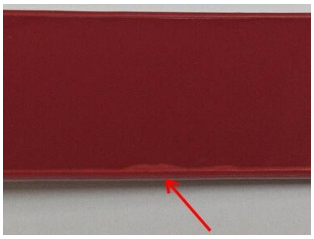

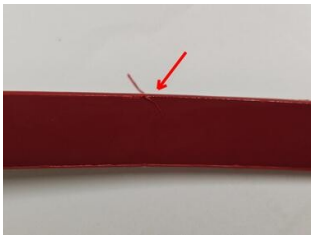
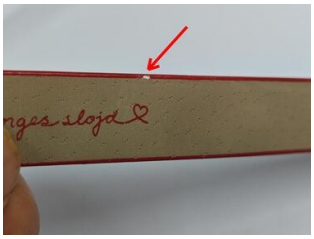

4	**F13 Scratch marks / cracks in surface. -**	MINOR Items affected: 8

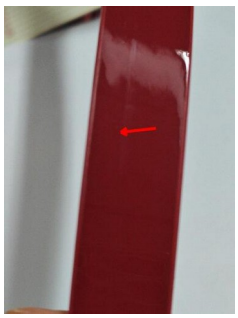
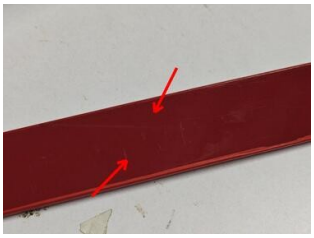
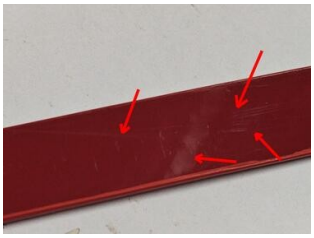

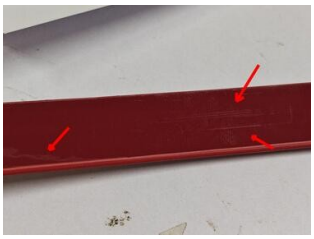
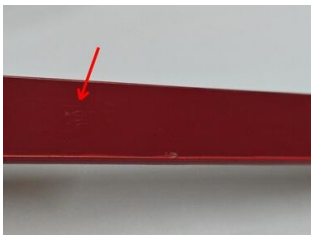
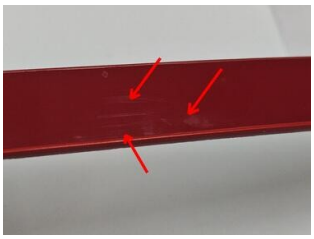

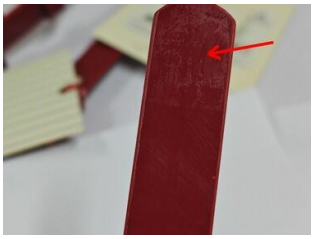
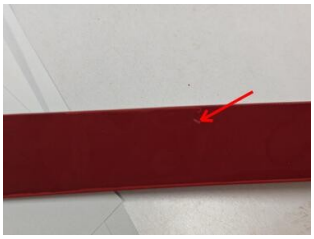

5	W3 Stitch, Broken or defect. -	MINOR Items affected: 3

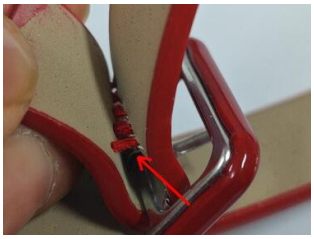

6	F8 Dying problem. Uneven surface color (Automatic translation)	MINOR Items affected: 2

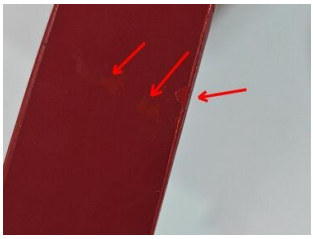

7	W1 Threads, untrimmed. -	MINOR Items affected: 1

CHECKPOINTS: 24

1	Factory details	

1.1	Factory name at the location for QC (not supplier name)	OK

Factory Name:

义乌萌萱贸易有限公司

Factory Address:

浙江省金华市义乌市柳青路 1565 号

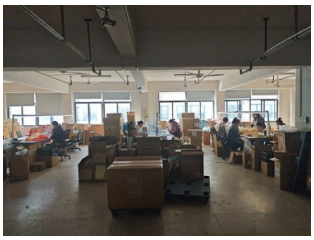

2	**Quantity Check**	

2.1	**Warehouse / carton piled view**	**OK**

2.2	**Production quantity match PO**	**OK**
	Bulk order quantity: 800 pieces Bulk packing quantity: 800 pieces (Automatic translation)	

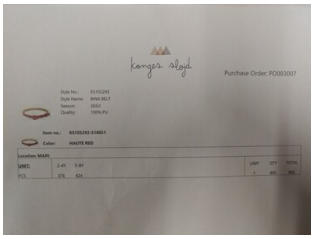

3	**Product**	

3.1	**Product compare against approved sample / color swatch/TECH file**	**OK**

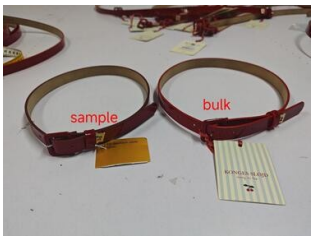

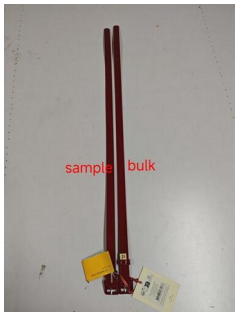

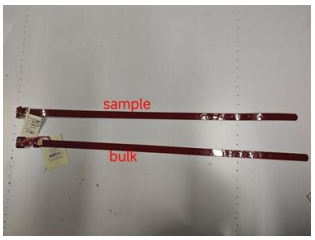

3.2	**Labelling (hangtag, main label, size label, care label, tracking label)**	**OK**

2-4Y: (376)

Barcode can be scanned	OK
Scanned barcode	5715681262276
Barcode from order data	5715681262276
Scanned format	EAN_13

5-8Y: (424)

Barcode can be scanned	OK
Scanned barcode	5715681262283
Barcode from order data	5715681262283
Scanned format	EAN_13

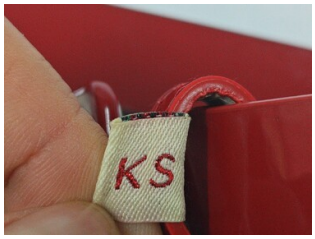

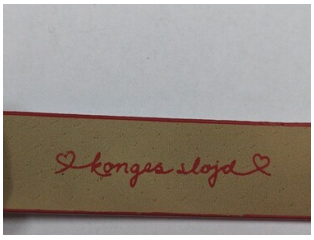

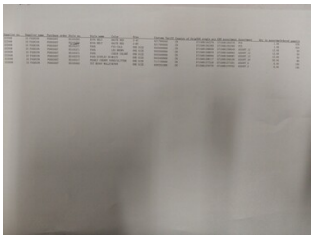

3.3	**Embriodery / Printing check**	**OK**

The logo orientation of the bulk order and the confirmed sample is inconsistent; the logo on the bulk order is printed upside down.

3.4	**Lace / Trimming / Accessories check**	**OK**

3.5	**Workmanship**	**Not OK**
	The logo printing direction is inconsistent between the bulk order and the confirmed sample; the logo letters on the bulk order are printed upside down. (Automatic translation)	

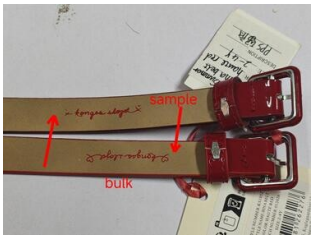

The cherry on the front is facing the same direction, while the logo and lettering on the back of the belt are printed upside down.

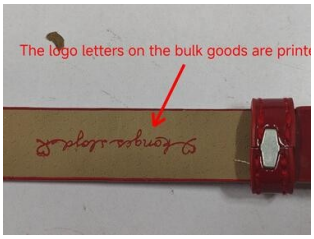

The logo letters on the truck were printed upside down.

3.6	Measurement

Measurement-2-4Y	Specification	Tolerance	Actual
BELT LENGTH FROM BUCKLE TO CENTRA HOLE (cm)	59.00	-	0.5

Measurement-5-8Y	Specification	Tolerance	Actual
BELT LENGTH FROM BUCKLE TO CENTRA HOLE (cm)	64.00	-	0.5

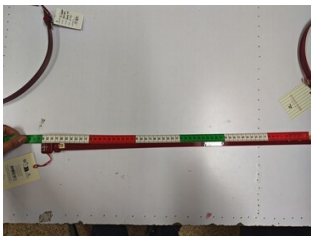
2-4Y length 59.5 cm

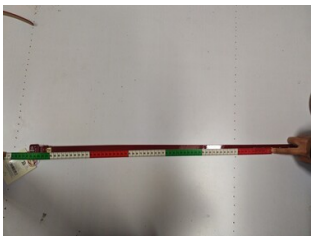
5-8Y, length 64.5 cm

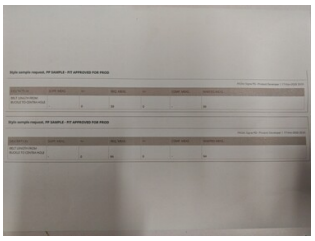

4	On-site Test	

4.1	Metal detection

4.2	Pull test	OK

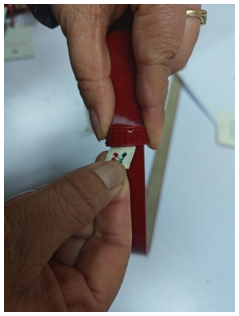

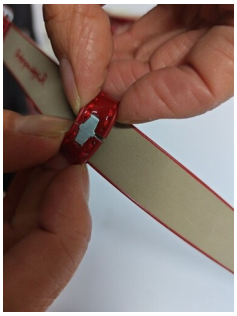

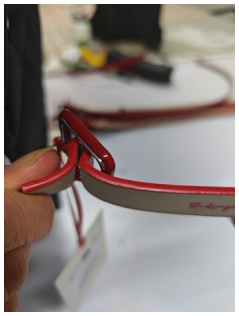

4.3	Smell check	OK

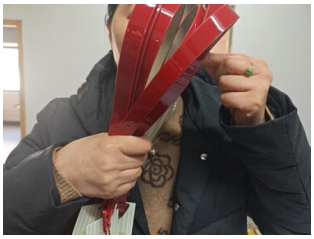

4.4	Humidity check

4.5	Garment weight (sweater only)

4.6	Prove of color fastness test from supplier	OK

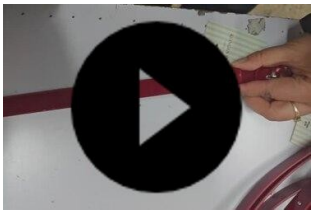

4.7	The product is packed in poly bag or carton. Supplier can't send products without packaging.	OK

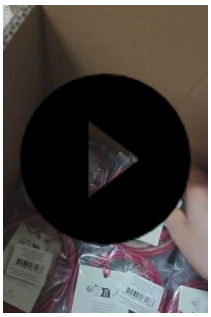

5	Pack and Packaging	

5.1	Approved sample/QA file available during inspection	OK

Confirmation sample provided by the factory

5.2	**Export carton (shipping mark, barcode)**	**OK**

Barcode can be scanned	
Scanned barcode	
Barcode from order data	
Scanned format	

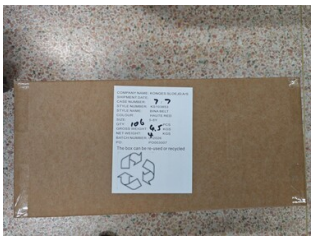

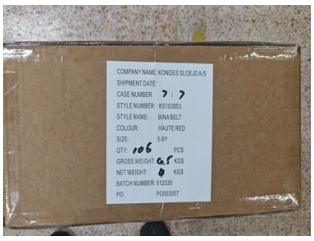

5.3	**Export carton (dimension, weight)**	**OK**

	Specification	Tolerance	Actual
L	-	-	45
W	-	-	30
H	-	-	20
Gross Weight	-	-	4.5

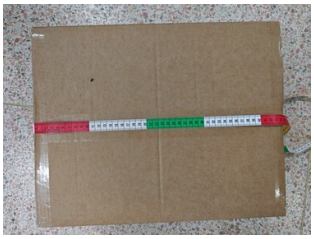

5.4	Carton Packing (quantity, ratio etc), 3 ply carton	OK

5.5	Inner package (polybag, sticker, tissue paper, silica gel etc)	OK

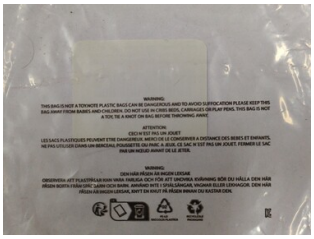

5.6	Hanger (quality, size etc)

5.7	Header card

5.8	Products are in polybags	OK

COMMENTS

QC-JOJO Chen Dec 27, 2025 03:15

Re-inspection scheduled

QC-JOJO Chen Inspector's conclusion Dec 15, 2025 07:47

Reasons for Bulk Order Rejection:

1. The logo orientation of the bulk order is inconsistent with the confirmed sample; the logo letters are printed upside down.

2. The logo printing on the bulk order is blurry, and the letters are unclear or discontinuous; re-inspection is required.

3. Belts with rough edges or peeling need to be re-inspected and repaired.

4. Belts have scratches or abrasions; it is recommended to pack them individually in long plastic bags.

The above issues require return for reprocessing.