

Oakter - MTD Report - 1st Jan 2026 to 30th Jan 2026

Phase	Total	Pass	Fail
SCRAP_PCB	20	0	20
TRC_REJECTION	40	40	0
PCB_REJECTION	39	39	0
VOLTAGE_PCB	3506	3506	0
PERIPHERAL	3524	3524	0
PCB_MAPPING	3509	3509	0
AGEING	3966	3945	21
NIC_MAPPING	2648	2648	0
PACKGING	2666	2666	0
MASTER_CARTON	3010	3010	0

VOLTAGE_PCB

Total Pass	Total Fail
3506	0

No failed items recorded for this phase.

PCB_MAPPING

Total Pass	Total Fail
3765	0

No failed items recorded for this phase.

AGEING

Total Pass	Total Fail
3945	21

Identifier	Failure Reason
MZ2022744	,Drift: [71.11s], Allowed: [14.35s], Read Time: [1/24/2026 3:30:18 PM], Meter Time: [1/24/2026 3:31:30 PM], RCR2 Reg: [121]

Identifier	Failure Reason
MZ2022799	,Drift: [12.40s], Allowed: [4.31s], Read Time: [1/17/2026 9:58:24 PM], Meter Time: [1/17/2026 9:58:37 PM], RCR2 Reg: [121]

Identifier	Failure Reason
MZ2023047	Energy Range Cumm KVAh Fail Found 63818.6764831543 Expected between Start Meter 99977.9595634937 and End Meter 64125.2044677734 Energy Range Cumm KVAh Fail Found 63818.6764831543 (-36.1672545011038%) Expected between Previous Meter 99977.9595634937 and Range 89980.1636071443
Identifier	Failure Reason
MZ2023463	,Drift: [20.43s], Allowed: [5.02s], Read Time: [1/27/2026 7:48:27 PM], Meter Time: [1/27/2026 7:48:48 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023486	,Drift: [21.00s], Allowed: [5.02s], Read Time: [1/27/2026 7:50:00 PM], Meter Time: [1/27/2026 7:50:21 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023525	,Drift: [24.52s], Allowed: [5.01s], Read Time: [1/27/2026 7:41:09 PM], Meter Time: [1/27/2026 7:41:34 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023530	,Drift: [22.94s], Allowed: [5.02s], Read Time: [1/27/2026 7:47:25 PM], Meter Time: [1/27/2026 7:47:48 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023532	,Drift: [82.05s], Allowed: [14.43s], Read Time: [1/27/2026 3:22:14 PM], Meter Time: [1/27/2026 3:23:37 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023546	,Drift: [79.89s], Allowed: [14.46s], Read Time: [1/27/2026 3:52:37 PM], Meter Time: [1/27/2026 3:53:57 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023599	,Drift: [80.84s], Allowed: [15.38s], Read Time: [1/28/2026 11:28:30 AM], Meter Time: [1/28/2026 11:29:51 AM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023688	,Drift: [75.03s], Allowed: [15.12s], Read Time: [1/28/2026 11:25:17 AM], Meter Time: [1/28/2026 11:26:33 AM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023731	,Drift: [79.44s], Allowed: [14.22s], Read Time: [1/27/2026 7:35:31 PM], Meter Time: [1/27/2026 7:36:51 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023826	,Drift: [69.67s], Allowed: [12.84s], Read Time: [1/27/2026 11:24:49 AM], Meter Time: [1/27/2026 11:25:59 AM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023828	,Drift: [73.08s], Allowed: [12.83s], Read Time: [1/27/2026 11:15:25 AM], Meter Time: [1/27/2026 11:16:39 AM], RCR2 Reg: [121]

Identifier	Failure Reason
MZ2023837	,Drift: [66.20s], Allowed: [12.83s], Read Time: [1/27/2026 11:19:50 AM], Meter Time: [1/27/2026 11:20:57 AM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023905	,Drift: [70.00s], Allowed: [12.77s], Read Time: [1/27/2026 3:32:21 PM], Meter Time: [1/27/2026 3:33:32 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023923	,Drift: [68.46s], Allowed: [12.98s], Read Time: [1/27/2026 6:19:37 PM], Meter Time: [1/27/2026 6:20:46 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023934	,Drift: [64.37s], Allowed: [12.88s], Read Time: [1/27/2026 4:12:31 PM], Meter Time: [1/27/2026 4:13:36 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023941	,Drift: [64.92s], Allowed: [12.86s], Read Time: [1/27/2026 3:30:07 PM], Meter Time: [1/27/2026 3:31:12 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023947	,Drift: [63.91s], Allowed: [12.89s], Read Time: [1/27/2026 4:03:28 PM], Meter Time: [1/27/2026 4:04:32 PM], RCR2 Reg: [121]
Identifier	Failure Reason
MZ2023950	,Drift: [14.18s], Allowed: [13.00s], Read Time: [1/27/2026 6:22:51 PM], Meter Time: [1/27/2026 6:22:37 PM], RCR2 Reg: [73]

NIC_MAPPING

Total Pass	Total Fail
2648	0

No failed items recorded for this phase.

PERIPHERIAL

Total Pass	Total Fail
3524	0

No failed items recorded for this phase.

PACKGING

Total Pass	Total Fail
2666	0

No failed items recorded for this phase.

MASTER_CARTON


Total Pass	Total Fail
3010	0

No failed items recorded for this phase.


SCRAP_PCB

Total Pass	Total Fail
0	20

Identifier	Failure Reason
340/W/AE0136/V8-18/1P4G/0725/14382	Scrap Rejection [W4 SMT TRACK DAMAGE]

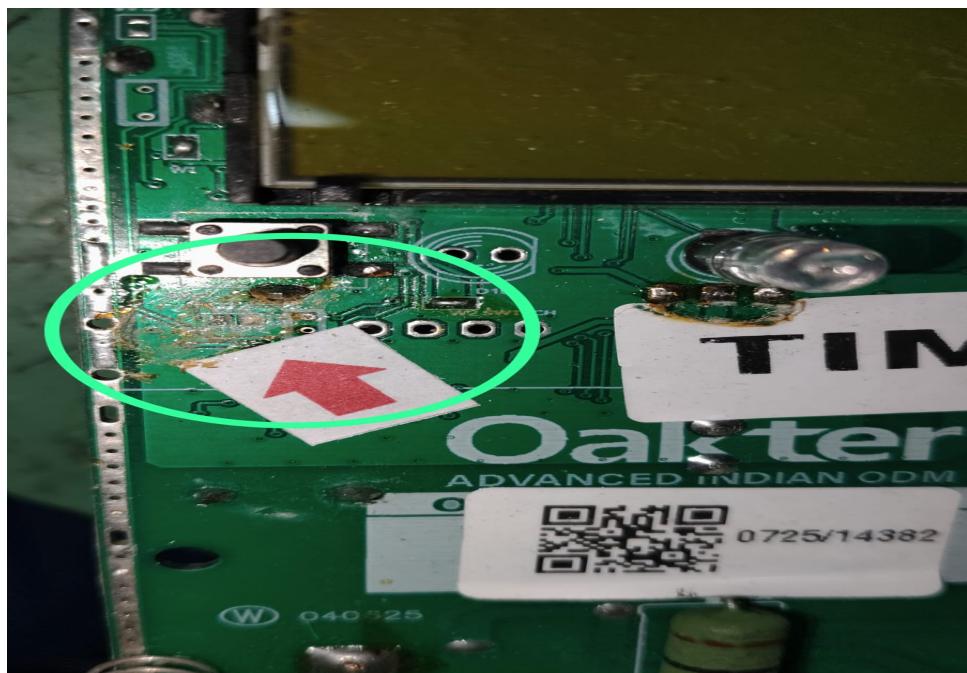


Identifier	Failure Reason
340/W/AE0136/V8-18/1P4G/0725/15587	Scrap Rejection [Track damage]

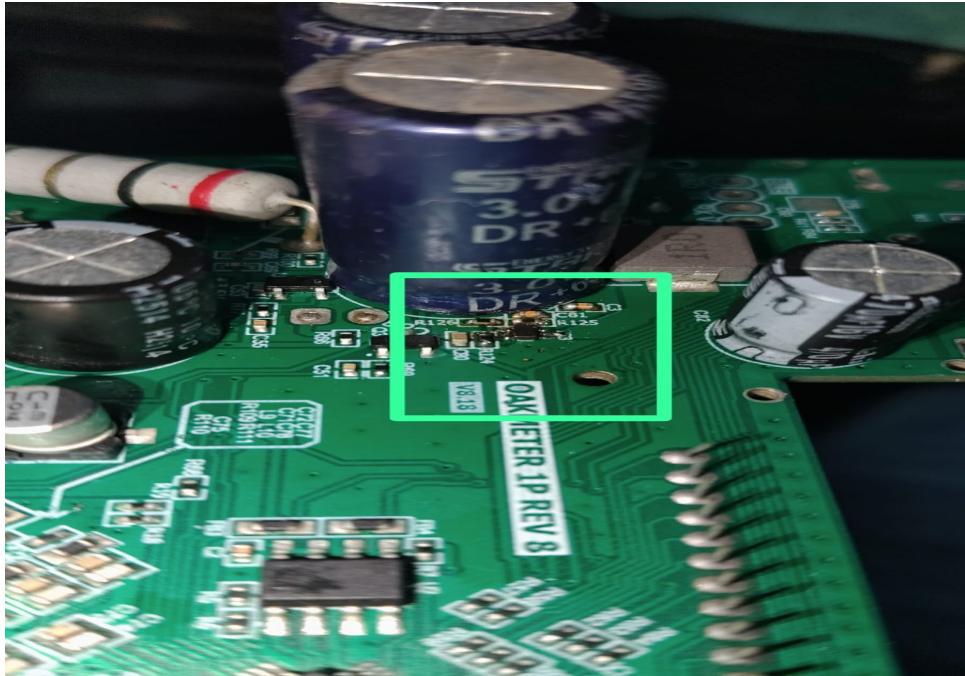


Identifier	Failure Reason
340/W/AE0136/V8-18/1P4G/0725/15706	Scrap Rejection [RELAY TRACK NG]




Identifier	Failure Reason
340/W/AE84/V8-18/1P4G/0625/001311	Scrap Rejection [R123 SMT TRACK DAMAGE]

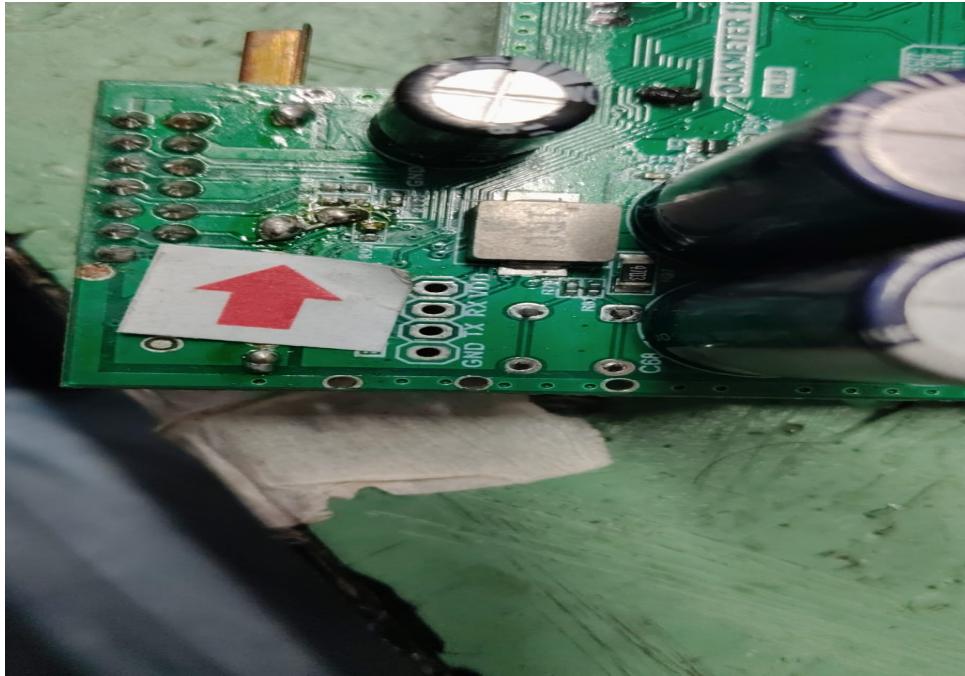


Identifier	Failure Reason
340/W/AE84/V8-18/1P4G/0625/10246	Scrap Rejection [Handling issue]

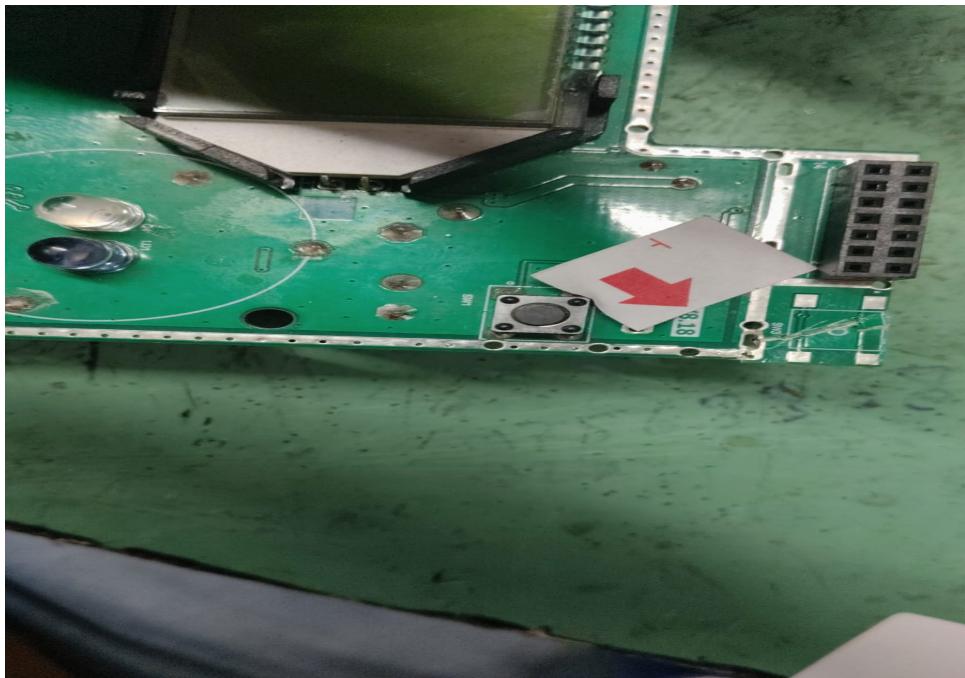


Identifier	Failure Reason
357/W/AE0176/V8-21/1P4G/0825/17187	Scrap Rejection [R61 SMT TRACK DAMAGE]

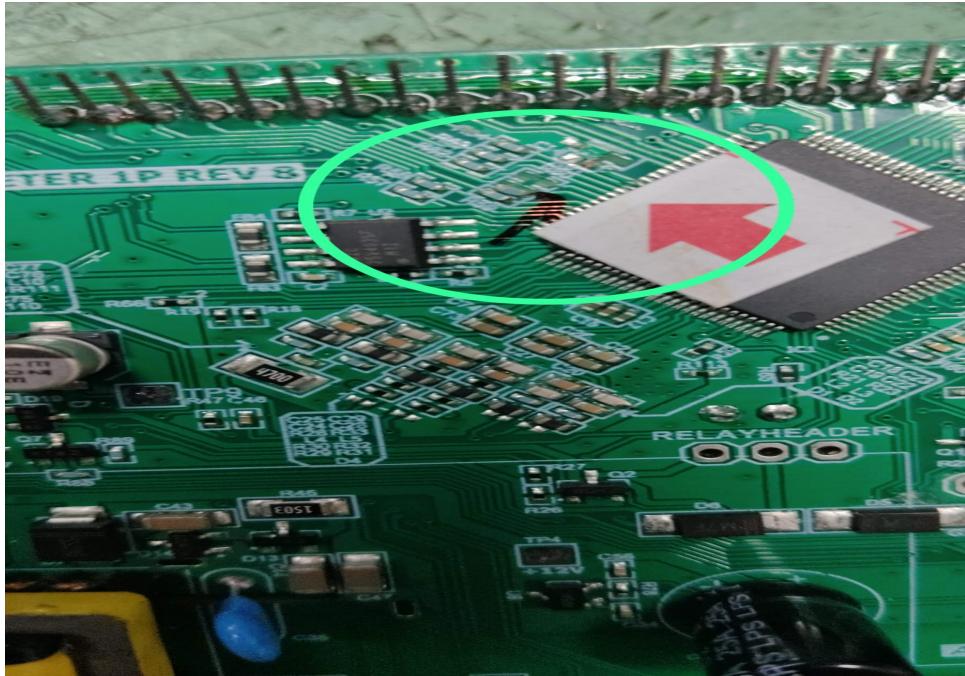


Identifier	Failure Reason
359/W/AE0193/V8-21/1P4G/0825/20755	Scrap Rejection [Track damage]

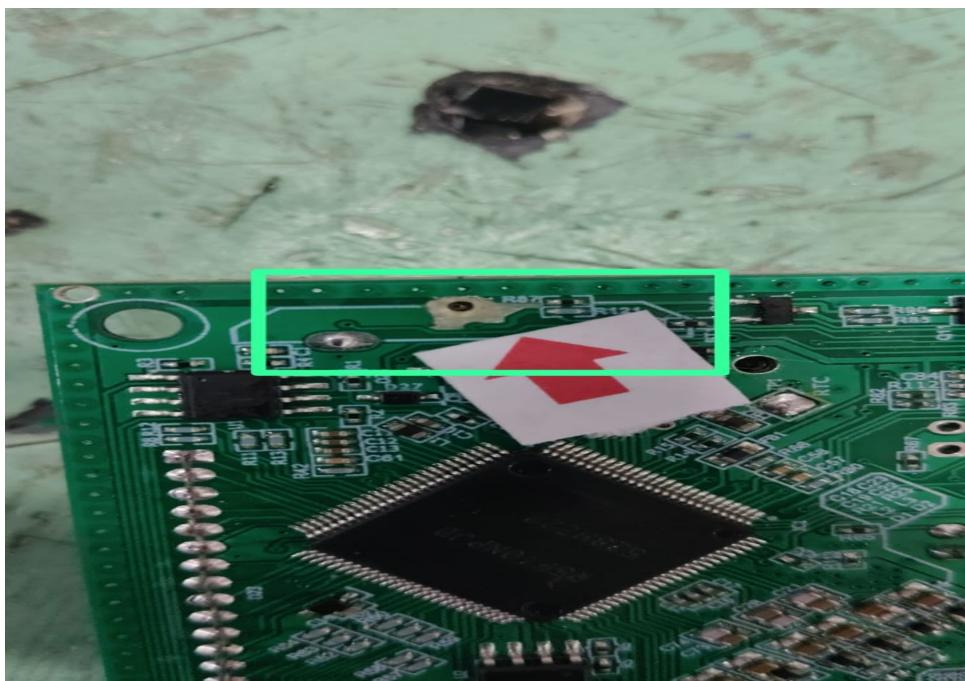

Identifier	Failure Reason
359/W/AE0199/V8-21/1P4G/0925/24139	Scrap Rejection [Track damage]

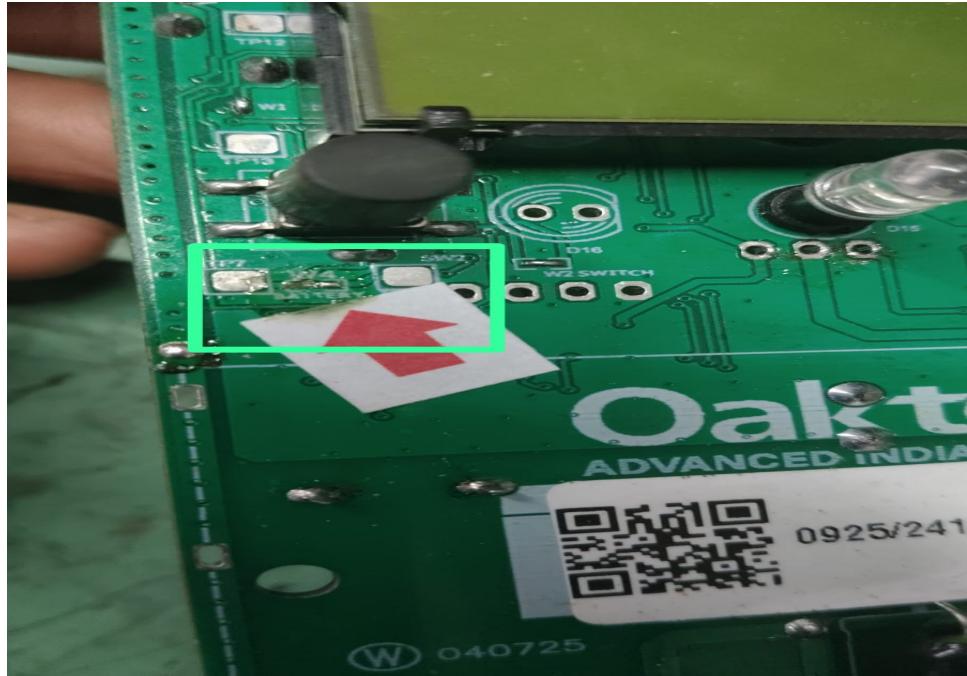

Identifier	Failure Reason
359/W/AE0199/V8-21/1P4G/0925/24432	Scrap Rejection [R1 Smt TRACK DAMAGE]

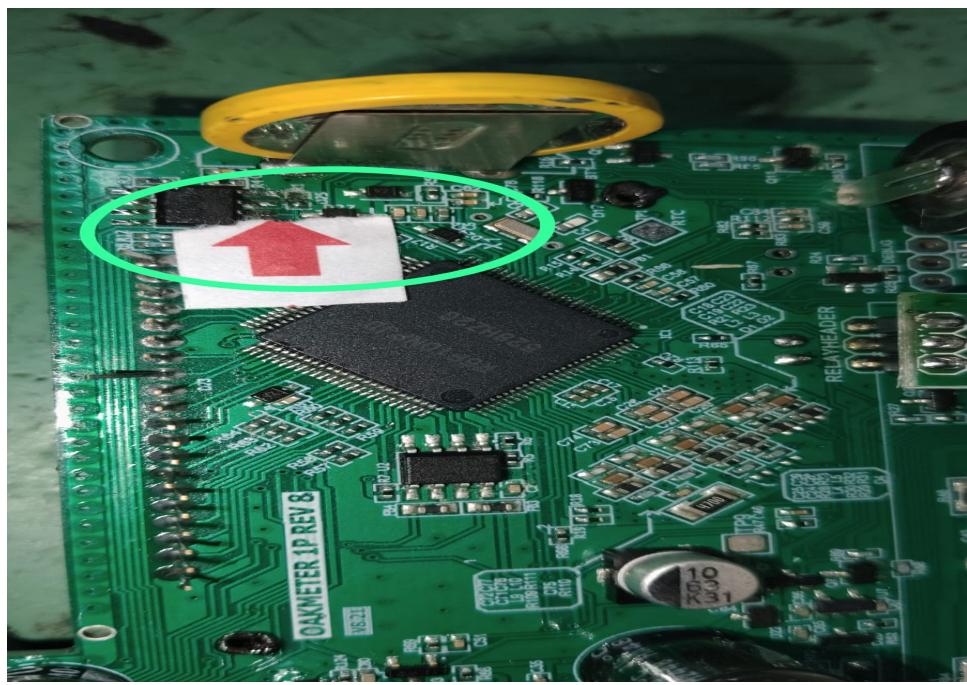

Identifier	Failure Reason
359/W/AE0245/V8-21/1P4G/1025/26923	Scrap Rejection [track damage]




Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/30163	Scrap Rejection [Track damage]




Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/30385	Scrap Rejection [Track damage]




Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/30450	Scrap Rejection [Track damage]

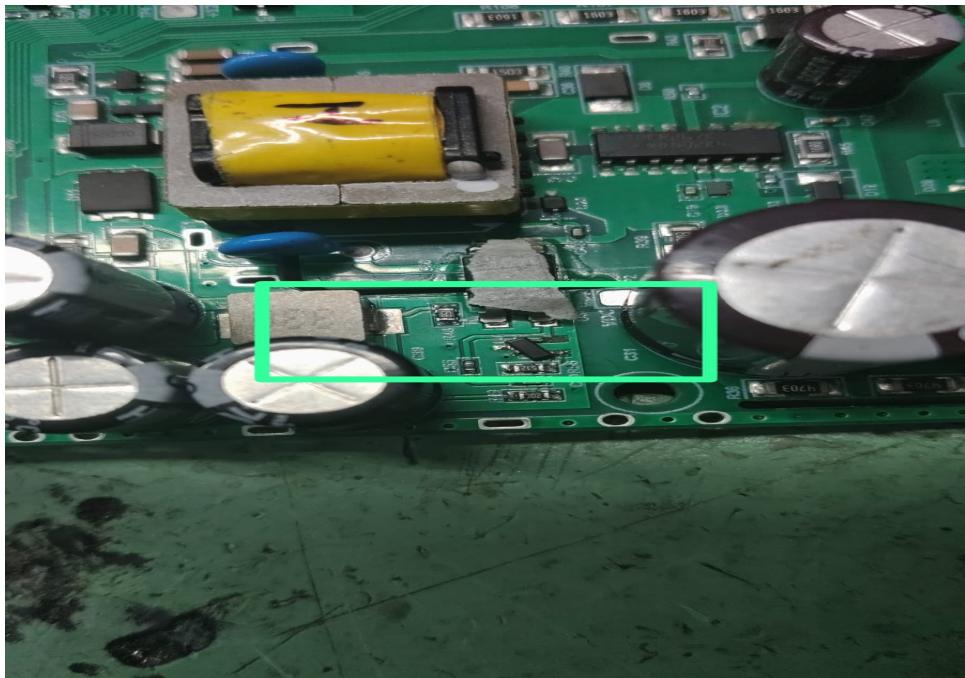


Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/30773	Scrap Rejection [Track damage]

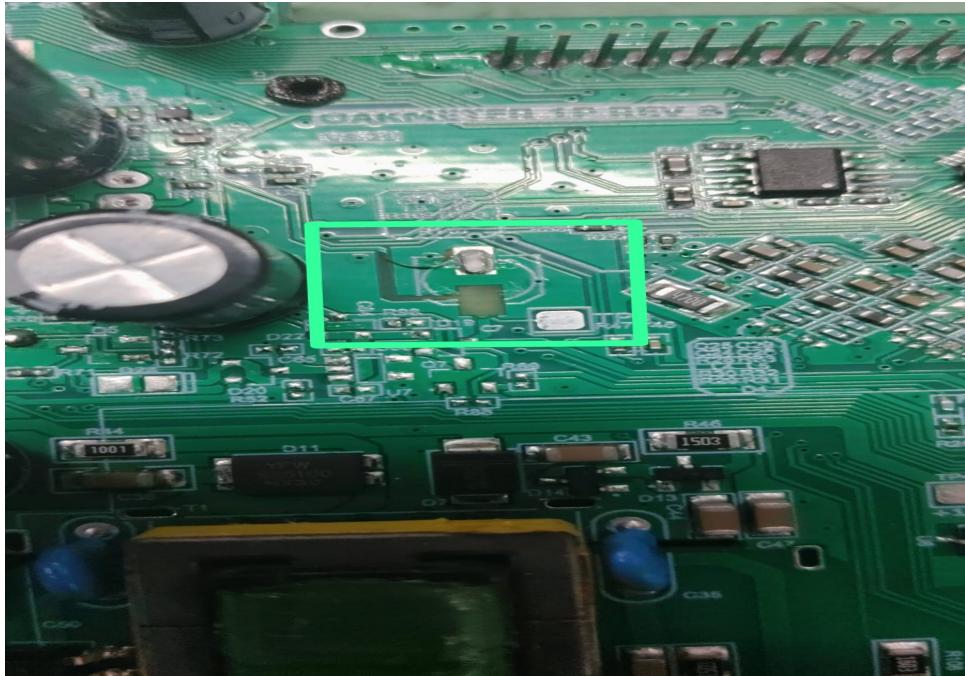


Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/31097	Scrap Rejection [Track damage]

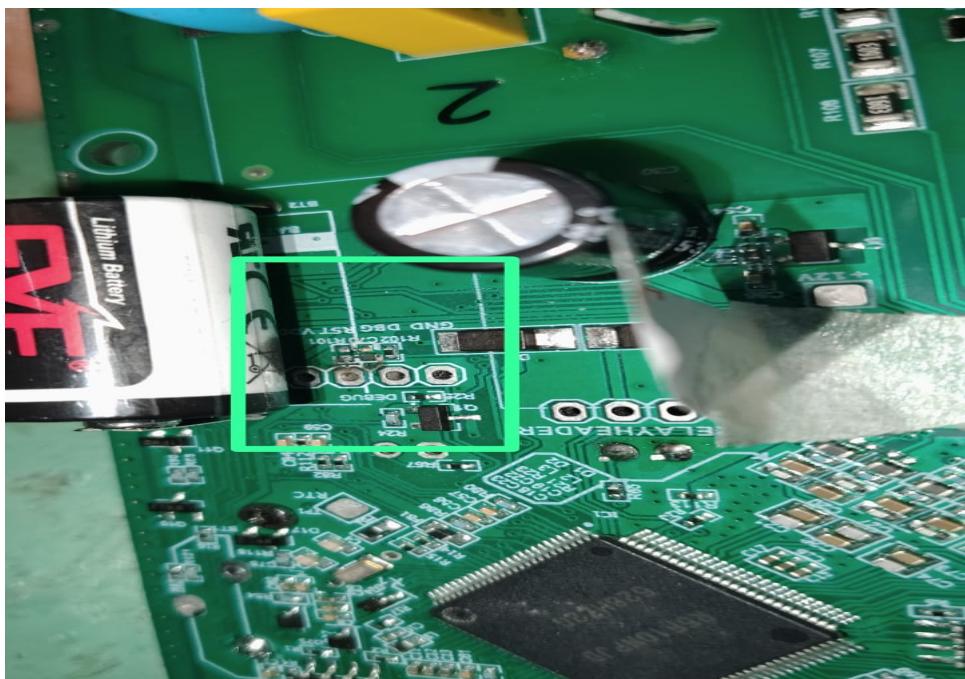

Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/31111	Scrap Rejection [track damage]

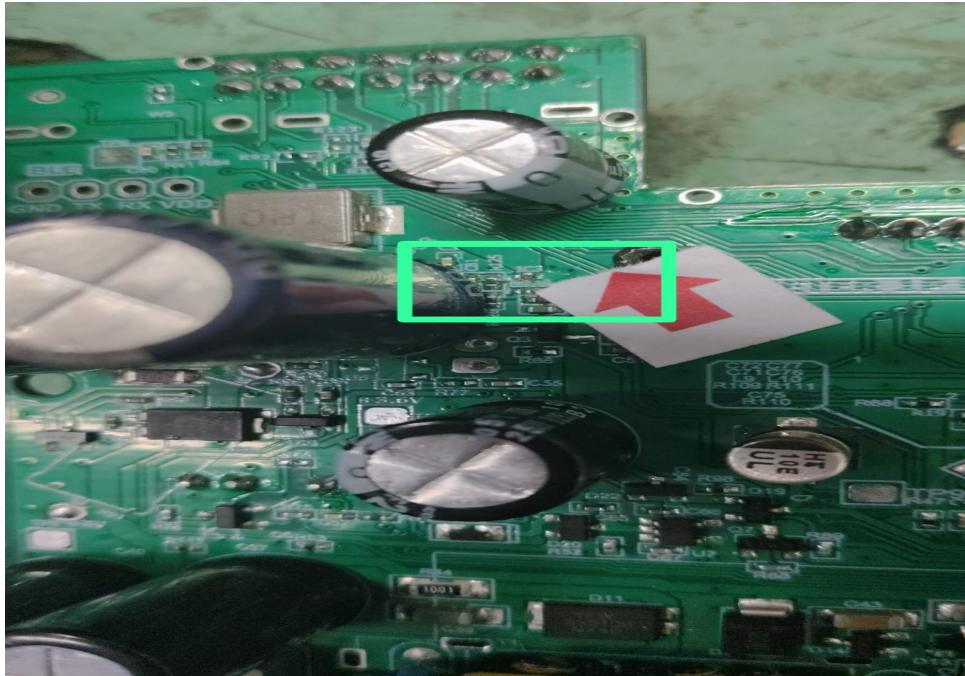


Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/31291	Scrap Rejection [Track damage]

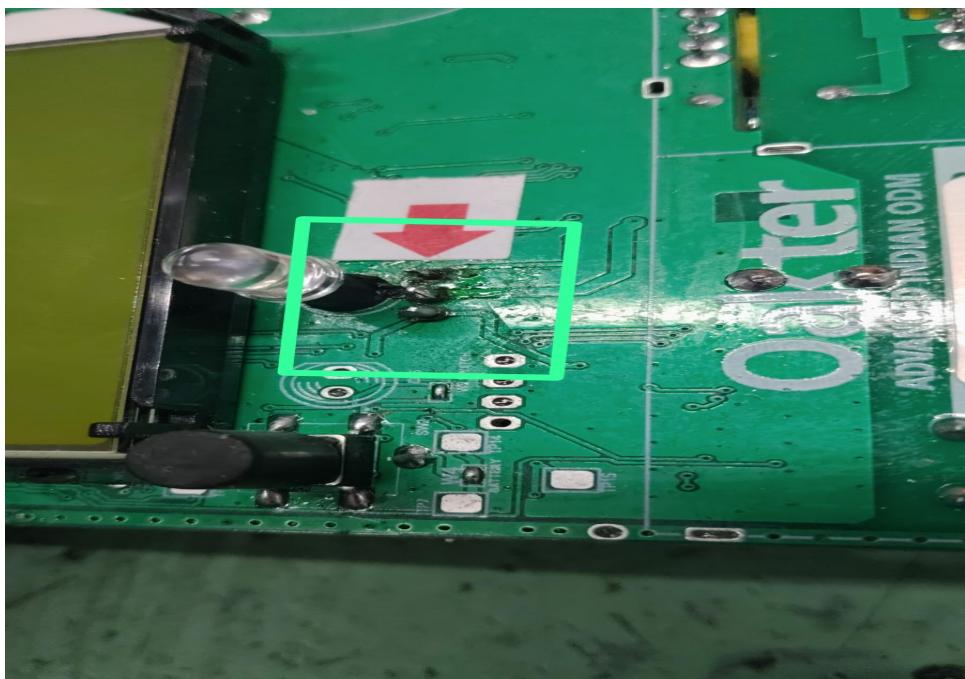


Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/35835	Scrap Rejection [Scrap PCB from visual rejection]



Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/37296	Scrap Rejection [C1 Track Damage]

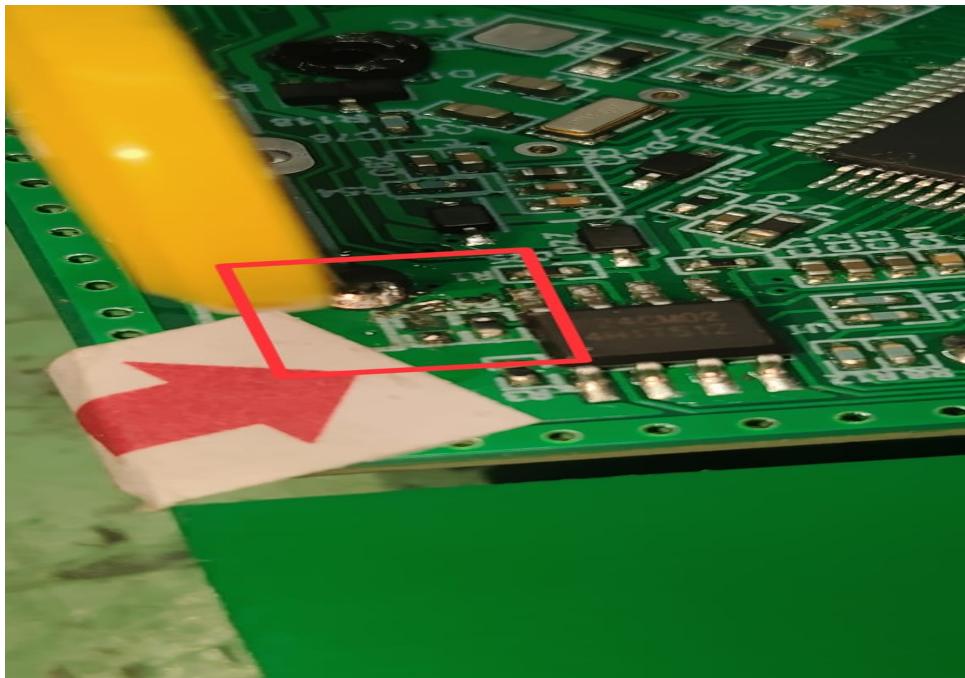

Identifier	Failure Reason
359/W/AE0304/V8-21/1P4G/1225/37302	Scrap Rejection [Track damage]

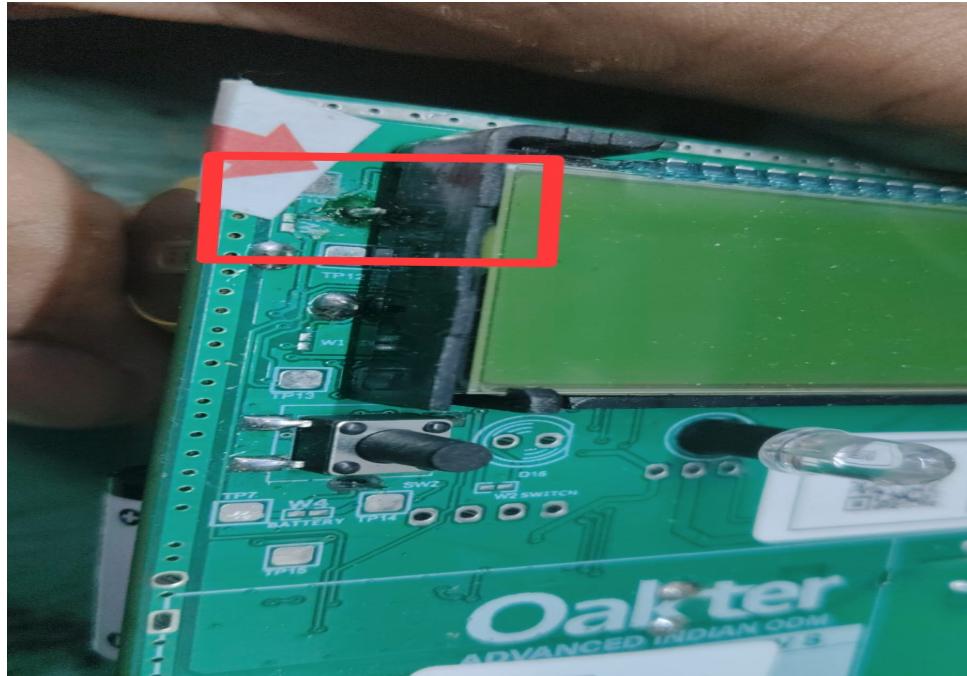

PCB_REJECTION

Total Pass	Total Fail
39	0

No failed items recorded for this phase.

TRC_REJECTION

Total Pass	Total Fail
40	0

No failed items recorded for this phase.