

REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 1 of 18

A) GENERAL INFO	RMATION	I					
Product Description	TEE-SHIRT						
Buyer	JENNYFER						
Supplier	SABARAN	G FASHION LTD			A . A		
Factory	SABARAN	G FASHION LTD					
Order No.	583316+5	83318					
Order Quantity	6000+120	= 6120 PCS					
Shipment Quantity	6042+120	PCS=6042 pcs					
Style No.	43RIBDEU	SM					
Colour	60-NOIR+2	255-BLANC					
Size Range	XS+S+M+L	+XL					
Inspection Date	07.01.202	5					
Inspection Location		8, BLOCK-K, RUP MIRPUR,DHAKA					
Inspector Full Name	1	DSSAIN SOHEL (D			Product photo		
	[X] Buyer- Reference [] Self Reference						
Inspection Service	[X] Final R	andom Inspection [] 1st [] 2nd [] 3rd Re-ins			pection [] 100% Inspection		
B) CONCLUSION	-						
OVERALL INSPECTION F	RESULT:	[] CONFORM	D [X] NOT CO	NFORMED	[] PENDING		
Inspection Criteria			Sectional Result		Special Attention		
1. Quantity Available		[X] Conformed	[] Not Conformed	[] Pending			
2. Style Check		[X] Conformed	[] Not Conformed	[] Pending			
3. Colour Shade Evaluat	ion	[X] Conformed	[] Not Conformed	[] Pending			
4. Hand Feel Check		[X] Conformed	[] Not Conformed	[] Pending			
5. Workmanship		[X] Conformed	[] Not Conformed	[] Pending			
6. Size Measurement		[] Conformed	[X] Not Conformed	[] Pending	Point-01		
7. Data Measurement /		[X] Conformed	[] Not Conformed	[] Pending			
8. Label, Marking & Inst	ruction	[X] Conformed	[] Not Conformed	[] Pending			
9. Unit Packaging		[] Conformed	[] Not Conformed	[X] Pending	Point- 02, 05		
10.Shipment Packaging		[] Conformed	[X] Not Conformed	[] Pending	Point-03		
11. Shipping Mark		[] Conformed	[x] Not Conformed	[] Pending	Point-04,06		

Details on Workmanship		Critical	Major	Minor
	Number of Defective Found:	00	07	12
	Number of Defective Allowed:	00	10	14

		AUTHORIZED BY,
Inspector's Name/Title:	SHARIF HOSSAIN SOHEL (DEWAN)/ SR. INSPECTOR	Z,
Intertek company name	ITS Lab test Bangladesh Ltd	Monir Hossain Head of Inspection, Operation, Softlines





REPORT DATE: 08-01-2025

PAGE: 2 of 18

C) S	C) SPECIAL ATTENTION								
		Special Attention Details							
No	Style No.								
1.		Garments Measurement: Measurement Discrepancies were found on Front Total length +/-1.5 cm. Please see the actual findings for details.							
2.		Folding instruction was not available for T-Shirt in the SOP, po sheet & technical sheet and factory also could not provide the folding instruction so, we could not verify it.							
3.	43RIBDEU	100% of the inspected cartons were found 5 ply, but client packing manual shown it should be 7 ply. Image#02.							
4.	SM	During inspection 07 Out of 18 inspected cartons shipping mark were found paper pasting. Image#01							
5.		During the inspection 100% inspected samples were found hangtag attached by loop pin. Which was similar with approved trims card & tech pack. But the approved samples were found hangtags attached by cord. Image#03							
6.		Supplier Address: (Section-2)" word found missing in 100% inspected carton's shipping mark's address part. Image#05							

NO.	NOTE:								
No	Style No.	Comments							
1		Fabric Weight: 60-NOIR: 228/221 (+3.63%/+0.45%), 255-BLANC: 223/218 (+1.36%/-0.90%). Required weight: 220 GSM as per technical file.							
2		During inspection Factory provide lab test report result was found pass.							
3	420100511	100% of the samples were found micro pack poly at inside poly. Image#04							
4	43RIBDEU SM	All defective samples were sealed into a Carton & handed over to the factory representative for client evaluation.							
5		Inspection was conducted based on TDS sample, PO sheet, packing list and trims card, Approved sample provided by factory/supplier & Approved sample and tech pack provided by client.							
6	100% inspected samples fabric composition at Care label was found for colour: ALL: 49 POLYESTER, 4% ELASTANE. which was similar with factory provided trims card and layout she								
7		No reference sample provided by the factory for ITS office.							
8		The hand-written Provisional Inspection Report was copied to the factory.							





REPORT DATE: 08-01-2025

PAGE: 3 of 18

SPECIAL ATTENTION PHOTOS






During inspection 07 Out of 18 inspected cartons shipping mark were found paper pasting. Image#01



100% of the inspected cartons were found 5 ply, but client packing manual shown it should be 7 ply. Image#02



During the inspection 100% inspected samples were found hangtag attached by loop pin. Which was similar with approved trims card & tech pack. But the approved sample were found hangtag attach by cord. Image#03











REPORT DATE: 08-01-2025

PAGE: 4 of 18




0 7 JAN 2025 CHECKEU-70 SENDER SABARANG FASHIONS LTD. **PLOT# 85-88, BLOCK-K,** RUPNAGAR I/A, MIRPUR, DHAKA-1216, BANGLADESH. SABARANG FASHIONS LTD SEA/FOB/BDCGP/BDCGP/FRLH Holding: Plot#85/88; Block-K Rupnagar-I/A Section-2 12/03/2025 ROISSY REFLEX Mirpur 5 1216 DHAKA : 08/01/2025 : 6109100010Cat. : 0 BANGLADESH /

100% inspected samples were found micro pack poly at inside poly. Image#04

Supplier Address: (Section-2)" word found missing in 100% inspected carton's shipping mark's address part. Image#05

D) INFORMATIVE NOTE								
		Defective/Representative sample(s) were sealed and kept at the factory.						
5.47	"	Style No.	No. of sample	Colour	Size	Reason		
[X]	Miscellaneous	43RIBDEUSM	09 Pcs	All	All	Defective Samples (Major)+measurement-02 pcs		
[54]	Miscellaneous	Production sample(s) to be kept in Intertek for reference:						
[X]		Style No.	No. of sample	Colour	Size	Reason		
		43RIBDEUSM	N/A	N/A	N/A	N/A		
[X]	Reporting Onsite	The hand-written Provisional Inspection Report was copied to the factory.						
[X]	Sample Identifying, Picking and Sealing after Quality Check	The inspected garments were identified with Intertek egg-crack label.						








REPORT DATE: 08-01-2025

PAGE: 5 of 18

E) INSPECT	TON REQ	UIREME	NT								
Inspection Sta	andard	[] ANS	SI/ASQ Z1.4	[]	BS 60	01 [X] ISO 2	859		
Form No:		ľ	ITS-FORM-027-GLOBAL Revision No.: 02								
Sampling Plan	1	S	Single S	Sampling Plan	for Nor	mal In	spection				
Inspection Le	vel]	[X] General Inspection Level :II [] Fixed Sample Size : [] 100% Inspection :								
Acceptable Q	uality Limit	(AQL) N	/lajor d	defective: N defective: 2 defective: 4	2.5	wed					
B) INSPECT											
Style No.	Checl	king Item					Result				Special Attention
43RIBDEUSM	Shipment	Lot Counti	ng	[X] Confor	formed [Not Conforn	med [Pending	Point-01
	Style	Ordei	er Shipment		Ad	ctual A	al Available Quantity		Inspection	Inspection Sample Size	
	No.	Quanti		Quantity	Packe	ed	Not Packed	No Finis		Packed Quantity	Not Packed Quantity
No. of Units	43RIBDE USM	6120 PC	:S	6162 PCS	6162	PCS	-	-		200	-
No. of Cartons	-	-		62	62		-	-		18	-
Style No.	0	rder No.		No. of car Opened Sampl	d for	Carton Number for Sampling				g	
43RIBDEUSM	583316			12 Cartons		05,	05,07,13,20,22,45,24,29,36,42,43,51				
43RIBDEUSM	5	83318	06 Cartor		ons	01,02,03,04,05,06					
Style No.	Order N	A 1		Re-packed ed Carton(s)			Carton Nur	nber fo	or Rep	acked and Sea	aled
43RIBDEUSM	583316		01 C	ARTON					29		








REPORT DATE: 08-01-2025

PAGE: 6 of 18

B) INSPECTION CRITERIA B-2 STYLE CHECK									
Style No.	Checking Ite	m	Result	Special Attention					
43RIBDEUSM	Style Check Agains	t Order	[X] Conformed [] Not Conformed [] Pending						
43RIBDEUSM	Style Check Aga Submitted San		[X] Conformed [] Not Conformed [] Pending						
-	B) INSPECTION CRITERIA B-3 COLOUR SHADE EVALUATION								
Style No.	Checking Ite	em	Result	Special Attention					
43RIBDEUSM	Colour Check Against Submitted Sample		I IXICONTORMED I NOT CONTORMED I PENDING						
•	TON CRITERIA FEEL CHECK								
Style No.	Checking Ite	em	Result	Special Attention					
43RIBDEUSM	Colour Check Ag Submitted San		[X] Conformed [] Not Conformed [] Pending						
B) INSPECTION CRITERIA B-5 WORKMANSHIP									
Style no.	Checking Item	Sample Size	Result	Special Attention					
43RIBDEUSM	Visual Check	200 Pcs	[X] Conformed [] Not Conformed [] Pending						








REPORT DATE: 08-01-2025

PAGE: 7 of 18

No.	Style No.	Details of Defective	Critical	Major	Minor
		Fabric hole at neck		01	
		Broken stitch at armhole/bottom (0.5cm)		02	
	1	Fabric fault at back (5cm)		01	
	1	Stain at front (obviously)		01	
	1	Distorted shape at neck (obviously)		01	
	1	Asymmetrical shape at armhole (obviously)		01	
	43RIBDEU	Foreign yarn at back (slightly)			02
	SM	Twisted at side seam (slightly)			01
	3111	Puckered at shoulder strap (slightly)			02
	1	Uneven width at shoulder strap (slightly)			02
	1	Thick yarn at back (slightly)			02
	1	Uncut thread at armpit (1cm)			01
	1	Pointy at armpit (slightly)			01
	1	Poor shape at neck (slightly)			01
	1				
		Found:	00	07	12
		Allowed:	00	10	14

B) INSPECTION CRITERIA B-6 SIZE MEASUREMENT							
Style No.	Checking Item	Sample Size	Result	Special Attention			
43RIBDEUSM	Size Measurement	20 Pcs	[] Conformed [X] Not Conformed [] Pending	Point-01			

B) INSPECTION CRITERIA B-7 DATA MEASUREMENT / CHECK								
Style No.	Checking Item	Sample Size	Result	Special Attention				
	[X] Fabric Weight	04 Pcs	[X] Conformed [] Not Conformed [] Pending					
43RIBDEUSM	[] Metal Detection	N/A	[] Conformed [] Not Conformed [] Pending					
43KIBDEUSIVI	[] Pull Test	N/A	[] Conformed [] Not Conformed [] Pending					
	[X] Lab test	-	[X] Conformed [] Not Conformed [] Pending					












REPORT DATE: 08-01-2025

PAGE: 8 of 18

B) INSPECTION CRITERIA B-8 LABEL, MARKING & INSTRUCTION							
Style No.	Checking Item	Sample Size	Result	Special Attention			
43RIBDEUSM	Labelling Conformity	200 Pcs	[X] Conformed [] Not Conformed [] Pending				

B) INSPECTION CRITERIA B-9 UNIT PACKAGING								
Style No.	Checking Item	Actual Finding	Result	Special Attention				
43RIBDEUSM	Unit Package Conformity	Each piece folded with hangtag with barcode and micro pack than put into an poly bag with poly sticker.	[] Conformed [] Not Conformed [X] Pending	Point-02,05				
43RIBDEUSM	Unit Package Barcode Check	Sample Size: 200 Pcs samples	[X] Conformed [] Not Conformed [] Pending	-				

B) INSPECTION CRITERIA B-10 SHIPMENT PACKAGING							
Style No.	Checking Item	Actual Finding	Result	Special Attention			
43RIBDEUSM	Inner Box Package	N/A	[] Conformed [] Not Conformed [] Pending				
43RIBDEUSM	Shipping Carton Package Conformity	01 blister poly bag was put into a 05 ply corrugated export carton with topbottom board and finally sealed by transparent gum tape.	[] Conformed [X] Not Conformed [] Pending	Point-03			
43RIBDEUSM	Packing Quantity and Assortment	Sample Size: 18 cartons	[X] Conformed[] Not Conformed[] Pending				
43RIBDEUSM	Shipping Carton Gross Weight	14.79 kgs (MAX)	[x] Conformed [] Not Conformed [] Pending				
43RIBDEUSM	Shipping Carton Dimension (L x W x H)	60 X 40 X 30 cm (MAX)	[x] Conformed [] Not Conformed [] Pending				







REPORT DATE: 08-01-2025

PAGE: 9 of 18

B) INSPECTION CRITERIA B-11 SHIPPING MARK							
Style No.	Checking Item	Actual Finding	Result	Special Attention			
43RIBDEUSM	Shipping Carton Barcode Check	Sample Size: 18 samples	[X] Conformed [] Not Conformed [] Pending				
43RIBDEUSM	Shipping Mark and Shipping Label	Sample Size: 18 samples	[] Conformed [x] Not Conformed [] Pending	Point-,04,06			

Disclaimer:

"This report is for the exclusive use of the client of Intertek named in this report ("Client") and is provided pursuant to an agreement for services between Intertek and Client ("Client Agreement"). No other person may rely on the terms of this report. This report provides a summary of the findings and other applicable information found/gatheBLACK (00004) during the audit conducted at the specified facilities on the specified date only. Therefore, this report does not cover, and Intertek accepts no responsibility for, other locations that may be used in the supply chain of the relevant product or service. Further, as the audit process used by Intertek is a sampling exercise only, Intertek accepts no responsibility for any non-compliant issues that may be revealed relating to the operations of the identified facility at any other date. Intertek's responsibility and liability are also limited in accordance to the terms and conditions of the Client Agreement. Intertek assumes no liability to any party, for any loss, expense or damage occasioned by the use of this information other than to the Client and in accordance with the Client Agreement and these disclaimers. In case there is any conflict between the disclaimers stated herein and the applicable terms and conditions of Intertek incorporated into the Client Agreement, then these disclaimers shall prevail."





REPORT DATE: 08-01-2025

PAGE: 10 of 18

PICTURE ATTACHED





Inspector carton selection

Carton stuck






Shipping mark

Shipping mark



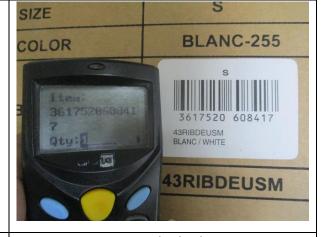

Shipping mark sticker

Barcode check

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.

ITS Labtest Bangladesh Ltd.,

Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh





REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 11 of 18





Shipping mark

Shipping mark sticker





Barcode check

Open carton





View of pack

View of pack

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.

ITS Labtest Bangladesh Ltd.,

Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh Tel: +88 0966 677 6669

Web: <u>www.intertek.com</u>





REPORT DATE: 08-01-2025


PAGE: 12 of 18





Product view

Product view

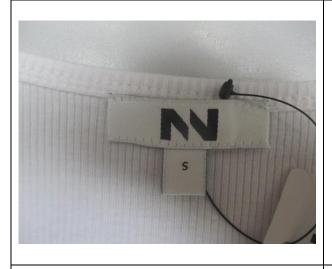





CNC label

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.



Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh





REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 13 of 18





CNC label

CNC label





CNC label

CNC label







REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 14 of 18





CNC label

CNC label





Hang tag

Hang tag





Poly sticker

Barcode check

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.

ITS Labtest Bangladesh Ltd.,

Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh

Tel: +88 0966 677 6669







REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025


PAGE: 15 of 18





Barcode check

Weight check

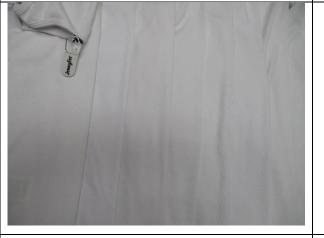



Shade check

Shade check





Fabric hole at neck (M)

Broken stitch (M)

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.

ITS Labtest Bangladesh Ltd.,

Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh






REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 16 of 18












REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 17 of 18

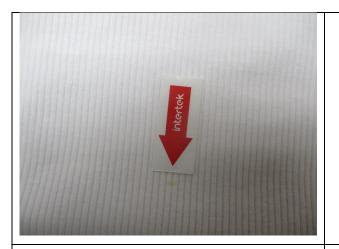



Foreign yarn at back (slightly) (m)

Twisted at side seam (slightly) (m)





Puckered at shoulder strap (slightly) (m)

Puckered at shoulder strap (slightly) (m)





Uneven width at shoulder strap (slightly) (m)

Uneven width at shoulder strap (slightly) (m)

The results reflect our findings at time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter This report does not evidence shipment.



Haidar Tower, House # 668, Choydana, Ward # 34, Gazipur City Corporation, Gazipur-1704, Bangladesh





REPORT NUMBER: INS-421186

REPORT DATE: 08-01-2025

PAGE: 18 of 18





