

This document provides additional assistance with wiring your Extron IPL PRO enabled product to your device. Different components may require a different wiring scheme than those listed below.

For complete operating instruction, refer to the user's manual for the specific Extron IPL PRO enabled product or the controlled device manufacturer supplied documentation.

Device Specifications:

Device Type: Matrix Switcher
Manufacturer: ABtUS
Firmware Version: N/A
Model(s): MAX-HDMI408A-G

Tested on the Following Software and Firmware Versions:

IP Link Pro Control Processor Firmware	Touch Link Panel Firmware	GS Version
2.04.0000-b007	2.01.0001-b001	1.2.1

Version History

Module Version	Date	Notes
1_0_0_0	12/27/2016	Initial Version

Module Notes

- For Serial Over Ethernet support, SerialOverEthernetClass must be used. Example: InterfaceName = ModuleName.SerialOverEthernetClass('192.168.254.254', PortNum, Model='ModelName')

Control Commands, States, and Qualifiers:

MatrixTieCommand	'String'	
['Input']	'1' – '4'	'Break'
['Output']	'1' – '4'	
Preset	'1' – '4'	
['Action']	'Set'	'Recall'

Cable and Adapter Requirements:

Captive Screw to Male DB9 RS-232 Serial Cable

Notes for the Device:

Serial communication:

Port Type: RS-232

Baud Rate: 9600


Data Bits: 8

Parity: None


Stop Bits: One

Flow Control: None

Pin Assignments Diagram

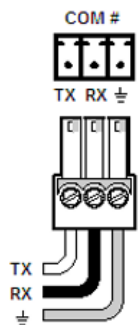

Please contact manufacturer for pin connection

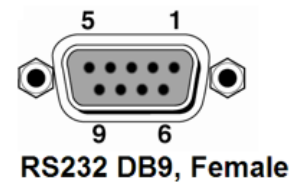

General Notes:

Appendix A. Set Commands

Matrix Tie Command	Input 1	Output 1	I1>O1\x0D
Matrix Tie Command	Input 1	Output 2	I1>O2\x0D
Matrix Tie Command	Input 1	Output 3	I1>O3\x0D
Matrix Tie Command	Input 1	Output 4	I1>O4\x0D
Matrix Tie Command	Input 2	Output 1	I2>O1\x0D
Matrix Tie Command	Input 2	Output 2	I2>O2\x0D
Matrix Tie Command	Input 2	Output 3	I2>O3\x0D
Matrix Tie Command	Input 2	Output 4	I2>O4\x0D
Matrix Tie Command	Input 3	Output 1	I3>O1\x0D
Matrix Tie Command	Input 3	Output 2	I3>O2\x0D
Matrix Tie Command	Input 3	Output 3	I3>O3\x0D
Matrix Tie Command	Input 3	Output 4	I3>O4\x0D
Matrix Tie Command	Input 4	Output 1	I4>O1\x0D
Matrix Tie Command	Input 4	Output 2	I4>O2\x0D
Matrix Tie Command	Input 4	Output 3	I4>O3\x0D
Matrix Tie Command	Input 4	Output 4	I4>O4\x0D
Matrix Tie Command	Input Break	Output 1	I0>O1\x0D
Matrix Tie Command	Input Break	Output 2	I0>O2\x0D
Matrix Tie Command	Input Break	Output 3	I0>O3\x0D
Matrix Tie Command	Input Break	Output 4	I0>O4\x0D
Preset 1 Action Recall			\x0BMARDCH\xFFQ\x01\x0B
Preset 1 Action Set			\x0BMARDCH\xFFP\x01\x0A
Preset 2 Action Recall			\x0BMARDCH\xFFQ\x02\x0C
Preset 2 Action Set			\x0BMARDCH\xFFP\x02\x0B
Preset 3 Action Recall			\x0BMARDCH\xFFQ\x03\x0D
Preset 3 Action Set			\x0BMARDCH\xFFP\x03\x0C
Preset 4 Action Recall			\x0BMARDCH\xFFQ\x04\x0E
Preset 4 Action Set			\x0BMARDCH\xFFP\x04\x0D