

This document provides additional assistance with wiring your Extron IP Link Pro Control Processor to your device. Different components may require a different wiring scheme than those listed below.

For complete operating instructions, refer to the user's manual for the specific IP Link Pro Control Processor or the documentation supplied by the manufacturer of the controlled device.

For more information on using Global Scripter Modules, refer to the "[Guide to Using Scripter Modules](#)" document.

Device Specifications

Device Type: Building Management Systems
Manufacturer: Color Kinetics
Firmware Version: N/A
Model(s): iPlayer 2, iPlayer 3

Tested on the Following Software and Firmware Versions

IP Link Pro Control Processor Firmware	Global Scripter Version
2.06.0002-b002	1.4.2

Version History

Module Version	Date	Notes
1_0_0_0	2/2/2018	Initial Version

Module Notes

Supported Classes and Examples

SerialClass
InterfaceName = ModuleName.SerialClass(ProcessorName, 'COM1', Model='iPlayer 2')
SerialOverEthernetClass
InterfaceName = ModuleName.SerialOverEthernetClass('192.168.254.254', 2001, Model='iPlayer 2')

Set Commands

Format with Qualifier:

```
InterfaceName.Set(Command, Value, {'Qualifier Key': 'Qualifier Value'})
```

Format without Qualifier:

```
InterfaceName.Set(Command, Value)
```

Command AbsoluteIntensity	Value 0 to 255 in steps of 1
# AbsoluteIntensity example InterfaceName.Set('AbsoluteIntensity', 255)	
Command LightsOff	Value None
# LightsOff example InterfaceName.Set('LightsOff', None)	
Command RelativeIntensity	Value 0 to 255 in steps of 1
# RelativeIntensity example InterfaceName.Set('RelativeIntensity', 255)	
Command Show	Value 1 to 225 in steps of 1
# Show example InterfaceName.Set('Show', 225)	

Cable and Adapter Requirements

Captive Screw to Male DB9 RS-232 Serial Cable

Notes for the Device

Serial communication

Port Type: RS-232

Baud Rate: 9600


Data Bits: 8

Parity: None


Stop Bits: One

Flow Control: None

Pin Assignments Diagram

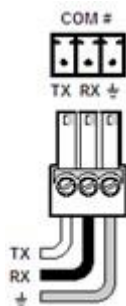

Signal	Main Cable	Pin	Signal
TxD		2	TxD
RxD		3	RxD
GND		5	GND

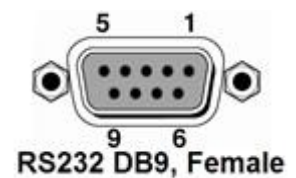

Appendix A. Set Commands

Absolute Intensity 0	X0200
Absolute Intensity 255	X02FF
Lights Off None	X0100
Relative Intensity 0	X03FF
Relative Intensity 255	X0301
Show 1	X0401
Show 225	X04E1