
DFM report: Enclosure


Plastic Injection Molding · ABS · 14 Nov 2026, 09:00

Failed (162 errors, 175 warnings)

Project	Sample report	Prepared by	DFM Workbench documentation
Document	Enclosure	Model	Enclosure
Process	Plastic Injection Molding	Material	ABS
Date	2026-11-14		

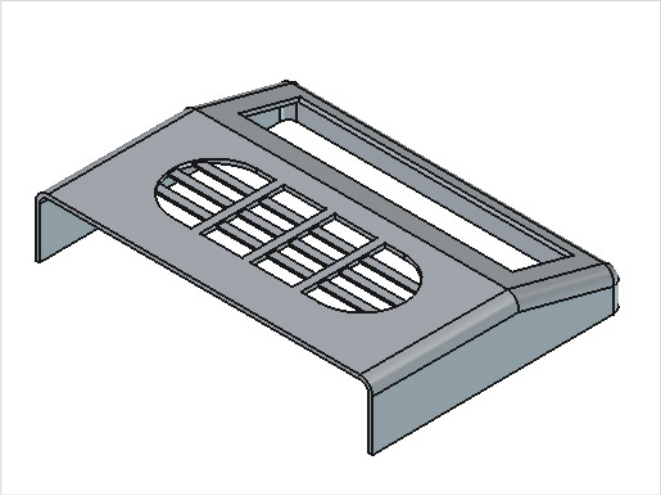

As designed

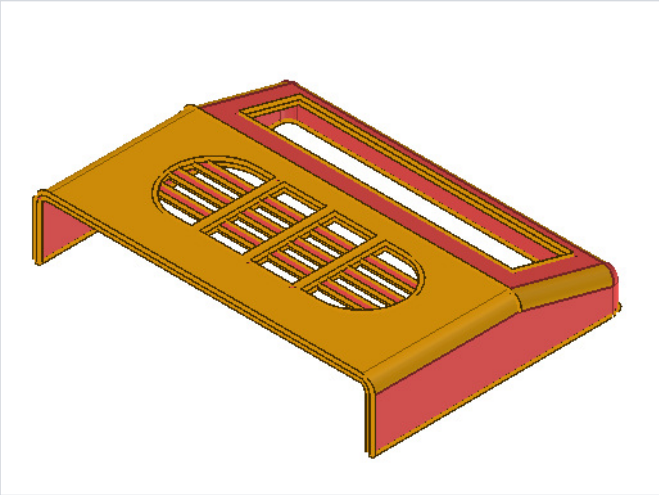

Findings highlighted

162	175	24	0
Errors	Warnings	Rules passed	Ignored

Summary by criticality


Criticality	Rule	Findings	Result
Critical	Minimum Draft Angle	68	58 errors
Critical	Undercut		Passed
High	Minimum Wall Thickness	40	13 errors
High	Sharp Internal Corners	91	91 errors
High	Boss Draft		Passed
High	Boss Wall Thickness		Passed
High	Rib Draft		Passed
High	Rib Thickness		Passed
High	Snap-Fit Strain		Passed
High	Thin Steel		Passed
High	Wall Thickness Transition		Passed
Medium	Boss Core Depth		Passed
Medium	Boss Height		Passed
Medium	Boss Outer Diameter		Passed
Medium	Boss Spacing		Passed
Medium	Cored Hole Depth		Passed
Medium	Hole Spacing		Passed
Medium	Living Hinge		Passed

Criticality	Rule	Findings	Result
Medium	Maximum Wall Thickness		Passed
Medium	Rib Height		Passed
Medium	Rib Spacing		Passed
Low	Moulded Text	1	1 warning
Low	Sharp External Corners	137	137 warnings
Low	Boss Hole Base Radius		Passed
Low	Boss Root Radius		Passed
Low	Internal Corner Radius		Passed
Low	Rib Root Radius		Passed
Low	Screw Boss Lead-In		Passed
Low	Standalone Boss		Passed

Minimum Draft Angle

58 errors 10 warnings


Criticality: Critical · Aim for 1° · At least 0.5° · Values for ABS
Minimum inclination of faces relative to the pull direction.

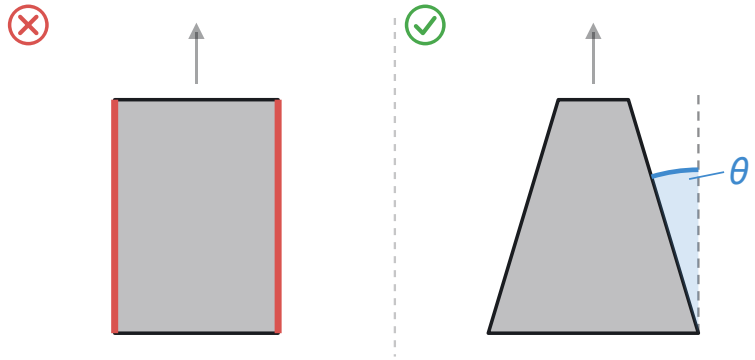

Critical Draft Violation (-75.23°): A vertical or reverse taper will cause the part to grip the mold as it shrinks. Attempting to eject will likely scratch the surface or physically trap the part in the cavity.

Insufficient Draft (0.87°): This angle is below the recommended 1.00°. While tilted correctly, it is too shallow to guarantee a clean release. Increasing the angle reduces the risk of part deformation or drag marks.

Viewport

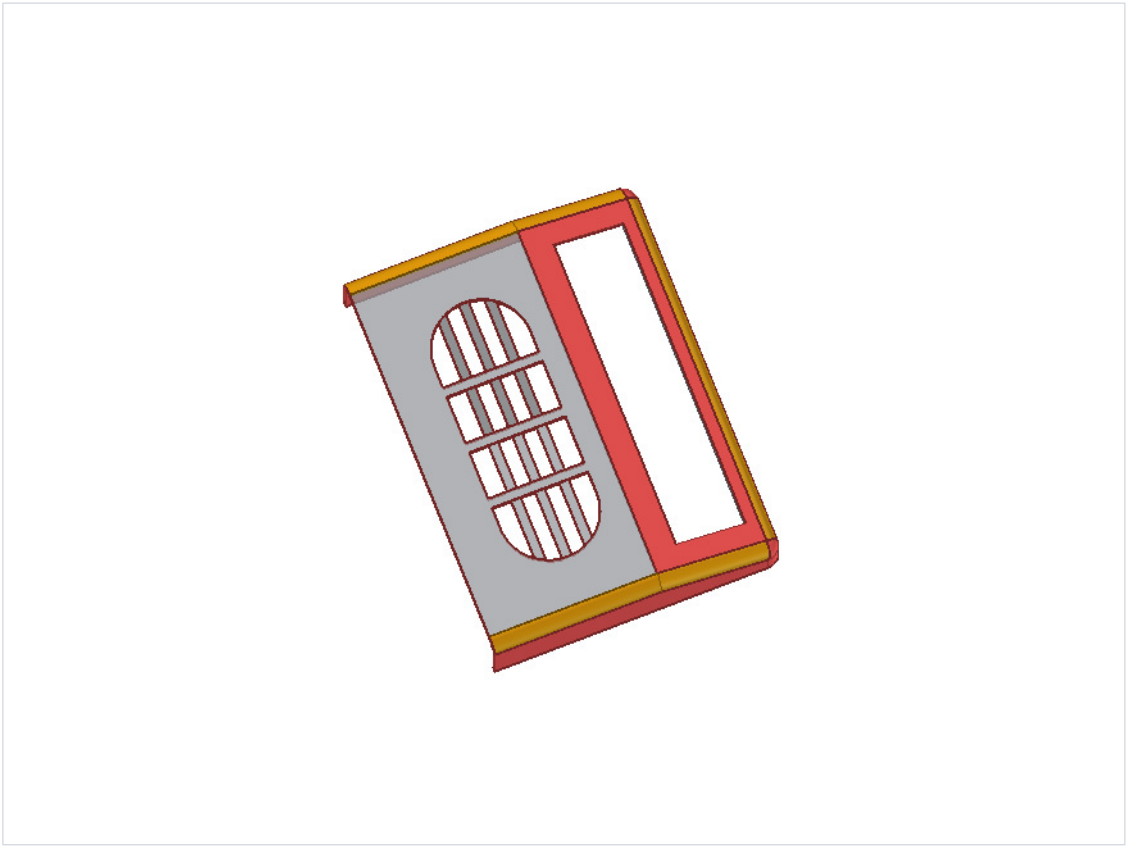

68 findings highlighted

Findings

Status	Geometry	Measured	Limit
Error	Face1	-75.23°	< 0.50°
Error	Face2	-0.00°	< 0.50°
Error	Face6	0.01°	< 0.50°
Error	Face7	0.00°	< 0.50°
Error	Face8	0.00°	< 0.50°

Status	Geometry	Measured	Limit
Error	Face9	0.00°	< 0.50°
Error	Face10	0.00°	< 0.50°
Error	Face11	0.01°	< 0.50°
Error	Face12	0.01°	< 0.50°
Error	Face15	0.00°	< 0.50°
Error	Face17	0.00°	< 0.50°
Error	Face18	0.00°	< 0.50°
Error	Face19	0.00°	< 0.50°
Error	Face20	0.01°	< 0.50°
Error	Face21	0.00°	< 0.50°
Error	Face23	0.00°	< 0.50°
Error	Face24	0.01°	< 0.50°
Error	Face26	-0.00°	< 0.50°
Error	Face27	-0.00°	< 0.50°
Error	Face29	-0.00°	< 0.50°
Error	Face30	-0.00°	< 0.50°
Error	Face32	-0.00°	< 0.50°
Error	Face33	-0.00°	< 0.50°
Error	Face35	-0.00°	< 0.50°
Error	Face36	-0.00°	< 0.50°


and 43 more, listed in the appendix.

Minimum Wall Thickness

13 errors 27 warnings

Criticality: High · Aim for 1.14 mm · At least 0.8 mm · Values for ABS


Minimum distance between opposing surfaces.

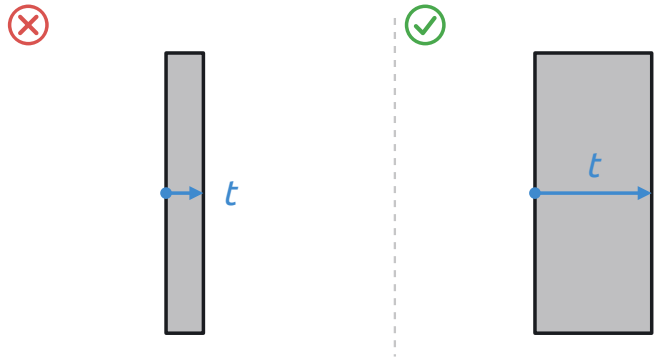

Critical Thinning (0.50mm): Wall thickness is below the 0.80mm threshold. The high injection pressure required to fill this area may cause structural weakness or "hesitation" marks in the final part.

Thin Wall Section (1.00mm): This area is below the recommended 1.14mm. Thin walls increase flow resistance and may lead to "short shots" or unintended cooling before the cavity is fully packed.

Viewport

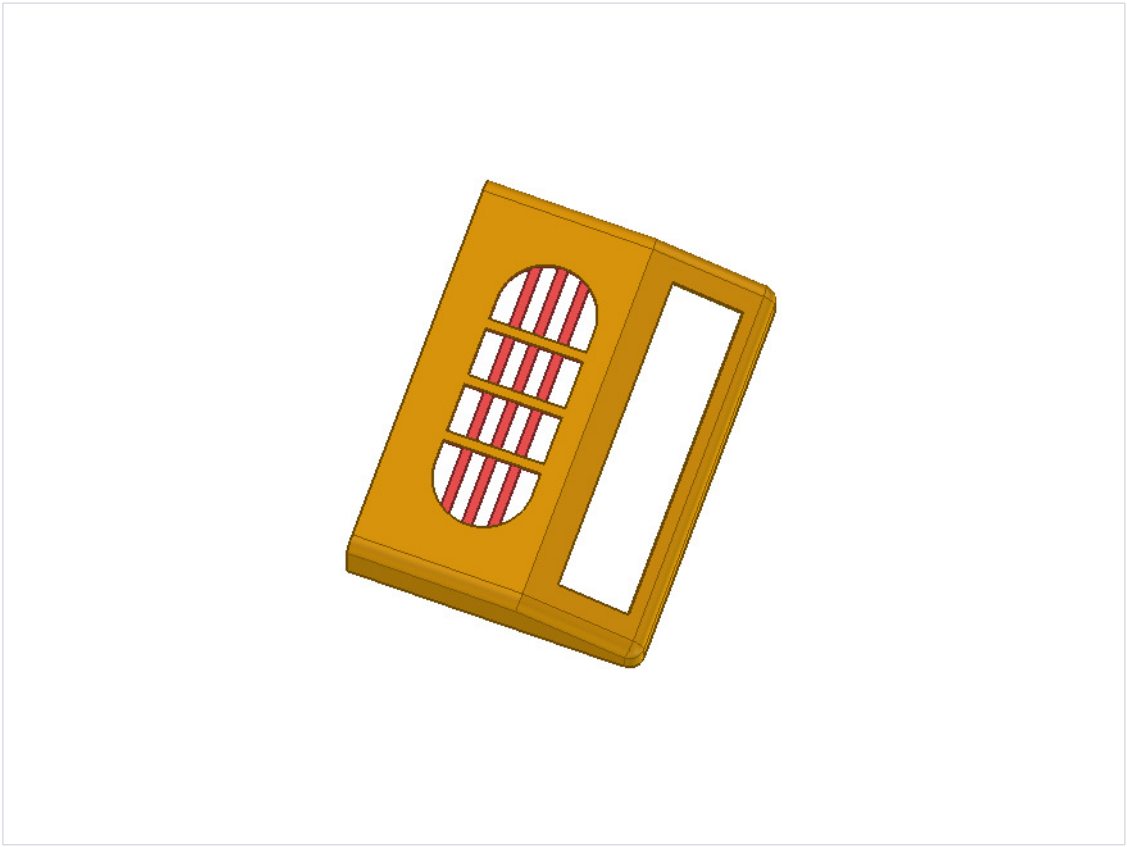

40 findings highlighted

Findings


Status	Geometry	Measured	Limit
Error	Face25	0.50mm	< 0.80mm
Error	Face28	0.50mm	< 0.80mm
Error	Face31	0.50mm	< 0.80mm
Error	Face34	0.50mm	< 0.80mm
Error	Face37	0.50mm	< 0.80mm

Status	Geometry	Measured	Limit
Error	Face40	0.50mm	< 0.80mm
Error	Face43	0.50mm	< 0.80mm
Error	Face46	0.50mm	< 0.80mm
Error	Face49	0.50mm	< 0.80mm
Error	Face52	0.50mm	< 0.80mm
Error	Face55	0.50mm	< 0.80mm
Error	Face58	0.50mm	< 0.80mm
Error	Face61	0.50mm	< 0.80mm
Warning	Face1	1.00mm	< 1.14mm
Warning	Face3	1.00mm	< 1.14mm
Warning	Face4	1.00mm	< 1.14mm
Warning	Face5	1.00mm	< 1.14mm
Warning	Face7	1.00mm	< 1.14mm
Warning	Face8	1.00mm	< 1.14mm
Warning	Face9	1.00mm	< 1.14mm
Warning	Face10	1.00mm	< 1.14mm
Warning	Face11	1.00mm	< 1.14mm
Warning	Face12	1.00mm	< 1.14mm
Warning	Face13	1.00mm	< 1.14mm
Warning	Face14	1.00mm	< 1.14mm

and 15 more, listed in the appendix.


Sharp Internal Corners 91 errors

Criticality: High · Reported as an error · Values for ABS
Concave intersections of surfaces without a radius.

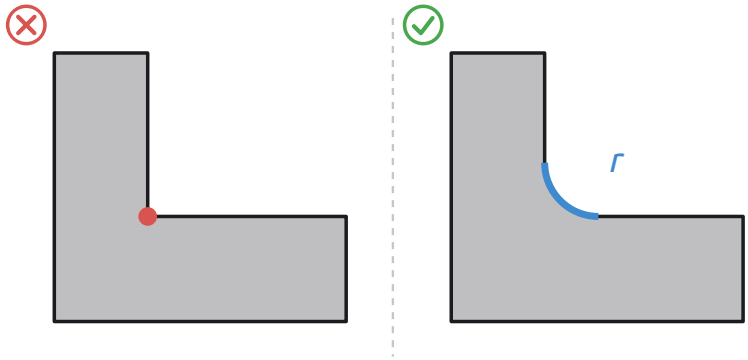

Internal Sharp Corner (90.00°): This concave edge disrupts plastic flow and creates a stress concentration. An internal fillet of radius 0.5x the nominal wall thickness is recommended.

Viewport

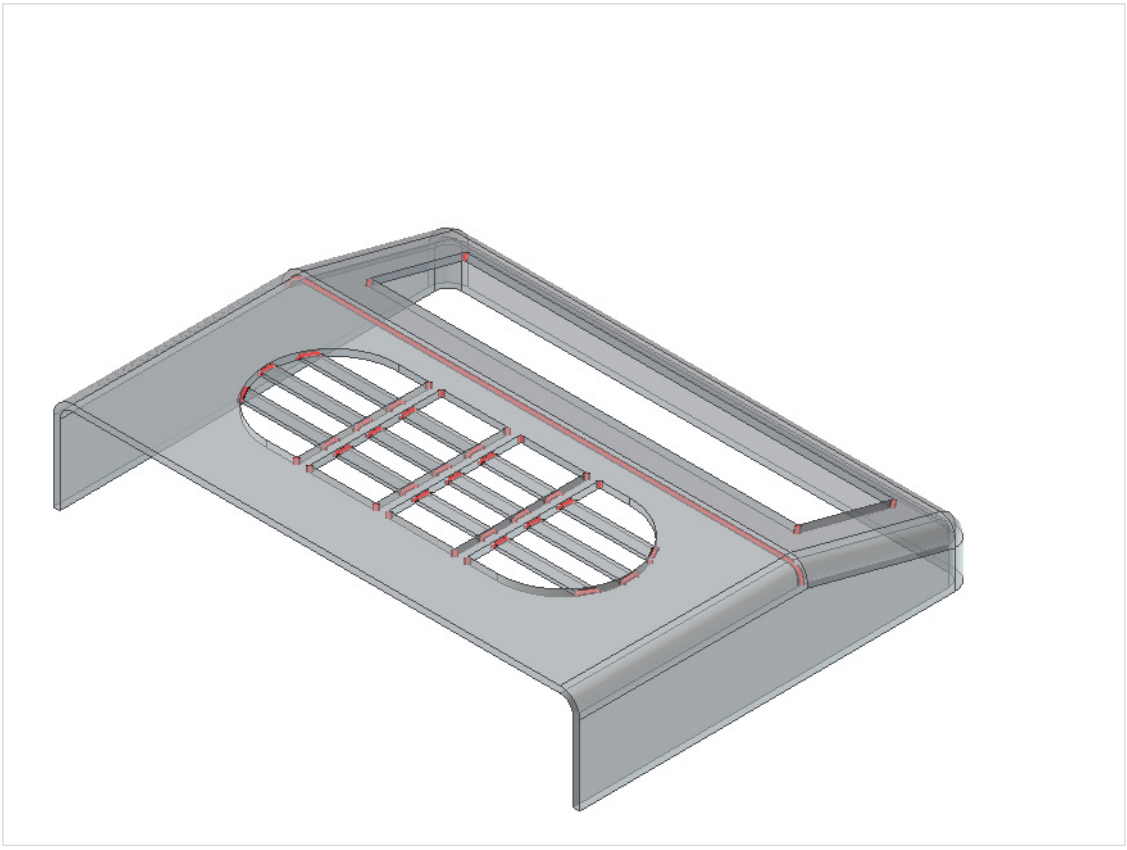

91 findings highlighted

Findings

Status	Geometry	Measured	Limit
Error	Edge10	90.00°	
Error	Edge11	90.00°	
Error	Edge14	14.77°	
Error	Edge21	10.43°	
Error	Edge80	10.43°	
Error	Edge147	90.00°	
Error	Edge151	90.00°	


Status	Geometry	Measured	Limit
Error	Edge152	126.86°	
Error	Edge153	90.00°	
Error	Edge154	90.00°	
Error	Edge156	90.00°	
Error	Edge159	90.00°	
Error	Edge161	126.86°	
Error	Edge162	90.00°	
Error	Edge164	90.00°	
Error	Edge165	90.00°	
Error	Edge167	90.00°	
Error	Edge168	90.00°	
Error	Edge170	90.00°	
Error	Edge171	90.00°	
Error	Edge173	90.00°	
Error	Edge174	90.00°	
Error	Edge176	90.00°	
Error	Edge177	90.00°	
Error	Edge179	90.00°	

and 66 more, listed in the appendix.

Moulded Text


1 warning

Criticality: Low · Aim for 0.5 mm · At least 0.25 mm
Stroke width of moulded lettering; also warns of text recessed into the part.

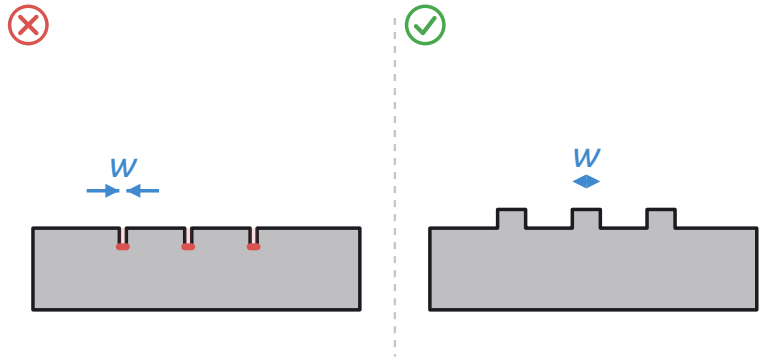

Recessed Text: Text 5 (engraved) is cut 1.00 mm into the part, so in the mould its letters are thin raised ribs of steel that chip and wear. Raise the text from the part instead (about 0.4 to 0.8 mm), or set it in a shallow recessed panel so it is raised but stays below the surface.

Viewport

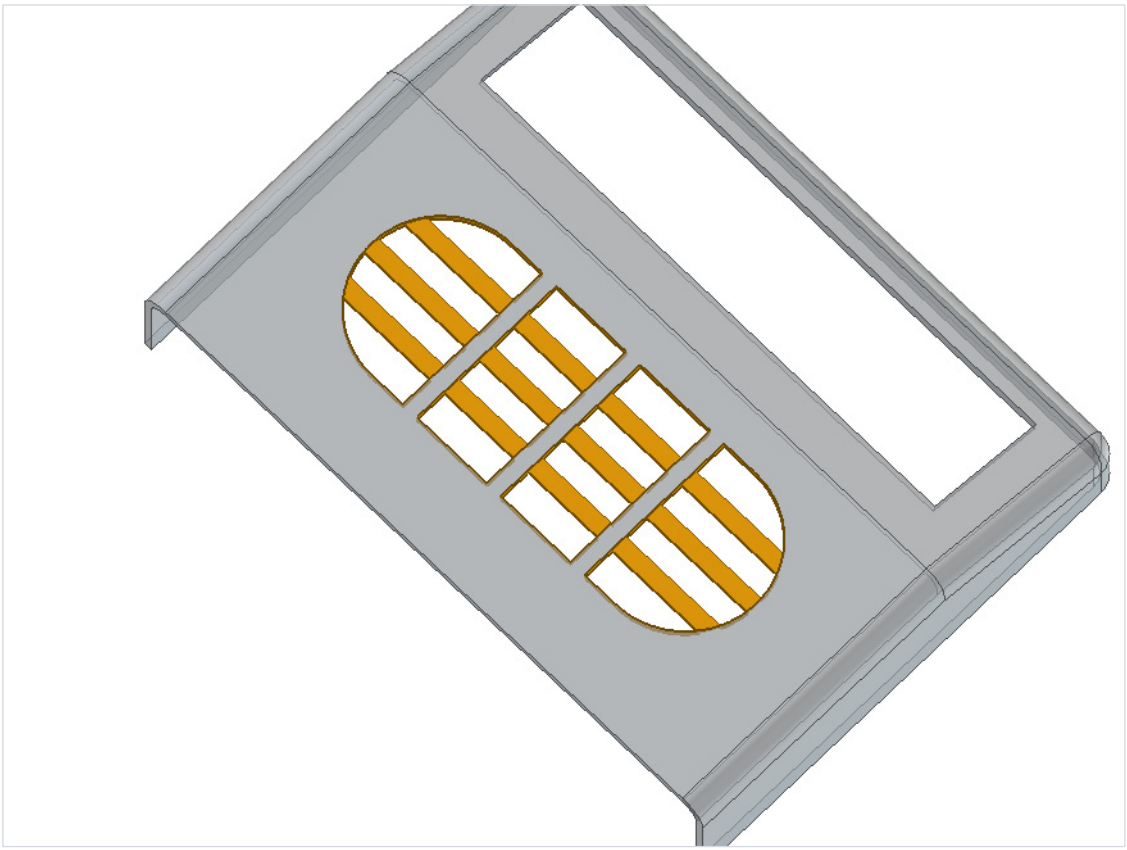

1 finding highlighted

Findings


Status	Geometry	Measured	Limit
Warning	Face26, Face27, Face28 +49	Text 5 (engraved): reces…	

Sharp External Corners

137 warnings


Criticality: Low · Reported as a warning · Values for ABS

Convex intersections of surfaces without a radius.

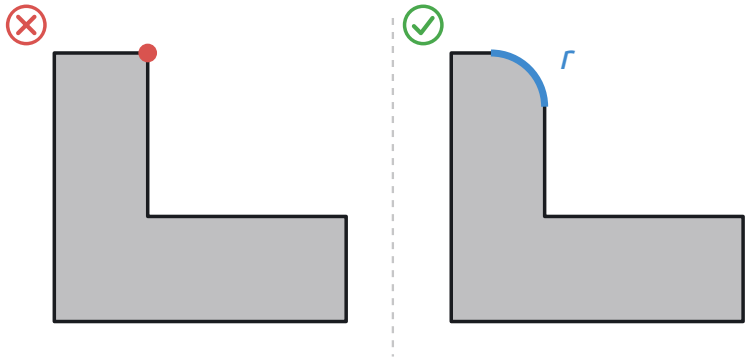

External Sharp Corner (14.77°): This external sharp corner creates a sharp internal corner in the mold cavity that cannot be CNC machined and requires EDM (Electrical Discharge Machining). Unless this edge lies on the parting line or is perpendicular to the pull direction, an external fillet of radius at least 0.5mm is recommended to reduce tooling cost and lead time.

Viewport

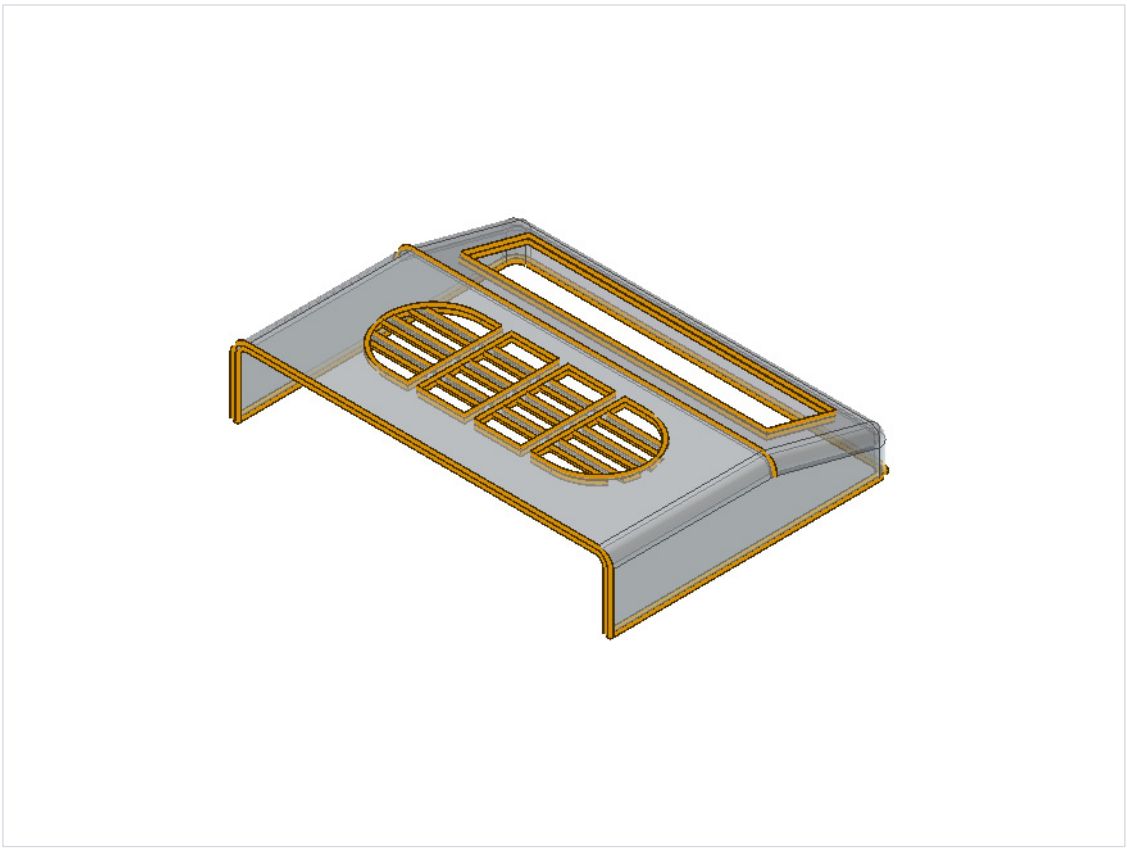

137 findings highlighted

Findings

Status	Geometry	Measured	Limit
Warning	Edge3	14.77°	
Warning	Edge5	90.00°	
Warning	Edge6	90.00°	
Warning	Edge7	90.00°	
Warning	Edge8	90.00°	
Warning	Edge9	90.00°	

Status	Geometry	Measured	Limit
Warning	Edge16	90.00°	
Warning	Edge17	90.00°	
Warning	Edge18	90.00°	
Warning	Edge24	90.00°	
Warning	Edge25	90.00°	
Warning	Edge26	90.00°	
Warning	Edge27	90.39°	
Warning	Edge28	90.00°	
Warning	Edge29	90.00°	
Warning	Edge30	90.01°	
Warning	Edge31	90.00°	
Warning	Edge32	90.00°	
Warning	Edge33	90.39°	
Warning	Edge34	90.00°	
Warning	Edge35	89.99°	
Warning	Edge39	90.00°	
Warning	Edge40	89.72°	
Warning	Edge43	89.61°	
Warning	Edge46	89.72°	

and 112 more, listed in the appendix.

Passed rules

Rule	Criticality	Target and limit
Undercut	Critical	Reported as an error
Boss Draft	High	Aim for 1° outside (half for the hole) · At least 0.5° outside (half…
Boss Wall Thickness	High	Aim for 60% of nominal wall · At most 75% of nominal wall
Rib Draft	High	Aim for 1° per side · At least 0.5° per side
Rib Thickness	High	Aim for 60% of nominal wall · At most 75% of nominal wall
Snap-Fit Strain	High	Aim for 1.2% strain at the root · At most 2% strain at the root
Thin Steel	High	Aim for 1.5 mm · At least 1 mm
Wall Thickness Transition	High	Aim for 15% of the thicker wall · At most 25% of the thicker wall
Boss Core Depth	Medium	Aim for 100% of boss height · At least 80% of boss height
Boss Height	Medium	Aim for 2.5× outer diameter · At most 3× outer diameter
Boss Outer Diameter	Medium	Aim for 2× hole diameter · At least 1.8× hole diameter
Boss Spacing	Medium	Aim for 2× nominal wall · At least 1× nominal wall
Cored Hole Depth	Medium	Aim for 2× hole diameter · At most 3× hole diameter
Hole Spacing	Medium	Aim for 2× wall or hole Ø (larger) · At least 1× wall or hole Ø (lar…
Living Hinge	Medium	Aim for 0.4 mm · At most 0.6 mm
Maximum Wall Thickness	Medium	Aim for 3.56 mm · At most 4.5 mm
Rib Height	Medium	Aim for 3× nominal wall · At most 5× nominal wall
Rib Spacing	Medium	Aim for 2× nominal wall · At least 1× nominal wall
Boss Hole Base Radius	Low	Aim for 50% of nominal wall · At least 25% of nominal wall
Boss Root Radius	Low	Aim for 50% of nominal wall · At least 25% of nominal wall

Rule	Criticality	Target and limit
Internal Corner Radius	● Low	Aim for 50% of nominal wall · At least 25% of nominal wall
Rib Root Radius	● Low	Aim for 40% of nominal wall · At least 25% of nominal wall
Screw Boss Lead-In	● Low	Reported as a warning
Standalone Boss	● Low	Reported as a warning

Appendix: all findings

Rule	Geometry	Measured	Limit	Status
Minimum Draft Angle	Face1	-75.23°	< 0.50°	Error
Minimum Draft Angle	Face2	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face6	0.01°	< 0.50°	Error
Minimum Draft Angle	Face7	0.00°	< 0.50°	Error
Minimum Draft Angle	Face8	0.00°	< 0.50°	Error
Minimum Draft Angle	Face9	0.00°	< 0.50°	Error
Minimum Draft Angle	Face10	0.00°	< 0.50°	Error
Minimum Draft Angle	Face11	0.01°	< 0.50°	Error
Minimum Draft Angle	Face12	0.01°	< 0.50°	Error
Minimum Draft Angle	Face15	0.00°	< 0.50°	Error
Minimum Draft Angle	Face17	0.00°	< 0.50°	Error
Minimum Draft Angle	Face18	0.00°	< 0.50°	Error
Minimum Draft Angle	Face19	0.00°	< 0.50°	Error
Minimum Draft Angle	Face20	0.01°	< 0.50°	Error
Minimum Draft Angle	Face21	0.00°	< 0.50°	Error
Minimum Draft Angle	Face23	0.00°	< 0.50°	Error
Minimum Draft Angle	Face24	0.01°	< 0.50°	Error
Minimum Draft Angle	Face26	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face27	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face29	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face30	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face32	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face33	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face35	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face36	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face38	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face39	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face41	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face42	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face44	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face45	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face47	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face48	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face50	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face51	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face53	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face54	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face56	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face57	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face59	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face60	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face62	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face63	-0.00°	< 0.50°	Error

Rule	Geometry	Measured	Limit	Status
Minimum Draft Angle	Face64	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face65	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face66	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face67	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face68	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face69	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face70	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face71	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face72	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face73	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face74	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face75	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face76	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face77	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face81	-0.00°	< 0.50°	Error
Minimum Draft Angle	Face4	0.87°	< 1.00°	Warning
Minimum Draft Angle	Face5	0.90°	< 1.00°	Warning
Minimum Draft Angle	Face13	0.90°	< 1.00°	Warning
Minimum Draft Angle	Face14	0.90°	< 1.00°	Warning
Minimum Draft Angle	Face22	0.90°	< 1.00°	Warning
Minimum Draft Angle	Face78	0.87°	< 1.00°	Warning
Minimum Draft Angle	Face79	0.75°	< 1.00°	Warning
Minimum Draft Angle	Face83	0.87°	< 1.00°	Warning
Minimum Draft Angle	Face85	0.87°	< 1.00°	Warning
Minimum Draft Angle	Face86	0.75°	< 1.00°	Warning
Minimum Wall Thickness	Face25	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face28	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face31	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face34	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face37	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face40	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face43	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face46	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face49	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face52	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face55	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face58	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face61	0.50mm	< 0.80mm	Error
Minimum Wall Thickness	Face1	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face3	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face4	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face5	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face7	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face8	1.00mm	< 1.14mm	Warning

Rule	Geometry	Measured	Limit	Status
Minimum Wall Thickness	Face9	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face10	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face11	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face12	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face13	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face14	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face15	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face17	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face18	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face19	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face20	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face21	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face22	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face23	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face24	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face78	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face79	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face83	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face84	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face85	1.00mm	< 1.14mm	Warning
Minimum Wall Thickness	Face86	1.00mm	< 1.14mm	Warning
Sharp Internal Corners	Edge10	90.00°		Error
Sharp Internal Corners	Edge11	90.00°		Error
Sharp Internal Corners	Edge14	14.77°		Error
Sharp Internal Corners	Edge21	10.43°		Error
Sharp Internal Corners	Edge80	10.43°		Error
Sharp Internal Corners	Edge147	90.00°		Error
Sharp Internal Corners	Edge151	90.00°		Error
Sharp Internal Corners	Edge152	126.86°		Error
Sharp Internal Corners	Edge153	90.00°		Error
Sharp Internal Corners	Edge154	90.00°		Error
Sharp Internal Corners	Edge156	90.00°		Error
Sharp Internal Corners	Edge159	90.00°		Error
Sharp Internal Corners	Edge161	126.86°		Error
Sharp Internal Corners	Edge162	90.00°		Error
Sharp Internal Corners	Edge164	90.00°		Error
Sharp Internal Corners	Edge165	90.00°		Error
Sharp Internal Corners	Edge167	90.00°		Error
Sharp Internal Corners	Edge168	90.00°		Error
Sharp Internal Corners	Edge170	90.00°		Error
Sharp Internal Corners	Edge171	90.00°		Error
Sharp Internal Corners	Edge173	90.00°		Error
Sharp Internal Corners	Edge174	90.00°		Error
Sharp Internal Corners	Edge176	90.00°		Error

Rule	Geometry	Measured	Limit	Status
Sharp Internal Corners	Edge177	90.00°		Error
Sharp Internal Corners	Edge179	90.00°		Error
Sharp Internal Corners	Edge180	90.00°		Error
Sharp Internal Corners	Edge182	90.00°		Error
Sharp Internal Corners	Edge183	90.00°		Error
Sharp Internal Corners	Edge184	66.43°		Error
Sharp Internal Corners	Edge186	90.00°		Error
Sharp Internal Corners	Edge187	95.74°		Error
Sharp Internal Corners	Edge188	90.00°		Error
Sharp Internal Corners	Edge189	90.00°		Error
Sharp Internal Corners	Edge191	90.00°		Error
Sharp Internal Corners	Edge192	66.43°		Error
Sharp Internal Corners	Edge193	90.00°		Error
Sharp Internal Corners	Edge195	95.74°		Error
Sharp Internal Corners	Edge196	90.00°		Error
Sharp Internal Corners	Edge198	90.00°		Error
Sharp Internal Corners	Edge199	90.00°		Error
Sharp Internal Corners	Edge200	90.00°		Error
Sharp Internal Corners	Edge201	90.00°		Error
Sharp Internal Corners	Edge203	90.00°		Error
Sharp Internal Corners	Edge204	90.00°		Error
Sharp Internal Corners	Edge206	90.00°		Error
Sharp Internal Corners	Edge207	90.00°		Error
Sharp Internal Corners	Edge208	90.00°		Error
Sharp Internal Corners	Edge209	90.00°		Error
Sharp Internal Corners	Edge211	90.00°		Error
Sharp Internal Corners	Edge212	90.00°		Error
Sharp Internal Corners	Edge214	90.00°		Error
Sharp Internal Corners	Edge215	90.00°		Error
Sharp Internal Corners	Edge216	95.74°		Error
Sharp Internal Corners	Edge218	90.00°		Error
Sharp Internal Corners	Edge219	66.43°		Error
Sharp Internal Corners	Edge220	90.00°		Error
Sharp Internal Corners	Edge221	90.00°		Error
Sharp Internal Corners	Edge223	90.00°		Error
Sharp Internal Corners	Edge224	95.74°		Error
Sharp Internal Corners	Edge225	90.00°		Error
Sharp Internal Corners	Edge227	66.43°		Error
Sharp Internal Corners	Edge228	90.00°		Error
Sharp Internal Corners	Edge230	90.00°		Error
Sharp Internal Corners	Edge231	90.00°		Error
Sharp Internal Corners	Edge232	90.00°		Error
Sharp Internal Corners	Edge233	90.00°		Error
Sharp Internal Corners	Edge235	90.00°		Error

Rule	Geometry	Measured	Limit	Status
Sharp Internal Corners	Edge236	90.00°		Error
Sharp Internal Corners	Edge238	90.00°		Error
Sharp Internal Corners	Edge239	90.00°		Error
Sharp Internal Corners	Edge240	90.00°		Error
Sharp Internal Corners	Edge241	90.00°		Error
Sharp Internal Corners	Edge243	90.00°		Error
Sharp Internal Corners	Edge244	90.00°		Error
Sharp Internal Corners	Edge246	90.00°		Error
Sharp Internal Corners	Edge247	90.00°		Error
Sharp Internal Corners	Edge250	90.00°		Error
Sharp Internal Corners	Edge252	126.86°		Error
Sharp Internal Corners	Edge254	90.00°		Error
Sharp Internal Corners	Edge257	126.86°		Error
Sharp Internal Corners	Edge259	90.00°		Error
Sharp Internal Corners	Edge261	90.00°		Error
Sharp Internal Corners	Edge262	90.00°		Error
Sharp Internal Corners	Edge264	90.00°		Error
Sharp Internal Corners	Edge266	90.00°		Error
Sharp Internal Corners	Edge268	90.00°		Error
Sharp Internal Corners	Edge269	90.00°		Error
Sharp Internal Corners	Edge271	90.00°		Error
Sharp Internal Corners	Edge273	90.00°		Error
Sharp Internal Corners	Edge275	90.00°		Error
Sharp Internal Corners	Edge276	90.00°		Error
Moulded Text	Face26, Face27, Face28 +49	Text 5 (engrave…		Warning
Sharp External Corners	Edge3	14.77°		Warning
Sharp External Corners	Edge5	90.00°		Warning
Sharp External Corners	Edge6	90.00°		Warning
Sharp External Corners	Edge7	90.00°		Warning
Sharp External Corners	Edge8	90.00°		Warning
Sharp External Corners	Edge9	90.00°		Warning
Sharp External Corners	Edge16	90.00°		Warning
Sharp External Corners	Edge17	90.00°		Warning
Sharp External Corners	Edge18	90.00°		Warning
Sharp External Corners	Edge24	90.00°		Warning
Sharp External Corners	Edge25	90.00°		Warning
Sharp External Corners	Edge26	90.00°		Warning
Sharp External Corners	Edge27	90.39°		Warning
Sharp External Corners	Edge28	90.00°		Warning
Sharp External Corners	Edge29	90.00°		Warning
Sharp External Corners	Edge30	90.01°		Warning
Sharp External Corners	Edge31	90.00°		Warning
Sharp External Corners	Edge32	90.00°		Warning
Sharp External Corners	Edge33	90.39°		Warning

Rule	Geometry	Measured	Limit	Status
Sharp External Corners	Edge34	90.00°		Warning
Sharp External Corners	Edge35	89.99°		Warning
Sharp External Corners	Edge39	90.00°		Warning
Sharp External Corners	Edge40	89.72°		Warning
Sharp External Corners	Edge43	89.61°		Warning
Sharp External Corners	Edge46	89.72°		Warning
Sharp External Corners	Edge56	10.43°		Warning
Sharp External Corners	Edge57	10.43°		Warning
Sharp External Corners	Edge61	90.00°		Warning
Sharp External Corners	Edge62	90.00°		Warning
Sharp External Corners	Edge63	90.00°		Warning
Sharp External Corners	Edge64	90.28°		Warning
Sharp External Corners	Edge65	90.39°		Warning
Sharp External Corners	Edge66	90.28°		Warning
Sharp External Corners	Edge83	90.00°		Warning
Sharp External Corners	Edge84	90.00°		Warning
Sharp External Corners	Edge85	90.00°		Warning
Sharp External Corners	Edge86	90.00°		Warning
Sharp External Corners	Edge87	90.00°		Warning
Sharp External Corners	Edge88	90.00°		Warning
Sharp External Corners	Edge89	90.00°		Warning
Sharp External Corners	Edge90	90.00°		Warning
Sharp External Corners	Edge91	90.00°		Warning
Sharp External Corners	Edge92	90.00°		Warning
Sharp External Corners	Edge93	90.00°		Warning
Sharp External Corners	Edge94	90.00°		Warning
Sharp External Corners	Edge95	90.00°		Warning
Sharp External Corners	Edge96	90.00°		Warning
Sharp External Corners	Edge97	90.00°		Warning
Sharp External Corners	Edge98	90.00°		Warning
Sharp External Corners	Edge99	90.00°		Warning
Sharp External Corners	Edge100	90.00°		Warning
Sharp External Corners	Edge101	90.00°		Warning
Sharp External Corners	Edge102	90.00°		Warning
Sharp External Corners	Edge103	90.00°		Warning
Sharp External Corners	Edge104	90.00°		Warning
Sharp External Corners	Edge105	90.00°		Warning
Sharp External Corners	Edge106	90.00°		Warning
Sharp External Corners	Edge107	90.00°		Warning
Sharp External Corners	Edge108	90.00°		Warning
Sharp External Corners	Edge109	90.00°		Warning
Sharp External Corners	Edge110	90.00°		Warning
Sharp External Corners	Edge111	90.00°		Warning
Sharp External Corners	Edge112	90.00°		Warning

Rule	Geometry	Measured	Limit	Status
Sharp External Corners	Edge113	90.00°		Warning
Sharp External Corners	Edge114	90.00°		Warning
Sharp External Corners	Edge115	90.00°		Warning
Sharp External Corners	Edge116	90.00°		Warning
Sharp External Corners	Edge117	90.00°		Warning
Sharp External Corners	Edge118	90.00°		Warning
Sharp External Corners	Edge119	90.00°		Warning
Sharp External Corners	Edge120	90.00°		Warning
Sharp External Corners	Edge121	90.00°		Warning
Sharp External Corners	Edge122	90.00°		Warning
Sharp External Corners	Edge123	90.00°		Warning
Sharp External Corners	Edge124	90.00°		Warning
Sharp External Corners	Edge125	90.00°		Warning
Sharp External Corners	Edge126	90.00°		Warning
Sharp External Corners	Edge127	90.00°		Warning
Sharp External Corners	Edge128	90.00°		Warning
Sharp External Corners	Edge129	90.00°		Warning
Sharp External Corners	Edge130	90.00°		Warning
Sharp External Corners	Edge131	90.00°		Warning
Sharp External Corners	Edge132	90.00°		Warning
Sharp External Corners	Edge133	90.00°		Warning
Sharp External Corners	Edge134	90.00°		Warning
Sharp External Corners	Edge135	90.00°		Warning
Sharp External Corners	Edge136	90.00°		Warning
Sharp External Corners	Edge137	90.00°		Warning
Sharp External Corners	Edge138	90.00°		Warning
Sharp External Corners	Edge139	90.00°		Warning
Sharp External Corners	Edge140	90.00°		Warning
Sharp External Corners	Edge141	90.00°		Warning
Sharp External Corners	Edge142	90.00°		Warning
Sharp External Corners	Edge143	90.00°		Warning
Sharp External Corners	Edge144	90.00°		Warning
Sharp External Corners	Edge145	90.00°		Warning
Sharp External Corners	Edge146	90.00°		Warning
Sharp External Corners	Edge148	90.00°		Warning
Sharp External Corners	Edge150	90.00°		Warning
Sharp External Corners	Edge155	90.00°		Warning
Sharp External Corners	Edge158	90.00°		Warning
Sharp External Corners	Edge160	90.00°		Warning
Sharp External Corners	Edge163	90.00°		Warning
Sharp External Corners	Edge166	90.00°		Warning
Sharp External Corners	Edge169	90.00°		Warning
Sharp External Corners	Edge172	90.00°		Warning
Sharp External Corners	Edge175	90.00°		Warning

Rule	Geometry	Measured	Limit	Status
Sharp External Corners	Edge178	90.00°		Warning
Sharp External Corners	Edge181	90.00°		Warning
Sharp External Corners	Edge185	90.00°		Warning
Sharp External Corners	Edge190	90.00°		Warning
Sharp External Corners	Edge194	90.00°		Warning
Sharp External Corners	Edge197	90.00°		Warning
Sharp External Corners	Edge202	90.00°		Warning
Sharp External Corners	Edge205	90.00°		Warning
Sharp External Corners	Edge210	90.00°		Warning
Sharp External Corners	Edge213	90.00°		Warning
Sharp External Corners	Edge217	90.00°		Warning
Sharp External Corners	Edge222	90.00°		Warning
Sharp External Corners	Edge226	90.00°		Warning
Sharp External Corners	Edge229	90.00°		Warning
Sharp External Corners	Edge234	90.00°		Warning
Sharp External Corners	Edge237	90.00°		Warning
Sharp External Corners	Edge242	90.00°		Warning
Sharp External Corners	Edge245	90.00°		Warning
Sharp External Corners	Edge248	90.00°		Warning
Sharp External Corners	Edge251	90.00°		Warning
Sharp External Corners	Edge253	90.00°		Warning
Sharp External Corners	Edge256	90.00°		Warning
Sharp External Corners	Edge258	90.00°		Warning
Sharp External Corners	Edge260	90.00°		Warning
Sharp External Corners	Edge263	90.00°		Warning
Sharp External Corners	Edge265	90.00°		Warning
Sharp External Corners	Edge267	90.00°		Warning
Sharp External Corners	Edge270	90.00°		Warning
Sharp External Corners	Edge272	90.00°		Warning
Sharp External Corners	Edge274	90.00°		Warning